



(Closed) unresolved item (352/78-06-02): the inspector reviewed the revised Job Rule M-17 (Revision 2) to verify that an acceptance criteria for rusting of hanger was delineated. The inspector also verified that the hanger vendor's storage criteria for acceptable rusting was incorporated in the job rule. The inspector verified that the revised maintenance requirements were incorporated on the periodic maintenance cards for the hangers. The rusting pipe support H88-118-H53 found during inspection 352/78-06 was inspected by Bechtel to the acceptance criteria in the Job Rule M-17 and was found to be acceptable. This item is considered resolved.

(Closed) noncompliance (352/78-11-03 and 353/78-07-01): The untreated (undecanted) waste waters were pumped from within the coffer dam surrounding the intake structure and also from the cooling tower blowdown water diffuser trench into the Schuylkill River. The inspector visited both these areas and found that the activities that caused the pumping of waste water no longer exist and there was no waste water being pumped at either location. The PECO finding report N-142 was reviewed to verify that immediate corrective action was taken and also verified by the licensee or organization. This item is considered closed.

(Closed) unresolved item (352/78-11-02 & 353/78-07-02): The inspector verified that excavated material from the cooling tower blowdown pipe trench was removed from the banks of Possum Hollow Run and that the bales of hay were placed on the bank of Possum Hollow Run to prevent erosion and minimize run off. This item is considered resolved.

(Open) inspector followup item (352/78-11-03 & 353/78-07-03): The inspector examined the areas east and west of Long View Road and noted that some areas were graded and seeded. There are still some active areas for depositing spoils adjacent to east and west of Long View Road. This item will be re-examined at a subsequent inspection.

(Closed) unresolved item (352/79-11-01): The contractor had mitered an end of a GE supplied pipe without prior approval from GE. The inspector reviewed the following documents relative to this item:

- PECO finding Report P-285 concerning this matter and the acceptable resolution of this item.
- Bechtel Inprocess Rework Notice No. P-726 for mitering of weld joint.
- Documentation for rework in accordance with GE field deviation disposition Request HHI-219.

This item is considered resolved.