

LICENSEE EVENT REPORT (LER)

APPROVED OMS NO. 2180 0104  
EXPIRES 8/31/85

FACILITY NAME (1)  
Limerick Generating Station - Unit 1

DOCKET NUMBER (2)  
0 5 0 0 0 3 5 2

PAGE (3)  
1 OF 0 2

TITLE (4)  
Reactor Enclosure HVAC Isolation

EVENT DATE (5)			LER NUMBER (6)			REPORT DATE (7)			OTHER FACILITIES INVOLVED (8)		
MONTH	DAY	YEAR	YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	MONTH	DAY	YEAR	FACILITY NAMES		DOCKET NUMBER(S)
0 1	1 8	8 5	8 5	0 1 2		0 0	2 1	9 8 5			0 5 0 0 0
THIS REPORT IS SUBMITTED PURSUANT TO THE REQUIREMENTS OF 10 CFR § (Check one or more of the following) (11)											

OPERATING MODE (9) 2	20.402(a)	20.406(a)	X	80.73(a)(2)(iv)	73.71(b)
POWER LEVEL (10) 00.4	20.406(a)(1)(ii)	80.36(a)(1)		80.73(a)(2)(v)	73.71(a)
	20.406(a)(1)(iii)	80.36(a)(2)		80.73(a)(2)(vi)	OTHER (Specify in Abstract Below and in Title, NRC Form 204A)
	20.406(a)(1)(iv)	80.73(a)(2)(i)		80.73(a)(2)(vii)(A)	
	20.406(a)(1)(v)	80.73(a)(2)(ii)		80.73(a)(2)(vii)(B)	
	20.406(a)(1)(vi)	80.73(a)(2)(iii)		80.73(a)(2)(viii)	

LICENSEE CONTACT FOR THIS LER (12)

NAME  
John C. Nagle, Engineer - Special Projects

TELEPHONE NUMBER  
AREA CODE: 2 1 5  
8 4 1 - 5 1 8 4

COMPLETE ONE LINE FOR EACH COMPONENT FAILURE DESCRIBED IN THIS REPORT (13)

CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO NRC	CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO NRC

SUPPLEMENTAL REPORT EXPECTED (14)

YES (If yes, complete EXPECTED SUBMISSION DATE)  NO

EXPECTED SUBMISSION DATE (15)

MONTH	DAY	YEAR

ABSTRACT (Limit to 1400 spaces, i.e., approximately fifteen single-space typewritten lines) (16)

Abstract: 85-012

During troubleshooting of the reactor enclosure HVAC differential pressure controls, an automatic isolation of the reactor enclosure HVAC system occurred. The unit was in the startup mode at less than four percent power when this event occurred. Apparently, the momentary misapplication of a jumper caused a short-circuit which caused a fuse to blow. The fuse provides power to instruments which provide inputs to the reactor enclosure HVAC isolation system (an engineered safety feature). In addition to the appropriate damper actuations, both the standby gas treatment system and reactor enclosure isolation system started, as designed.

IEAS

LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

FACILITY NAME (1)	DOCKET NUMBER (2)	LER NUMBER (8)			PAGE (3)		
		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER			
Limerick Generating Station Unit 1	05000352	85	012	00	02	OF	02

TEXT (If more space is required, use additional NRC Form 368) (17)

Description of the Event:

At approximately 1023 hours, with the unit at less than four percent power in the startup mode, an isolation of the reactor enclosure heating ventilation and air conditioning system occurred due to an indicated low differential pressure condition. In addition to the proper operation of the associated dampers, the Standby Gas Treatment system and the Reactor Enclosure Recirculation system performed as designed.

Consequences of the Event:

The unit was in the startup mode at very low power and all equipment responded correctly. Therefore, the consequences of this event are minimal.

Cause of the Event:

The system engineer accidentally caused a short circuit while applying a momentary jumper while troubleshooting of a faulty pressure control damper which is part of the reactor enclosure differential pressure control system. The circuit protected by this fuse provides power to a pressure switch which provides one of the inputs to the isolation logic. The loss of power produces an output which is identical to the initiation condition for this device and the isolation logic responded accordingly.

Corrective Actions:

The fuse was promptly replaced, the isolation reset, and the HVAC system returned to the normal mode of operation.

PHILADELPHIA ELECTRIC COMPANY

2301 MARKET STREET

P.O. BOX 8699

PHILADELPHIA, PA. 19101

(215) 841-4000

February 19, 1985

Docket No. 50-352

Document Control Desk  
U.S. Nuclear Regulatory Commission  
Washington, DC 20555

SUBJECT: Licensee Event Report  
Limerick Generating Station - Unit 1

This LER concerns the automatic isolation of the reactor enclosure ventilation system.

Reference: Docket No. 50-352  
Report Number: 85-012  
Revision Number: 00  
Event Date: January 18, 1985  
Report Date: February 19, 1985  
Facility: Limerick Generating Station  
P.O. Box A, Sanatoga, PA 19464

This LER is being submitted pursuant to the requirements of 10 CFR 50.73(a)(2)(iv).

Very truly yours,



W. T. Ullrich  
Superintendent  
Nuclear Generation Division

cc: Dr. Thomas E. Murley, Administrator, Region I, USNRC  
J. T. Wiggins, Senior Site Inspector  
See Service List

LE 22  
11

cc: Judge Helen F. Hoyt  
Judge Jerry Harbour  
Judge Richard F. Cole  
Troy B. Conner, Jr., Esq.  
Ann P. Hodgdon, Esq.  
Mr. Frank R. Romano  
Mr. Robert L. Anthony  
Ms. Phyllis Zitner  
Charles W. Elliott, Esq.  
Zori G. Ferkin, Esq.  
Mr. Thomas Gerusky  
Director, Penna. Emergency Management Agency  
Angus Love, Esq.  
David Wersan, Esq.  
Robert J. Sugarman, Esq.  
Martha W. Bush, Esq.  
Spence W. Perry, Esq.  
Jay M. Gutierrez, Esq.  
Atomic Safety & Licensing Appeal Board  
Atomic Safety & Licensing Board Panel  
Docket & Service Section (3 Copies)  
James Wiggins  
Timothy R. S. Campbell

January 16, 1985