

LICENSEE EVENT REPORT (LER)

FACILITY NAME (1) Susquehanna Steam Electric Station - Unit 1	DOCKET NUMBER (2) 0 5 0 0 0 3 8 7	PAGE (3) 1 OF 0 1
--	--------------------------------------	----------------------

TITLE (4)
RWCU Isolation (ESF Actuation).

EVENT DATE (5)			LER NUMBER (6)			REPORT DATE (7)			OTHER FACILITIES INVOLVED (8)											
MONTH	DAY	YEAR	YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	MONTH	DAY	YEAR	FACILITY NAMES		DOCKET NUMBER(S)									
0	2	1	8	5	8	5	0	0	7	0	0	0	3	1	9	8	5			0 5 0 0 0

OPERATING MODE (9) 5	THIS REPORT IS SUBMITTED PURSUANT TO THE REQUIREMENTS OF 10 CFR § (Check one or more of the following) (11)									
POWER LEVEL (10) 0 1 0 1 0	<input type="checkbox"/> 20.402(b)	<input type="checkbox"/> 20.406(c)	<input checked="" type="checkbox"/> 50.73(a)(2)(iv)	<input type="checkbox"/> 73.71(b)						
	<input type="checkbox"/> 20.406(a)(1)(i)	<input type="checkbox"/> 50.38(e)(1)	<input type="checkbox"/> 50.73(a)(2)(v)	<input type="checkbox"/> 73.71(e)						
	<input type="checkbox"/> 20.406(a)(1)(ii)	<input type="checkbox"/> 50.38(e)(2)	<input type="checkbox"/> 50.73(a)(2)(vii)	OTHER (Specify in Abstract below and in Text, NRC Form 366A)						
	<input type="checkbox"/> 20.406(a)(1)(iii)	<input type="checkbox"/> 50.73(a)(2)(ii)	<input type="checkbox"/> 50.73(a)(2)(viii)(A)							
	<input type="checkbox"/> 20.406(a)(1)(iv)	<input type="checkbox"/> 50.73(a)(2)(iii)	<input type="checkbox"/> 50.73(a)(2)(viii)(B)							
<input type="checkbox"/> 20.406(a)(1)(v)	<input type="checkbox"/> 50.73(a)(2)(iii)	<input type="checkbox"/> 50.73(a)(2)(ix)								

LICENSEE CONTACT FOR THIS LER (12)

NAME L.A. Kuczynski - Nuclear Plant Specialist, Level III	TELEPHONE NUMBER 7 1 7 5 4 2 - 3 7 5 9
--	---

COMPLETE ONE LINE FOR EACH COMPONENT FAILURE DESCRIBED IN THIS REPORT (13)

CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO NPROS	CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO NPROS
A	CIE	*	*	N					

SUPPLEMENTAL REPORT EXPECTED (14) <input type="checkbox"/> YES (if yes, complete EXPECTED SUBMISSION DATE) <input checked="" type="checkbox"/> NO	EXPECTED SUBMISSION DATE (15) MONTH: DAY: YEAR:
--	--

ABSTRACT (Limit to 1400 spaces, i.e., approximately fifteen single space typewritten lines) (16)

On February 16, 1985, with the Unit shut down for its first refueling outage, the breaker supplying an instrument bus was opened by a person or persons unknown. An operator was dispatched to the area and could not determine who and how the breaker was opened. The breaker's position was open, not tripped. The breaker was then closed by the operator. One of the effects of the breaker being opened was that the Reactor Water Cleanup system isolated on a false non-regenerative heat exchanger high outlet temperature signal caused by the loss of power to the temperature sensor's trip circuitry. During restoration of the Reactor Water Cleanup (RWCU) system, the RWCU pump suction containment inboard and outboard isolation valves closed on a high differential flow signal. The affected valves are considered part of the Primary Containment Isolation System, an Engineered Safety Feature.

One week later, another RWCU isolation occurred on the high differential flow signal when one of the two filter demineralizers was removed from its precoat cycle to start a backwash cycle. The appropriate system operating procedure was being followed during each occurrence.

To prevent recurrence of these events, nuclear licensed operators will receive additional training in Reactor Water Cleanup system operation. Additionally, comments to the system's operating procedures will be solicited during the training and incorporated as necessary.

* Not Applicable.
8503270068 850319
PDR ADOCK 05000387
S PDR

JE22
1/1



Pennsylvania Power & Light Company

Two North Ninth Street • Allentown, PA 18101 • 215 / 770-5151

March 19, 1985

U.S. Nuclear Regulatory Commission
Document Control Desk
Washington, DC 20555

SUSQUEHANNA STEAM ELECTRIC STATION
LICENSEE EVENT REPORT 85-007-00
ER 100450 FILE 841-23
PLAS-057

Docket No. 50-387
License No. NPF-14

Attached is Licensee Event Report 85-007-00. This event was determined reportable per 10CFR50.73(a)(2)(iv), in that the Unit experienced unanticipated actuations of an Engineered Safety Feature when the Reactor Water Cleanup System inboard and outboard containment isolation valves closed.

H.W. Keiser
Superintendent of Plant-Susquehanna

LAK/pjg

cc: Dr. Thomas E. Murley
Regional Administrator, Region I
U.S. Nuclear Regulatory Commission
631 Park Avenue
King of Prussia, PA 19406

Mr. R.H. Jacobs
Senior Resident Inspector
U.S. Nuclear Regulatory Commission
P.O. Box 52
Shickshinny, PA 18655

IE22
//