

LICENSEE EVENT REPORT

JUN 16 1983

CONTROL BLOCK			
LICENSEE CODE M N M N P I 1	LICENSE NUMBER 0 0 - 0 0 0 0 0 0 - 0 0	LICENSE TYPE J 4 1 1 1 1 1 4	JAT IS 1 E
CON'T			
REPORT SOURCE L O 0 5 0 0 0 2 6 3	CCKET NUMBER O 0 5 1 9 8 3	EVENT DATE O 6 1 6 8 3	REPORT DATE O
EVENT DESCRIPTION AND PROBABLE CONSEQUENCES			
During normal operation, routine inspection found a steam leak on a reducer at the D moisture separator drain valve CV-3134. The leak was a hole approximately 1/8" x 3/16" on a 6"-4" carbon steel reducer just downstream of CV-3134.			
Reportable under Tec. Spec. 6.7.B.2.d. There have been no previous similar occurrences for this system. There was no affect on public health or safety.			
SYSYEM CODE H H	CAUSE CODE E	COMP SUBCODE B Z	VALVE SUBCODE
LEAD NO. 8 3	SEQUENTIAL REPORT NO. 0 1 1	OCCURRENCE CODE 0 3	REVISION NO. 0
ACTION TAKEN C X A	EFFECT ON PLANT A	SHUTDOWN METHOD A	HOURS 0 0 9 5
FUTURE ACTION	ATTACHMENT SUBMITTED N	NPRD-4 FORM SUB N	PRIME COMP SUPPLIER A
CAUSE DESCRIPTION AND CORRECTIVE ACTIONS			
The cause of the leak was wet steam erosion caused from flashing steam downstream of CV-3134 at 380°F and 195 psi. The specification calls for stainless steel piping downstream of CV-3134 where the carbon steel reducer was found. All moisture separator drain valves with carbon steel reducers were UT inspected and found in good condition. The carbon steel reducers will be replaced with stainless.			
FACILITY STATUS E	% POWER 1 0 0	OTHER STATUS NA	METHOD OF DISCOVERY A Operator Observation
ACTIVITY CONTENT RELEASED OR RELEASE Z	AMOUNT OF ACTIVITY NA	LOCATION OF RELEASE	
PERSONNEL EXPOSURES NUMBER 0 0 0	TYPE Z	DESCRIPTION NA	
PERSONNEL INJURIES NUMBER 0 0 0	DESCRIPTION NA		
LOSS OF OR DAMAGE TO FACILITY TYPE Z	DESCRIPTION NA		
PUBLICITY ISSUED N	DESCRIPTION NA		

NRG USE ONLY

NAME OF PREPARED: Patrick Sheahan

PHOTO: (612) 295-5151

IE22 83 RETROFIT
1/1



Monticello
263

Northern States Power Company

414 Nicollet Mall
Minneapolis, Minnesota 55401
Telephone (612) 330-5500

June 16, 1983

Regional Administrator
Region III
U S Nuclear Regulatory Commission
799 Roosevelt Road
Glen Ellyn, IL 60137

MONTICELLO NUCLEAR GENERATING PLANT
Docket No. 50-263 License No. DPR-22 *83-11*

Leak in Moisture Separator Drain to 14B Heater

The License Event Report for this occurrence is attached.

This event is reported in compliance with Technical Specification 6.7.B.2.d since it represents an abnormal degradation of a system designed to contain radioactive material resulting from the fission process.

David Musolf

David Musolf
Manager - Nuclear Support Services

DMM/KNC/js

cc: NRC Document Control Desk (1)
NRC Resident Inspector
MPCA
Attn: J W Ferman

Attachment

1E22
1/1
83 RETRO-FIT
JUN 20 1983