

Entergy Operations, Inc. 1448 S.R. 333 Russeliville, AR. 72901 Ter 501 858-5000

June 25, 1997

2CAN069711

U. S. Nuclear Regulatory Commission Document Control Desk Mail Station OP1-17 Washington, DC 20555

Subject: Arkansas Nuclear One - Unit 2 Docket No. 50-368 License No. NFF-6 Licensee Event Report 50-368/97-004-00

Gentlemen:

In accordance with 10CFR50.73(a)(2)(i)(B), enclosed is the subject report concerning radioactive gaseous effluent sampling.

Very truly yours,

Chis finde for DC Mons.

Dwight C. Mims Director, Nuclear Safety

DCM/dc

enclosure

9707020247 970

ADOCK 05000368

PDR

PDR

TE22/

U. S. NRC June 25, 1997 2CAN069711 PAGE 2

 cc: Mr. Ellis W. Merschoff Regional Administrator
U. S. Nuclear Regulatory Commission Region IV
611 Ryan Plaza Drive, Suite 400 Arlington, TX 76011-8064

> NRC Senior Resident Inspector Arkansas Nuclear One P.O. Box 310 London, AR 72847

Institute of Nuclear Power Operations 700 Galleria Parkway Atlanta, GA 30339-5957

U.S. NUCLEAR REGULATORY COMMISSION (5-92) LICENSEE EVENT REPORT (LER)							APPROVED BY OMB NO. 3150-0104 EXPIRES 5/31/95 ESTIMATED BURDEN PER RESPONSE TO COMPLY WITH THIS INFORMATION COLLECTION REQUEST: 50.0 HRS. FORWARD COMMENTS REGARDING BURDEN ESTIMATE TO THE INFORMATION AND RECORDS MANAGEMENT BRANCH (MNBB 7714), U.S. NUCLEAR REGULATORY COMMISSION, WASHINGTON, DC 20555-0001, AND TO THE PAPERWORK REDUCTION PROJECT (3150-0104), OFFICE OF MANAGEMENT AND BUDGET. WASHINGTON, DC 20503							
FACILIT	Y NAME	(1)			and a second second	CONSTRAINTS OF	The Second States				DOCKET NUMBER (2)	P	AGE (3)
TITLE (4) Alte	rnate	Radioactiv	e Gaseous Efflu	ent Sam	plir	ng Not E	stabli	shed Wi	thin One	Hour As Requir	ed Due T	o Inadeq	uate
EVEN	T DATE	(5)		LER NUMBER (6)	30351100 (1990)	1	REPO	RT DATE	E (7)	1	OTHER FACIL	ITLES IN	VOLVED (8	3)
MONTH	DAY	YEAR	YEAR	SEQUENTIAL	REVISI	ON	MONTH	DAY	YEAR	FACILI	LITY NAME		DOCKET NUMBER	
05	26	97	97	004	00	-	06	25	97	FACILI	LITY NAME		DOCKET NUMBER	
OPERA	TING	-	THIS RE	PORT IS SUBMITT	ED PURS	UANT	TO THE	REQUI	REMENTS	OF 10 CI	R: (Check one	or more) (11)	and an and a second second second
MODE (9) 5		20.4	20.402(b'			20.405	(c)		1	50.73(a)(2)(i)	v) 73.7		1(b)	
POW	/ER	and the second se	20.4	20.405(a)(1)(i)			50.36(c)(1)			50.73(a)(2)(v))	73.71(c)	
LEVEL (10) 0		0	20.405(a)(1)(ii)			50.36(c)(2)			Section of the sector	50.73(a)(2)(vii)			OTHER	
y na ang na sina di sa katalan			20.405(a)(1)(iii)			X	X 50.73(a)(2)(i) 50.73(a)(2)(ii)			50.73(a)(2)(viii)(A) 50.73(a)(2)(viii)(B)		iii)(A))(A) Specify in)(B) Abstract Below and in Text	
			20.4	20.405(a)(1)(iv)								iii)(B)		
		20.405(a)(1)(v)				50.73(a)(2)(iii)			50.73(a)(2)(x))			
	CONTRACTOR OF CASE	THE REAL PROPERTY OF	2019 Contractive Constant of Con-	e prograf Symmet Hokard Antonizatively independent of	LICENS	SEE (CONTACT	FOR TH	IS LER	(12)		CAR INCOMENCE IN CARD		langacharangenet Harlacharyen
NAME Dee Can	twell,	Nuclea	r Safety a	and Licensing Sp	pecialis	st					TELEPHONE NUMB 501-858-5589	ER (Incl	ude Area	Code)
	ervice energianes		COM	PLETE ONE LINE	FOR EACH	H CO	MPONENT	FAILUR	E DESCR	IBED IN	THIS REPORT (13	5)	articologia di Staticaria	
CAUSE	SYST	EM	COMPONENT	MANUFACTURER	REPOR	RTAB	LE		CAUSE	SYSTEM	COMPONENT MANUF		CTURER	REPORTABLE TO NPRDS
Carlounik Karlanaka	al according to the second		SUPPLEME	NTAL REPORT EXPE	ECTED (14)				-	XPECTED	MONTH	DAY	YEAR
YES (If yes, complete EXPECTED SUBMISSION DATE)					x	NO		SUBMISSION DATE (15)						
ABSTRAC At 20 not e instr	146 on stabl	nit to May ishe atio	1400 space 26, 19 d withi n. Thi	es, i.e., appro) 97, alterna n one hour s event, in	te sa upon itiat	y 15 mpl los ed	single ing c s of by a	apab: norma tripp	l typewr llity al rac ped sa	for an ioact ample p	nes) (16) n inservice ive gaseous pump breake	efflu efflu r, res	lent pa lent ulted	th was in an

instrumentation. This event, initiated by a tripped sample pump breaker, resulted in an unmonitored release for one hour and twelve minutes. At 2145 on May 26, 1997, an ANO-2 shift engineer noticed the Radiological Dose Assessment Computer System (RDACS) terminal indicated that the sample pump on the containment building Super Particulate Iodine Noble Gas (SPING) radiation monitor was inoperable. Chemistry was contacted to investigate the apparent failure. Upon verification of the failed sample pump, chemistry personnel immediately began preparations for the installation of alternate sampling equipment. Prior to installation of the alternate sample pump, the chemist determined that the breaker for the sample pump was tripped. The chemist reset the breaker and started the SPING sample pump. Thirteen minutes had elapsed from the time of discovery of the failed sample pump until sampling was restored. However, upon reviewing the RDACS computer logs, it was determined that the sample pump had been out of service for one hour and twelve minutes, exceeding ANO's self-imposed one hour time limit. This event can be attributed to inadequate alarming capabilities on the RDACS terminals. A software change to RDACS was implemented to allow annunciation for conditions requiring a one hour response.

NRC FORM 366A (5-92)	U.S. NUCLEAR REG	APPROVED BY OMB NO. 3150-0104 EXPIRES 5/31/95					
LICENSEE EVI TEXT CO	ESTIMATED BURDEN PER RESPONSE TO COMPLY W THIS INFORMATION COLLECTION REQUEST: 50.0 HI FORWARD COMMENTS REGARDING BURDEN ESTIMATE THE INFORMATION AND RECORDS MANAGEMENT BRAN (MNBB 7714), U.S. NUCLEAR REGULATORY COMMISSI WASHINGTON, DC 20555-0001, AND TO THE PAPERW REDUCTION PROJECT (3150-0104), OFFICE MANAGEMENT AND RUDGET, WASHINGTON DC 205						
FACILITY NAME (DOCKET NUMBER (2)		LER NUMBER (6	PAGE (3)			
			YEAR	SEQUENTIAL NUMBER	REVISION NUMBER		
Arkansas Nuclear One - Unit 2		005000368		004	00	2 OF 3	

TEXT (If more space is required, use additional copies of NRC Form 366A) (17)

A. Plant Status

At the time this event occurred, Arkansas Nuclear One, Unit 2 (ANO-2) was in cold shutdown during Refueling Outage 2R12.

B. Event Description

At 2145 on May 26, 1997, an ANO-2 shift engineer noticed that the Radiological Dose Assessment Computer System (RDACS)[IL] terminal indicated that the sample pump on the containment building Super Particulate Iodine Noble Gas (SPING) radiation monitor was inoperable. The shift engineer contacted chemistry to investigate the apparent failure. Chemistry personnel confirmed inoperability of the pump and immediately proceeded to the SPING to install alternate sampling equipment. ANO-2 Technical Specification 3.3.3.9 states that, with less than the minimum number of iodine and particulate channels operable, effluent releases via the affected pathways may continue provided samples are continuously collected with auxiliary sampling equipment. Although not specifically stated in the specification, ANO's current interpretation requires that alternate sampling capability be established within one hour for inservice effluent paths upon loss of normal radioactive gaseous effluent instrumentation. Prior to installation of the alternate sample pump, the chemist determined that the breaker for the sample pump was tripped. The chemist reset the breaker, started the SPING sample pump, and instructed the count room chemist to clear the alarms. Operations was notified at 2158 that the SPING was back in service. Thirteen minutes had elapsed from the time of discovery of the failed sample pump until sampling was restored. However, upon review of the alarm logs of the RDACS computer, the count room chemist was able to determine that the SPING pump was de-energized at 2046. The SPING had been out of service one hour and twelve minutes, which was twelve minutes longer than the allowed time specified in the Technical Specification Interpretation.

C. Root Cause

The SPINGs perform the gaseous effluent monitoring required by technical specifications. Each SPING monitors the data it produces and assigns a status flag to the data. RDACS provides a status screen that displays status messages sent to RDACS by the SPING. When a status changes from a "normal" value, the RDACS terminal will beep and a message will appear at the top of the screen. To observe these alarms, it is necessary for personnel to be present at the terminal when the alarming condition occurs. The RDACS terminal for Unit 2 is located at the back of the control room on the shift engineer's desk. Personnel were not present at the terminal at the time of the sample pump failure. There is one RDACS terminal in each control room and one in the chemistry laboratory. The terminal located in the chemistry laboratory does not have visual or audible alarms for SPING channels. The root cause of this condition was a design inadequacy in the alarming capabilities of the RDACS terminals.

NRC FORM 365A	J.S. NUCLEAR REGULATORY COMMISSION	Τ	APPROVED BY	OMB NO. 3150 ES 5/31/95	0-0104
LICENSEE EVENT R TEXT CONTIN	ESTIMATED BURDEN PER RESPONSE TO COMPLY THIS INFORMATION COLLECTION REQUEST: 50.0 FORWARD COMMENTS REGARDING BURDEN ESTIMATE THE INFORMATION AND RECORDS MANAGEMENT BR (MNBB 7714), U.S. NUCLEAR REGULATORY COMMISS WASHINGTON, DC 20555-0001, AND TO THE PAPER REDUCTION PROJECT (3150-0104), OFFICE MANAGEMENT AND BUDGET, WASHINGTON, DC 20				
FACILITY NAME (1)	DOCKET NUMBER (2)	1	LER NUMBER (6	PAGE (3)	
		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	
Arkansas Nuclear One - Unit 2	005000368	97	004	00	3 OF 3

TEXT (If more space is required, use additional copies of NRC Form 366A) (17)

D. Corrective Actions

A software change was implemented on June 9, 1997, that will cause the RDACS trouble annunciator located in the front of the control room to alarm when a sample pump failure has existed for ten minutes. The annunciator will indicate a condition requiring a one hour response.

E. Safety Significance

Based on data obtained before and after this event, it was determined that no significant or abnormal releases of radioactivity occurred. A radiation monitor in service during the time that the sample pump was de-energized, and containment ventilation samples collected before and after this event, indicated no significant activity during the release. Therefore, this condition was not safety significant.

F. Basis for Reportability

Failure to establish alternate sampling for inservice effluent paths within one hour did nor meet ANO's current interpretation of Unit-2 Technical Specification 3.3.3.9. This is reportable pursuant to 10CFR50.73(a)(2)(i)(B) as an operation or condition prohibited by the plant's Technical Specification.

G. Additional Information

An event was reported in Licensee Event Report 50-313/95-010-00, letter 0CAN109508 dated October 4, 1995, with some similarity to this condition in that alternate sampling capability for inservice effluent paths was not established within one hour, as required by ANO's interpretation of the applicable Technical Specifications, upon loss of normal radioactive gaseous effluent instrumentation. The events differ in that the previous event was attributed to lack of guidance regarding prioritization for establishment of alternate sampling upon the loss of SPING channels for multiple release paths.

Energy Industry Identification System (EIIS) codes are identified in the text as [XX].