

LICENSEE EVENT REPORT (LER)

FACILITY NAME (1) RIVER BEND STATION	DOCKET NUMBER (2) 050000458	PAGE (3) 1 OF 4
---	--------------------------------	--------------------

TITLE (4)  
Loss of Shutdown Cooling due to Spurious EPA Breaker Trip

EVENT DATE (5)			LER NUMBER (6)			REPORT DATE (7)			OTHER FACILITIES INVOLVED (8)														
MONTH	DAY	YEAR	YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	MONTH	DAY	YEAR	FACILITY NAMES		DOCKET NUMBER(S)												
12	11	87	87	033	000	11	11	87			050000												
<table border="1" style="width:100%; border-collapse: collapse;"> <tr> <td style="width:15%;">OPERATING MODE (9) 4</td> <td colspan="11">THIS REPORT IS SUBMITTED PURSUANT TO THE REQUIREMENTS OF 10 CFR § 170.400 (C) - (I) - (J) - (K) - (L) - (M) - (N) - (O) - (P) - (Q) - (R) - (S) - (T) - (U) - (V) - (W) - (X) - (Y) - (Z) - (AA) - (AB) - (AC) - (AD) - (AE) - (AF) - (AG) - (AH) - (AI) - (AJ) - (AK) - (AL) - (AM) - (AN) - (AO) - (AP) - (AQ) - (AR) - (AS) - (AT) - (AU) - (AV) - (AW) - (AX) - (AY) - (AZ) - (BA) - (BB) - (BC) - (BD) - (BE) - (BF) - (BG) - (BH) - (BI) - (BJ) - (BK) - (BL) - (BM) - (BN) - (BO) - (BP) - (BQ) - (BR) - (BS) - (BT) - (BU) - (BV) - (BW) - (BX) - (BY) - (BZ) - (CA) - (CB) - (CC) - (CD) - (CE) - (CF) - (CG) - (CH) - (CI) - (CJ) - (CK) - (CL) - (CM) - (CN) - (CO) - (CP) - (CQ) - (CR) - (CS) - (CT) - (CU) - (CV) - (CW) - (CX) - (CY) - (CZ) - (DA) - (DB) - (DC) - (DD) - (DE) - (DF) - (DG) - (DH) - (DI) - (DJ) - (DK) - (DL) - (DM) - (DN) - (DO) - (DP) - (DQ) - (DR) - (DS) - (DT) - (DU) - (DV) - (DW) - (DX) - (DY) - (DZ) - (EA) - (EB) - (EC) - (ED) - (EE) - (EF) - (EG) - (EH) - (EI) - (EJ) - (EK) - (EL) - (EM) - (EN) - (EO) - (EP) - (EQ) - (ER) - (ES) - (ET) - (EU) - (EV) - (EW) - (EX) - (EY) - (EZ) - (FA) - (FB) - (FC) - (FD) - (FE) - (FF) - (FG) - (FH) - (FI) - (FJ) - (FK) - (FL) - (FM) - (FN) - (FO) - (FP) - (FQ) - (FR) - (FS) - (FT) - (FU) - (FV) - (FW) - (FX) - (FY) - (FZ) - (GA) - (GB) - (GC) - (GD) - (GE) - (GF) - (GG) - (GH) - (GI) - (GJ) - (GK) - (GL) - (GM) - (GN) - (GO) - (GP) - (GQ) - (GR) - (GS) - (GT) - (GU) - (GV) - (GW) - (GX) - (GY) - (GZ) - (HA) - (HB) - (HC) - (HD) - (HE) - (HF) - (HG) - (HH) - (HI) - (HJ) - (HK) - (HL) - (HM) - (HN) - (HO) - (HP) - (HQ) - (HR) - (HS) - (HT) - (HU) - (HV) - (HW) - (HX) - (HY) - (HZ) - (IA) - (IB) - (IC) - (ID) - (IE) - (IF) - (IG) - (IH) - (II) - (IJ) - (IK) - (IL) - (IM) - (IN) - (IO) - (IP) - (IQ) - (IR) - (IS) - (IT) - (IU) - (IV) - (IW) - (IX) - (IY) - (IZ) - (JA) - (JB) - (JC) - (JD) - (JE) - (JF) - (JG) - (JH) - (JI) - (JJ) - (JK) - (JL) - (JM) - (JN) - (JO) - (JP) - (JQ) - (JR) - (JS) - (JT) - (JU) - (JV) - (JW) - (JX) - (JY) - (JZ) - (KA) - (KB) - (KC) - (KD) - (KE) - (KF) - (KG) - (KH) - (KI) - (KJ) - (KK) - (KL) - (KM) - (KN) - (KO) - (KP) - (KQ) - (KR) - (KS) - (KT) - (KU) - (KV) - (KW) - (KX) - (KY) - (KZ) - (LA) - (LB) - (LC) - (LD) - (LE) - (LF) - (LG) - (LH) - (LI) - (LJ) - (LK) - (LL) - (LM) - (LN) - (LO) - (LP) - (LQ) - (LR) - (LS) - (LT) - (LU) - (LV) - (LW) - (LX) - (LY) - (LZ) - (MA) - (MB) - (MC) - (MD) - (ME) - (MF) - (MG) - (MH) - (MI) - (MJ) - (MK) - (ML) - (MM) - (MN) - (MO) - (MP) - (MQ) - (MR) - (MS) - (MT) - (MU) - (MV) - (MW) - (MX) - (MY) - (MZ) - (NA) - (NB) - (NC) - (ND) - (NE) - (NF) - (NG) - (NH) - (NI) - (NJ) - (NK) - (NL) - (NM) - (NN) - (NO) - (NP) - (NQ) - (NR) - (NS) - (NT) - (NU) - (NV) - (NW) - (NX) - (NY) - (NZ) - (OA) - (OB) - (OC) - (OD) - (OE) - (OF) - (OG) - (OH) - (OI) - (OJ) - (OK) - (OL) - (OM) - (ON) - (OO) - (OP) - (OQ) - (OR) - (OS) - (OT) - (OU) - (OV) - (OW) - (OX) - (OY) - (OZ) - (PA) - (PB) - (PC) - (PD) - (PE) - (PF) - (PG) - (PH) - (PI) - (PJ) - (PK) - (PL) - (PM) - (PN) - (PO) - (PP) - (PQ) - (PR) - (PS) - (PT) - (PU) - (PV) - (PW) - (PX) - (PY) - (PZ) - (QA) - (QB) - (QC) - (QD) - (QE) - (QF) - (QG) - (QH) - (QI) - (QJ) - (QK) - (QL) - (QM) - (QN) - (QO) - (QP) - (QQ) - (QR) - (QS) - (QT) - (QU) - (QV) - (QW) - (QX) - (QY) - (QZ) - (RA) - (RB) - (RC) - (RD) - (RE) - (RF) - (RG) - (RH) - (RI) - (RJ) - (RK) - (RL) - (RM) - (RN) - (RO) - (RP) - (RQ) - (RR) - (RS) - (RT) - (RU) - (RV) - (RW) - (RX) - (RY) - (RZ) - (SA) - (SB) - (SC) - (SD) - (SE) - (SF) - (SG) - (SH) - (SI) - (SJ) - (SK) - (SL) - (SM) - (SN) - (SO) - (SP) - (SQ) - (SR) - (SS) - (ST) - (SU) - (SV) - (SW) - (SX) - (SY) - (SZ) - (TA) - (TB) - (TC) - (TD) - (TE) - (TF) - (TG) - (TH) - (TI) - (TJ) - (TK) - (TL) - (TM) - (TN) - (TO) - (TP) - (TQ) - (TR) - (TS) - (TT) - (TU) - (TV) - (TW) - (TX) - (TY) - (TZ) - (UA) - (UB) - (UC) - (UD) - (UE) - (UF) - (UG) - (UH) - (UI) - (UJ) - (UK) - (UL) - (UM) - (UN) - (UO) - (UP) - (UQ) - (UR) - (US) - (UT) - (UU) - (UV) - (UW) - (UX) - (UY) - (UZ) - (VA) - (VB) - (VC) - (VD) - (VE) - (VF) - (VG) - (VH) - (VI) - (VJ) - (VK) - (VL) - (VM) - (VN) - (VO) - (VP) - (VQ) - (VR) - (VS) - (VT) - (VU) - (VV) - (VW) - (VX) - (VY) - (VZ) - (WA) - (WB) - (WC) - (WD) - (WE) - (WF) - (WG) - (WH) - (WI) - (WJ) - (WK) - (WL) - (WM) - (WN) - (WO) - (WP) - (WQ) - (WR) - (WS) - (WT) - (WU) - (WV) - (WW) - (WX) - (WY) - (WZ) - (XA) - (XB) - (XC) - (XD) - (XE) - (XF) - (XG) - (XH) - (XI) - (XJ) - (XK) - (XL) - (XM) - (XN) - (XO) - (XP) - (XQ) - (XR) - (XS) - (XT) - (XU) - (XV) - (XW) - (XX) - (XY) - (XZ) - (YA) - (YB) - (YC) - (YD) - (YE) - (YF) - (YG) - (YH) - (YI) - (YJ) - (YK) - (YL) - (YM) - (YN) - (YO) - (YP) - (YQ) - (YR) - (YS) - (YT) - (YU) - (YV) - (YW) - (YX) - (YY) - (YZ) - (ZA) - (ZB) - (ZC) - (ZD) - (ZE) - (ZF) - (ZG) - (ZH) - (ZI) - (ZJ) - (ZK) - (ZL) - (ZM) - (ZN) - (ZO) - (ZP) - (ZQ) - (ZR) - (ZS) - (ZT) - (ZU) - (ZV) - (ZW) - (ZX) - (ZY) - (ZZ)</td> </tr> </table>												OPERATING MODE (9) 4	THIS REPORT IS SUBMITTED PURSUANT TO THE REQUIREMENTS OF 10 CFR § 170.400 (C) - (I) - (J) - (K) - (L) - (M) - (N) - (O) - (P) - (Q) - (R) - (S) - (T) - (U) - (V) - (W) - (X) - (Y) - (Z) - (AA) - (AB) - (AC) - (AD) - (AE) - (AF) - (AG) - (AH) - (AI) - (AJ) - (AK) - (AL) - (AM) - (AN) - (AO) - (AP) - (AQ) - (AR) - (AS) - (AT) - (AU) - (AV) - (AW) - (AX) - (AY) - (AZ) - (BA) - (BB) - (BC) - (BD) - (BE) - (BF) - (BG) - (BH) - (BI) - (BJ) - (BK) - (BL) - (BM) - (BN) - (BO) - (BP) - (BQ) - (BR) - (BS) - (BT) - (BU) - (BV) - (BW) - (BX) - (BY) - (BZ) - (CA) - (CB) - (CC) - (CD) - (CE) - (CF) - (CG) - (CH) - (CI) - (CJ) - (CK) - (CL) - (CM) - (CN) - (CO) - (CP) - (CQ) - (CR) - (CS) - (CT) - (CU) - (CV) - (CW) - (CX) - (CY) - (CZ) - (DA) - (DB) - (DC) - (DD) - (DE) - (DF) - (DG) - (DH) - (DI) - (DJ) - (DK) - (DL) - (DM) - (DN) - (DO) - (DP) - (DQ) - (DR) - (DS) - (DT) - (DU) - (DV) - (DW) - (DX) - (DY) - (DZ) - (EA) - (EB) - (EC) - (ED) - (EE) - (EF) - (EG) - (EH) - (EI) - (EJ) - (EK) - (EL) - (EM) - (EN) - (EO) - (EP) - (EQ) - (ER) - (ES) - (ET) - (EU) - (EV) - (EW) - (EX) - (EY) - (EZ) - (FA) - (FB) - (FC) - (FD) - (FE) - (FF) - (FG) - (FH) - (FI) - (FJ) - (FK) - (FL) - (FM) - (FN) - (FO) - (FP) - (FQ) - (FR) - (FS) - (FT) - (FU) - (FV) - (FW) - (FX) - (FY) - (FZ) - (GA) - (GB) - (GC) - (GD) - (GE) - (GF) - (GG) - (GH) - (GI) - (GJ) - (GK) - (GL) - (GM) - (GN) - (GO) - (GP) - (GQ) - (GR) - (GS) - (GT) - (GU) - (GV) - (GW) - (GX) - (GY) - (GZ) - (HA) - (HB) - (HC) - (HD) - (HE) - (HF) - (HG) - (HH) - (HI) - (HJ) - (HK) - (HL) - (HM) - (HN) - (HO) - (HP) - (HQ) - (HR) - (HS) - (HT) - (HU) - (HV) - (HW) - (HX) - (HY) - (HZ) - (IA) - (IB) - (IC) - (ID) - (IE) - (IF) - (IG) - (IH) - (II) - (IJ) - (IK) - (IL) - (IM) - (IN) - (IO) - (IP) - (IQ) - (IR) - (IS) - (IT) - (IU) - (IV) - (IW) - (IX) - (IY) - (IZ) - (JA) - (JB) - (JC) - (JD) - (JE) - (JF) - (JG) - (JH) - (JI) - (JJ) - (JK) - (JL) - (JM) - (JN) - (JO) - (JP) - (JQ) - (JR) - (JS) - (JT) - (JU) - (JV) - (JW) - (JX) - (JY) - (JZ) - (KA) - (KB) - (KC) - (KD) - (KE) - (KF) - (KG) - (KH) - (KI) - (KJ) - (KK) - (KL) - (KM) - (KN) - (KO) - (KP) - (KQ) - (KR) - (KS) - (KT) - (KU) - (KV) - (KW) - (KX) - (KY) - (KZ) - (LA) - (LB) - (LC) - (LD) - (LE) - (LF) - (LG) - (LH) - (LI) - (LJ) - (LK) - (LL) - (LM) - (LN) - (LO) - (LP) - (LQ) - (LR) - (LS) - (LT) - (LU) - (LV) - (LW) - (LX) - (LY) - (LZ) - (MA) - (MB) - (MC) - (MD) - (ME) - (MF) - (MG) - (MH) - (MI) - (MJ) - (MK) - (ML) - (MM) - (MN) - (MO) - (MP) - (MQ) - (MR) - (MS) - (MT) - (MU) - (MV) - (MW) - (MX) - (MY) - (MZ) - (NA) - (NB) - (NC) - (ND) - (NE) - (NF) - (NG) - (NH) - (NI) - (NJ) - (NK) - (NL) - (NM) - (NN) - (NO) - (NP) - (NQ) - (NR) - (NS) - (NT) - (NU) - (NV) - (NW) - (NX) - (NY) - (NZ) - (OA) - (OB) - (OC) - (OD) - (OE) - (OF) - (OG) - (OH) - (OI) - (OJ) - (OK) - (OL) - (OM) - (ON) - (OO) - (OP) - (OQ) - (OR) - (OS) - (OT) - (OU) - (OV) - (OW) - (OX) - (OY) - (OZ) - (PA) - (PB) - (PC) - (PD) - (PE) - (PF) - (PG) - (PH) - (PI) - (PJ) - (PK) - (PL) - (PM) - (PN) - (PO) - (PP) - (PQ) - (PR) - (PS) - (PT) - (PU) - (PV) - (PW) - (PX) - (PY) - (PZ) - (QA) - (QB) - (QC) - (QD) - (QE) - (QF) - (QG) - (QH) - (QI) - (QJ) - (QK) - (QL) - (QM) - (QN) - (QO) - (QP) - (QQ) - (QR) - (QS) - (QT) - (QU) - (QV) - (QW) - (QX) - (QY) - (QZ) - (RA) - (RB) - (RC) - (RD) - (RE) - (RF) - (RG) - (RH) - (RI) - (RJ) - (RK) - (RL) - (RM) - (RN) - (RO) - (RP) - (RQ) - (RR) - (RS) - (RT) - (RU) - (RV) - (RW) - (RX) - (RY) - (RZ) - (SA) - (SB) - (SC) - (SD) - (SE) - (SF) - (SG) - (SH) - (SI) - (SJ) - (SK) - (SL) - (SM) - (SN) - (SO) - (SP) - (SQ) - (SR) - (SS) - (ST) - (SU) - (SV) - (SW) - (SX) - (SY) - (SZ) - (TA) - (TB) - (TC) - (TD) - (TE) - (TF) - (TG) - (TH) - (TI) - (TJ) - (TK) - (TL) - (TM) - (TN) - (TO) - (TP) - (TQ) - (TR) - (TS) - (TT) - (TU) - (TV) - (TW) - (TX) - (TY) - (TZ) - (UA) - (UB) - (UC) - (UD) - (UE) - (UF) - (UG) - (UH) - (UI) - (UJ) - (UK) - (UL) - (UM) - (UN) - (UO) - (UP) - (UQ) - (UR) - (US) - (UT) - (UU) - (UV) - (UW) - (UX) - (UY) - (UZ) - (VA) - (VB) - (VC) - (VD) - (VE) - (VF) - (VG) - (VH) - (VI) - (VJ) - (VK) - (VL) - (VM) - (VN) - (VO) - (VP) - (VQ) - (VR) - (VS) - (VT) - (VU) - (VV) - (VW) - (VX) - (VY) - (VZ) - (WA) - (WB) - (WC) - (WD) - (WE) - (WF) - (WG) - (WH) - (WI) - (WJ) - (WK) - (WL) - (WM) - (WN) - (WO) - (WP) - (WQ) - (WR) - (WS) - (WT) - (WU) - (WV) - (WW) - (WX) - (WY) - (WZ) - (XA) - (XB) - (XC) - (XD) - (XE) - (XF) - (XG) - (XH) - (XI) - (XJ) - (XK) - (XL) - (XM) - (XN) - (XO) - (XP) - (XQ) - (XR) - (XS) - (XT) - (XU) - (XV) - (XW) - (XX) - (XY) - (XZ) - (YA) - (YB) - (YC) - (YD) - (YE) - (YF) - (YG) - (YH) - (YI) - (YJ) - (YK) - (YL) - (YM) - (YN) - (YO) - (YP) - (YQ) - (YR) - (YS) - (YT) - (YU) - (YV) - (YW) - (YX) - (YY) - (YZ) - (ZA) - (ZB) - (ZC) - (ZD) - (ZE) - (ZF) - (ZG) - (ZH) - (ZI) - (ZJ) - (ZK) - (ZL) - (ZM) - (ZN) - (ZO) - (ZP) - (ZQ) - (ZR) - (ZS) - (ZT) - (ZU) - (ZV) - (ZW) - (ZX) - (ZY) - (ZZ)										
OPERATING MODE (9) 4	THIS REPORT IS SUBMITTED PURSUANT TO THE REQUIREMENTS OF 10 CFR § 170.400 (C) - (I) - (J) - (K) - (L) - (M) - (N) - (O) - (P) - (Q) - (R) - (S) - (T) - (U) - (V) - (W) - (X) - (Y) - (Z) - (AA) - (AB) - (AC) - (AD) - (AE) - (AF) - (AG) - (AH) - (AI) - (AJ) - (AK) - (AL) - (AM) - (AN) - (AO) - (AP) - (AQ) - (AR) - (AS) - (AT) - (AU) - (AV) - (AW) - (AX) - (AY) - (AZ) - (BA) - (BB) - (BC) - (BD) - (BE) - (BF) - (BG) - (BH) - (BI) - (BJ) - (BK) - (BL) - (BM) - (BN) - (BO) - (BP) - (BQ) - (BR) - (BS) - (BT) - (BU) - (BV) - (BW) - (BX) - (BY) - (BZ) - (CA) - (CB) - (CC) - (CD) - (CE) - (CF) - (CG) - (CH) - (CI) - (CJ) - (CK) - (CL) - (CM) - (CN) - (CO) - (CP) - (CQ) - (CR) - (CS) - (CT) - (CU) - (CV) - (CW) - (CX) - (CY) - (CZ) - (DA) - (DB) - (DC) - (DD) - (DE) - (DF) - (DG) - (DH) - (DI) - (DJ) - (DK) - (DL) - (DM) - (DN) - (DO) - (DP) - (DQ) - (DR) - (DS) - (DT) - (DU) - (DV) - (DW) - (DX) - (DY) - (DZ) - (EA) - (EB) - (EC) - (ED) - (EE) - (EF) - (EG) - (EH) - (EI) - (EJ) - (EK) - (EL) - (EM) - (EN) - (EO) - (EP) - (EQ) - (ER) - (ES) - (ET) - (EU) - (EV) - (EW) - (EX) - (EY) - (EZ) - (FA) - (FB) - (FC) - (FD) - (FE) - (FF) - (FG) - (FH) - (FI) - (FJ) - (FK) - (FL) - (FM) - (FN) - (FO) - (FP) - (FQ) - (FR) - (FS) - (FT) - (FU) - (FV) - (FW) - (FX) - (FY) - (FZ) - (GA) - (GB) - (GC) - (GD) - (GE) - (GF) - (GG) - (GH) - (GI) - (GJ) - (GK) - (GL) - (GM) - (GN) - (GO) - (GP) - (GQ) - (GR) - (GS) - (GT) - (GU) - (GV) - (GW) - (GX) - (GY) - (GZ) - (HA) - (HB) - (HC) - (HD) - (HE) - (HF) - (HG) - (HH) - (HI) - (HJ) - (HK) - (HL) - (HM) - (HN) - (HO) - (HP) - (HQ) - (HR) - (HS) - (HT) - (HU) - (HV) - (HW) - (HX) - (HY) - (HZ) - (IA) - (IB) - (IC) - (ID) - (IE) - (IF) - (IG) - (IH) - (II) - (IJ) - (IK) - (IL) - (IM) - (IN) - (IO) - (IP) - (IQ) - (IR) - (IS) - (IT) - (IU) - (IV) - (IW) - (IX) - (IY) - (IZ) - (JA) - (JB) - (JC) - (JD) - (JE) - (JF) - (JG) - (JH) - (JI) - (JJ) - (JK) - (JL) - (JM) - (JN) - (JO) - (JP) - (JQ) - (JR) - (JS) - (JT) - (JU) - (JV) - (JW) - (JX) - (JY) - (JZ) - (KA) - (KB) - (KC) - (KD) - (KE) - (KF) - (KG) - (KH) - (KI) - (KJ) - (KK) - (KL) - (KM) - (KN) - (KO) - (KP) - (KQ) - (KR) - (KS) - (KT) - (KU) - (KV) - (KW) - (KX) - (KY) - (KZ) - (LA) - (LB) - (LC) - (LD) - (LE) - (LF) - (LG) - (LH) - (LI) - (LJ) - (LK) - (LL) - (LM) - (LN) - (LO) - (LP) - (LQ) - (LR) - (LS) - (LT) - (LU) - (LV) - (LW) - (LX) - (LY) - (LZ) - (MA) - (MB) - (MC) - (MD) - (ME) - (MF) - (MG) - (MH) - (MI) - (MJ) - (MK) - (ML) - (MM) - (MN) - (MO) - (MP) - (MQ) - (MR) - (MS) - (MT) - (MU) - (MV) - (MW) - (MX) - (MY) - (MZ) - (NA) - (NB) - (NC) - (ND) - (NE) - (NF) - (NG) - (NH) - (NI) - (NJ) - (NK) - (NL) - (NM) - (NN) - (NO) - (NP) - (NQ) - (NR) - (NS) - (NT) - (NU) - (NV) - (NW) - (NX) - (NY) - (NZ) - (OA) - (OB) - (OC) - (OD) - (OE) - (OF) - (OG) - (OH) - (OI) - (OJ) - (OK) - (OL) - (OM) - (ON) - (OO) - (OP) - (OQ) - (OR) - (OS) - (OT) - (OU) - (OV) - (OW) - (OX) - (OY) - (OZ) - (PA) - (PB) - (PC) - (PD) - (PE) - (PF) - (PG) - (PH) - (PI) - (PJ) - (PK) - (PL) - (PM) - (PN) - (PO) - (PP) - (PQ) - (PR) - (PS) - (PT) - (PU) - (PV) - (PW) - (PX) - (PY) - (PZ) - (QA) - (QB) - (QC) - (QD) - (QE) - (QF) - (QG) - (QH) - (QI) - (QJ) - (QK) - (QL) - (QM) - (QN) - (QO) - (QP) - (QQ) - (QR) - (QS) - (QT) - (QU) - (QV) - (QW) - (QX) - (QY) - (QZ) - (RA) - (RB) - (RC) - (RD) - (RE) - (RF) - (RG) - (RH) - (RI) - (RJ) - (RK) - (RL) - (RM) - (RN) - (RO) - (RP) - (RQ) - (RR) - (RS) - (RT) - (RU) - (RV) - (RW) - (RX) - (RY) - (RZ) - (SA) - (SB) - (SC) - (SD) - (SE) - (SF) - (SG) - (SH) - (SI) - (SJ) - (SK) - (SL) - (SM) - (SN) - (SO) - (SP) - (SQ) - (SR) - (SS) - (ST) - (SU) - (SV) - (SW) - (SX) - (SY) - (SZ) - (TA) - (TB) - (TC) - (TD) - (TE) - (TF) - (TG) - (TH) - (TI) - (TJ) - (TK) - (TL) - (TM) - (TN) - (TO) - (TP) - (TQ) - (TR) - (TS) - (TT) - (TU) - (TV) - (TW) - (TX) - (TY) - (TZ) - (UA) - (UB) - (UC) - (UD) - (UE) - (UF) - (UG) - (UH) - (UI) - (UJ) - (UK) - (UL) - (UM) - (UN) - (UO) - (UP) - (UQ) - (UR) - (US) - (UT) - (UU) - (UV) - (UW) - (UX) - (UY) - (UZ) - (VA) - (VB) - (VC) - (VD) - (VE) - (VF) - (VG) - (VH) - (VI) - (VJ) - (VK) - (VL) - (VM) - (VN) - (VO) - (VP) - (VQ) - (VR) - (VS) - (VT) - (VU) - (VV) - (VW) - (VX) - (VY) - (VZ) - (WA) - (WB) - (WC) - (WD) - (WE) - (WF) - (WG) - (WH) - (WI) - (WJ) - (WK) - (WL) - (WM) - (WN) - (WO) - (WP) - (WQ) - (WR) - (WS) - (WT) - (WU) - (WV) - (WW) - (WX) - (WY) - (WZ) - (XA) - (XB) - (XC) - (XD) - (XE) - (XF) - (XG) - (XH) - (XI) - (XJ) - (XK) - (XL) - (XM) - (XN) - (XO) - (XP) - (XQ) - (XR) - (XS) - (XT) - (XU) - (XV) - (XW) - (XX) - (XY) - (XZ) - (YA) - (YB) - (YC) - (YD) - (YE) - (YF) - (YG) - (YH) - (YI) - (YJ) - (YK) - (YL) - (YM) - (YN) - (YO) - (YP) - (YQ) - (YR) - (YS) - (YT) - (YU) - (YV) - (YW) - (YX) - (YY) - (YZ) - (ZA) - (ZB) - (ZC) - (ZD) - (ZE) - (ZF) - (ZG) - (ZH) - (ZI) - (ZJ) - (ZK) - (ZL) - (ZM) - (ZN) - (ZO) - (ZP) - (ZQ) - (ZR) - (ZS) - (ZT) - (ZU) - (ZV) - (ZW) - (ZX) - (ZY) - (ZZ)																						

OPERATING MODE (9) 4	POWER LEVEL (10) 0.710	<table border="1" style="width:100%; border-collapse: collapse;"> <tr> <td>20.402(a)</td> <td>20.402(a)</td> <td><input checked="" type="checkbox"/></td> <td>00.73(a)(2)(iv)</td> <td>73.71(b)</td> </tr> <tr> <td>20.402(a)(1)(B)</td> <td>00.20(a)(1)</td> <td></td> <td>00.73(a)(2)(v)</td> <td>73.71(c)</td> </tr> <tr> <td>20.402(a)(1)(B)</td> <td>00.20(a)(2)</td> <td><input checked="" type="checkbox"/></td> <td>00.73(a)(2)(vi)</td> <td>OTHER (Specify in Abstract below and in Text, NRC Form 206A)</td> </tr> <tr> <td>20.402(a)(1)(B)</td> <td>00.73(a)(2)(B)</td> <td></td> <td>00.73(a)(2)(vii)(A)</td> <td></td> </tr> <tr> <td>20.402(a)(1)(C)</td> <td>00.73(a)(2)(B)</td> <td></td> <td>00.73(a)(2)(vii)(B)</td> <td></td> </tr> <tr> <td>20.402(a)(1)(D)</td> <td>00.73(a)(2)(B)</td> <td></td> <td>00.73(a)(2)(viii)</td> <td></td> </tr> </table>										20.402(a)	20.402(a)	<input checked="" type="checkbox"/>	00.73(a)(2)(iv)	73.71(b)	20.402(a)(1)(B)	00.20(a)(1)		00.73(a)(2)(v)	73.71(c)	20.402(a)(1)(B)	00.20(a)(2)	<input checked="" type="checkbox"/>	00.73(a)(2)(vi)	OTHER (Specify in Abstract below and in Text, NRC Form 206A)	20.402(a)(1)(B)	00.73(a)(2)(B)		00.73(a)(2)(vii)(A)		20.402(a)(1)(C)	00.73(a)(2)(B)		00.73(a)(2)(vii)(B)		20.402(a)(1)(D)	00.73(a)(2)(B)		00.73(a)(2)(viii)	
20.402(a)	20.402(a)	<input checked="" type="checkbox"/>	00.73(a)(2)(iv)	73.71(b)																																					
20.402(a)(1)(B)	00.20(a)(1)		00.73(a)(2)(v)	73.71(c)																																					
20.402(a)(1)(B)	00.20(a)(2)	<input checked="" type="checkbox"/>	00.73(a)(2)(vi)	OTHER (Specify in Abstract below and in Text, NRC Form 206A)																																					
20.402(a)(1)(B)	00.73(a)(2)(B)		00.73(a)(2)(vii)(A)																																						
20.402(a)(1)(C)	00.73(a)(2)(B)		00.73(a)(2)(vii)(B)																																						
20.402(a)(1)(D)	00.73(a)(2)(B)		00.73(a)(2)(viii)																																						

LICENSEE CONTACT FOR THIS LER (12)  
E. R. Grant - Director-Nuclear Licensing

TELEPHONE NUMBER  
AREA CODE: 5104, NUMBER: 381-4145

COMPLETE ONE LINE FOR EACH COMPONENT FAILURE DESCRIBED IN THIS REPORT (13)

CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO NRC	CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO NRC
B	ED	52	G082	Y					

SUPPLEMENTAL REPORT EXPECTED (14)

YES (If yes, complete EXPECTED SUBMISSION DATE)  NO

EXPECTED SUBMISSION DATE (15)  
MONTH: 04, DAY: 15, YEAR: 88

ABSTRACT (Limit to 1400 spaces, i.e., approximately fifteen single-space typewritten lines) (16)

At approximately 1030 on 12/11/87 with the unit in Cold Shutdown (Mode 4), a loss of the Division II Reactor Protection System (RPS) bus occurred due to the trip of normal power supply Electrical Protection Assembly (EPA) breaker C71-S003D. The loss of the RPS bus resulted in all required Division II isolations which caused a loss of RHR "A" shutdown cooling. The bus was re-energized from the alternate power source, all isolations reset and shutdown cooling restarted. The logic card in the EPA breaker was found to be malfunctioning and two integrated circuit (IC) chips were replaced. The Surveillance Test Procedure (STP) was successfully performed and the breaker was returned to service.

At approximately 1857 on 12/19/87 with the unit again in Mode 4 following a manual unit shutdown, a second trip of EPA breaker C71-S003D occurred. Again, the breaker logic card was found to be defective. Three integrated circuit (IC) chips were replaced, the STP successfully performed and the breaker was returned to service. The output voltage of the motor-generator set was subsequently increased slightly to help prevent recurrence.

In each case, the unit was already in cold shutdown and all safety systems functioned as designed. Following the first event shutdown, cooling was restored within ten minutes by utilizing the alternate power supply. Therefore, there was no impact on the health and safety of the public as a result of these events.

*Handwritten initials/signature*

LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

FACILITY NAME (1)  RIVER BEND STATION	DOCKET NUMBER (2)  0 5 0 0 0 4 5 8	LER NUMBER (6)			PAGE (3)	
		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER		
		8 7	- 0 3 3	- 0 0	0 2	OF 0 4

TEXT (If more space is required, use additional NRC Form 366A's) (17)

REPORTED CONDITION AND INVESTIGATION

At approximately 1030 on 12/11/87 with the plant in Cold Shutdown (Mode 4) and in the final stages of the first refueling outage, a loss of power occurred to the Division II Reactor Protection System (RPS) (\*JC\*) bus. Loss of the RPS bus resulted in all required system isolations and actuations including a loss of Residual Heat Removal System (RHR) (\*BO\*) "A" shutdown cooling due to the isolation of the shutdown cooling suction valve. Operations immediately took action to restore power to the bus from the alternate power supply. All isolations were reset and systems restored to their normal configurations. RHR "A" shutdown cooling was restored in approximately 10 minutes.

Loss of one RPS bus by design causes a half-scrum signal, automatic initiation of the associated trains of Standby Gas Treatment (\*BH\*) and Fuel Building Charcoal Ventilation (\*BH\*) systems, and isolation of various lines penetrating the primary containment, including the RHR shutdown cooling suction line.

Immediate investigation found that Electrical Protection Assembly (EPA) breaker (\*52\*) C71-S003D had tripped (General Electric Model 914E175). EPA breaker C71-S003D is one of two EPA breakers installed between the normal power supply to the RPS bus motor generator (MG) set (\*MG\*) and the RPS bus itself. Two other EPA breakers are also installed between the alternate bus power supply and the RPS bus. Alternate power is supplied from a divisional motor control center (\*MCC\*) through a power line conditioning transformer (\*XMFR\*). (There are a total of eight EPA breakers in use at River Bend Station, two on each of the normal and alternate power supplies on each of the two RPS buses.) The EPA breakers monitor power supply voltage and frequency and after a time delay trip on an over-voltage, under-voltage or under-frequency condition to insure that power to the RPS bus is maintained within the equipment design requirements. The RPS bus was being supplied from the normal power supply at the time of this event.

Troubleshooting the logic card within the EPA breaker which contains the trouble detection, timing and tripping circuits revealed that the logic card was defective. Two integrated circuit (IC) chips in the under-voltage section of the logic card were replaced, the Surveillance Test Procedure (STP) was successfully performed and the breaker was returned to service.

At approximately 1857 on 12/19/87 with the unit again in Mode 4 following a manual unit shutdown, power was again lost to the Division II RPS bus. Investigation again revealed that the C71-S003D EPA breaker had tripped. Again, all required system isolations and actuations occurred. Power was restored to the RPS bus from the alternate power supply, all isolations were reset and systems were returned to their normal configurations.

LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

FACILITY NAME (1)  RIVER BEND STATION	DOCKET NUMBER (2)  0 5 0 0 0 4 5 8	LER NUMBER (6)			PAGE (3)		
		YEAR 8 7	SEQUENTIAL NUMBER 0 3 3	REVISION NUMBER -			
		-			0 0 0 3 OF 0 4		

TEXT (If more space is required, use additional LER Form 366A's) (17)

Following this occurrence, Gulf States Utilities (GSU) Engineering worked closely with Maintenance during troubleshooting. It was determined that the under-frequency and the over-voltage sections of the logic card were functioning properly. However, the output signals from the detector circuit in the under-voltage section of the logic card to the timing circuit were very erratic. It was determined that the solid-state (IC chip) timer circuit could be made to give a false under-voltage trip signal at voltages as high as 119.8 volts. The lower allowable voltage limit per the River Bend Station Technical Specifications is 115 volts. The measured output voltage from the MG set was at approximately 119.8 volts following the EPA breaker trip.

Additionally, during the performance of STP-508-1600 "EPA 18 month channel calibration" on 12/17/87, the logic card on EPA breaker C71-S003A on the normal power supply to the Division I RPS bus was found to exhibit similar characteristics as the failures reported here. However, this failure did not result in a spurious trip or a loss of power to the Division I RPS bus. This failure was also reworked, the STP successfully performed and the EPA breaker was returned to service.

CORRECTIVE ACTION

Following the first trip occurrence on 12/11/87, only two of the three IC chips which comprise the under-voltage timing and tripping circuit were replaced. Following the second trip, and for additional assurance, all three IC chips were replaced on the logic board, including the two previously replaced. This made significant improvement in the stability of the timer and trip circuits at the 119.8 volt setting of the MG set. To further gain additional margin of assurance against spurious under-voltage trips, the output voltage of the MG set was increased to approximately 121 volts which is consistent with the setting of the Division I RPS bus MG set. Following these corrective actions, the STP was successfully performed and the system was returned to normal operation.

It should be noted that similar occurrences were previously addressed by LERs 85-006 and 86-024. In each case, the logic cards were reworked by replacing defective IC chips. Additionally, two Modification Requests (MRs) were implemented to improve the reliability of the breakers. MR 86-0604 removed trip indication status LED which was suspected to be overloading the output chip. MR 87-0008 was written to make further improvement by replacing all IC components with ones which were hand-selected and tested to provide optimum logic card performance. It was felt at that time that these two modifications would be adequate to prevent recurrence of the spurious trips. However, since these modifications were implemented, the two occurrences reported here indicate that the corrective actions previously taken were not entirely adequate to prevent recurrences or to reduce the frequency of spurious trips to an acceptable level.

LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

FACILITY NAME (1)  RIVER BEND STATION	DOCKET NUMBER (2)  0 5 0 0 0 4 5 8	LER NUMBER (6)			PAGE (3)	
		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER		
		8 7	0 3 3	0 0	0 4	OF 0 4

TEXT (If more space is required, use additional NRC Form 366A's) (17)

Therefore, GSU Engineering is currently working with General Electric (GE) to devise additional improvements. A three step approach is being utilized. A short range plan is being developed which will involve recommendations for operational changes and minor modifications to the present EPA breakers. The intermediate range plan calls for extensive engineering evaluation of the present design and may result in more extensive modifications to the logic board within the EPA breakers. Another aspect of the intermediate range plan is to investigate the feasibility of providing additional local indication or computer monitoring of the breakers to aid in troubleshooting. Finally, a long term plan involves the opening of discussions between GSU and GE concerning an overall redesign of the EPA breakers. Implementation of this long term plan will be contingent upon the success of the short term and intermediate term plans.

A status and estimated completion dates for these three phases of the improvement plan will be provided in a revised LER by 4/15/88.

SAFETY ASSESSMENT

In both events, the unit was already in cold shutdown and all safety systems functioned per their design. Following the first event, shutdown cooling was restored within ten minutes by utilizing the alternate power supply. Prior to the second event, shutdown cooling was not in service since the unit was in process of restarting. Reactor core cooling was being maintained with Reactor Water Cleanup (\*CE\*) which was restored within 11 minutes.

The nature of the failures which occurred in these cases as discussed previously in LER 86-024, do not prevent the EPA breaker from tripping when required to perform their intended function. In addition, these spurious trips place the unit in the fail-safe condition by providing a half-scrum and isolations upon tripping.

Therefore, there was no significant impact on the health and safety of the public as a result of these events.

NOTE: Energy Industry Identification System Codes are identified in the text as (\*XX\*).

**GULF STATES UTILITIES COMPANY**



RIVER BEND STATION POST OFFICE BOX 220 ST. FRANCISVILLE, LOUISIANA 70775

AREA CODE 504 635-6094 346-8651

January 11, 1988  
RBG- 27271  
File Nos. G9.5, G9.25.1.3

U.S. Nuclear Regulatory Commission  
Document Control Desk  
Washington, D.C. 20555

Gentlemen:

River Bend Station - Unit 1  
Docket No. 50-458

Please find enclosed Licensee Event Report No. 87-033 for River Bend Station - Unit 1. This report is being submitted pursuant to 10CFR50.73.

Sincerely,

J. E. Booker *by LJK*  
Manager-River Bend Oversight  
River Bend Nuclear Group

*ABG* *CS*  
JEB/TFP/PDG/DAS/ch

cc: U.S. Nuclear Regulatory Commission  
611 Ryan Plaza Drive, Suite 1000  
Arlington, TX 76011

NRC Resident Inspector  
P.O. Box 1051  
St. Francisville, LA 70775

INPO Records Center  
1100 Circle 75 Parkway  
Atlanta, GA 30339-3064

*IE22*  
*1/1*