NRC For (9-83)	- 386			LIC	ENSEE EVE	NT RE	PORT	(LER)	U.S. NUK AJ ED	CLEAR REGULA	TORY COMMISSION 0 3150-0104
FACILIT	-	(1)						0	OCKET NUMBER	(2)	PAGE 13
Hop	e Cr	ceek Gene	erating	Statio	n				0 15 10 10	0131514	1 OF 014
Ina	dver	tent "B	" Channe	el LOCA	Signals	Duri	ing 1	Instrume	nt Calil	bration	
EV	ENT DAT	E (B)		(6)	REPORT DAT	. (7)		OTHER	ACILITIES INVOL	VED (8)	
MONTH	DAY	YEAR YEAR	SEQUENTIAL	NUMBER	MONTH DAY	YEAR		FACILITY NAM	-6.9	DOCKET NUMBE	R(S)
						H				0 15 0 1	
017	03	8 6 8 6	033	01	0 9 3 0	8 6				0 151010	0 1 0 1 1 1
OPI	RATING	THIS RE	PORT IS SUBMITT	ED PURSUANT	TO THE REQUIREME	NTS OF 10	CFR §: /	Check one or more o	if the following) (11	,	
	100 300	2 20	402()	-	20.406(c)		X	60.73(a)(2)(iv)		73.71(b)	
LEVE		1 1 8 20	406(a)(1)(W)	-	50.36(c)(1)		-	50.73(a)(2)(v)		73.71(e)	antiby in Abstract
		20	406(a)(1)(W)		50.73(e)(2)(i)			50.73(a)(2)(viii)(A	0	below and 366A)	in Text, NRC Form
		20	405 (a) (1) (iv)		60.73(a)(2)(H)			50.73(a)(2)(vill)(8	0	Specia	al Report
		20	.406 (s) (1) (v)		50.73(a)(2)(Hi)			50.73(e)(2)(x)		-	-
NAME					ICENSEE CONTACT	POR THIS	LER (12)			TELEPHONE NU	MBER
									AREA CODE		
R.	G. B	irley							61019	31 31 91.	-15121318
			COMPLETE	DEPORTARIE	EACH COMPONENT	FAILURE	DESCRIBI	ED IN THIS REPOR	T (13)	1	
CAUSE	SYSTEM	COMPONENT	TURER	TO NPROS		CAUSE	SYSTEM	COMPONENT	TURER	TO NPADS	2
		111							111		
			SUPPLEM	ENTAL REPORT	EXPECTED (14)	-				MONT	H DAY YEAR
					-				SUBMISSI DATE (11	ON S)	
ABSTRAC	T (Limit	to 1400 parces /	SUBMISSION DAT		X NO						
	Pl I& 36 th in Co eq in th re of po pro pro pro Pl S Co Pl I & S Co Pl I & S Co Pl I & S Co Pl I & S Co Pl I & S Co Pl I S C S C S C S C S C S C S C S C S C S	ant in O C calibr 82 B. T e "B" Ch correct re Cooli uipment jected i e operat set the erationa either rt of th njunctio ocedure r I&C Te ocedures uipment. chnical nstitute erating rsuant t	PERATION ating Po wo similannel Lo return o ng Syste initiate nto the or, afte logic an of the of the in use. chnician for use for use Specifie d the f at rate	NAL CON ost Acc lar even oss of of a le ems (EC ed and vessel er veri nd retu- tion. echnici a proce corre ns and e on al proced cation irst ar d tempe	DITION 2 cident Mo ents occu Coolant evel inst CCS) and performe in both fying th ing the A Reacto The ro ian in th edural in ective ac developm l instru dures will surveill nd second erature a a) (2) (iv)	Renito rred Acci rume Engi d as a ins at t as or sc ot c e pendeq tion ment l be ance E cond p and p and p	eact ring whi dent tanc tanc tanc tanc tanc tanc tanc ta	or criti level t ch resul (LOCA) o servic ed Safet igned. es. Fol OCA sign ted equi did not was per mance of regardi cudes in nstrumer addition cedures. jections ure. Th	cal wit ransmit ted in logic d e. All y Featu Core Sp lowing hal was pment t occur a sonnel valvin ing the hcreased t speci affect E h to exi Specific	h power ter BB- actuati ue to Emerge re (ESF ray and each ev invalid o the r s a res error o g, in type of train: fic CCS and sting vents he read is rep ation	<pre>< <1%. LT- lon of ency f) a RHR yent d, normal sult on the ing d ESF ctor ported</pre>
		J.1.9 (0	special	Report)	403 8409	30					5.22
			E E E	Report) 3610100 DR AD	403 8607 OCK 0500	30 0345				-	IE22

LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

US NUCLEAR REGULATORY COMMISSION APPROVED OMB NO 3150-0104

PAGE 3

2 05 0 4

EXPIRES 8/31/85

FACILITY NAME (1)	DOCKET NUMBER (2)		LE	A NUMBER (6)			
	A CARLES STATE	YEAR		SEQUENTIAL		NUMBER	
Hope Creek Generating Station	0 15 10 10 10 13 15 14	816	_	01 31 3	-	011	01

PLANT AND SYSTEM IDENTIFICATION

General Electric - Boiling Water Reactor (BWR/4) Nuclear Boiler Instrumentation - "B" Channel Loss of Coolant Accident (LOCA) Logic (EIIS Designator: JE)

IDENTIFICATION OF OCCURRENCE

Inadvertent "B" Channel LOCA Signals During Instrument Calibration Performance Event Date: 07/03/86 Event Time: 1352 and 1509 This LER was initiated by Incident Reports 86-110 and 86-111.

CONDITIONS PRIOR TO OCCURRENCE

Plant in OPERATIONAL CONDITION 2. Reactor critical with power <1%. Low power testing underway in accordance with the power ascension program. I&C Technicians calibrating Post Accident Monitoring level transmitter BB-LT-3682 B.

DESCRIPTION OF OCCURRENCE

Two similar events occurred within a short period of time when Post Accident Monitoring level transmitter BB-LT-3682 B was being returned to service following calibration by I&C Technicians. Both events consisted of actuation of the "B" Channel LOCA logic. All Emergency Core Cooling Systems (ECCS) and Engineered Safety Feature equipment associated with this channel initiated and (ESF) performed as designed except for the Reactor Core Isolation Cooling (RCIC) System which was previously manually isolated as allowed by Technical Specifications. Core Spray and RHR injected into the vessel resulting in a 30 inch (approx. 6,000 gallons) rise for the first event and a 5 inch (approx. 1,000 gallons) rise for the In accordance with the Event Classification Guide, an second. Event was declared for each actuation. Following each Unusual event the operator, after verifying that the LOCA signal was invalid, reset the "B" channel logic and returned the associated equipment to the normal operational condition. A Reactor scram did not occur as a result of either event. The power ascension program was placed on hold until an initial assessment was performed by station management.

ANALYSIS OF OCCURRENCE

In each of the events I&C Technicians were returning Post Accident Monitoring level transmitter BB-LT-3682 B to service following calibration activities. Although this transmitter is not a Technical Specification surveillance related instrument, it shares common variable and reference sensing lines with a number of ECCS

NRC Form JOSA

LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

US NUCLEAR REGULATORY COMMISSION APPROVED OM8 NO 3150-0104

EXPIRES 8/31/85

		YEAR		SEQUENTIAL	1	REVISION		-	-	-
				NUMBER	-	NUMBER		1 1		
Hope Creek Generating Station 0 5 0 0	0 3 5 4	816	_	0 3 3	3-	0 1	013	OF	0	14

ANALYSIS OF OCCURRENCE CONT'D

RC Form

and ESF level and pressure transmitters. Any transient introduced as a result of improper valving or venting on a single transmitter, as occurred these cases, can affect all instruments sharing the common sensing lines.

I&C uses two types of procedures to perform instrument calibrations. Instruments which require surveillance in accordance with Technical Specifications have specific procedures for a particular transmitter. Other plant instruments are calibrated using general procedures written for a particular brand of transmitter. In addition to different types of procedures, the I&C Department has two distinct groups of technicians. The group responsible for completion of Technical Specification surveillance testing have received additional training on the sensitive nature of these tests and have been instructed on lessons learned from previous LOCA events. Other instruments, mainly non surveillance related, can be calibrated by other I&C Technicians with the proper qualifications.

The instrument involved in these events is not surveillance related and thus was being calibrated using a general procedure and by technicians that are not part of the surveillance group. The procedure in use did not have adequate precautions or instructions to the technicians to exercise care in returning the transmitter to service and to ensure that proper venting had been achieved.

The event occurred twice due to a problem concerning calibration data. During the initial calibration, the technician was concerned about the excessive error encountered between the required data and the as found data. Prior to contacting his immediate supervisor on the concern, he valved the transmitter into service. This action resulted in the first actuation of the logic. After conferring with his supervisor, he returned to the location of the transmitter and valved it out of service a second time. At this time, Operations determined that the work being performed by these technicians could have been responsible for the logic actuation. Upon being notified that a problem existed, the technician valved the transmitter back into service which resulted in the second event.

The root cause of these events was personnel error on the part of the I&C Technician in the performance of valving, in conjunction with a procedural inadequacy regarding the type of procedure that should be used. The events constitute the first and second ECCS injections with the reactor at rated temperature and pressure. The public health and safety was not compromised by this event. This LER is being submitted pursuant to 10CFR50.73(a)(2)(iv) and Technical Specification 3.5.1.q (Special Report). LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

US NUCLEAR REGULATORY COMMISSION APPROVED OMB NO 3150-0104

EXPIRES 8/31/65

FACILITY NAME (1)	DOCKET NUMBER (2)		L	ER NUMBER (6)		1	AGE	3)
		YEAR		SEQUENT AL NUMBER	REVISION		Π	
Hope Creek Generating Station	0 15 10 10 10 13 15 14	816	-	01313	- 011	014	OF	0 14

CORRECTIVE ACTION

The following corrective actions have been recommended and/or implemented as a result of these events:

- All I&C Technicians were advised of the consequences of these events and instructed to notify the Control Room prior to valving any transmitter in or out of service.
- o A review by I&C and Nuclear System Engineering has been completed to identify all non surveillance instruments which interface and can affect the ECCS and ESF instrumentation.
- All work on the above identified instruments has been terminated until instrument specific procedures are developed and approved.
- Work on the identified instruments using instrument specific procedures will only be performed by technicians with training relative to surveillance testing and lessons learned from previous LOCA events.
- o The scope of the I&C training program is being reevaluated with regard to continuing hands on training of all technicians.

Sincerely,

2 Jala

R. S. Salvesen General Manager -Hope Creek Operations

RGB:tlb



Public Service Electric and Gas Company P.O. Box L. Hancocks Bridge, New Jersey 08038

Hope Creek Operations

September 30, 1986

U.S. Nuclear Regulatory Commission Document Control Desk Washington, DC 20555

Dear Sir:

HOPE CREEK GENERATING STATION DOCKET NO. 50-354 UNIT NO. 1 LICENSEE EVENT REPORT 86-033-01

This Licensee Event Report Supplement is being submitted to satisfy the Special Report requirements of Technical Specification 3.5.1.g.

Sincerely yours,

RADAL

R. S. Salvesen General Manager -Hope Creek Operations

KMH:tlb Attachment

C Distribution

IE22-'11

The Energy People