



Commonwealth Edison
 72 West Adams Street, Chicago, Illinois
 Address Reply to: Post Office Box 767
 Chicago, Illinois 60690 - 0767

Dcd

April 14, 1989

PRIORITY ROUTING	
First	Second
RA	RC
ORA	ROC
ORP	ORC
ORS	ORL
ORSS	ORSL
ORMA	ORML
	ORPD

ORC (handwritten next to ORC)
FILE 102 (handwritten below table)

Mr. A. Bert Davis
 Regional Administrator
 U.S. Nuclear Regulatory Commission
 Region III
 799 Roosevelt Road
 Glen Ellyn, IL 60137

Subject: Braidwood Station Unit 2
 Diesel Generator 1DG01KB Failure
NRC Docket No. 50-457

Reference: (a) NUREG-1276, Technical Specification,
 (b) October 28, 1988, S.C. Hunsader letter to
 A.B. Davis

Dear Mr. Davis:

Section 4.8.1.1.3 of reference (a) requires that all diesel generator failures, valid or non-valid, be reported to the NRC pursuant to Specification 6.9.2. The enclosure provides the report that addresses one invalid test failure experienced on diesel generator 2DG01KB.

Reference (b) is the most recent report addressing diesel generator failures, submitted per Section 4.8.1.1.3.

Please direct any questions concerning this matter to this office.

Very truly yours,

S.C. Hunsader
 Nuclear Licensing Administrator

IE22
~~*IE21*~~
 ||

/scl:0081T:1

cc: S. Sands-NRR
 Resident Inspector-Braidwood
 NRC-Document Control Desk

8904250417 890414
 PDR ADOCK 05000457
 PDC

APR 19 1989

2B D/G INVALID FAILURE REPORT

On February 15, 1989, at 2039, the 2B Diesel Generator was started in performance of the Monthly Operability Surveillance 2BwOS 8.1.1.2.a-2 using a manual SI signal. A strip chart recorder was connected at the local control panel to record the starting time. Local indication showed that the Diesel Generator came up to speed, voltage and frequency, but immediately thereafter, the voltage and frequency indications malfunctioned. The Diesel Generator run was then manually terminated. Due to three identical situations occurring previously on the 2A Diesel Generator when using a strip chart recorder, the secondary potential transformer fuse, which is located just upstream of the strip chart connections, was inspected. The fuse was found blown and was replaced. A continuity check of the strip chart recorder indicated no dead grounds. A second start attempt was performed at 2125 and produced identical results. The fuse was again replaced and the strip chart recorder connections were removed from the local control panel. The surveillance was restarted at 2139 using stopwatches to time the Diesel Generator start. The Diesel Generator operated as designed and the surveillance was completed at 2259. A Modification Request has been initiated to engineer and install terminal points for strip chart connections which will be electrically isolated from the Diesel Generator circuitry. This failure has been attributed to an intermittent short in the strip chart recorder and has been determined to be invalid in accordance with Regulatory Guide 1.108, Section C.2.e.2.

The 2A and the 2B Diesel Generator are currently being tested monthly in accordance with Technical Specification 4.8.1.1.2. The 2A Diesel Generator has had 3 valid failures in its 42 valid tests since the completion of pre-operational testing. The 2B Diesel Generator has had no valid failures in its 22 valid tests since the completion of pre-operational testing.