

Braidwood 1

Initiating Events

Significance:  Jun 30, 2002

Identified By: Self Disclosing

Item Type: FIN Finding

OPERATOR ERROR ISOLATING HEATER DRAIN FLOW

A finding of very low safety significance was identified through a self-revealing event when an operator inadvertently performed steps to isolate heater drain pump flow on Unit 1, which was operating at full power, instead of Unit 2, which was shutdown at the time. The primary cause of this finding was related to the cross-cutting area of Human Performance. Despite several unit-specific visual indications that were available, the operator did not perform adequate self-checking to ensure that he was on the correct unit. This finding was more than minor because it increased the likelihood of a reactor trip event due to low steam generator level and also could have affected the availability of the main feedwater mitigating system because the motor-driven main feedwater pump, if it had been operating, could have tripped on low suction pressure. The finding was only of very low safety significance because the exposure time was short, all other mitigating systems were available, and the main feedwater system could have been recovered by fairly simple operator actions. [This finding was determined not to be a violation of NRC requirements.]

Inspection Report# : [2002006\(pdf\)](#)

Significance:  Nov 19, 2001

Identified By: Self Disclosing

Item Type: NCV NonCited Violation

FAILURE TO FOLLOW PROCEDURE DURING STARTUP

The 1A reactor coolant pump first stage seal failed due to operators failing to follow procedural guidance during pump startup. This finding was determined to be of very low safety significance because the seal failure did not result in an actual loss of reactor coolant. A Non-Cited Violation of Technical Specification 5.4.1.a. was identified.

Inspection Report# : [2001011\(pdf\)](#)

Significance:  Nov 19, 2001

Identified By: Licensee

Item Type: NCV NonCited Violation

FAILURE TO FOLLOW FIRE PROTECTION PROCEDURES

Technical Specification 5.4.1.c. requires written procedures shall be established, implemented, and maintained for Fire Protection Program Implementation. The Fire Protection Program was implemented, in part, by procedure OP-AA-201-004, "Fire Prevention for Hot Work." Condition Report 00079302 cited 13 examples of the failure to follow OP-AA-201-004 during the licensee's Unit 1 Spring 2001 refueling outage.

Inspection Report# : [2001011\(pdf\)](#)

Significance: N/A Sep 30, 2001

Identified By: Self Disclosing

Item Type: NCV NonCited Violation

FAILURE TO FOLLOW PROCEDURE RESULTING IN A WATER SPILL

Valve 1CV8396A was left open during the local leak rate testing for the seal water return header penetration P-28 which resulted in the spill of a large amount of water when other portions of the chemical and volume control system were tested. This event was more than minor, as the incorrect manipulation of a valve resulted in a spill of a large amount of water which lead to the estimated low level contamination of 29 individuals and an additional 128 millirem of dose to clean up of the spill. The failure to properly perform valve manipulations during valve lineups was

reasonably viewed as a precursor to a significant event. The finding was of very low safety significance because the dose received due to clean up was low and the spill did not impact reactor safety because Unit 1 was shutdown for a refueling outage. The spill did not impact reactor vessel or cavity water level. A Non-Cited Violation was identified for the failure to follow a pretest valve lineup procedure.

Inspection Report# : [2001010\(pdf\)](#)

Significance:  Jun 16, 2001

Identified By: Self Disclosing

Item Type: FIN Finding

INADVERTENT DELUGE OF THE UNIT 2 EAST MAIN POWER TRANSFORMER

Operator Error Resulted in the Inadvertent Deluge of the Unit 2 East main power transformer on June 16, 2001. This event was more than minor, because it could be reasonably viewed as a precursor to a significant event. The finding was of very low safety significance because the transformer deluge did not result in a plant transient. This was not a violation as the Unit 2 east main power transformer was non-safety-related equipment.

Inspection Report# : [2001007\(pdf\)](#)

Significance:  May 21, 2001

Identified By: Self Disclosing

Item Type: FIN Finding

FOREIGN MATERIAL IN THE 2A MOTOR DRIVEN FEEDWATER PUMP LUBRICATING OIL SYSTEM

The Unit 2A motor driven feedwater pump tripped on March 30, 2001, due to low lubricating oil pressure. The feedwater pump's shaft driven lubricating oil pump was damaged by foreign material which had been left inside the pump's lubricating oil system during maintenance activities in August 1999. This event was considered more than minor, because if left uncorrected, the same issue (foreign material in a lube oil system) under the same conditions, could have become a more significant safety concern. The finding was of very low safety significance because the motor driven startup feedwater pump was available (i.e., not affected by this event). This resulted in full mitigating credit in the Phase II analysis using the NRC SDP analysis. This was not a violation as the feedwater pump was nonsafety-related equipment.

Inspection Report# : [2001006\(pdf\)](#)

Significance: N/A Nov 30, 2000

Identified By: NRC

Item Type: NCV NonCited Violation

Instrumentation Not Available for Determining RCP Seal Temperature

Due to the potential loss of RCP seal cooling and CCW flow to the thermal barriers, the licensee stated that the RCP seals could withstand a complete loss of seal cooling if the RCPs were tripped prior to seal temperature reaching 235°F. However, analyzed instrumentation for the RCP seal leak-off temperature indication was not available to the operators outside of the MCR. This temperature indication was not on the remote shutdown panel (RSP) or the fire hazard panel and was necessary for the plant operators to determine when to trip the RCPs. If the RCPs were not secured prior to reaching the temperature limit, the seals could fail resulting in a small LOCA and adversely impact reactor coolant makeup capability.

Inspection Report# : [2000006\(pdf\)](#)

Significance: N/A Nov 30, 2000

Identified By: NRC

Item Type: NCV NonCited Violation

Molded Case Circuit Breakers Not Periodically Inspected and Tested

During the inspection, the licensee could not provide any objective evidence (e.g., procedures) that the molded case circuit breakers at the 120Vac and 125Vdc voltage levels had been periodically manually exercised, inspected, and tested. Periodic maintenance and testing of molded case circuit breakers is necessary to ensure ease of operation and to assure that set-point drift remains within that allowed by the circuit breaker coordination design calculations.

Inspection Report# : [2000006\(pdf\)](#)

Significance:  Aug 21, 2000

Identified By: NRC

Item Type: FIN Finding

Emergent Work Associated with the Failure of 2HD046A Heater Drain Pump Discharge Valve

The inspectors identified that operations management personnel were not aware of the impact on risk from the realignment of the Unit 2 heater drain pump flow control valves due to emergent work, which could have impacted the risk associated with planned maintenance. The actual risk to the plant of having the Unit 2 heater drain pump flow control valves realigned did not change the plant risk status and therefore this issue was determined to be of very low safety significance.

Inspection Report# : [2000011\(pdf\)](#)

Significance:  May 15, 2000

Identified By: NRC

Item Type: NCV NonCited Violation

Failure to Follow Adverse Weather Requirements

The inspectors identified two examples of a non-cited violation for the failure to ensure that the area surrounding the Unit 1 transformer yard was free from loose debris in accordance with procedural requirements on two occasions. On April 20, 2000, and on May 8, 2000, the licensee implemented adverse weather preparation procedures 0BwOA ENV-1, 1BwOA ENV-1, and 2BwOA ENV-1 due to the issuance of a tornado watch for an area that included Braidwood Station. One of the required protective actions performed by the licensee was an inspection of the switchyard and the Unit 1 and 2 transformer yards and loose materials were to be secured or removed. The inspectors identified loose material in the Unit 1 transformer yaerd on both occasions that had not been removed and was not secured. Since no loss of off-site power occurred because of the failure to secure loose materials, this finding is considered to be of very low risk significance.

Inspection Report# : [2000005\(pdf\)](#)

Mitigating Systems

Significance:  Sep 30, 2002

Identified By: NRC

Item Type: NCV NonCited Violation

FAILURE TO ESTABLISH COMPENSATORY FIREWATCHES FOR TWO REMOVED FIRE RATED BARRIERS

A finding of very low safety significance was identified by the inspectors for a violation of Technical Specification Fire Protection Program requirements. The licensee removed two fire rated barriers (floor plugs) in the auxiliary building, and left them off for over five months, without establishing the required compensatory fire watches. The primary cause of this violation was related to the cross-cutting area of Human Performance. The licensee Fire Marshall failed to identify that the floor plugs were rated fire barriers, despite labels indicating that the 10 CFR 50, Appendix R, program applied to them, before authorizing their removal. This issue was more than minor because a fire in one elevation of the auxiliary building could have spread to other elevations and therefore affected redundant trains of mitigating systems. The issue was of very low safety significance because the inspectors could not develop realistic fire scenarios in one elevation that could reasonably propagate to the elevations above. The issue was a Non-Cited Violation of Technical Specification 5.4.1 which required the implementation of written procedures covering the Fire Protection Program.

Inspection Report# : [2002007\(pdf\)](#)

Significance: SL-IV Jun 30, 2002

Identified By: Licensee

Item Type: NCV NonCited Violation

INADEQUATE 10 CFR 50.59 EVALUATION FOR PROCEDURE CHANGE TO RH OPERATING PROCEDURE

The licensee identified that a change to the operating procedure for the residual heat removal pumps required prior NRC approval because the change could have caused a more than minor increase in the consequences of a steam line break accident. The thyroid dose to the control room operators could have increased by more than a minor amount above that previously analyzed. This was determined to be a Severity Level IV Non-Cited Violation of 10 CFR 50.59. Because the issue affected the NRC's ability to perform its regulatory function, it was evaluated with the traditional enforcement process. The finding was determined to be of very low safety significance because, although the procedure change could have resulted in a delay in cooling down the reactor to stop a radiation release, the effect of the change would have occurred late in the accident scenario when the technical support staff would have been available to develop methods of reducing the radiation release time and to monitor and reduce operator exposure.

Inspection Report# : [2002006\(pdf\)](#)

Significance:  Mar 31, 2002

Identified By: NRC

Item Type: NCV NonCited Violation

FAILURE TO IDENTIFY AND DOCUMENT FAILURE OF AF PUMP

The licensee failed to identify the cause and prevent recurrence for the September 1999 failure of the 1B auxiliary feedwater system, a significant condition adverse to quality. The cause of the failure was not determined until a subsequent failure occurred in November 2001. This finding was determined to be of very low safety significance because only one train of a Technical Specification safety-related system failed for less than the Technical Specification allowed outage time. The failure to identify the cause of the September 1999 failure was considered a Non-Cited Violation of 10 CFR 50, Appendix XVI.

Inspection Report# : [2002004\(pdf\)](#)

Significance:  Mar 31, 2002

Identified By: NRC

Item Type: NCV NonCited Violation

FAILURE TO INCLUDE APPROPRIATE PREREQUISITES IN MONTHLY SURVEILLANCE

The inspectors identified a Non-Cited Violation for inadequate test controls during a monthly surveillance testing of the 1B auxiliary feedwater system monthly surveillance test. This finding was of very low safety significance because the inspectors determined that this preconditioning issue had not led to an actual decline in performance of the 1B auxiliary feedwater system.

Inspection Report# : [2002005\(pdf\)](#)

Significance:  Feb 22, 2002

Identified By: NRC

Item Type: VIO Violation

VIOLATION OF 10 CFR APPENDIX B, CRITERION XVI, FOR THE LICENSEE'S FAILURE TO IDENTIFY THE CAUSE AND TAKE ACTION TO PREVENT RECURRENCE FOR FAILURES UNIT 1 PRESSURIZER PORV ACCUMULATOR CHECK VALVES

The inspectors identified an apparent violation of 10 CFR 50, Appendix B, Criterion XVI, "Corrective Action," for the licensee's failure to identify the cause and take action to prevent recurrence for failures of the check valves between the instrument air system and the accumulators for the Unit 1 pressurizer power operated relief valves (PORVs).

Specifically, following the October 1998 failures of all the Unit 1 pressurizer PORV accumulator check valves, a significant condition adverse to quality, the licensee did not determine the cause of the back leakage and take actions to preclude repetition as evidenced by the similar failures of the same valves in September 2001. The staff's significance determination of this finding was not complete at the time of issuance of this report; therefore, this issue is considered an unresolved item. The safety significance of this issue has been characterized as "To Be Determined (TBD)" pending the completion of additional risk analysis. Per NRC final significance determination letter to Exelon, dated July 23, 2002, the NRC concluded that the finding is characterized as White, and issued a Notice of Violation for a violation of

10 CFR 50, Appendix B, Criterion XVI, "Corrective Actions." The NRC determined that the licensee failed to correct and prevent recurrence of the Unit 1 pressurizer power operated relief valve air accumulator check valves leak-through, a significant condition adverse to quality. Specifically, Unit 1 pressurizer relief valves failed to meet testing acceptance criteria in April 1991, October 1992, April 1994, January 1995, October 1995, October 1998, and September 2001. This resulted in several extended periods where the unit was operated in a condition where the pressurizer power operated relief valves may not have been able to perform their intended safety function of opening following events which resulted in isolation of instrument air to the containment or loss of service air compressors. The licensee's significance determination agreed with the NRC's.

Inspection Report# : [2002003\(pdf\)](#)

Inspection Report# : [2002007\(pdf\)](#)

Significance:  Dec 29, 2001

Identified By: Licensee

Item Type: NCV NonCited Violation

FAILURE TO PROPERLY RECORD M&TE

Technical Specification 5.4.1 requires, in part, that written procedures be established, implemented, and maintained covering those activities listed in Regulatory Guide 1.33, Appendix A, Revision 2, February 1978. Section 8 of Appendix A to this Regulatory Guide requires, in part, that procedures of a type appropriate to the circumstances be provided to ensure that measuring and testing devices are properly controlled, calibrated and adjusted. On November 28, 2001, the licensee identified that measurement and test equipment were not being properly recorded as required by Step 4.7.3 of station procedure MA-AA-716, "Control of Portable Measurement and Test Equipment Program," Revision 1. Reference condition report No. 84419.

Inspection Report# : [2001013\(pdf\)](#)

Significance:  Dec 29, 2001

Identified By: Self Disclosing

Item Type: NCV NonCited Violation

FAILURE TO PERFORM RH PUMP MAINTENANCE IN ACCORDANCE WITH PROCEDURE

When placing shutdown cooling in service at the start of a forced outage on November 7, 2001, the 2B residual heat removal pump seized and was inoperable. The licensee determined that the failure of the 2B residual heat removal pump was due to a combination of a maintenance error which left the clearance between the pump impeller and the stuffing box extension wear ring less than that required and temperature transients when placing the RH pump in the shutdown cooling mode at a high temperature. This finding was determined to be of very low safety significance because the B train of residual heat removal was inoperable for less than the Technical Specification allow outage time. A Non-Cited Violation of Technical Specification 5.4.1 was identified.

Inspection Report# : [2001013\(pdf\)](#)

Significance:  Sep 30, 2001

Identified By: Self Disclosing

Item Type: NCV NonCited Violation

FAILURE TO HAVE PROCEDURE APPROPRIATE TO CIRCUMSTANCES

The Unit 1 motor operated valve 1MOV-SI8804B, failed to open during a routine surveillance rendering the B train of the emergency core cooling systems inoperable. This event was more than minor, in that it had an actual impact on safety as it resulted in the inoperability of one train (i.e., the 1B train of the emergency core cooling systems) of a safety-related, mitigating system. The finding was of very low safety significance, because the 1A emergency core cooling system remained operable and the licensee could manually restore the 1B train. A Non-Cited Violation was identified for the failure to adequately set the instantaneous current trip setpoint for the 1MOV-SI8804B valve motor operator breaker.

Inspection Report# : [2001010\(pdf\)](#)

Significance:  Jun 30, 2001

Identified By: NRC

Item Type: NCV NonCited Violation

INADEQUATE PROCEDURE FOR PERFORMING MAINTENANCE ON THE 1AOV-SX178 VALVE

The Unit 1B diesel driven auxiliary feedwater pump room cooler discharge isolation valve failed to open during a routine surveillance due to foreign material in the valve operator control air solenoid. The inspectors identified this as a non-cited violation owing to inadequate procedures governing the valve maintenance (Technical Specification 5.4.1).

This finding was considered more than minor, as it had a credible impact on safety that affected the availability of one train (i.e., the Unit 1B AF Pump) of a safety related, mitigating system.

Inspection Report# : [2001007\(pdf\)](#)

Significance:  Feb 09, 2001

Identified By: NRC

Item Type: NCV NonCited Violation

VIOLATION OF CRITERION III DUE TO FAILURE TO CORRECTLY TRANSLATE TANK WEIGHT INTO A SEISMIC CALCULATION

The inspectors identified a non-cited violation for failure to verify that the correct carbon dioxide tank weight was used in a seismic calculation. The finding was of very low safety significance because of the overall low probability of an earthquake occurring and the presence of the motor-driven auxiliary feedwater pump. The licensee entered the issue into the corrective action program and performed a qualitative operability assessment to demonstrate that the tank would not fail during a seismic event.

Inspection Report# : [2001002\(pdf\)](#)

Significance: N/A Nov 30, 2000

Identified By: Licensee

Item Type: NCV NonCited Violation

ESW Suction Valves Not Protected from Fire Induced Spurious Actuations

During the licensee's self-assessment activities in May 2000, prior to the NRC inspection, the licensee identified that the circuit breakers supplying power to ESW suction valves (1SX001A, 1SX001B, 2SX001A and 2SX001B) were not de-energized during normal plant operations in accordance with the response to FSAR Question 10.65. These valves supplied ESW to both units. The power removal commitment was to ensure that the valves would not close due to fire-induced spurious operations.

Inspection Report# : [2000006\(pdf\)](#)

Significance:  Aug 21, 2000

Identified By: NRC

Item Type: NCV NonCited Violation

Equipment Alignment of 1A SI Pump

The inspectors identified a NCV because maintenance personnel violated station administrative procedures for equipment control of plant barriers and ran welding cables through a ventilation damper above the Unit 1A SI Pump room door without a pre-approved plant barrier impairment evaluation. The risk significance for running the cables through the ventilation damper was determined to be of very low safety significance because their placement was later determined not to impact the auxiliary building ventilation system's ability to perform it's safety function.

Inspection Report# : [2000011\(pdf\)](#)

Significance:  May 15, 2000

Identified By: NRC

Item Type: NCV NonCited Violation

Failure to Follow Technical Specification Outage Limit

Between March 26 and April 1, 2000, the 2A essential service water pump was inoperable for longer than the allowed outage time for TS 3.7.8. The licensee performed maintenance on the A train of essential service water that required draining of the suction piping. The design of the piping did not allow for adequate fill and vent upon return to service and the licensee's fill and vent procedure was not adequate to overcome the design deficiency. Since it was shown that the design basis accident criteria could be met and that the TS LCO was not met, this event was of very low risk significance.

Inspection Report# : [2000005\(pdf\)](#)

Barrier Integrity

Significance:  Mar 31, 2002

Identified By: Self Disclosing

Item Type: NCV NonCited Violation

FAILURE TO USE CORRECT INSTANTANEOUS CURRENT TRIP SETPOINT

The licensee failed to incorporate the correct instantaneous current trip setpoint following maintenance and replacement of a safety-related, motor operated valve's molded case circuit breaker. This issue was originally identified during the replacement of a similar molded case circuit breaker in September 2001. The inspectors identified a Non-Cited Violation for inadequate corrective actions. This finding was of very low safety significance because the issue did not represent an actual loss of a safety function of the reactor containment fan coolers.

Inspection Report# : [2002005\(pdf\)](#)

Significance:  Feb 22, 2002

Identified By: Self Disclosing

Item Type: NCV NonCited Violation

FAILURE TO FOLLOW PROCEDURE RESULTED IN THE INOPERABILITY OF THE 1B CONTAINMENT SPRAY SUCTION VALVE FROM THE CONTAINMENT SUMP

Following a trip of the circuit breaker during surveillance testing, the licensee determined that 14 months earlier, technicians failed to reset the instantaneous overcurrent trip setpoint for the 1CS009B circuit break as prescribed in the station procedure resulting in the instantaneous overcurrent being left at a nonconservatively low value. This event was considered self-revealing. The inspectors determined that this issue had a credible impact on safety because under certain voltage conditions the 1B train of the containment spray would not have been capable of fulfilling the design safety function. The inspectors concluded that this issue could have affected the capability of controlling containment pressure; however, because no actual reduction of the containment pressure control function occurred, this issue was of very low safety significance. The failure to follow the maintenance procedure for the inspection and testing of the 1B containment spray suction valve from the containment sump circuit breaker was a violation of Technical Specification 5.4.1.a. However, since this finding is of very low safety significance and it was captured in the licensee's corrective action program, this finding is being treated as a Non-Cited Violation consistent with Section V1.A.1 of the NRC Enforcement Policy.

Inspection Report# : [2002003\(pdf\)](#)

Significance:  Nov 19, 2001

Identified By: NRC

Item Type: VIO Violation

FAILURE TO MAINTAIN AN ADEQUATE TEST CONTROL PROGRAM

Green. The licensee did not consider instrument inaccuracies when establishing the acceptance criteria for Technical Specification Surveillance Requirement 3.7.9.2, ultimate heat sink average temperature. This instrument tolerance band was not accounted for in design analyses. This finding was determined to be of very low safety significance because with the most conservative instrument inaccuracies applied to the actual maximum ultimate heat sink temperature

recorded, the Technical Specification limit was not exceeded. The inspectors determined this failure to properly control test procedures was a violation of 10 CFR Part 50, Appendix B, Criterion XI, "Test Control." The licensee disagreed with the inspectors' conclusions and did not place this issue into the corrective action program. Therefore, a Notice of Violation was issued.

Inspection Report# : [2001011\(pdf\)](#)

Inspection Report# : [2002007\(pdf\)](#)

Significance: N/A Mar 31, 2001

Identified By: NRC

Item Type: NCV NonCited Violation

INADEQUATE POST MAINTENANCE TESTING ASSOCIATED WITH PREVENTIVE MAINTENANCE ON THE OA HYDROGEN RECOMBINER

The inspectors identified an NCV of Technical Specification 5.4.1.a for failure to have work instructions appropriate for the circumstances. Post maintenance testing for leakage associated with replaced seals on the OA hydrogen recombiner was not planned. Because the inspectors identified the inadequate post maintenance testing before the completion of the scheduled maintenance there was no degraded cornerstone. The violation was considered significant because had the seals failed, excessive leakage of containment post accident atmosphere would have bypassed the designed filtered ventilation system. However, the subsequent testing of the seals determined them operable and the reactor containment was not degraded.

Inspection Report# : [2001005\(pdf\)](#)

Emergency Preparedness

Occupational Radiation Safety

Significance:  Nov 19, 2001

Identified By: NRC

Item Type: NCV NonCited Violation

FAILURE TO FOLLOW TS 5.7.2(d)

Green. The licensee failed to barricade, conspicuously post, and install a flashing light activated as a warning device to control access to a high radiation area (greater than 1000 mrem/hour) located in the 1B Reactor Containment Fan Coolers plenum. This finding was determined to be of very low safety significance because unauthorized entry into the inadequately controlled high radiation areas did not appear to occur and a substantial potential for an overexposure did not exist. A Non-Cited Violation of Technical Specification 5.7.2(d) was identified.

Inspection Report# : [2001011\(pdf\)](#)

Significance: SL-IV Sep 25, 2001

Identified By: Licensee

Item Type: VIO Violation

DELIBERATE FAILURE TO FOLLOW PROCEDURES

On September 25, 2001, in a letter to Mr. O. Kingsley from Mr. J. Grobe, the NRC issued Enforcement Action (EA) No. 01-131 concerning a deliberate violation of licensee procedure, BwRP 5822-3, Revision 1, "Operation and Calibration of the Eberline PM-7 Portal Monitors," that occurred on October 23, 2000, at the licensee's facility. Specifically, the NRC concluded that a contractor boilermaker deliberately violated the procedure when he exited the protected area after twice activating the alarms on two separate portal monitors at the gatehouse and deliberately failed to contact the radiation protection department, as required by station procedure. Since the violation was determined to be willful, the NRC did not assign a significance to the violation using the NRC's Significance Determination Process. In accordance with the NRC Enforcement Policy, the NRC determined that the incident constituted a Severity Level IV

violation of the Braidwood Station Facility Operating License. The NRC has concluded that information regarding the reason for the violation, the corrective actions taken and planned to correct the violation and prevent recurrence and the date when full compliance was achieved was adequately addressed on the docket in our June 11, 2001 letter, and in Exelon's response dated July 13, 2001.

Inspection Report# : [2001010\(pdf\)](#)

Public Radiation Safety

Physical Protection

Significance:  Oct 20, 2000

Identified By: NRC

Item Type: FIN Finding

Access Control (Identification, Authorization, and Search of Personnel, Packages, and Vehicles)

The NRC Determined that the licensee did not have a drill and exercise program to test certain personnel to provide a high probability of detecting contraband items during searches from being introduced into the protected area via a specific point. The licensee's Appendix B security drill and exercise program applied only to other personnel. The inspector reviewed the risk significance of this finding and found the risk to be very low since there were no actual intrusions and there have not been greater than two similar findings in four quarters.

Inspection Report# : [2000016\(pdf\)](#)

Miscellaneous

Significance: N/A Feb 22, 2002

Identified By: NRC

Item Type: FIN Finding

INSPECTORS NOTED SEVERAL EXAMPLES WHERE APPARENT CAUSE EVALUATIONS (ACEs) WERE OF POOR QUALITY.

The inspectors concluded that the licensee adequately identified, evaluated, and resolved problems within the requirements of the corrective action program (CAP). In general, the significance threshold for entering issues into the corrective action program appeared appropriate. However, the inspectors noted several examples where apparent cause evaluations (ACEs) were of poor quality. These deficiencies were not identified by line management during the licensee's review and approval process. The types of deficiencies varied but included the following: • New information that could impact the original operability and reportability evaluations was not re-evaluated by shift management. • Other apparent problems were mentioned but were not fully addressed in the evaluation. For example, potential common cause failure mechanisms were included as possible apparent causes; however, the impact on like-equipment was not resolved or evaluated. • The extent of the evaluations and corrective actions were not always well documented. In addition, the inspectors noted that equipment problems identified during outages were not always evaluated for operability or reportability. In addition, causes for significant equipment problems were not always addressed prior to plant startup. The licensee was effective in correcting broke/fix type issues such as equipment problems, procedure deficiencies, and calculational errors. However, the licensee was less effective in correcting recurring human performance problems. This was evidenced by recurring problems associated with configuration control, contractor control, foreign material exclusion control, fire protection control, and rework issues. Through interviews and observations, the inspectors concluded that Braidwood established a safety-conscious work environment where people were not reluctant to raise issues. However, the inspectors noted that recent changes to the CAP made it somewhat burdensome to enter items into the corrective action program computerized process. Additionally, the inspectors

ascertained that the recent changes to the CAP also made the trending condition report-related data burdensome by making the manipulation of the data difficult.

Inspection Report# : [2002003\(pdf\)](#)

Significance: N/A Dec 31, 2000

Identified By: Licensee

Item Type: NCV NonCited Violation

Failure to Meet Tech Spec Requirements

TS 5.4.1c. requires written procedures shall be established, implemented, and maintained for Fire Protection Program Implementation. The FPP was implemented, in part, by OP-AA-201-004, "Fire Prevention for Hot Work." CR A2000-04494 cited 45 examples of failure to follow procedure during licensee's U2 fall 2000 refueling outage.

Inspection Report# : [2000018\(pdf\)](#)

Significance: N/A Sep 22, 2000

Identified By: NRC

Item Type: FIN Finding

PROBLEM IDENTIFICATION AND RESOLUTION

The team identified that the licensee was effective at identifying problems and placing them in the corrective action system. Also, the inspectors concluded that the licensee personnel communicated an acceptable level of responsibility in identifying and entering safety issues into the corrective action program. However, the inspectors identified several examples of minor problems that did not result in any adverse consequences which were similar to problems identified by licensee personnel during recent self-assessments.

Inspection Report# : [2000013\(pdf\)](#)

Last modified : December 02, 2002