

## Catawba 2

### 3Q/2003 Plant Inspection Findings

---

#### Initiating Events

---

#### Mitigating Systems

**Significance:**  Jan 31, 2003

Identified By: NRC

Item Type: NCV NonCited Violation

##### **Failure to Update and Maintain Control of Design Calculations**

A non-cited violation of 10 CFR 50, Appendix B, Criterion III, "Design Control," and 10 CFR 50, Appendix B, Criterion V, "Instructions, Procedures, and Drawings," was identified for inadequate control of design calculations. This finding adversely affects the design control attribute of the mitigating systems cornerstone and is greater than minor because there were multiple examples of Type II calculation deficiencies that were significant enough to require revision of several design calculations to ensure the component cooling water system met design criteria. Specific examples of inadequate design calculations included failure to use appropriate and/or current calculation inputs, out of date active design calculations, and the failure to incorporate design changes into the existing design calculations. This finding is of very low safety significance because the resulting design calculation revisions did not show that the component cooling water system was operating outside of its design criteria. (Section 1R21.231 b)

Inspection Report# : [2002008\(pdf\)](#)

---

#### Barrier Integrity

**Significance:**  Sep 20, 2003

Identified By: NRC

Item Type: NCV NonCited Violation

##### **Effect of RCP Thermal Barrier Rupture on MOV Closure and Containment Isolation**

The inspectors identified a non-cited violation for failure to comply with 10 CFR 50 Appendix B, Criterion 3, Design Control, due to inadequate design measures. Specifically, the licensee failed to assure adequate relief valve sizing to prevent exceeding the design pressure of the component cooling water (KC) piping in the event of a reactor coolant pump (RCP) thermal barrier rupture. This finding represented a performance deficiency because it involved the licensee's failure to assure the design adequacy of the KC relief valve to protect the piping from exceeding design limits in the event of a RCP thermal barrier leak. This finding is more than minor because it affects the Reactor Safety Cornerstone, Barrier Integrity attribute of design control and affects the associated objective. The inadequately sized relief valve represents a potential open path way in the physical integrity of the reactor containment. The NRC performed a phase three significance determination screening analysis and concluded the finding is of very low safety significance. (Section 4OA5.1)

Inspection Report# : [2003004\(pdf\)](#)


---

---

## Emergency Preparedness

---

## Occupational Radiation Safety

**Significance:**  Jun 28, 2003

Identified By: NRC

Item Type: NCV NonCited Violation

### **Failure to Post a Radiation Area**

The inspectors identified a non-cited violation for failure to post a radiation area as required by 10 CFR 20.1902, Posting Requirement, paragraph (a), Posting of Radiation Areas. Radioactive samples having a dose rate greater than 5 millirem/hour at 30 centimeters were stored in the chemistry lab in such a manner that an individual could receive a whole body dose from the stored material without the proper radiation sign posting. The finding was more than minor because it was associated with the Occupational Radiation Safety Cornerstone and affected the process attribute of exposure/contamination control and monitoring. The finding was determined to be of very low safety significance using the Occupational Radiation Safety SDP, because this finding was not an overexposure or substantial potential for an overexposure, and did not compromise the ability to assess dose, nor was it an ALARA issue. (Section 2OS1.1)

Inspection Report# : [2003003\(pdf\)](#)

**Significance:**  Jun 28, 2003

Identified By: NRC

Item Type: NCV NonCited Violation

### **Failure to Perform Adequate Routine Surveys**

The inspectors identified a non-cited violation for failure to perform adequate radiological surveys as required by 10 CFR 20.1501, General, paragraph (a). Three radiological surveys conducted in the chemistry laboratory over a three month period were insufficient to detect radiation levels from potential radiological hazards that could create radiation areas. The finding was more than minor because they were associated with the Occupational Radiation Safety Cornerstone and affected the process attribute of exposure/contamination control and monitoring to protect the worker from exposure to radiation. The finding was determined to be of very low safety significance using the Occupational Radiation Safety SDP, because it was not an overexposure or substantial potential for an overexposure and did not compromise the ability to assess dose, nor was it an ALARA issue. (Section 2OS1.2)

Inspection Report# : [2003003\(pdf\)](#)

**Significance:** N/A Mar 29, 2003

Identified By: NRC

Item Type: NCV NonCited Violation

### **Falsification of Radiological Survey Records**

A Severity Level IV violation that was characterized as an NCV of Technical Specification 5.4 and 10 CFR 50.9 was identified for a period of at least January 1 through June 4, 2002. This involved a health physics technician failing to perform required, routine radiation surveys on numerous occasions and deliberately fabricating data on the radiological survey records, which are required to be maintained by 10 CFR 20.2103. Because this issue involved willfulness on the part of a licensee employee and inaccurate information which impacts the regulatory process, it was not subject to the provisions of the Reactor Oversight Process, and was dispositioned in accordance with traditional enforcement. The finding was determined to be greater than minor because it was willful and involved required radiation surveys, some

involving high radiation areas, that were not made over an extended period of time. (Section 4OA5.2)  
Inspection Report# : [2003002\(pdf\)](#)

---

## Public Radiation Safety

---

### Physical Protection

**Significance:**  Dec 20, 2002

Identified By: NRC

Item Type: NCV NonCited Violation

#### **Failure to comply with Interim Compensatory Measure B.4.f**

A non-cited violation of Provision III.A of the February 25, 2002, Order for Interim Safeguards and Security Compensatory Measures for Catawba was identified. The finding was more than minor because it was associated the "Response to Contingency Events" attribute and affected the objective of the Physical Protection Cornerstone to provide adequate assurance that the physical protection system can protect against the design basis threat of radiological sabotage. It was determined to be of very low safety significance in that it involved a failure to meet regulatory requirements and represented a vulnerability in safeguards systems or plan; however, there have not been greater than two similar findings in the previous four quarters. (Section V.F

Inspection Report# : [2002009\(pdf\)](#)

---

### Miscellaneous

Last modified : December 01, 2003