

Exelon Generation Company, LLC      www.exeloncorp.com  
Byron Station  
4450 North German Church Road  
Byron, IL 61010-9794

October 25, 2002

LTR: BYRON 2002-0109  
File: 1.10.0101

United States Nuclear Regulatory Commission  
Attn: Document Control Desk  
Washington, DC 20555-0001

Byron Station Unit 2  
Facility Operating License No. NPF-66  
NRC Docket No. STN 50-455

Subject: Byron Station Unit 2 Response to NRC Bulletin 2001-01, "Circumferential Cracking of Reactor Pressure Vessel Head Penetration Nozzles"

On August 3, 2001, the NRC issued NRC Bulletin 2001-01, "Circumferential Cracking of Reactor Pressure Vessel Head Penetration Nozzles". This bulletin requires that the following information be submitted to the NRC within 30 days after plant restart following the next refueling outage:

- a description of the extent of reactor pressure vessel head penetration nozzle leakage and cracking detected, including the number, location, size, and nature of each crack detected; and
- if cracking is identified, a description of the inspections, repairs, and other corrective actions taken to satisfy applicable regulatory requirements.


Pursuant to 10 CFR 50.54, "Conditions of Licenses," paragraph (f), Attachment 1 to this letter provides the Byron Station Unit 2 30-day response. This response is due to the NRC by November 6, 2002.

A088

October 25, 2002  
U.S. Nuclear Regulatory Commission  
Page 2

If you have any questions or desire additional information regarding this letter, please contact William Grundmann, Regulatory Assurance Manager, at (815) 406-2800.

Respectfully,

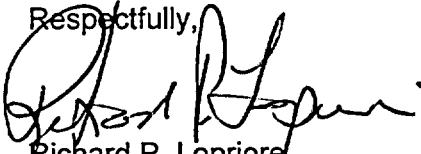

Richard P. Lopriore  
Site Vice President  
Byron Nuclear Generating Station

RPL/MR/rah

Enclosures: Attachment 1, Byron Station Unit 2 Response to NRC Bulletin 2001-01


cc: Regional Administrator – NRC Region III  
NRC Senior Resident Inspector – Byron Station  
NRC Project Manager – NRR – Byron Station  
Office of Nuclear Facility Safety – Illinois Department of Nuclear Safety

STATE OF ILLINOIS )  
COUNTY OF OGLE )  
  
IN THE MATTER OF )  
  
EXELON GENERATION COMPANY, LLC ) Docket Numbers  
BYRON STATION UNIT 2 ) STN 50-455

**SUBJECT: Byron Station Unit 2 Response to NRC Bulletin 2001-01, "Circumferential Cracking of Reactor Pressure Vessel Head Penetration Nozzles"**

**AFFIDAVIT**

I affirm that the content of this transmittal is true and correct to the best of my knowledge, information and belief.

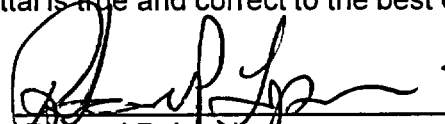


Richard P. Lopforo  
Site Vice President  
Byron Nuclear Generating Station


Subscribed and sworn to before me, a Notary Public in and

for the State above named, this 25 day of

October, 2002



Notary Public

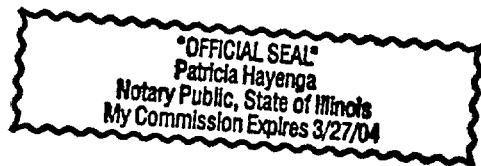

**ATTACHMENT 1**

**Byron Station Unit 2**

**Response to NRC Bulletin 2001-01**

**"Circumferential Cracking of Reactor Pressure  
Vessel Head Penetration Nozzles"**

## Attachment 1

### Byron Station Unit 2

#### Response to NRC Bulletin 2001-01

On August 3, 2001, the NRC issued NRC Bulletin 2001-01, "Circumferential Cracking of Reactor Pressure Vessel Head Penetration Nozzles". This bulletin requires that the following information be submitted to the NRC within 30 days after plant restart following the next refueling outage:

5. *Addressees are requested to provide the following information within 30 days after plant restart following the next refueling outage:*
  - a. *a description of the extent of vessel head penetration (VHP) nozzle leakage and cracking detected at your plant, including the number, location, size, and nature of each crack detected;*
  - b. *if cracking is identified, a description of the inspections (type, scope, qualification requirements, and acceptance criteria), repairs, and other corrective actions you have taken to satisfy applicable regulatory requirements. This information is requested only if there are any changes from prior information submitted in accordance with this bulletin.*

#### Byron Station Unit 2 Response

- a. *a description of the extent of VHP nozzle leakage and cracking detected at your plant, including the number, location, size, and nature of each crack detected;*

#### Response

No VHP nozzle leakage or cracking was detected during refueling outage B2R10 in Fall 2002. The following inspections were performed on the reactor pressure vessel (RPV) head during refueling outage B2R10:

- Pre and post-outage VT-2 examinations of the accessible areas on top of the RPV head (i.e., control rod drive mechanism housings) were performed at normal reactor coolant system pressure. No evidence of leakage, boric acid residue, or degradation of material due to corrosion was identified during these inspections.
- VT-1 examinations were performed on the core exit thermocouple clamp assemblies. There was no evidence of erosion, corrosion, or wear of the bolting material, and there were no instances of bolting material degradation due to corrosion. These connections, which are disassembled each refueling outage, were specifically examined for leakage by VT-2 qualified personnel during unit startup and no abnormal conditions were identified.

## Attachment 1

- A 100% bare metal RPV head examination was completed. This examination consisted of visual examinations (360°) of the RPV head vent penetration and all RPV head nozzles (78) at the annulus region to determine if any boric acid leakage was evident. In addition, the bare metal RPV head was visually examined for general condition and to ensure no RPV head wastage was present. These examinations found no evidence of boric acid leakage from the nozzles or degradation of the RPV head.
- b. *if cracking is identified, a description of the inspections (type, scope, qualification requirements, and acceptance criteria), repairs, and other corrective actions you have taken to satisfy applicable regulatory requirements. This information is requested only if there are any changes from prior information submitted in accordance with this bulletin.*

### Response

No VHP nozzle leakage or cracking was identified during refueling outage B2R10; therefore, no inspections, repairs, or other corrective actions were required.