

NP-33-03-008-00

Docket No. 50-346

License No. NPF-3

September 8, 2003


United States Nuclear Regulatory Commission
Document Control Desk
Washington, D.C. 20555

Ladies and Gentlemen:

LER 2003-008
Davis-Besse Nuclear Power Station, Unit No. 1
Date of Occurrence – July 8, 2003

Enclosed please find Licensee Event Report (LER) 2003-008, which is being submitted to provide written notification of an issue involving the installation of relays in the Safety Features Actuation System with insufficient contact voltage ratings. This LER is being submitted in accordance with 10CFR50.73(a)(2)(i)(B) and 10CFR50.73(a)(2)(ix)(A). Commitments associated with this LER are listed in the Attachment.

Very truly yours,

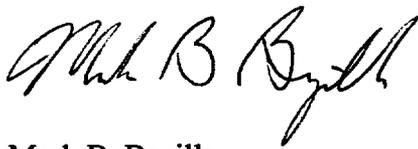

Mark B. Bezilla
Site Vice-President

GMW/s

Attachments

cc: Regional Administrator, USNRC Region III
DB-1 NRC Senior Resident Inspector
DB-1 Senior Project Manager, USNRC
Utility Radiological Safety Board

JE22

Docket Number 50-346
License Number NPF-3
NP-33-03-008-00
Attachment
Page 1 of 1

COMMITMENT LIST

The following list identifies those actions committed to by the Davis-Besse Nuclear Power Station in this document. Any other actions discussed in the submittal represent intended or planned actions by Davis-Besse. They are described only as information and are not regulatory commitments. Please notify the Manager - Regulatory Affairs (419-321-8450) at Davis-Besse of any questions regarding this document or associated regulatory commitments.

COMMITMENTS

DUE DATE

- | | |
|---|-----------------------|
| 1. Remove new Generation 3 Relays from the Safety Features Actuation System and replace with previous model relays. | 1. Completed. |
| 2. Revise procedure NOP-CC-7002, Procurement Engineering, to strengthen requirement to perform an equivalency review, establish procedural controls that allow a vendor to perform an equivalency evaluation, and establish clear guidance on when to review plant design parameters when performing an equivalency evaluation. | 2. November 26, 2003. |

NRC FORM 366 (7-2001)	U.S. NUCLEAR REGULATORY COMMISSION	APPROVED BY OMB NO. 3150-0104 <small>Estimated burden per response to comply with this mandatory information collection request: 50 hrs. Reported lessons learned are incorporated into the licensing process and fed back to industry. Send comments regarding burden estimate to the Records Management Branch (T-6 E6), U.S. Nuclear Regulatory Commission, Washington, DC 20555-0001, or by internet e-mail to bjs1@nrc.gov, and to the Desk Officer, Office of Information and Regulatory Affairs, NEOB-10202 (3150-0104), Office of Management and Budget, Washington, DC 20503. If a means used to impose information collection does not display a currently valid OMB control number, the NRC may not conduct or sponsor, and a person is not required to respond to, the information collection.</small>	EXPIRES 7-31-2004
LICENSEE EVENT REPORT (LER) (See reverse for required number of digits/characters for each block)			

1. FACILITY NAME Davis-Besse Unit Number 1	2. DOCKET NUMBER 05000346	3. PAGE 1 OF 7
--	-------------------------------------	--------------------------

4. TITLE
 Relays Installed in Safety Features Actuation System with Insufficient Contact Voltage Ratings

5. EVENT DATE			6. LER NUMBER			7. REPORT DATE			8. OTHER FACILITIES INVOLVED	
MO	DAY	YEAR	YEAR	SEQUENTIAL NUMBER	REV NO	MO	DAY	YEAR	FACILITY NAME	DOCKET NUMBER
07	08	2003	2003	-- 008 --	00	09	08	2003		05000
									FACILITY NAME	DOCKET NUMBER
										05000

9. OPERATING MODE	5	11. THIS REPORT IS SUBMITTED PURSUANT TO THE REQUIREMENTS OF 10 CFR §: (Check all that apply)								
10. POWER LEVEL	000	20.2201(b)			20.2203(a)(3)(ii)			50.73(a)(2)(ii)(B)		<input checked="" type="checkbox"/> 50.73(a)(2)(ix)(A)
		20.2201(d)			20.2203(a)(4)			50.73(a)(2)(iii)		50.73(a)(2)(x)
		20.2203(a)(1)			50.36(c)(1)(i)(A)			50.73(a)(2)(iv)(A)		73.71(a)(4)
		20.2203(a)(2)(i)			50.36(c)(1)(ii)(A)			50.73(a)(2)(v)(A)		73.71(a)(5)
		20.2203(a)(2)(ii)			50.36(c)(2)			50.73(a)(2)(v)(B)		OTHER Specify in Abstract below or in NRC Form 368A
		20.2203(a)(2)(iii)			50.46(a)(3)(ii)			50.73(a)(2)(v)(C)		
		20.2203(a)(2)(iv)			50.73(a)(2)(i)(A)			50.73(a)(2)(v)(D)		
		20.2203(a)(2)(v)			<input checked="" type="checkbox"/>	50.73(a)(2)(i)(B)			50.73(a)(2)(vii)	
20.2203(a)(2)(vi)			50.73(a)(2)(i)(C)			50.73(a)(2)(viii)(A)				
20.2203(a)(3)(i)			50.73(a)(2)(ii)(A)			50.73(a)(2)(viii)(B)				

12. LICENSEE CONTACT FOR THIS LER

NAME Gerald M. Wolf, Staff Engineer - Licensing	TELEPHONE NUMBER (Include Area Code) (419) 321-8001
---	---

13. COMPLETE ONE LINE FOR EACH COMPONENT FAILURE DESCRIBED IN THIS REPORT

CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO EPIX	CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO EPIX

14. SUPPLEMENTAL REPORT EXPECTED				15. EXPECTED SUBMISSION DATE			
YES (if yes, complete EXPECTED SUBMISSION DATE).	<input checked="" type="checkbox"/>	No			MONTH	DAY	YEAR

16. ABSTRACT (Limit to 1400 spaces, i.e., approximately 15 single-spaced typewritten lines)

On July 8, 2003, with the plant shutdown in Mode 5, it was discovered that output relays with insufficient contact voltage ratings were installed in the Safety Features Actuation System (SFAS). Approximately 250 output relays were replaced during the current extended outage due to the relay coils approaching end-of-life. The replacement relays were specifically manufactured and qualified for the Davis-Besse Nuclear Power Station SFAS. Due to errors in the procurement process, the new relays were manufactured to match the contact rating of the original SFAS relays (5 amps @ 30 VDC) instead of the upgraded ratings evaluated by the vendor during original installation (6 amps @ 125 VDC). It was discovered that five relays were installed during plant operation, but none were installed in redundant actuated equipment circuits. Testing during the current outage, which discovered the issue, did not reveal any operational problems with the five previously-installed relays. The new relays have been removed from the SFAS and the original design relays reinstalled. Additionally, the procurement process is being revised to strengthen equivalency reviews. This issue is being reported per 10CFR50.73(a)(2)(i)(B) and 10CFR50.73(a)(2)(ix)(A) as a condition prohibited by the Technical Specifications and as a single cause that could have prevented the safety function of trains or channels in different systems.

LICENSEE EVENT REPORT (LER)

FACILITY NAME (1)	DOCKET (2)	LER NUMBER (6)			PAGE (3)
Davis-Besse Unit Number 1	05000346	YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	2 OF 7
		2003	-- 008 --	00	

NARRATIVE (If more space is required, use additional copies of NRC Form 366A) (17)

DESCRIPTION OF OCCURRENCE:

The Safety Features Actuation System (SFAS) [JE] at the Davis-Besse Nuclear Power Station (DBNPS) is designed to automatically prevent or limit fission product and energy release from the core, to isolate the containment vessel and to initiate the operation of Engineered Safety Features equipment in the event of a loss of coolant accident. The SFAS consists of four identical redundant sensing and logic channels and two identical redundant actuation channels. Each sensing channel includes analog circuits with analog isolation devices, and each logic channel includes trip bistable modules with digital isolation devices. The isolated output of the trip bistable module is used to comprise coincidence matrices with the terminating relays within the actuation channel of the SFAS.

The trip bistables monitor the station variables and normally feed continuous electrical (fail-safe) signals into two-out-of-four coincidence matrices. Should any of the station variables exceed their trip setpoints, the corresponding bistables in each of the four channels will trip and cease sending output signals. If two of the four channel bistables monitoring the same station variable cease to send output signals, the corresponding normally-energized terminating relays on all channels will trip.

The SFAS is a fail-safe, de-energize to trip, system. Therefore, if the power supply to a channel is lost, that channel will trip, reducing the system coincidence matrices from two-out-of-four to one-out-of-three mode. The terminating relays of sensing and logic channels 1 and 3 must both be de-energized to activate safety actuation channel 1. Similarly, sensing and logic channels 2 and 4 must both be de-energized to activate safety actuation channel 2. The terminating relays (also known as output relays) [JE-RLY] act on the actuation control devices such as motor controllers and solenoid valves.

The DBNPS has experienced failures of the SFAS output relays in the past few years. These failures, attributed to age degradation of the relays, are typically failures of the relay coils where the coil open-circuits and de-energizes, resulting in closure of the output relay contacts and providing a "half-trip" condition. In this "half-trip" condition, a trip of the complementary relay in the corresponding SFAS channel would cause the actuated component to go to its SFAS desired position. While no actuations of SFAS equipment occurred as a result of these failures in the recent past, and although the half-trip of a channel is a conservative design feature response, it is an undesired operational condition.

In approximately 1997, the relay manufacturer ended production of the relays used as SFAS output relays and divested itself of the tooling needed to produce these relays. In July of 1998, it was realized that the existing DBNPS stock of spare SFAS output relays would only last for several years at the observed failure rate. However, because these relays were no longer being manufactured, the lack of stock of new relays represented a concern for the

LICENSEE EVENT REPORT (LER)

FACILITY NAME (1)	DOCKET (2)	LER NUMBER (6)			PAGE (3)
Davis-Besse Unit Number 1	05000346	YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	3 OF 7
		2003	-- 008 --	00	

NARRATIVE (If more space is required, use additional copies of NRC Form 366A) (17)

DESCRIPTION OF OCCURRENCE: (Continued)

remainder of plant life. Therefore, in the Fall of 1999, plans were developed to acquire replacement relays, and replace approximately 250 of the 286 output relays during the Thirteenth Refueling Outage (13RFO) scheduled to begin in the Spring of 2002. Since a direct replacement for the relays was no longer manufactured, relay manufacturer Deutsch was contacted to acquire suitable, non-safety grade replacement relays, which were then qualified for safety-related service by Wyle Laboratories, an independent testing lab, to the specifications supplied for use in a safety-grade application. The new Generation 3 (G3) relays (Deutsch Model 4CP36AF) were shipped to the DBNPS in September of 2000.

During pre-installation functional testing at the DBNPS in December 2001, an intermittent failure of one G3 relay was identified in which the relay failed in a non-conservative manner. The relay's normally closed contacts did not repeatedly close when the relay coil was de-energized. The failed relay was examined and the cause of failure was determined to be a mechanical defect in the relay that occurred during manufacturing. Because only one failure was observed during bench testing, it was believed this failure was a random failure. During 13RFO, the approximately 250 Generation 1 (G1) and Generation 2 (G2) relays originally installed in the SFAS were removed and replaced with the new G3 relays. The old G1 and G2 relays were stored in the Instrument and Control Maintenance shop.

Upon receipt of a Wyle Laboratory report on July 10, 2002, stating the December 2001 failure was due to an isolated, random failure caused during the manufacturing process, the fact that this conclusion was based upon a sample size of one was questioned by DBNPS Plant Engineering. Since there was no conclusive evidence that the defect was limited to a single relay, it was determined by Plant Engineering that additional evidence was necessary to justify the conclusion. Therefore, 10 additional G3 relays were sent to Wyle Laboratories for further analysis. These 10 relays passed all additional functional testing, and therefore no destructive testing of the 10 relays was performed as had been done for the failed relay. The results of the additional functional testing were documented in a Wyle Laboratory report dated August 9, 2002.

On February 27, 2003, during preparation for performing the integrated test of SFAS Train 2 during the continuing outage, a second G3 relay failed to reset appropriately, which raised the concern of a possible common mode failure with the new relays. This second failed relay along with a sample of the G3 relays was sent to Wyle Laboratory for inspection. The results of this inspection revealed that the contact rating of the G3 relays were incompatible with the configuration of the SFAS. Specifically, it was discovered that the G3 relay contacts are rated at 5 amperes (amps) at 30 volts direct current (VDC) resistive load. When installed in the SFAS, these contacts experience a nominal voltage of either 120 volts alternating current (VAC) or 125 VDC, or approximately four times the rated load. Additionally, most of the relay contacts are used to operate either a solenoid or another relay coil, introducing an inductive component of the load.

LICENSEE EVENT REPORT (LER)

FACILITY NAME (1)	DOCKET (2)	LER NUMBER (6)			PAGE (3)
Davis-Besse Unit Number 1	05000346	YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	4 OF 7
		2003	-- 008 --	00	

NARRATIVE (If more space is required, use additional copies of NRC Form 366A) (17)

DESCRIPTION OF OCCURRENCE: (Continued)

As a result of the discovery that the G3 relays were incompatible with the SFAS, the G3 relays were removed from the SFAS. The previously installed G1 and G2 relays were removed from storage, and those that were successfully bench-tested were reinstalled in the SFAS along with additional G1 relays. These relays will be fully tested as part of restart activities.

It was initially believed that this issue was not reportable because none of the G3 relays were known to be installed when the SFAS was required to be operable per Technical Specification (TS) 3.3.2.1, Safety Features Actuation System Instrumentation. However, after further review, on July 8, 2003, with the plant in Mode 5, it was discovered that five of the G3 relays had been installed during the Thirteenth Operating Cycle, which concluded on February 16, 2002. The relays installed were as follows:

- Relay 2K12J installed 5/2/2001 for CV5010E, Containment Hydrogen Analyzer 2 Discharge Valve
- Relay 4K23D installed 6/1/2001 for CV5076, Containment Vacuum Relief Isolation Butterfly Valve
- Relay 2K27D installed 8/20/2001 for RC240B, Pressurizer Sample Line Isolation Valve
- Relay 4K23B installed 10/17/2001 for P43-3, Component Cooling Water Pump 3
- Relay 3K25A installed 11/6/2001 for CS1530, Containment Spray Auto Control Valve 1.

The G3 relays had been procured to replace the older G1 relays. Once the G3 relays were approved for use and placed into stock, they were installed instead of the older G1 relays upon failure of a G1 relay. This was done to monitor operation and evaluate performance prior to the wholesale change out that was planned during 13RFO.

APPARENT CAUSE OF OCCURRENCE:

The originally installed Couch Type 4C relays (G1) are small, hermetically sealed rotary relays designed primarily for military usage. These relays were designed with a rugged balanced arm motor assembly and a rotary contact mechanism that ensures stable operation during conditions of bumping, vibration, shock, and acceleration. These relays were widely used in missile and aircraft applications. The contacts of the relays are rated for 5 amps at 30 VDC. Correspondence between the relay manufacturer, the DBNPS Architect/Engineer, the vendor of the SFAS (Consolidated Controls) and Toledo Edison (original licensee for the DBNPS) in the early 1970s indicate that the relay manufacturer successfully evaluated the performance of the relays at 6 amps at 125 VDC inductive loads (making but not breaking). However, the SFAS vendor did not adequately document the contact rating discrepancy to allow for later changes in the procurement of replacement relays.

LICENSEE EVENT REPORT (LER)

FACILITY NAME (1)	DOCKET (2)	LER NUMBER (6)			PAGE (3)
Davis-Besse Unit Number 1	05000346	YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	5 OF 7
		2003	-- 008 --	00	

NARRATIVE (If more space is required, use additional copies of NRC Form 366A) (17)

APPARENT CAUSE OF OCCURRENCE: (Continued)

During the procurement process for the G3 replacement relays, the DBNPS procurement engineer did not follow procedures and perform an equivalency evaluation as required for the new relays. Instead, due to weak procedural requirements governing the performance of equivalency evaluations, the engineer delegated the vendor of the relays the responsibility for performing an equivalency review. While the DBNPS design specification for the SFAS specified the proper relay contact ratings, this information had been removed from the procurement package by the procurement engineer on the basis that the relays were purchased by part number rather than by the design specification. The relay vendor qualified the new relays to the requirements set forth in the DBNPS purchase order, which specified the new relays be the same in form, fit, and function as those previously supplied. Since the purchase order did not specify a relay contact voltage rating, the manufacturer of the G3 replacement relays recognized that the original G1 relays had contacts rated for 5 amps at 30 VDC, and manufactured the replacement G3 relays with the same contact ratings. The relay vendor qualified the new G3 relays to these same requirements, resulting in the G3 relays having contacts rated for 5 amps at 30 VDC instead of 6 amps at 125 VDC.

A review of the G3 relay internals indicates significant differences in construction of the G3 relays when compared to the previously installed G1 and G2 relays. The G3 relays are essentially a relay within a relay, where a small cubical relay was installed in the same relay casing as the original G1 and G2 relays. This small cubical relay is a rocker style relay, as opposed to the original G1 and G2 rotary design. The relay contacts inside the small G3 cubical relay have less internal clearances than the original G1 and G2 rotary design, making them more susceptible to contact arcing at higher voltages.

ANALYSIS OF OCCURRENCE:

Because the G3 relays could have failed in a non-conservative manner, any SFAS channel where these relays were installed during the operating cycle was potentially incapable of performing its designated safety function. Therefore, for the five installations listed above, the associated functional units were inoperable per TS 3.3.2.1, and per TS Table 3.3-3 Action 11, with these output logic channels inoperable, the associated components should have been tripped within one hour or be at least Hot Standby within the next 6 hours. These actions were not taken while the plant was in Mode 1 with the relays installed; therefore this condition represents operation prohibited by the Technical Specifications, which is reportable per 10CFR50.73(a)(2)(i)(B).

Reporting of single causes that could have prevented the safety function of trains or channels in different systems is required by 10CFR50.73(a)(2)(ix)(A). Since the affected trains of equipment were in different systems, no potential loss of safety function for the entire system occurred, and so this issue is not reportable under 10CFR50.73(a)(2)(v). However, because a single cause (improper procurement of replacement relays) potentially rendered the affected individual trains incapable of performing their safety function, this issue is reportable per 10CFR50.73(a)(2)(ix)(A).

LICENSEE EVENT REPORT (LER)

FACILITY NAME (1)	DOCKET (2)	LER NUMBER (6)			PAGE (3)
Davis-Besse Unit Number 1	05000346	YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	6 OF 7
		2003	-- 008 --	00	

NARRATIVE (If more space is required, use additional copies of NRC Form 366A) (17)

ANALYSIS OF OCCURRENCE: (Continued)

Each month during power operation, all four channels of the SFAS are functionally tested to demonstrate functionality and operability of the system. The normal testing that was performed with these five G3 relays installed did not reveal any abnormal relay operation (it should be noted that these monthly functional tests do not apply normal operating voltages to the contacts). However, these five G3 relays were satisfactorily tested during the performance of the integrated SFAS time response test performed during 13RFO on February 11, 2003 (actuation channel 1) and on March 7, 2003 (actuation channel 2), where normal operating voltage is applied to the relay contacts. This testing reasonably indicates that the SFAS equipment would have performed its safety function under accident conditions.

The consequences of a non-conservative failure of any of these five relays would result in an SFAS-actuated component not actuating when required. The component could still be manually actuated as operators perform post-actuation safety system verification, but the particular SFAS auto-initiation function would be impaired. Since the relays were not installed in redundant channels, the redundant SFAS-actuated component remained capable of performing its designated safety function in the event of an actuation of the SFAS. Additionally, the procedure utilized in the event of an SFAS actuation directs the verification of a proper SFAS actuation. A failure of the SFAS output relay would not prevent manual actuation of the SFAS-actuated component.

CORRECTIVE ACTIONS:

All the G3 relays have been removed from the SFAS and replaced with successfully bench tested G1 or G2 relays. These relays will be fully tested as part of restart activities.

Procedure NOP-CC-7002, Procurement Engineering, will be revised as follows to:

- Strengthen the requirement that instructs Procurement Engineering personnel to perform an equivalency review
- Establish procedural controls that allow a vendor to perform an equivalency evaluation
- Establish clear guidance that instructs Procurement Engineering personnel on when to review plant design parameters when performing an equivalency evaluation.

This procedure revision will be complete by November 26, 2003.

LICENSEE EVENT REPORT (LER)

FACILITY NAME (1)	DOCKET (2)	LER NUMBER (6)			PAGE (3)
Davis-Besse Unit Number 1	05000346	YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	7 OF 7
		2003	-- 008 --	00	

NARRATIVE (If more space is required, use additional copies of NRC Form 366A) (17)

FAILURE DATA:

There have been no LERs in the past three years involving improper procurement of Technical Specification equipment at the DBNPS. Furthermore, there have been no recent DBNPS Corrective Action Documents of a similar nature involving installation of inappropriately procured equipment that rendered Technical Specification equipment inoperable.

Energy Industry Identification System (EIIS) codes are identified in the text as [XX].

NP-33-03-008-00

CRs 03-05402, 03-03232, 03-02725