

Lankenau Hospital  
100 Lancaster Ave  
Wynnewood PA, 19096

April 8, 2005

NRC Operations Center  
NRC Region One Office  
NRC Document Control Center

Dear Sir or Madam:

I am writing to notify the NRC of an incident involving the performance of our Nucletron V2 microselectron High Dose Rate Afterloading device. We are filing this report according to the requirements of 10 CFR 21.21(d). While it is our belief that we are not required to do so, we are following the suggestion of Michelle Beardsley of NRC Region 1, Medical Branch in filing this report. The information that we are supplying here has all been provided to Nucletron Corporation of Columbia, MD for their analysis. It is our belief that they, if anyone at all, should be the party responsible for the management of these issues under these regulations and those of the FDA. That viewpoint aside, we are following this Region 1 interpretation. Additionally, I am attaching a copy of the Nucletron Service Report from this incident.

Required Information under reporting in 10 CFR 21.21(d)(4):

- i) Informing Individual – Nathan Anderson, Authorized Medical Physicist, Lankenau Hospital, Department of Radiation Oncology, 100 Lancaster Ave., Wynnewood, PA 19096
- ii) Identification of the facility, the activity, or the basic component supplied for such facility or such activity with in the United States which falls to comply or contains a defect – The supplier of the treatment device and the transfer tube is Nucletron Corporation, of Columbia MD. The item which had the initial breakdown in performance was a Nucletron microSelectron GYN transfer tube for channel 1. This item developed an internal constriction that caused the source's inability to retract. We are contending that the classification of the component performance as failing to comply or containing a defect is not something that we as end users are able to determine. This may or may not be true. Nucletron Corporation would be the determinate of that.
- iii) Same as above

IE 20


- iv) The situation described here created the situation whereby we were required to initiate our emergency procedures. During routine daily quality assurance testing, the HDR treatment device was set up with two GYN transfer tubes connected between the treatment device and the autoradiograph device. All pieces are manufactured and supplied by Nucletron Corporation and their use here is within the intended uses. After transfer tubes were attached and locked in place, the morning QA treatment delivery to the autoradiograph device was initiated. During initial runs through the tube, a number of daily checks were performed to verify the functionality of the emergency stops and interruption buttons. Finally, on the last iteration, the check cable went out through transfer tube one and returned. This indicated that the tube was clear. Then the source went out into transfer tube one. It dwelled in the tube for 101.2 seconds. When the cable was being driven back into the safe, it encountered a lag in the stepper motor, indicating that there was either a partial or total constriction of the path. The unit correctly initiated an emergency stop. The source position indicator correctly displayed that the source was stuck in the exposed position. The interrupt button and emergency stop buttons were activated but the source remained in the transfer tube. The room was secured until Nucletron service arrived. When they arrived, they decided to enter the room, and use the emergency source retraction handles to try to drive the source into the safe. The engineer entered the room alone. The manual crank for the source cable functioned correctly and the source was returned to the safe within 17 seconds of entry into the room. The engineer's personal dosimeter indicated an exposure of 5 mR whole body dose. Upon inspection of the transfer tube after removal from the machine, there was no external sign of any wear on the transfer tube. However, when a check wire was run through, it was discovered that there was a constriction or edge that had developed just inside the end that connects to the treatment unit. This constriction is what caused the source drive in to fail. These transfer tubes are measured and inspected on a monthly basis as required. The same transfer tube is used on a daily basis and had in fact been used twice the day before successfully. The nature of the defect in the tube therefore can only be described in my opinion as wear and tear. This transfer tube was approximately two years old. This same opinion was expressed by the on site engineer.
- v) This incident occurred on Wednesday April 6, 2005
- vi) There are transfer tubes for all of our applicators. We possess a total of 22 transfer tubes. Each of them is measured and inspected on a monthly basis for condition according to 10 CFR 35.
- vii) The corrective action taken was that the transfer tube was replaced with a new one. The source and cable were inspected on camera and no

April 8, 2005

problems were identified. This action has corrected the root problem. Additionally, it should be noted that the procedures for source recovery as described in the Nucletron manuals and the on site emergency procedures were followed and were successful. The final manner of source retraction was the one that was successful, but successful it was.

- viii) Related advice - As I explained to Nucletron, I agree the source retraction failed to retract due to a constriction in the transfer tube. This condition was easily detectable with a test cable once it was removed. Currently we inspect the tubes for length and condition thoroughly on a monthly basis as required by part 35. The tubes are also visually inspected before each use. However, it seems reasonable to expect that the check cable should have identified this constriction; it did not detect this. Additionally, it seems that the emergency stop button should have had enough pull to negotiate this constriction; again, it did not. Without significant testing from Nucletron, we can not know the specifics of the internal circumstances which caused the source cable to encounter a constriction that the check cable did not.

Sincerely,

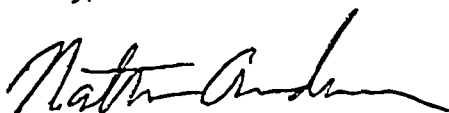

Nathan Anderson  
Medical Physicist  
Department of Radiation Oncology  
Lankenau Hospital

Cc: Lankenau Hospital Rad Onc Incident File  
Nancy Sherwin, MD, RSO  
Gary Antonelli, Manager/Radiation Oncology  
NRC Document Control Desk  
Region 1 Office, Medical Division



Nucletron®

## Field Service Report

Nucletron Corporation, Service Department, 8671 Robert Fulton Drive, Columbia, MD 21046 PH: 410-872-4400 Fax: 410-312-4185

Customer Lankenau Hospital		Call Type <input type="checkbox"/> Phone <input type="checkbox"/> Recall <input checked="" type="checkbox"/> Repair		Call No. US3007_155966_R	
Address 100 Lancaster Avenue Wynnewood, PA 19016		<input type="checkbox"/> Install <input type="checkbox"/> Training <input type="checkbox"/> PM		SPC Codes	Equip. 023 <input checked="" type="checkbox"/> Failure D1 <input checked="" type="checkbox"/> Action A2 <input checked="" type="checkbox"/>
Phone No. 610 645.2433		<input type="checkbox"/> CA <input type="checkbox"/> Other <input type="checkbox"/>		Serial No. 31412	
PO No.		Charge Type <input checked="" type="checkbox"/> Contract <input type="checkbox"/> No Charge <input type="checkbox"/> Bill		FW version 1.50A	
Dosimeter Reading: 5 mR		<input type="checkbox"/> Install <input type="checkbox"/> Warranty <input type="checkbox"/>		Date In 6-Apr-05	Out 6-Apr-05
Symptom				Time In 9:45	Out 11:45

System displays EC 4, EC 16, source will not retract via normal means or emergency stop action.

## Resolution

Entered room under Nucletron RSO supervision via telephone, confirmed source not retracted. Turned crank to manually retract source.

Experienced moderate resistance at the start of action, restriction immediately released, after which crank turned normally with almost no resistance to end stop. All alarms ceased, confirmed source in safe with Ludlum meter.

Channel 1 GYN transfer tube was connected to appropriate port on Nucletron autoradiograph device, and was the channel involved with the incident. Upon inspection, no external indication was present of any defect. Manual insertion of dummy cable was met with mild resistance when transfer tube was held straight, but with mild deflection at proximal end (indexer connector), dummy cable will not enter beyond the approximate point where the aluminum connector body joins yellow transfer tube material.

Returned defective transfer tube to Nucletron office for RMA, requested a replacement be sent via Fedex next day.

## For Office Use Only - This Is Not An Invoice

Qty used	Description	Part Number	Qty ret	Return Status	RX Call (if different)	Description of problem / failure
	Transfer tube, V2, GYN Channel 1	111002	1	DEF		Source sticks @ Indexer end

Travel Charged	3.00 Hrs	Airline		Travel Expenses (Meals, Tolls, etc)
Regular Charged	2.00 Hrs	Rental Car		
Overtime Charged	Hrs	Hotel		
O/T (Sundays & Holidays)	Hrs	No of Miles		

Wed Apr 2005 04/06/05 08:27:23  
Engineer

Wed Apr 2005 04/06/05 08:28:09  
Customer



**Lankenau Hospital**  
*Jefferson Health System*

Radiation Oncology Department

## FAX COVER SHEET

### RADIATION ONCOLOGY DEPARTMENT THE LANKENAU HOSPITAL

100 Lancaster Avenue  
 Wynnewood, PA 19096  
 Phone: 610-6452433 Fax: 610-645-3595

#### Members

- Albert Einstein Healthcare Network  
 Albert Einstein Medical Center  
 Belmont Behavioral Health  
 Germantown Hospital and Community Health Services  
 MossRehab  
 Willowcrest
- Frankford Health Care System  
 Frankford Campus  
 Torresdale Campus
- Main Line Health  
 Bryn Mawr Hospital  
 Bryn Mawr Rehab  
 Lankenau Hospital  
 Paoli Memorial Hospital
- Magee Rehabilitation
- Thomas Jefferson University Hospital  
 Methodist Hospital

Jefferson HealthCARE physicians

Jefferson HomeCARE

Jefferson SeniorCARE

- Methodist Hospital Nursing Center
- Mid County Senior Services
- The Wayne Center

Alliance Partners

- Pottstown Memorial Medical Center
- Riddle Memorial Hospital
- Underwood-Memorial Hospital

TO: Operations Center  
 FROM: Nathan Anderson  
 RE: 10 CFR 21.21(d)  
 DATE: 4/8/05  
 # of PAGES: 4 + COVER

### CONFIDENTIAL NOTICE

The Telecopied material and the information contained within is intended only for the use of the individual or entity to which it is addressed and may contain information that is privileged. Please call the above number if you receive this in error. Thank you.