

SAFETY INSPECTION REPORT AND COMPLIANCE INSPECTION

1. LICENSEE/LOCATION INSPECTED: Acuren Inspection, Inc La Porte, Texas 77571		2. NRC/REGIONAL OFFICE: U.S. Nuclear Regulatory Commission Region I, 475 Allendale Road King of Prussia, Pennsylvania 19406-1415	
3. BOOKLET NUMBER(S) 03034780		4. LICENSE NUMBER(S) 42 27593-01	5. DATE(S) OF INSPECTION November 21, 2005

LICENSEE

The inspection was an examination of the activities conducted under your license as they relate to radiation safety and to compliance with the Nuclear Regulatory Commission (NRC) rules and regulations and the conditions of your license. The inspection consisted of selective examinations of procedures and representative records, interviews with personnel, and observations by the inspector. The inspection findings are as follows:

- 1. Based on the inspection findings, no violations were identified.
- 2. Previous violation(s) closed:
 - 1. The violation(s) specifically described to you by the inspector as non-cited violations, are not being cited because they were self-identified, non-repetitive, and corrective action was or is being taken, and the remaining entries in the NRC Enforcement Policy (NUREG 1000, to exercise discretion) were satisfied.

Non-Cited violation(s) was/were discussed involving the following requirement(s) and Corrective Action(s):

- 4. During this inspection certain of your activities, as described below and/or attached, were in violation of NRC requirements and are being cited. This form is a NOTICE OF VIOLATION, which may be subject to posting in accordance with 10 CFR 19.11.

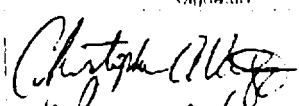
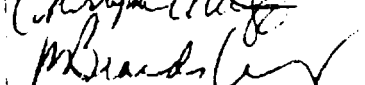
10 CFR 71.51(a) requires that a licensee who transports licensed material outside of the site of usage, as specified in the NRC license, or whose transport is on public highways, or who delivers licensed material to a carrier for transport, comply with the applicable requirements of the regulations appropriate to the mode of transport of the Department of Transportation (DOT) in 49 CFR Parts 170 through 189. 49 CFR 172.704 (c) (2) requires that a hazmat employee receive training as required by 49 CFR 172 subpart H, at least once every three years.

Contrary to the above, the licensee did not provide training to hazmat employees at least once every three years. Specifically, the licensee did not provide hazmat training to its radiographers since 2001. This is a Severity Level IV violation (Supplement VI).

Licensee stated that within 30 days all radiographers/assistants will receive hazmat training.

Licensee's Statement of Corrective Actions for Item 4, above.

I hereby state that, within 30 days, the actions described by me to the inspector will be taken to correct the violations identified. This statement of corrective actions is made in accordance with the requirements of 10 CFR 2.201 (corrective steps already taken, corrective steps which will be taken) with full compliance will be achieved. I understand that no further written response to NRC will be required, unless specifically requested.

NAME	Printed Name	Signature	Date
LICENSEE'S REPRESENTATIVE	CHRISTOPHER A. VAREO		12-22-05
NRC INSPECTOR	Michelle Beardsley		11-14-05



Acuren Inspection
500 Colonial Drive, Suite 100
Virginia Beach, VA 23462

Phone 757-340-5110
Fax 757-340-5526

Materials Engineering and Testing

FAX COVER SHEET

DATE: 12/22/05

TO: Michelle Beardsley

OF: U.S. Nuclear Regulatory Comm.

FAX: 610-337-5393

FROM: C. Vargo

FAX: 757-340-5526

Subject: Safety report and compliance

Pages: 2 including this cover sheet

Notes: