



UNITED STATES  
NUCLEAR REGULATORY COMMISSION  
REGION II  
101 MARIETTA STREET, N.W.  
ATLANTA, GEORGIA 30303  
NOV 6 1978

*Central File*  
*50-390*  
*391*

In Reply Refer To:

RII:JPO

50-438, 50-439

50-259, 50-260

50-296, 50-518

50-519, 50-520

50-521, 50-553

50-554, 50-327

50-328, 50-390

50-391, 50-566

50-567

Tennessee Valley Authority  
Attn: Mr. N. B. Hughes  
Manager of Power  
830 Power Building  
Chattanooga, Tennessee 37401

Gentlemen:

The enclosed Circular 78-18 is forwarded to you for information. No specific action is requested and no written response is required. If you desire additional information regarding this matter, please contact this office.

Sincerely,

James P. O'Reilly  
Director

Enclosures:

1. IE Circular 78-18
2. List of IE Circulars  
Issued in 1978

7811150073  
Supp. 01 07  
02  
03  
04  
05  
06

*As 2*  
*GD*

Tennessee Valley Authority

-2-

cc w/encl:

J. E. Gilleland  
Assistant Manager of Power  
830 Power Building  
Chattanooga, Tennessee 37401

W. W. Aydelott, Project Manager  
Bellefonte Nuclear Plant  
P. O. Box 2000  
Hollywood, Alabama 35752

J. F. Cox  
400 Commerce Street  
W9D199  
Knoxville, Tennessee 37902

J. G. Dewease, Plant Superintendent  
Box 2000  
Decatur, Alabama 35602

R. T. Hathcote, Project Manager  
Hartsville Nuclear Plant  
P. O. Box 2000  
Hartsville, Tennessee 37074

G. G. Stack, Project Manager  
Sequoyah Nuclear Plant  
P. O. Box 2000  
Daisy, Tennessee 37319

J. M. Ballentine  
Plant Superintendent  
Sequoyah Nuclear Plant  
P. O. Box 2000  
Daisy, Tennessee 37319

T. B. Northern, Jr.  
Project Manager  
Watts Bar Nuclear Plant  
P. O. Box 2000  
Spring City, Tennessee 37381

W. P. Kelleghan, Project Manager  
Phipps Bend Nuclear Plant  
P. O. Box 2000  
Surgoinville, Tennessee 37873

M. M. Price, Project Manager  
Yellow Creek Nuclear Plant  
P. O. Box 2000  
Iuka, Mississippi 38852

UNITED STATES  
NUCLEAR REGULATORY COMMISSION  
OFFICE OF INSPECTION AND ENFORCEMENT  
WASHINGTON, D. C. 20555

November 6, 1978

IE Circular 78-18

UL FIRE TEST

Background

On September 15, 1978, a fire test of a full-scale vertical cable tray array was conducted at the Underwriters Laboratory (UL) near Chicago, Illinois. It was part of the fire protection research program managed by Sandia Laboratories under NRC contract. The purpose of the test was to demonstrate the effectiveness of area sprinklers and cable tray fire barriers constructed of ceramic fiber blankets in preventing damage to cables as a result of an exposure to a flammable liquid fire. The test resulted in damage to some electrical cables.

Discussion

The configuration of the fire test was selected to simulate a section of a plant area with vertical cable trays containing redundant safety divisions arranged such that the redundant divisions could be simultaneously exposed to a potential fire resulting from an inadvertent spill of flammable liquid in the area. The arrangement of the cable trays and the designation of the redundant tray divisions is shown in Figure 1. Figure 2 shows the location of the fire detectors and the three groups of sprinklers. Each of the five cable trays contained cable insulated with polyvinyl chloride and was enclosed in a separated ceramic fiber blanket fire barrier from floor to ceiling in accordance with the manufacturer's recommendations. The sprinkler and detector arrangement was as permitted by NFPA Code. However, no water was actually used at any time during this test due to the failure of some sprinkler heads to actuate, as explained below.

Each sprinkler location in the test arrangement contained three nominally identical temperature sensing sprinkler heads with fusible links adjacent to an open sprinkler head which was connected to a manual water supply valve. The temperature sensing heads were wired to signal when their links fused. After all three temperature sensing heads at a given location activated, then the water supply for the open head was to be manually admitted. The sprinklers were of a type which actuate at the slow end of acceptance for reaction time. The test procedure required that all three temperature sensing heads had to activate before water would be turned on. In this way, it was expected to get some data on variability in the response time of identical sprinklers.

November 6, 1978

IE Circular 78-18

### Test Details

The test was started by igniting the two gallons of heptane that was poured into the floor pan. A fully developed fire occurred almost immediately. The ceiling smoke detector alarmed in about 15 seconds. In about 50-60 seconds, two of the three temperature sensing sprinklers located between the wall and cable trays 1 and 2 activated. The fire between cable trays 1, 2, 3, and 4 appeared most intense, apparently because of a chimney effect between the four trays. The flames between cable trays 3 and 5 did not appear to be so intense. The ceramic fiber blanket absorbed some of the heptane so that after the heptane in the pan burned, most of the flame seemed to come from the bottom outside surface of the ceramic fiber blanket. No additional temperature sensing sprinkler heads at any location activated; thus, the sprinkler water supply was not turned on for any of the three sprinkler locations. The apparent slow response of the third temperature sensing sprinkler is being investigated, since this was not intended to be a slow response sprinkler.

At about 3 minutes into the test there was an indication of a short circuit in cable tray 3, which was probably caused by the fire. After 5-7 minutes the height of the flames appeared to subside; however, residual flames continued for about 40 minutes.

### Preliminary Results and Analyses

Preliminary information indicates that the flammable liquid or flames penetrated the protective barriers at the bottom of the vertical trays and caused fire damage to the polyvinyl chloride insulation on cables in four of the five trays.

On subsequent 500-volt megger tests, it was found that another cable in tray 2 had also experienced some damage, as evidenced by a conductor to ground short.

The most probable cause of the fire damage in certain cable trays appears to be related to the absorption or seepage of heptane under the ceramic fiber blanket at the juncture with the floor. Once the heptane entered the interior regions of the cable tray, then ignition apparently occurred via the small opening at the floor or through a vapor/air path within the joints. There is some indication that some cable damage was caused by absorption of heptane on the inside of the barrier (wicking effect) and its ignition which heated a cable tray ladder rung, causing damage to a cable in contact with the rung. The ingress of the heptane into the ceramic fiber needs to be further evaluated since this appears to be the most significant failure mode.

November 6, 1978

IE Circular 78-18

#### Tentative Conclusions

The test results are still being analyzed, and it would be premature to establish firm conclusions at this time; however, the results now available indicate that the following areas of the fire protection program need close consideration:

1. To protect against spills of flammable liquids, barriers or curbs may be needed to prevent entry of the flammable liquid behind fire barriers. A wick effect may also need to be considered in the design of fire barriers.
2. Some small fires may not actuate sprinkler heads. To reduce this possibility in sprinkler systems to be installed, fast response sprinkler heads should be considered (less than approximately 3 minutes in the UL Standard 199 "Automatic Sprinklers for Fire Protection Service").
3. The location of the fire detection devices and the sprinkler heads relative to the fire and components being protected is of great importance. The path of the air movement in the area influences the actuation of such devices and should be considered in the system layout.

The final results of this test will be issued when the analysis of the test is complete.

This circular is being issued for information only. No specific action is requested and no written response is required. If you desire additional information regarding this matter, contact the Director of the appropriate NRC Regional Office.

#### Attachments:

1. Figure 1
2. Figure 2

LISTING OF IE CIRCULARS ISSUED IN 1978

Circular No.	Subject	Date of Issue	Issued To
78-01	Loss of Well Logging Source	4/5/78	All Holders of Well Logging Source Licenses
78-02	Proper Lubricating Oil for Terry Turbines	4/20/78	All Holders of Reactor OLs or CPs
78-03	Packaging Greater Than Type A Quantities of Low Specific Activity Radioactive Material for Transport	5/12/78	All Holders of Reactor OLs, CPs, Fuel Cycle, Priority I Material and Waste Disposal Licenses
78-04	Installation Error That Could Prevent Closing of Fire Doors	5/15/78	All Holders of Reactor OLs or CPs
78-05	Inadvertent Safety Injection During Cooldown	5/23/78	All Holders of Reactor OLs or CPs
78-06	Potential Common Mode Flooding of ECCS Equipment Rooms at BWR Facilities	5/23/78	All Holders of Reactor OLs or CPs
78-07	Damaged Components of a Bergen-Paterson Series 25000 Hydraulic Test Stand	5/31/78	All Holders of Reactor OLs or CPs
78-08	Environmental Qualification of Safety Related Equipment at Nuclear Power Plants	5/31/78	All Holders of Reactor OLs or CPs
78-09	Arcing of General Electric Company Size 2 Contactors	6/5/78	All Holders of CPs


IE Circular No. 78-18  
November 6, 1978

LISTING OF IE CIRCULARS ISSUED IN 1978

Circular No.	Subject	Date of Issue	Issued to
78-10	Control of Sealed Sources Used in Radiation Therapy	6/14/78	All Medical Licensees in Categories G and G1
78-11	Recirculation M-G Set Overspeed Stops	6/15/78	All Holders of BWR OLs or CPs
78-12	HPCI Turbine Control Valve Lift Rod Bending	6/30/78	All Holders of BWR OLs or CPs for plants with HPCI Terry Turbine
78-13	Inoperability of Multiple Service Water Pumps	7/10/78	All Holders of Reactor OLs and CPs except for plants located in: AL, AK, CA, FL, GA, LA, MS, SC
78-14	HPCI Turbine Reversing Chamber Hold Down Bolting	7/12/78	All Holders of BWR OLs or CPs for plants with a HPCI Terry Turbine excepting Duane Arnold and Monticello
78-15	Checkvalves Fail to Close In Vertical Position	7/20/78	All Holders of Reactor OLs or CPs
78-16	Limitorque Valve Actuators	7/26/78	All Holders of Reactor OLs or CPs
78-17	Inadequate Guard Training/Qualification and Falsified Training Records	10/13/78	All Holders of and applicants for Reactor OLs.

Enclosure  
Page 2 of 2

Figure 1

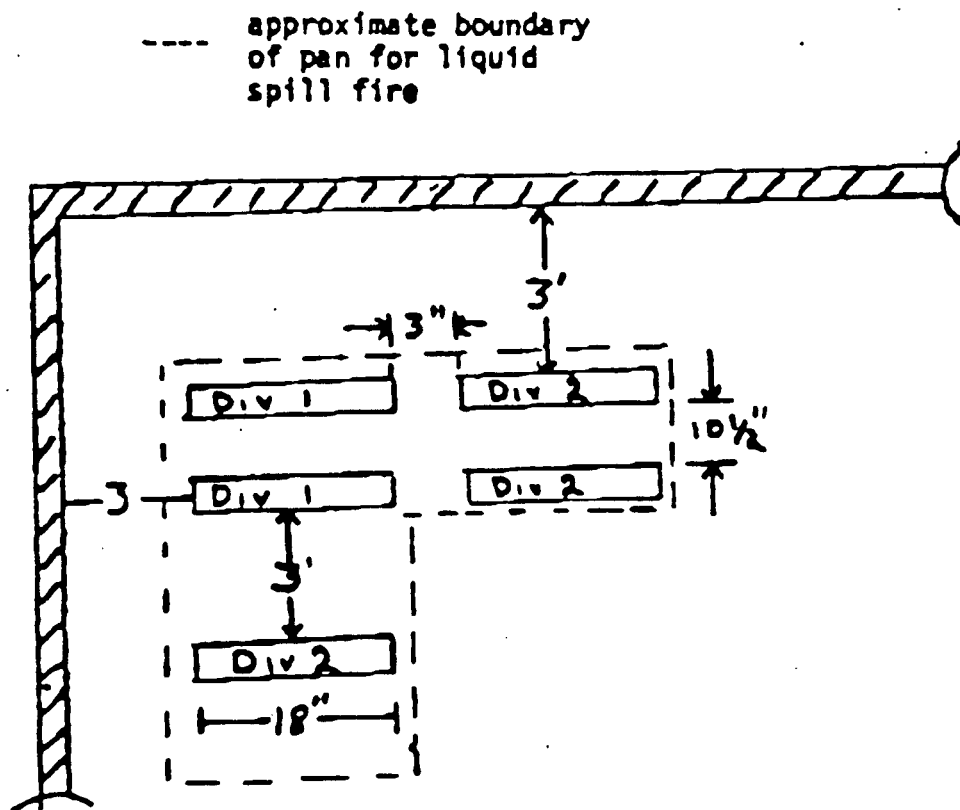

Vertical Tray Corner Test



