

William J. Cahill, Jr.
Vice President

Consolidated Edison Company of New York, Inc.
4 Irving Place, New York, N Y 10003
Telephone (212) 460-3819

REGULATORY DOCKET FILE COPY

November 14, 1975

Re Indian Point Unit No. 2
Docket No. 50-247

Director of Nuclear Reactor Regulation
ATTN: Mr. Karl R. Goller
Assistant Director for
Operating Reactors
Division of Reactor Licensing
U.S. Nuclear Regulatory Commission
Washington, D. C. 20555



Gentlemen

In accordance with the requirements of the Directorate of Licensing letter of November 8, 1973, Con Edison herewith submits the results of inspections of hydraulic snubbers installed in Indian Point Unit No. 2. The unit was shut down on October 16, 1975 and resumed power operation on October 31, 1975. The inspections were completed on October 24, 1975.


Very truly yours

A handwritten signature in cursive script, appearing to read "William J. Cahill, Jr.".

mr**b**

William J. Cahill, Jr.
Vice President

Copy to Mr. James P. O'Reilly, Director
Office of Inspection and Enforcement
Region 1
U.S. Nuclear Regulatory Commission
King of Prussia, PA 19406

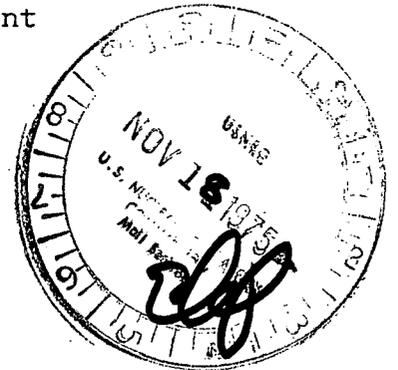

8111110589 751114
PDR ADDCK 05000247
Q PDR

13155

Results of Inspection of Hydraulic Snubbers
Installed at Indian Point Unit No. 2
October 24, 1975

Bergen-Paterson Snubbers:

Date of Inspection: Inspections and maintenance actions
completed October 31, 1975

Number of snubbers Installed: 456

Seal Material: Millable gum - 88

Ethylene-Propylene - 368

No. of Snubbers Inspected: All ethylene propylene

Results

Ten snubbers had indications of significant leakage.
All units were in operable condition.

Snubber No. 46-SR-3 was found to have its piston rod
dust cover separated from the snubber body. The cause
of this damage was not determined. The operability
and reliability of the snubber were not affected, and
there was no fluid leakage.

Corrective Action:

All snubbers with indications of leakage were restored
to normal fluid level. Where necessary, fittings
were tightened. In one case, the filler valve was
replaced. The snubber with a separated dust cover
was replaced.

Snubbers Supplied by Other Manufacturers (Grinnell):

Date of Inspection: Completed October 24, 1975

No. of Oil Reservoirs Installed: 8

No. of Oil Reservoirs Inspected: 8

Seal Material: Not applicable

Results:

All units were in normal condition:

Corrective Action

No corrective action necessary.