

Consolidated Edison Company of New York, Inc.
4 Irving Place, New York, N. Y. 10003
Telephone (212) 460-5133


Regulatory

File Clk

November 6, 1975

RE: Indian Point Unit No. 2
Docket No. 50-247
A.O.-75-2-24 (A)


Mr. James P. O'Reilly, Director
Office of Inspection and Enforcement
Region 1
U.S. Nuclear Regulatory Commission
King of Prussia, PA 19406

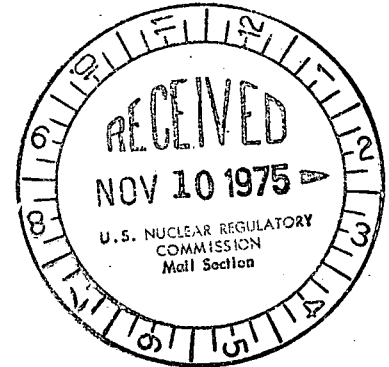

Dear Mr. O'Reilly:

In accordance with the requirements of the Technical Specifications to Facility Operating License DPR-26, the attached report of Abnormal Occurrence A.O.-75-2-24(A) is submitted. This report fulfills the requirement for a written report within 14 days of an Abnormal Occurrence and is in accordance with the format set forth in Regulatory Guide 1.16, Revision 3.

Three copies of this letter and the attachment are enclosed as required.

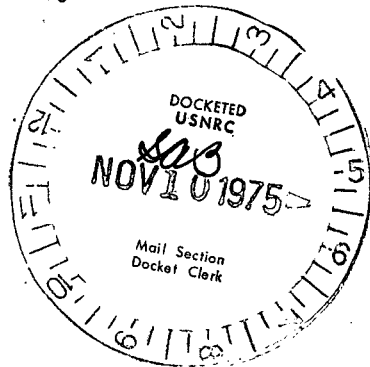

Very truly yours,

Carl L. Newman

Carl L. Newman
Vice President

encl.
mp

Copies to: Director of Nuclear Reactor Regulation
ATTN: Mr. Donald F. Knuth, Director (40 copies)
Office of Inspection and Enforcement
U.S. Nuclear Regulatory Commission
Washington, D.C. 20555

Director of Nuclear Reactor Regulation
ATTN: Mr. William F. McDonald, Director (3 copies)
Office of Management Info. and Program Control
U.S. Nuclear Regulatory Commission
Washington, D.C. 20555

8111090203 751106
PDR ADDCK 05000247
S PDR

12892

**NRC DISTRIBUTION FOR PART 50 DOCKET MATERIAL
(TEMPORARY FORM)**

CONTROL NO: 12892

FILE: _____

FROM: Consolidated Edison Co. New York, N.Y. Carl L. Newman		DATE OF DOC 11-6-75	DATE REC'D 11-10-75	LTR XXX	TWX	RPT	OTHER
TO: Mr. James P. O'Reilly		ORIG	CC 38	OTHER	SENT NRC PDR SENT LOCAL PDR		XXX XXX
CLASS XXX	UNCLASS	PROP INFO	INPUT	NO CYS REC'D 38	DOCKET NO: 50-247		

DESCRIPTION:
Letter trans the following.....

ENCLOSURES:
Abnormal Occurrence # 75-24, on 10-23-75,
Concerning the pressure drop for each of # 24
and # 25 fan cooler units exceeding the Tech.
Specs limits.....

(38 Copies Received)

PLANT NAME: Indian Point # 2

FOR ACTION/INFORMATION

SAB 11-11-75

BUTLER (L) W/ Copies	SCHWENCER (L) W/ Copies	ZIEMANN (L) W/ Copies	REGAN (E) W/ Copies
CLARK (L) W/ Copies	STOLZ (L) W/ Copies	DICKER (E) W/ Copies	LEAR (L) W/ Copies
PARR (L) W/ Copies	VASSALLO (L) W/ Copies	KNIGHTON (E) W/ Copies	SPIES W/ Copies
KNIEL (L) W/ Copies	PURPLE (L) W/ Copies	YOUNGBLOOD (E) W/ Copies	LPM W/ Copies

Reid w/3

**DO NOT REMOVE
ACKNOWLEDGED**

INTERNAL DISTRIBUTION

REG FILE NRC PDR OGC, ROOM P-506A GOSSICK/STAFF CASE GIAMBUSSO BOYD MOORE (L) DEYOUNG (L) SKOVHOLT (L) GOLLER (L) (Ltr) P. COLLINS DENISE REG OPR FILE & REGION (2) MPC (3)	TECH REVIEW SCHROEDER MACCARY KNIGHT PAWLICKI SHAO STELLO HOUSTON NOVAK ROSS IPPOLITO TEDESCO J. COLLINS LAINAS BENAROYA VOLLMER	DENTON GRIMES GAMMILL KASTNER BALLARD SPANGLER ENVIRO MULLER DICKER KNIGHTON YOUNGBLOOD REGAN PROJECT LDR HARLESS	LIC ASST R. DIGGS (L) H. GEARIN (L) E. GOULBOURNE (L) P. KREUTZER (E) J. LEE (L) M. RUSHBROOK (L) S. REED (E) M. SERVICE (L) S. SHEPPARD (L) M. SLATER (E) H. SMITH (L) S. TEETS (L) G. WILLIAMS (E) V. WILSON (L) R. INGRAM (L) M. DUNCAN (E)	A/T IND. BRAITMAN SALTZMAN MELTZ PLANS MCDONALD CHAPMAN DUBE (Ltr) E. COUPE PETERSON HARTFIELD (2) KLECKER EISENHUT WIGGINTON F. Williams Hanauer
---	---	--	--	--

EXTERNAL DISTRIBUTION

- | | | |
|---|--------------------------------|------------------------|
| 1 - LOCAL PDR Montrose, N.Y. | 1 - NATIONAL LABS | 1 - PDR-SAN/LA/NY |
| 1 - TIC (ABERNATHY) (1)(2)(10) | 1 - W. PENNINGTON, Rm E-201 GT | 1 - BROOKHAVEN NAT LAB |
| 1 - NSIC (BUCHANAN) | 1 - CONSULTANTS | 1 - G. ULRIKSON ORNL |
| 1 - ASLB | NEWMARK/BLUME/AGBABIAN | |
| 1 - Newton Anderson | R. Ingram | |
| 5 - ACRS XXXXXX SENT to L.A. | | |

JH

LICENSEE EVENT REPORT

CONTROL BLOCK:

--	--	--	--	--	--

(PLEASE PRINT ALL REQUIRED INFORMATION)

01	NYIP S	2	00	-0	00	00	-0	00	41	11	11	01
7	8	9	14	15	25	26	30	31	32			

01	CONT	MI	T	L	05	-0	24	7	10	23	75	11	06	75
7	8	57	58	59	60	61	68	69	74	75	80			

EVENT DESCRIPTION

02 Durign the performance of periodic surveillane test PT-SAL, it was found
 03 that the pressure drop across the demister and Hepa Filter for each of No.
 04 24 and No. 25 fan cooler units exceeded the Tech. Spec. limit of 5 inches
 05 of water. The as found pressure drops were 5.2 inches for No. 24 and 5.7
 06 inches for No. 25. The remaining units were below the limit. Similar
 (Cont'd)

07	SB	E	BL	OW	ER	N	M4	70	Y	
7	8	9	10	11	12	17	43	44	47	48

CAUSE DESCRIPTION

08 The fan cooler units manufactured by MSA Research Corp. developed exces-
 09 sive pressure drop across demister due to dust accumulation. Demisters
 10 were washed and pressure drop reduced to below Tech. Spec. limits.

11	G	00	00	NA	B	Periodic Surveillance Test			
7	8	9	10	12	13	44	45	46	80

12	Z	Z	NA	NA			
7	8	9	10	11	44	45	80

PERSONNEL EXPOSURES

13	00	00	Z	NA		
7	8	9	11	12	13	80

PERSONNEL INJURIES

14	00	00	NA		
7	8	9	11	12	80

PROBABLE CONSEQUENCES

15 NA

LOSS OR DAMAGE TO FACILITY

16	Z	NA		
7	8	9	10	80

PUBLICITY

17 NA

ADDITIONAL FACTORS

18 Event Descrip. (Cont'd) events occurred previously on January 3, 1975
 19 and July 30, 1975. (A.O.-75-2-24(A)).

NAME: Michael Shatkouski PHONE: (914) 739-8823