


Carl L. Newman
Vice President

Consolidated Edison Company of New York, Inc.
4 Irving Place, New York, N. Y. 10003
Telephone (212) 460-5133

September 29, 1976

Re: Indian Point Unit No. 3
Docket No. 50-286
R.O. -76-3-31(B)

Mr. James P. O'Reilly, Director
Office of Inspection and Enforcement
Region 1
U.S. Nuclear Regulatory Commission
King of Prussia, PA 19406

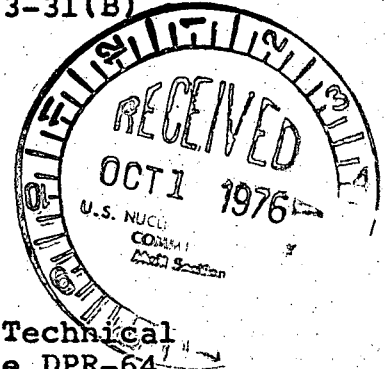


Dear Mr. O'Reilly:

In accordance with the requirements of the Technical Specifications to Facility Operating License DPR-64 the attached report of Reportable Occurrence R.O. -76-3-31(B) is submitted. This report fulfills the requirement for a written report within 30 days of a Reportable Occurrence and is in accordance with the format set forth in Regulatory Guide 1.16, Revision 4.

Three copies of this letter and the attachment are enclosed as required.

Very truly yours,

Carl L. Newman
Vice President

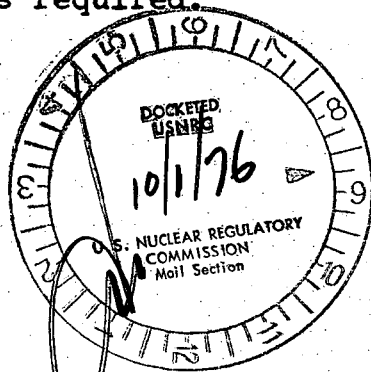

Enc:
CLN/mmg

REGULATORY DOCKET FILE COPY

copy to : Director of Nuclear Reactor Regulation
ATTN: Dr. Ernst Volgenau, Director (30 copies)
Office of Inspection and Enforcement
U.S. Nuclear Regulatory Commission
Washington, D.C. 20555

Director of Nuclear Reactor Regulation
ATTN: Mr. William G. McDonald, Director (3 copies)
Office of Management Information and
Program Control
U.S. Nuclear Regulatory Commission
Washington, D.C. 20555

9996

Mr. George T. Berry
General Manager and Chief Engineer
Power Authority of the State of New York
10 Columbus Circle
New York, N.Y. 10019

8111070470 760929
PDR ADOCK 05000286
S PDR

LICENSEE EVENT REPORT

O.-76-3-31(B)

CONTROL BLOCK:

--	--	--	--	--	--

[PLEASE PRINT ALL REQUIRED INFORMATION]

LICENSEE NAME:

01	N	Y	I	P	S	3
----	---	---	---	---	---	---

 LICENSE NUMBER:

0	0	-	0	0	0	0	0	-	0	0
---	---	---	---	---	---	---	---	---	---	---

 LICENSE TYPE:

4	1	1	1	1
---	---	---	---	---

 EVENT TYPE:

0	3
---	---

CATEGORY:

01	CONT
----	------

 REPORT TYPE:

L

 REPORT SOURCE:

L

 DOCKET NUMBER:

0	5	0	-	0	2	8	6
---	---	---	---	---	---	---	---

 EVENT DATE:

0	8	3	0	7	6
---	---	---	---	---	---

 REPORT DATE:

0	9	2	9	7	6
---	---	---	---	---	---

EVENT DESCRIPTION

02 During operational testing of the emergency diesel generators, No. 31
 03 diesel generator began cycling between 56 and 63 cycles per second. The
 04 diesel was shut down and declared inoperable. Investigation revealed
 05 a low oil level in the diesel governor. The proper oil level was re-
 06 stored and the diesel was successfully retested and declared operable.

SYSTEM CODE:

E	E
---	---

 CAUSE CODE:

A

 COMPONENT CODE:

M	E	C	F	U	N
---	---	---	---	---	---

 PRIME COMPONENT SUPPLIER:

N

 COMPONENT MANUFACTURER:

W	2	9	0
---	---	---	---

 VIOLATION:

N

 [R.O.-76-3-31(B)]

CAUSE DESCRIPTION

08 A Woodward Governor, associated with the emergency diesel, malfunctioned
 09 due to low oil level. This low oil level was attributed to a local oil
 10 drain valve which was not closed tightly. The valve was subsequently
 11 tightened.

FACILITY STATUS:

B

 % POWER:

0	7	5
---	---	---

 OTHER STATUS:

NA

 METHOD OF DISCOVERY:

B

 DISCOVERY DESCRIPTION:

Surveillance Testing

FORM OF ACTIVITY RELEASED:

Z

 CONTENT OF RELEASE:

Z

 AMOUNT OF ACTIVITY:

NA

 LOCATION OF RELEASE:

NA

PERSONNEL EXPOSURES

13 NUMBER:

0	0	0
---	---	---

 TYPE:

Z

 DESCRIPTION:

NA

PERSONNEL INJURIES

14 NUMBER:

0	0	0
---	---	---

 DESCRIPTION:

NA

PROBABLE CONSEQUENCES

15 NA

LOSS OR DAMAGE TO FACILITY

16 TYPE:

Z

 DESCRIPTION:

NA

PUBLICITY

17 NA

ADDITIONAL FACTORS

18 NA

19

NAME: Austin J. Decker II PHONE: 914-739-8823