

# WOLF CREEK

NUCLEAR OPERATING CORPORATION

Russell A. Smith  
Plant Manager

July 25, 2011

WO 11-0058

U. S. Nuclear Regulatory Commission  
ATTN: Document Control Desk  
Washington, DC 20555


Subject: Docket No. 50-482: Licensee Event Report 2011-006-00, "Auxiliary Feedwater Actuation due to Operators Inability to Control Steam Generator Level in Mode 4"

Gentlemen:

The enclosed Licensee Event Report is being submitted pursuant to 10 CFR 50.73(a)(2)(iv)(A) regarding an Engineered Safety Features Actuation at the Wolf Creek Generating Station.

This letter contains no commitments. If you have any questions concerning this matter, please contact me at (620) 364-4156, or Mr. Gautam Sen at (620) 364-4175.

Sincerely,

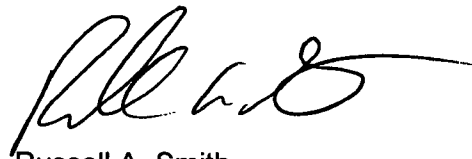

Russell A. Smith

Enclosure

cc: E. E. Collins (NRC), w/e  
J. R. Hall (NRC), w/e  
G. B. Miller (NRC), w/e  
Senior Resident Inspector (NRC), w/e

Lead  
NRR

<b>NRC FORM 366</b> <b>U.S. NUCLEAR REGULATORY COMMISSION</b> (10-2010)	<b>APPROVED BY OMB: NO. 3150-0104</b> <b>EXPIRES: 10/31/2013</b> Estimated burden per response to comply with this mandatory collection request: 80 hours. Reported lessons learned are incorporated into the licensing process and fed back to industry. Send comments regarding burden estimate to the Records and FOIA/Privacy Service Branch (T-5 F52), U.S. Nuclear Regulatory Commission, Washington, DC 20555-0001, or by internet e-mail to infocollects@nrc.gov, and to the Desk Officer, Office of Information and Regulatory Affairs, NEOB-10202, (3150-0104), Office of Management and Budget, Washington, DC 20503. If a means used to impose an information collection does not display a currently valid OMB control number, the NRC may not conduct or sponsor, and a person is not required to respond to, the information collection.
<b>LICENSEE EVENT REPORT (LER)</b>  (See reverse for required number of digits/characters for each block)	

<b>1. FACILITY NAME</b> WOLF CREEK GENERATING STATION	<b>2. DOCKET NUMBER</b> 05000 482	<b>3. PAGE</b> 1 OF 4
--	--------------------------------------	--------------------------

**4. TITLE**  
Auxiliary Feedwater Actuation due to Operators Inability to Control Steam Generator Level in Mode 4

5. EVENT DATE			6. LER NUMBER			7. REPORT DATE			8. OTHER FACILITIES INVOLVED	
MONTH	DAY	YEAR	YEAR	SEQUENTIAL NUMBER	REV NO.	MONTH	DAY	YEAR	FACILITY NAME	DOCKET NUMBER
05	24	2011	2011	- 006	- 00	07	25	2011	FACILITY NAME	DOCKET NUMBER
										05000
										05000

<b>9. OPERATING MODE</b>  Mode 4	<b>11. THIS REPORT IS SUBMITTED PURSUANT TO THE REQUIREMENTS OF 10 CFR§:</b> <i>(Check all that apply)</i>			
<b>10. POWER LEVEL</b>  0	<input type="checkbox"/> 20.2201(b)	<input type="checkbox"/> 20.2203(a)(3)(i)	<input type="checkbox"/> 50.73(a)(2)(i)(C)	<input type="checkbox"/> 50.73(a)(2)(vii)
	<input type="checkbox"/> 20.2201(d)	<input type="checkbox"/> 20.2203(a)(3)(ii)	<input type="checkbox"/> 50.73(a)(2)(ii)(A)	<input type="checkbox"/> 50.73(a)(2)(viii)(A)
	<input type="checkbox"/> 20.2203(a)(1)	<input type="checkbox"/> 20.2203(a)(4)	<input type="checkbox"/> 50.73(a)(2)(ii)(B)	<input type="checkbox"/> 50.73(a)(2)(viii)(B)
	<input type="checkbox"/> 20.2203(a)(2)(i)	<input type="checkbox"/> 50.36(c)(1)(i)(A)	<input type="checkbox"/> 50.73(a)(2)(iii)	<input type="checkbox"/> 50.73(a)(2)(ix)(A)
	<input type="checkbox"/> 20.2203(a)(2)(ii)	<input type="checkbox"/> 50.36(c)(1)(ii)(A)	<input checked="" type="checkbox"/> 50.73(a)(2)(iv)(A)	<input type="checkbox"/> 50.73(a)(2)(x)
	<input type="checkbox"/> 20.2203(a)(2)(iii)	<input type="checkbox"/> 50.36(c)(2)	<input type="checkbox"/> 50.73(a)(2)(v)(A)	<input type="checkbox"/> 73.71(a)(4)
	<input type="checkbox"/> 20.2203(a)(2)(iv)	<input type="checkbox"/> 50.46(a)(3)(ii)	<input type="checkbox"/> 50.73(a)(2)(v)(B)	<input type="checkbox"/> 73.71(a)(5)
<input type="checkbox"/> 20.2203(a)(2)(v)	<input type="checkbox"/> 50.73(a)(2)(i)(A)	<input type="checkbox"/> 50.73(a)(2)(v)(C)	<input type="checkbox"/> OTHER	
<input type="checkbox"/> 20.2203(a)(2)(vi)	<input type="checkbox"/> 50.73(a)(2)(i)(B)	<input type="checkbox"/> 50.73(a)(2)(v)(D)	Specify in Abstract below or in NRC Form 366A	

**12. LICENSEE CONTACT FOR THIS LER**

FACILITY NAME Gautam Sen, Manager Regulatory Affairs	TELEPHONE NUMBER (Include Area Code) (620) 364-4175
---	--

**13. COMPLETE ONE LINE FOR EACH COMPONENT FAILURE DESCRIBED IN THIS REPORT**

CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO EPIX	CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO EPIX

<b>14. SUPPLEMENTAL REPORT EXPECTED</b> <input type="checkbox"/> YES (If yes, complete 15. EXPECTED SUBMISSION DATE) <input checked="" type="checkbox"/> NO	<b>15. EXPECTED SUBMISSION DATE</b>	MONTH	DAY	YEAR

**ABSTRACT** (Limit to 1400 spaces, i.e., approximately 15 single-spaced typewritten lines)

On May 24, 2011 at 1120 CDT, Wolf Creek Generating Station (WCGS) was in Mode 4 during a startup at the end of Refueling Outage 18. A reactor trip signal, a Feedwater Isolation Signal actuation and an Auxiliary Feedwater actuation occurred due to a Lo-Lo Steam Generator level. Steam Generator levels were being maintained at 30 – 35% level in anticipation of full flow auxiliary feedwater testing which would increase the steam generator levels. The cause of the event was inadequate operator control of steam generator levels. Remedial training was conducted for the control room staff.

The safety significance of this event is low. This event is bounded by analyses as reported in the WCGS Updated Safety Analysis Report Section 15.2.7, "Loss of Normal Feedwater Flow." There were no adverse effects on the health and safety of the public.

**LICENSEE EVENT REPORT (LER)**

1. FACILITY NAME	2. DOCKET	6. LER NUMBER			3. PAGE
WOLF CREEK GENERATING STATION	05000 482	YEAR	SEQUENTIAL NUMBER	REV NO.	2 OF 4
		2011	-- 006 --	00	

**PLANT CONDITIONS AT THE TIME OF THE EVENT**

Mode 4  
 RCS temperature 325-330 degrees F  
 RCS pressure 513 psig

**DESCRIPTION OF THE EVENT**

While in Mode 4, a reactor trip signal, a Feedwater Isolation Signal (FWIS) actuation and a motor-driven (MD) Auxiliary Feedwater actuation occurred due to Lo-Lo level in the "B" Steam Generator (SG) [EIS Code: SB] on May 24, 2011 at 1120CDT. Wolf Creek Generating Station (WCGS) was starting up at the end of Refueling Outage 18, using procedure GEN 00-002, "Cold Shutdown to Hot Standby." Due to the length of the shutdown, the reactor core was xenon free and had low decay heat. No structures, systems, or components were inoperable that contributed to the event.

Prior to the event, reactor trip breakers were closed to perform Digital Rod Position Indication (DRPI) [EIS Code: AA] testing. All control rods were fully inserted. Preparations were being made to perform full flow auxiliary feedwater (AFW) [EIS Code: BA] testing per procedure STS AL-212, "MD AFP Comprehensive Pump Testing, Flow Path Verification & CV Testing." The start up main feedwater pump (MFP) [EIS Code: SJ-P] was providing feedwater to the SGs. SG levels were supposed to be maintained at 30 – 35% level in anticipation that the full flow AFW testing would increase the SG levels. The SG atmospheric relief valves (ARV) [EIS Code: SB-RV] were in automatic. The balance of plant operator was controlling SG levels and pressures to maintain conditions for the AFW testing and Mode 4.

The "B" SG level was approximately 28-30%. Feedwater flow was increased using the main feedwater regulating bypass valve being supplied by the start up MFP. The "B" SG pressure started increasing, the SG ARV went nearly closed and the "B" SG level rapidly dropped to the Lo-Lo setpoint of 23.5%. A reactor trip signal, a FWIS actuation and a motor-driven AFW actuation occurred due to Lo-Lo level in the "B" SG.

**BASIS FOR REPORTABILITY**

The reactor trip signal and actuation of the Engineered Safety Feature Actuation Signals (ESFAS) instrumentation described in this event is reportable per 10 CFR 50.73(a)(2)(iv)(A), which requires reporting of "Any event or condition that resulted in manual or automatic actuation of any of the systems listed in paragraph (a)(2)(iv)(B) of this section." Paragraph (B)(1) of 10 CFR 50.73(a)(2)(iv) includes "Reactor protection system (RPS) including: reactor scram or reactor trip." Paragraph (B)(6) of 10 CFR 50.73(a)(2)(iv) includes "PWR auxiliary or emergency feedwater."

**LICENSEE EVENT REPORT (LER)**

1. FACILITY NAME	2. DOCKET	6. LER NUMBER			3. PAGE
WOLF CREEK GENERATING STATION	05000 482	YEAR	SEQUENTIAL NUMBER	REV NO.	3 OF 4
		2011	-- 006 --	00	

**ROOT CAUSE**

Control Room Operators failed to adequately maintain SG levels in Mode 4 using the main feedwater regulating bypass valves. As a result, the "B" SG level reached the Lo-Lo level setpoint causing a reactor trip signal, a FWIS actuation and a motor-driven AFW actuation. In addition, non-conservative decision making occurred in establishing the 30% steam generator level in preparations for the AFW flow testing.

**CORRECTIVE ACTIONS**

Remedial training was conducted for the control room staff. The training included understanding the phenomenon associated with SG level control for shrink and swell, understanding and complying with controlling bands, proper use of resources, proper alarm response and providing margin in controlling bands to the staff.

The following procedures will be enhanced:

- GEN 00-002, "Cold Shutdown to Hot Standby," to include specific guidance for the operation of the SG ARVs.
- STS AL-212, "MD AFP Comprehensive Pump Testing, Flow Path Verification & CV Testing," to provide more definitive guidance on the required SG level for full flow testing.

**SAFETY SIGNIFICANCE**

The safety significance of this event is low. This event is analyzed as reported in WCGS Updated Safety Analysis Report (USAR) Section 15.2.7, "Loss of Normal Feedwater Flow." Results of the analysis show that a loss of normal feedwater does not adversely affect the core, the reactor coolant system, or the steam system, since the AFW capacity is such that reactor coolant water is not relieved from the pressurizer relief or safety valves.

There were no adverse effects on the health and safety of the public.

**OPERATING EXPERIENCE/PREVIOUS SIMILAR OCCURRENCES**

LER 2010-005-00 described a reactor trip at 100% power due low SG levels due to a trip of a main feedwater (MFW) pump. The failed transfer of an inverter to its alternate power supply caused the MFW pump trip.

LER 2010-006-00 described a reactor trip at 42% power due to a trip of the "A" MFW pump. The control room operators manually tripped the reactor due to decreasing SG levels. The cause of the MFW pump trip was a failed servo in the MFW control circuitry.

**LICENSEE EVENT REPORT (LER)**

1. FACILITY NAME	2. DOCKET	6. LER NUMBER			3. PAGE
WOLF CREEK GENERATING STATION	05000 482	YEAR	SEQUENTIAL NUMBER	REV NO.	4 OF 4
		2011	-- 006 --	00	

LER 2010-012-00 described a reactor trip at 15% power due to low SG levels. The cause was operation of the plant during power ascension outside the main feedwater regulating bypass valves optimum operating region and the feedwater preheating limitations. Procedures were revised to correct this condition.