

NRC DISTRIBUTION FOR PART 50 DOCKET MATERIAL

FILE NUMBER
INCIDENT REPORT

TO: N.C. Moseley

FROM: Duke Power Co.
Charlotte, N.C.
W. O. Parker, Jr.

DATE OF DOCUMENT
2-26-76
DATE RECEIVED
3-10-76

LETTER
 ORIGINAL
 COPY

NOTORIZED
 UNCLASSIFIED

PROP INPUT FORM

NUMBER OF COPIES RECEIVED
1

DESCRIPTION
Ltr. trans the following.....

PLANT NAME: Oconee # 1

ENCLOSURE
RO # 76-2, on 1-28-76, Concerning Inoperable
1A LPI, 1A RBS, and 1A HPI Pumps due to failure
of ES spare breakers.....

(1 Cy. Received)

ACKNOWLEDGED

DO NOT REMOVE

NOTE: IF PERSONNEL EXPOSURE IS INVOLVED
SEND DIRECTLY TO KREGER/J. COLLINS

SAFETY	FOR ACTION/INFORMATION	ENVIRO	SAB 3-10-76
BRANCH CHIEF:	Purple		
W/3 CYS FOR ACTION			
LIC. ASST:	Sheppard		
W/ CYS			
ACRS CYS HOLDING/SENT TO LA			

INTERNAL DISTRIBUTION			
<input checked="" type="checkbox"/> REG FILE			
NRC PDR			
I & E (2)			
MIPC (3)			
SCHROEDER/IPPOLITO			
HOUSTON			
NOVAK/CHECK			
GRIMES/SCHWENCER			
CASE			
F. WILLIAMS			
HANAUER			
TEDESCO/MACCARY			
EISENHUT			
BAER			
SHAO			
VOLLMER/BUNCH			
KREGER/J. COLLINS			

EXTERNAL DISTRIBUTION			CONTROL NUMBER
LPDR: Waltham, S.C.			2425
TIC			
NSIC			

DUKE POWER COMPANY

Regulatory

File Cy

POWER BUILDING

422 SOUTH CHURCH STREET, CHARLOTTE, N. C. 28242

WILLIAM O. PARKER, JR.
VICE PRESIDENT
STEAM PRODUCTION

TELEPHONE: AREA 704
373-4083

February 26, 1976

Mr. Norman C. Moseley, Director
U. S. Nuclear Regulatory Commission
Suite 818
230 Peachtree Street, Northwest
Atlanta, Georgia 30303




Re: Oconee Unit 1
Docket No. 50-269

Dear Mr. Moseley:

Pursuant to Sections 6.2 and 6.6.2 of the Oconee Nuclear Station Technical Specifications, please find attached Reportable Occurrence Report RO-269/76-2.


Very truly yours,

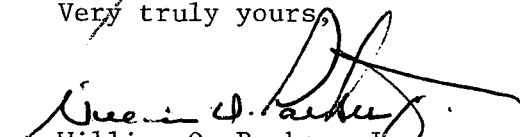
William O. Parker, Jr.

MST;mmb

Attachment

CC Director, Office of Management Information
and Program Control

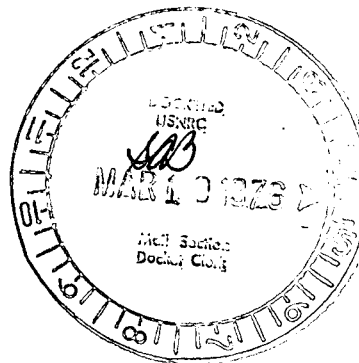

2425

DUKE POWER COMPANY
OCONEE UNIT 1

Report No.: RO-269/76-2

Report Date: February 26, 1976

Occurrence Date: January 28, 1976

Facility: Oconee Unit 1, Seneca, South Carolina

Identification of Occurrence: Inoperable 1A LPI, 1A RBS, and 1A HPI pumps due to failure of ES spare breakers.

Conditions Prior to Occurrence: Unit at 100% full power

Description of Occurrence:

On January 27, 1976, during the performance of periodic maintenance on the Oconee Unit 1 Engineered Safeguards (ES) electrical breakers, spare breakers were placed in the 1A Low Pressure Injection, 1A Reactor Building Spray, and 1A high pressure injection pump motor circuits. Each pump was verified to be operable at that time; however, the pumps would not start on January 28, 1976. Subsequent testing revealed that the pumps could be successfully started only once after resetting the breakers (spares installed on January 27, 1976). The original ES breakers were reinstalled and tested and the pumps declared operable by 1030 hours January 28, 1976.

Apparent Cause of Occurrence:

This occurrence was apparently caused by a procedure deficiency in that the procedure did not clearly identify the correct substitute ES safety-related breakers to be used in these circuits. In this case, the original breakers were replaced with ones similar in appearance, but lacking an installed 250 OHM 50 watt resistor necessary for the breaker to correctly cycle.

Analysis of Occurrence:

Although the ES electrical breakers mentioned were replaced with inoperable spares, the redundant systems were tested and verified operable as required by Oconee Technical Specifications 3.3.5 and 3.3.7 and would have functioned properly if required. Also, the original breakers were reinstalled within the 24-hour maintenance period permitted by Technical Specification 3.3.5. Therefore, it is concluded that the health and safety of the public was not affected by this occurrence.

Corrective Action:

To prevent further occurrences of this type, a color coding scheme is being devised to assure that electrical breakers are properly matched to correct cabinets and that spare breakers are properly identified. This scheme will be completed and implemented in station maintenance procedures by June 1, 1976.