



UNITED STATES
NUCLEAR REGULATORY COMMISSION
REGION II
101 MARIETTA ST., N.W., SUITE 3100
ATLANTA, GEORGIA 30303

AUG 27 1980

In Reply Refer To:

RII:JPO

50-369, 50-370

~~50-269~~, ~~50-270~~

~~50-287~~, 50-413

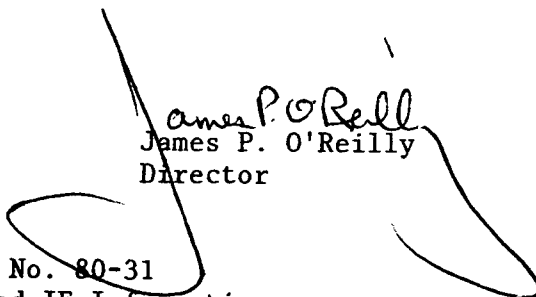
50-414

Duke Power Company
ATTN: W. O. Parker, Jr.
Vice President, Steam Production
P. O. Box 2178
Charlotte, NC 28242

Gentlemen:

This Information Notice is provided as a notification of a matter of possible safety significance. It is expected that recipients will review the information for possible applicability to their facilities, and where applicable, consider the recommended action. If you have questions regarding this matter, please contact the director of this office.

Sincerely,


James P. O'Reilly
Director

Enclosures:

1. IE Information Notice No. 80-31
2. List of Recently Issued IE Information Notices

cc w/encl:

M. D. McIntosh, Plant Manager
J. C. Rogers, Project Manager
J. E. Smith, Station Manager
D. G. Beam, Project Manager
J. W. Hampton, Station Manager

8009120 343

UNITED STATES
NUCLEAR REGULATORY COMMISSION
OFFICE OF INSPECTION AND ENFORCEMENT
WASHINGTON, D.C. 20555

August 27 , 1980

IE Information Notice No. 80-31: MALOPERATION OF GOULD-BROWN BOVERI 480
VOLT-TYPE K-600S AND K-DON 600S CIRCUIT
BREAKERS

Description of Circumstances:

The Cincinnati Gas & Electric Company reported problems with the Gould-Brown Boveri Type K-600S and K-DON 600S circuit breakers used in 480 volt a.c. circuits at the William H. Zimmer nuclear stations. The problem involved inadvertent circuit breaker closure during operation of the breaker charging springs when the breaker was racked out to the test position.

The problem resulted from the use of undersized bushings in the circuit breaker secondary close latches. The undersized bushings caused the secondary close latch to hang-up on the shunt trip device resulting in an inadvertent circuit breaker closure when the spring charging motor was energized.

The vendor has stated that the problem does not exist during normal operations with the circuit breaker in the connected position.

Recommended Action for Licensees and Holders of Construction Permits:

All licensees of operating nuclear power reactors and holders of construction permits should be aware of the potential problems described above. The vendor has stated that a small number of circuit breakers were assembled with undersized secondary latch bushings between 1969 and 1977. It is recommended that the following actions be taken:

- (1) Determine if the subject circuit breakers are installed in any safety-related application at your facility. The affected circuit breakers are manufactured by Gould-Brown Boveri and are types K-600S and K-DON 600S, 480-volt a.c. electrically operated, drawout type with static trip device.
- (2) If it is determined that your facility has the circuit breakers described in Item (1) above, perform the K-600S, K-DON 600S Field Test Procedure attached to this information notice (Gould-Brown Boveri I.B.-9.1.7-6 Issue F, Addendum 2, dated March 4, 1980).
- (3) If maloperation of the circuit breaker occurs during performance of the field test procedure described in Item (2) above, perform the corrective action described in the attached field test procedure (installation of a 0.050 shim to the secondary close latch and retest of the circuit breaker).

No written response to this information notice is required; however, if additional information is required, contact the Director of the appropriate NRC Regional Office.

Enclosure:

Excerpt from Gould-Brown Boveri
Letter to NRC Region III dated
June 2, 1980.

IN 80-31
August 27, 1980

Excerpt from Gould-Brown
Boveri I.B.-9.1.7.6 Issue F,
Addendum 2, Page 1, dated
March 4, 1980

K-600S, K-DON 600S FIELD TEST PROCEDURE

CAUTION: REFER TO I.B-9.1.7-6 FOR CIRCUIT BREAKER INSTRUCTIONS AND SAFETY
PROCEDURES

- A. This procedure is to be performed to determine if the secondary close latch hangs up on the shunt trip device causing inadvertent closing of the circuit breaker at the completion of the closing springs charging.
1. Rack out the circuit breaker to the test position.
 2. Move the toggle switch to the "on" position to charge the closing springs.
 3. Move the toggle switch to the "off" position.
 4. Perform a trip free operation by holding the manual red trip button in and lifting the manual close lever to discharge the closing springs. (The breaker should not close)
 5. Move the toggle switch to the "on" position to charge the closing springs. Note at the end of the charging if the breaker inadvertently closed.

6. If the breaker closed during Step 5, then it has failed and a 0.050 shim must be added per page 2 of this procedure.

 7. If the breaker did not inadvertently close during Step 5, then Steps 3 thru 5 should be repeated twelve times without failure. A 0.050 shim must be added if any failures occur.
- B. If it was necessary to install a 0.050 shim, then repeat Steps 3 thru 5 twelve times to check that the breaker does not inadvertently close.

Excerpt from Gould-Brown
Boveri I.B.-9.1.7-6 Issue F,
Addendum 2, Page 2, dated
March 4, 1980

PROCEDURE FOR ASSEMBLING SHIM IN K-600S, K-DON 600S

BREAKER WITHOUT REMOVING THE OPERATING MECHANISM

CAUTION: REFER TO I.B-9.1.7-6 PAGE 10 FOR CIRCUIT BREAKER REMOVAL (DRAWOUT TYPE) BEFORE PROCEEDING.

DISASSEMBLY:

1. Tilt breaker back, loosen wires by removing cleat 650441-D, from left side of breaker frame.
2. Remove relay from bottom of breaker by removing screws that hold relay. Do not disconnect wires.
3. Block jack bar open to move arm away from mag-latch.
4. Enter through left side of breaker and remove three screws, 54341-E2, that hold the mag-latch to the mechanism side plate. Slide mag-latch and shunt trip away from mechanism frame. Use care not to disconnect spring, 650216-A11, between primary latch and mag-latch.

ASSEMBLY:

1. Slide shim, 711917-B, in between mechanism side plate and mag-latch and reattach mag-latch with longer screws, 54341-E3.
2. Tighten screws, making sure spring, 650216-A11, is connected.
3. Replace parts in reverse order.

IN 80-31
August 27, 1980

RECENTLY ISSUED
IE INFORMATION NOTICES

Information Notice No.	Subject	Date Issued	Issued To
80-31	MALOPERATION OF GOULD- BROWN BOVERI TYPE 480 VOLT TYPE K-600S AND K-DON 600S CIRCUIT BREAKERS	8/27/80	All Light Water reactor facilities holding an OL or CP
80-30	Potential for Unaccept- able Interaction Between the Control Rod Drive Scram Function and Non-Essential Control Air at Certain GE BWR Facilities	8/19/80	All boiling water reactor facilities holding power reactor OLs or CPs.
80-29	Broken Studs on Terry Turbine Steam Inlet Flange	8/7/80	All light water reactor facilities holding power reactor OLs or CPs
Supplement to 80-06	Notification of Significant Events at Operating Power Reactor Facilities	7/29/80	All holders of reactor OLs and near-term operating license applicants
80-28	Prompt Reporting Of Required Information To NRC	6/13/80	All applicants for and holders of nuclear power reactor construction
80-27	Degradation of Reactor Coolant Pump Studs	6/11/80	All pressurized water reactor facilities holding power reactor OLs or CPs
80-26	Evaluation of Contractor QA Programs	6/10/80	All Part 50 licensees
80-25	Transportation of Pyrophoric Uranium	5/30/80	Material licensee in priority/categories II-A, II-D, III-I and IV-DI; agreement state licensees in equivalent categories
80-24	Low Level Radioactive Waste Burial Criteria	5/30/80	All NRC and agreement state licensees
80-23	Loss of Suction to Emergency Feedwater Pumps	5/29/80	All power reactor facilities with an OL or CP
80-22	Breakdown In Contamina- tion Control Programs	5/28/80	All power reactor OLs and near-term CPs