

SAFETY INSPECTION REPORT AND COMPLIANCE INSPECTION

1. LICENSEE/LOCATION INSPECTED:

Gibson County Coal, LLC
P.O. Box 1269
Princeton, Indiana 47670

REPORT NUMBER(S) 2016001

2. NRC/REGIONAL OFFICE

Region III
U. S. Nuclear Regulatory Commission
2443 Warrenville Road, Suite 210
Lisle, IL 60532-4352

3. DOCKET NUMBER(S)

030-35481

4. LICENSE NUMBER(S)

13-32272-01

5. DATE(S) OF INSPECTION

June 14, 2016

LICENSEE:

The inspection was an examination of the activities conducted under your license as they relate to radiation safety and to compliance with the Nuclear Regulatory Commission (NRC) rules and regulations and the conditions of your license. The inspection consisted of selective examinations of procedures and representative records, interviews with personnel, and observations by the inspector. The inspection findings are as follows:

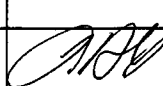
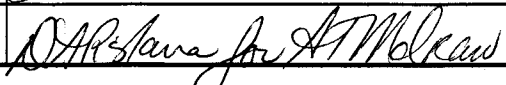
- 1. Based on the inspection findings, no violations were identified.
- 2. Previous violation(s) closed.
- 3. The violation(s), specifically described to you by the inspector as non-cited violations, are not being cited because they were self-identified, non-repetitive, and corrective action was or is being taken, and the remaining criteria in the NRC Enforcement Policy, to exercise discretion, were satisfied.

Non-cited violation(s) were discussed involving the following requirement(s):

- 4. During this inspection, certain of your activities, as described below and/or attached, were in violation of NRC requirements and are being cited in accordance with NRC Enforcement Policy. This form is a NOTICE OF VIOLATION, which may be subject to posting in accordance with 10 CFR 19.11.
(Violations and Corrective Actions)

Statement of Corrective Actions

I hereby state that, within 30 days, the actions described by me to the Inspector will be taken to correct the violations identified. This statement of corrective actions is made in accordance with the requirements of 10 CFR 2.201 (corrective steps already taken, corrective steps which will be taken, date when full compliance will be achieved). I understand that no further written response to NRC will be required, unless specifically requested.

TITLE	PRINTED NAME	SIGNATURE	DATE
LICENSEE'S REPRESENTATIVE			
NRC INSPECTOR	Luis Nieves Folch		6/14/2016
BRANCH CHIEF	Aaron T. McCraw		7/12/16

Docket File Information
SAFETY INSPECTION REPORT AND COMPLIANCE INSPECTION

1. LICENSEE/LOCATION INSPECTED:

Gibson County Coal, LLC
P.O. Box 1269
Princeton, Indiana 47670

REPORT NUMBER(S) 2016001

2. NRC/REGIONAL OFFICE

Region III
U. S. Nuclear Regulatory Commission
2443 Warrenton Road, Suite 210
Lisle, IL 60532-4352

3. DOCKET NUMBER(S)

030-35481

4. LICENSE NUMBER(S)

13-32272-01

5. DATE(S) OF INSPECTION

June 14, 2016

6. INSPECTION PROCEDURES USED

87124

7. INSPECTION FOCUS AREAS

03.01-03.07

SUPPLEMENTAL INSPECTION INFORMATION

1. PROGRAM CODE(S)

03120

2. PRIORITY

5

3. LICENSEE CONTACT

John Spears - RSO

4. TELEPHONE NUMBER

(812) 386-2322

Main Office Inspection Next Inspection Date: June 14, 2021

Field Office Inspection 2579 West Gibson Coal Road, Princeton, IN

Temporary Job Site Inspection _____

PROGRAM SCOPE

This was a routine, unannounced inspection of a coal mining operation in Princeton, Indiana. The gauges were installed on two above-ground/processing areas. The licensee possessed two elemental analyzers and six slurry density gauges. All service and maintenance on the gauges, including installation and removal, was performed by the manufacturer. The licensee performed inventory and shutter checks as required by the license. All devices were leak tested as required. The licensee had determined that no individuals required monitoring because projected doses to individuals were below dose limits for members of the general public. The Princeton location has been inactive for approximately 6 months; 3 gauges were installed and locked out and in secured storage. The inspector review the requirement of Section 30.36(d)(3) with the licensee.

Performance Observations

The inspector toured the plant facility and verified the gauges with the licensee's current inventory. Interviews with personnel indicated adequate knowledge of the licensee's radiation safety procedures. The inspector performed independent and confirmatory radiation measurements which indicated results consistent with the licensee's survey records and postings.

No violations of NRC requirements were identified as a result of this inspection.

DJP
ATM
7/12/16