

# REGULATORY DOCKET FILE COPY

## DISTRIBUTION

- Docket
- NRC-PDR
- Local PDR
- ORB Reading
- NRR READING
- D. Eisenhut
- RVollmer
- OELD
- OI&E (3)
- DLZiemann
- ~~XXXXXXXX~~
- JShea
- HSmith
- VHoonan
- NSIC
- TERA
- ACRS (16)

Docket No. 50-244

Mr. Leon D. White, Jr.  
 Vice President  
 Electric and Steam Production  
 Rochester Gas & Electric Corporation  
 89 East Avenue  
 Rochester, New York 14649

FEB 26 1980

Dear Mr. White:

DCrutchfield

The NRC Staff has reviewed the actions you have taken to correct the cracking that was found in the feedwater system piping at your plant, as summarized in Table 1 of the enclosed safety analysis.

We find that the repair program, the nondestructive inspections and leakage testing performed following the repairs are adequate to ensure the integrity of the feedwater piping will be maintained until the recommendations of your Owners' Group and the NRC's Pipe Crack Study Group have been evaluated.

Should we determine that further actions are required after that evaluation, you will be notified.

Sincerely,

Original signed by

Dennis L. Ziemann, Chief  
 Operating Reactors Branch #2  
 Division of Operating Reactors

Enclosure:  
 Safety Analysis of Interim  
 Actions Taken to Eliminate  
 Feedwater Piping Cracking

cc w/enclosure  
 See next page

*DLZ*

8003240305

OFFICE >	DOR:..ORB.#2	DOR:..ORB.#2			
SURNAME >	JShea: cc	DLZiemann			
DATE >	2/16/80	2/26/80		P	

1958 3 833

1958 3 833

cc

Harry H. Voigt, Esquire  
LeBoeuf, Lamb, Leiby & MacRae  
1757 N Street, N. W.  
Washington, D. C. 20036

Mr. Michael Slade  
12 Trailwood Circle  
Rochester, New York 14618

Rochester Committee for  
Scientific Information  
Robert E. Lee, Ph.D.  
P. O. Box 5236 River Campus  
Station  
Rochester, New York 14627

Jeffrey Cohen  
New York State Energy Office  
Swan Street Building  
Core 1, Second Floor  
Empire State Plaza  
Albany, New York 12223

Director, Technical Development Programs  
State of New York Energy Office  
Agency Building 2  
Empire State Plaza  
Albany, New York 12223

Rochester Public Library  
115 South Avenue  
Rochester, New York 14604

Supervisor of the Town  
of Ontario  
107 Ridge Road West  
Ontario, New York 14519

Director, Technical Assessment  
Division  
Office of Radiation Programs  
(AK-459)  
U. S. Environmental Protection  
Agency  
Crystal Hall #2  
Arlington, Virginia 20460


U. S. Environmental Protection  
Agency  
Region II Office  
ATTN: EIS COORDINATOR  
26 Federal Plaza  
New York, New York 10007

Herbert Grossman, Esq., Chairman  
Atomic Safety and Licensing Board  
U. S. Nuclear Regulatory Commission  
Washington, D. C. 20555

Dr. Richard F. Cole  
Atomic Safety and Licensing Board  
U. S. Nuclear Regulatory Commission  
Washington, D. C. 20555

Dr. Emmeth A. Luebke  
Atomic Safety and Licensing Board  
U. S. Nuclear Regulatory Commission  
Washington, D. C. 20555

Mr. Thomas B. Cochran  
Natural Resources Defense Council, Inc.  
1725 I Street, N. W.  
Suite 600  
Washington, D. C. 20006

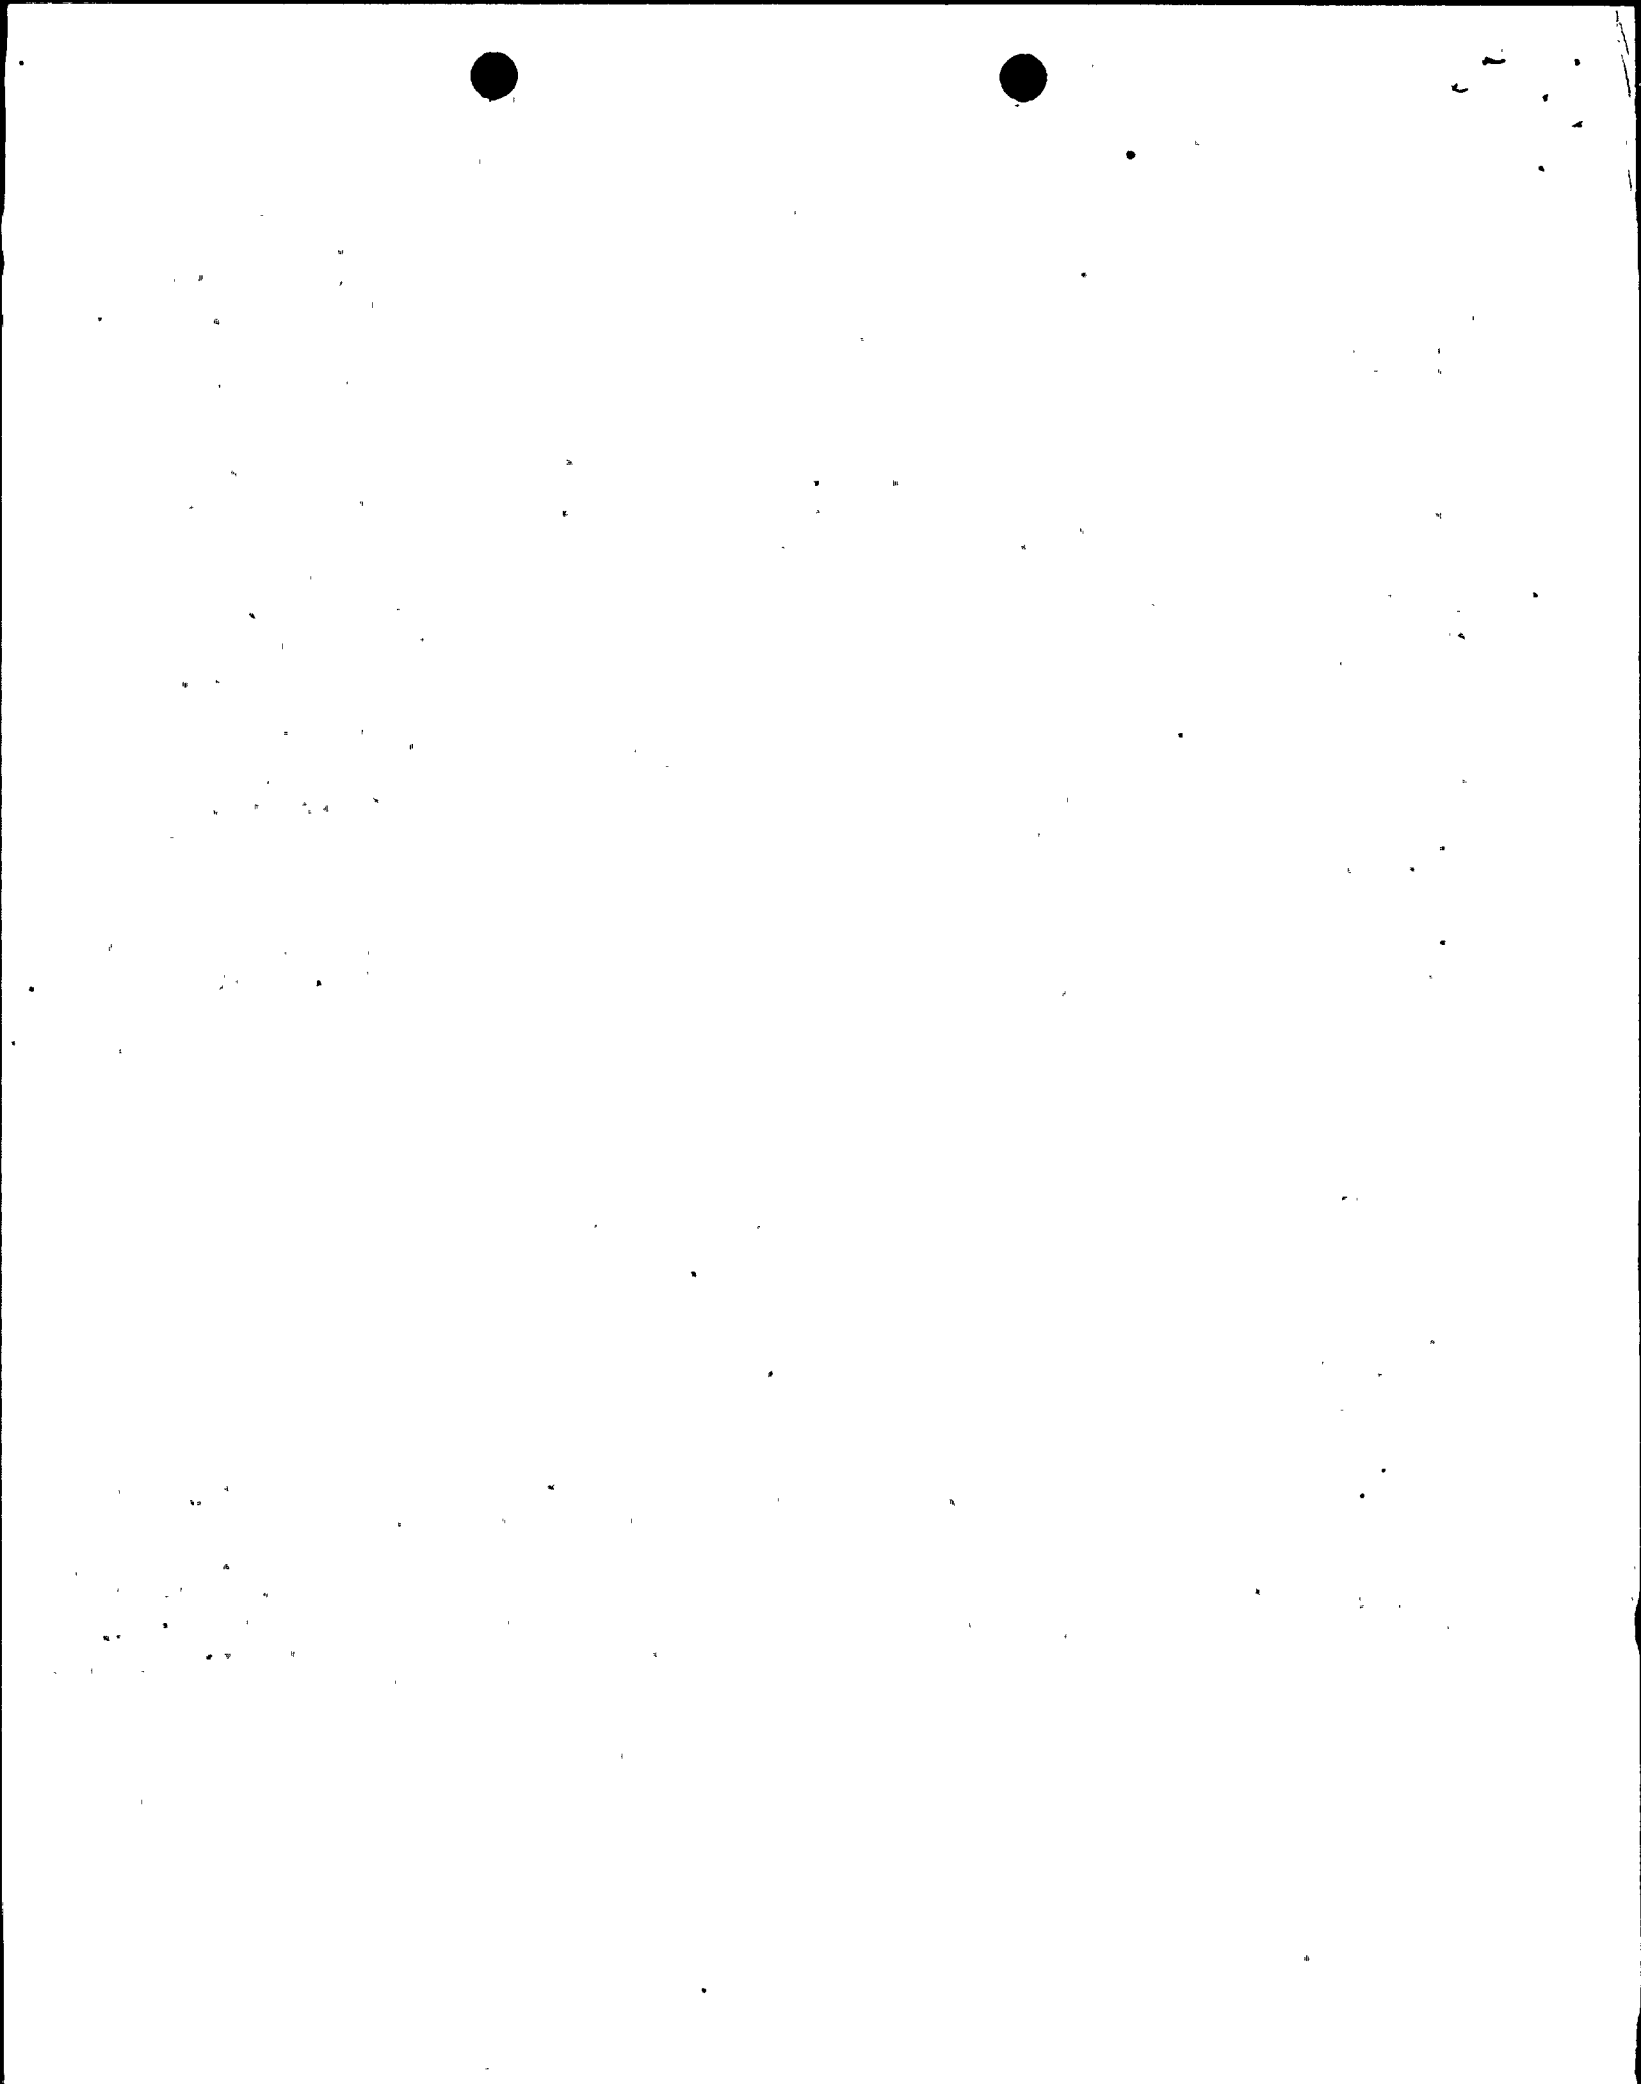

SAFETY ANALYSIS OF INTERIM ACTIONS TAKEN  
TO ELIMINATE FEEDWATER PIPING CRACKS

On May 20, 1979, Indiana and Michigan Power Company notified the NRC of cracking in two feedwater lines at their D. C. Cook Unit 2 facility. The cracking was discovered following a shutdown on May 19 to investigate leakage inside containment. Leaking circumferential cracks were identified in the 16-inch diameter feedwater elbows adjacent to two steam generator nozzle to elbow welds. Subsequent radiographic examinations revealed cracks in all eight steam generator feedwater lines at this location on both units 1 and 2.

On May 25, 1979, a letter was sent to all PWR licensees by the Office of Nuclear Reactor Regulation which informed licensees of the D. C. Cook failures and requested specific information on feedwater system design, fabrication, inspection and operating histories. To further explore the generic nature of the cracking problem, the Office of Inspection and Enforcement requested licensees of PWR plants in current outages to immediately conduct volumetric examination of certain feedwater piping welds. As a result of these actions several other licensees reported cracking in the steam generator feedwater nozzle-to-piping weld vicinity. On June 25, 1979, IE Bulletin 79-13 was issued. The Bulletin required inspection of the steam generator nozzle-to-pipe welds and adjacent areas within 90 days. If flaws were found in these welds, the feedwater piping welds to the first support, the feedwater piping to containment penetration and the auxiliary feedwater to main feedwater piping connection were required to be inspected.

In conformance with the Bulletin, the licensees of the plants listed in the attached Table 1 completed the radiographic examinations and found cracking in the feedwater piping systems.

Meetings and/or telephone conference calls were held with the respective licensees to discuss the following items regarding the feedwater piping cracks at their facilities:

1. Nature and extent of the cracking.
2. Metallurgical evaluation of the cracking including identification of the mode of failure.
3. Stress analyses
4. Operating history
5. Feedwater chemistry
6. Corrective actions
7. Safety implications

The licensees' interim reports containing the information above were submitted and reviewed by the staff prior to the units returning to power. The extent of the cracking at the facilities is summarized in Table 1. The mode of failure at all the facilities discussed in this analysis, with the exception of Yankee Rowe, was identified as fatigue assisted by corrosion. The Yankee Rowe facility had gross fabrication defects in its feedwater piping. No anomalies were found in the Code required stress analyses at the facilities.

From the results of instrumentation installed at several plants which have experienced feedwater piping cracks and other modeling and analyses by a utility sponsored Owners

Group, significant cyclic stresses have been identified that occur in the feedwater piping in the vicinity of the steam generator nozzle from mixing and stratification of cold auxiliary feedwater with hot water from the steam generator during low flow conditions. The Owners Group is expected to complete their investigations and make recommendations for changes in design and operating procedures in February 1980.

The licensees have repaired and/or replaced the affected piping in most cases with improved designs to minimize stress risers. In addition, the licensees have committed to reinspect the steam generator to feedwater piping weld vicinities at the subsequent refueling outage.

Although the piping has been repaired at the facilities listed in Table 1, the staff feels that cracking could re-occur in the future at these facilities. The staff and Owners Group both have performed independent analyses and have determined that flawed feedwater piping could withstand challenges from operating and faulted loads including seismic and limited water loads without loss of piping integrity. Pipe breaks have occurred in the past in feedwater piping as the result of water hammer loads. However, design changes such as "J" tubes have been made and operational changes have occurred to minimize the possibility of water hammer. In the unlikely event of a feedwater pipe break from a severe water hammer, the consequences have been analyzed as a design base accident and acceptable measures to deal with the event have been established.

The NRC has instituted a Pipe Crack Study Group to review this and other pipe cracking problems in PWR's. It is anticipated that the Pipe Crack Study Group will complete its work by June 1980 and provide recommendations for review and implementation by licensees as new criteria for operating plants.

We conclude that repairs to the feedwater piping, the nondestructive inspections performed and scheduled, and the analyses performed for flawed piping ensure that the piping integrity will be maintained until the recommendations of the Owners Group and the Pipe Crack Study Group have been evaluated. Should the staff determine that further actions are required after evaluation of the Owners Group and Pipe Crack Study Group recommendations, the licensees will be notified at that time.

Table 1 - Summary of PWR Feedwater Piping Cracks

PLANT	EXTENT OF CRACKING (NOZZLE VICINITY)			PIPING COMPONENT	PROBABLE CAUSE	COMMENTS
	Max. Depth	Location max. Depth Crack	No. of Lines Cracked			
Westinghouse						
D. C. Cook 1/2	Thru wall	TOP	8 of 8	elbow	Corrosion Assisted Fatigue	2 cracks thru wall
Beaver Valley	0.400"	9 O'clock	3 of 3	elbow	Corrosion Assisted Fatigue	13 additional fab. indications reported
Kewaunee	0.050"	7 O'clock	2 of 2	pipe	Corrosion Assisted Fatigue	3" dia. aux. feed n SG inlet
Pt. Beach 1/2	0.047"	3 O'clock	2 of 2	reducer	Corrosion Assisted Fatigue	3" dia. aux. feed n SG inlet
H.B. Robinson 2	0.750"	9 O'clock	3 of 3	reducer	Corrosion Assisted Fatigue	Shallow cracking in under thermal sleeve
Salem 1	0.211"		4 of 4	elbow reducer	Corrosion Assisted Fatigue	
San Onofre 1	0.100"	Lower half of reducer	3 of 3	reducer	Stress Assisted Corrosion	Multiple branched evidence of some fr
Surry 1/2	0.080"	2 and 5 O'clock	6 of 6	reducer	Corrosion Assisted Fatigue	
Glenn	0.107"	8:30 O'clock	2 of 2	elbow	Stress Assisted Corrosion/Corrosion Fatigue	Cracks also at deep machining marks
Zion 1/2	0.088"	4 O'clock	8 of 8	elbow pipe	Corrosion Assisted Fatigue	
Yukon Rowe						Gross fabrication defects in piping






Table 1 - Summary of PWR Feedwater Piping Cracks

PLANT	EXTENT OF CRACKING (NOZZLE VICINITY)			PIPING COMPONENT	PROBABLE CAUSE	COMMENTS
	Max. Depth	Location max. Depth Crack	No. of Lines Cracked			
Combustion Engineering						
Millstone 2	0.250"	12 O'clock	2 of 2	pipe	Not analyzed	
Palisades	0.170"	3 and 9 O'clock	2 of 2	pipe	Corrosion Assisted Fatigue	Cracks found also a vicinity of horizon piping