


Central File

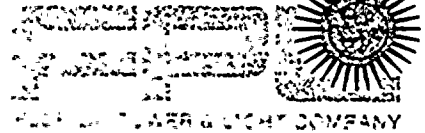


1981 FEB 14

January 29, 1981
L-81-29

Mr. James P. O'Reilly, Director, Region II
Office of Inspection and Enforcement
U. S. Nuclear Regulatory Commission
101 Marietta Street, Suite 3100
Atlanta, Georgia 30303

Dear Mr. O'Reilly:

Re: RII:JPO
50-250, 50-251
IE Bulletin 80-24

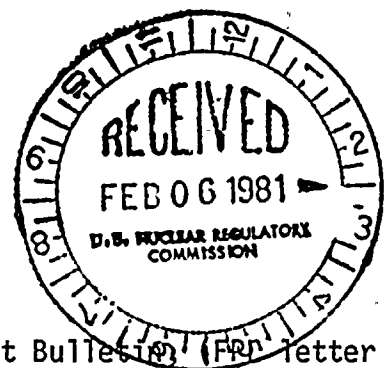

As discussed in our initial response to the subject Bulletin (FR) letter L-81-7 dated January 7, 1981, we committed to investigate other instances of system leakage inside containment by reviewing the Generation Equipment Maintenance System (GEMS) data base. Our review of the GEMS data base showed one additional instance of minor leakage of component cooling water inside containment from the head flange of the excess letdown heat exchanger. This leakage, however, was not quantified. Repairs were made by tightening the studs and nuts securing the flange.

An additional 6 manhours were expended in preparation of this supplement.

Very truly yours,

J. de Mastroy
jr

Robert E. Uhrig
Vice President
Advanced Systems & Technology

REU/PLP/mrs

cc: Director, Office of Inspection and Enforcement
Harold Reis, Esquire

8102280009
Q

