
LICENSEE EVENT REPORT

~	CONTROL BLOCK: (PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)
0 1	A L B R F 3 2 0 0 - 6 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0
CON'T	REPORT L 6 0 5 0 0 0 2 9 6 7 0 6 1 2 7 9 8 0 7 1 1 7 9 9 EVENT DESCRIPTION AND PROBABLE CONSEQUENCES 10
0 2	During normal operation while performing SI 4.1.A-14, Turbine First Stage Permissive,
0 3	pressure switches PS-1-81A & B and PS-1-91A & B setpoints exceeded T. S. Table
0 4	3.1.A limit of 154 psig. A reactor trip would have occurred from a turbine trip with 1
0 5	reactor power greater than 31.3 percent. Previous occurrences 50-259/7816, 50-260/
0 6	7916, and 50-259/798. There was no hazard to the public health or safety. There are
0 7	no redundant channels.
08 7 8	<u> </u>
09	SYSTEM CAUSE CAUSE COMPONENT CODE SUBCODE SUBC
	LER/RO EVENT YEAR SEQUENTIAL OCCURRENCE REPORT NO. 17 REPORT 7 9 0 7 0 3 L 0 0
	ACTION FUTURE EFFECT SHUTDOWN HOURS 22 ATTACHMENT NPRD-4 PRIME COMPONENT METHOD HOURS 22 SUBMITTED FORM SUB. SUPPLIER MANUFACTURER [E 18 X 19 Z 20 Z 21 0 0 0 Y 23 N 24 N 25 B 0 7 0 26 33 34 34 42 44 43 45 44 47 47
त्त्र	CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27) The model B2T-A12SS switches had drifted. The switches were recalibrated and function-
1 0	
	ally tested satisfactorily. The cause of the instrument drift is still under inves-
1 2	tigation.
1 3	
1 4 7 8	9 80
15	ACILITY STATUS TO THER STATUS TO THER STATUS TO THER STATUS TO THE STATU
1 6 RE	CTIVITY CONTENT LEASED OF RELEASE AMOUNT OF ACTIVITY 35 Z 33 Z 34 NA NA NA NA
7 8	9 10 11 44 45 80 PERSONNEL EXPOSURES NUMBER TYPE DESCRIPTION (39) 0 0 0 (37) z (38) NA
7 8	9 11 12 13 80 PERSONNEL INJURIES 80
1 8	[0
1 9	LOSS OF OR DAMAGE TO FACILITY 43 TYPE DESCRIPTION Z 42 NA
	9 10 80 PUBLICITY SSUED DESCRIPTION 45 NRC USE ONLY
2 0	SSUED 44 NA 68 69 . 80 2
-	NAME OF PREPARER

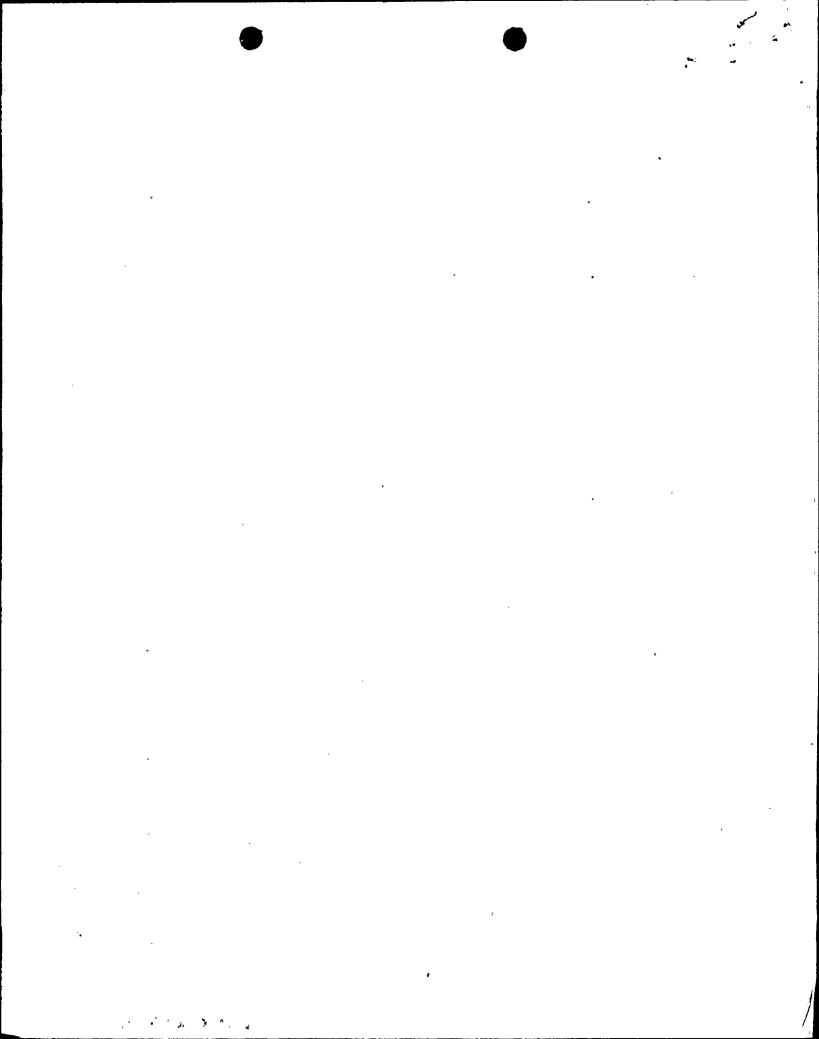

LER SUPPLEMENTAL INFORMATION

BFRO-50- 296 / 797 Technical Specification Involved Table 3.1.A
Reported Under Technical Specification 6.7:2.b.2
Date of Occurrence 6-12-79 Time of Occurrence 0930 Unit 3
Identification and Description of Occurrence:
As found setpoints for PS-1-81A and B, PS-1-91A and B (RPS Turbine First Stage Pressure Permissive - SI 4.1.A-14) exceeded technical specification limit of \$\frac{2}{2}\$154 psig by 9.5 to 12 psig.
Conditions Prior to Occurrence:
Unit @ 1070 MWe. Steady state.
·
<i></i>
Action specified in the Technical Specification Surveillance Requirements met due to inoperable equipment. Describe.
Setpoints adjusted to within technical specification limits. Each instrument channel was satisfactorily functionally tested.
Apparent Cause of Occurrence:
Drift of instrument setpoint.
Analysis of Occurrence:
Presently reviewing setpoint data for all three units, Investigation of cause of setpoint drift continuing.
••••••••••••••••••••••••••••••••••••••
Corrective Action:
Instrument calibration.

Failure Data:

50-259/7816, 50-260/7916, and 50-259/798.

*Retention: Period - Lifetime; Responsibility - Administrative Supervisor

*Revision:

• • ¥ • • • • •