

NRC DISTRIBUTION FOR PART 50 DOCKET MATERIAL

FILE NUMBER
INCIDENT REPORT

TO:
Mr. James P. O'Reilly

FROM:
Rochester Gas & Electric Corp.
Rochester, New York
L. D. White, Jr.

DATE OF DOCUMENT
9/14/76

DATE RECEIVED
9/17/76

LETTER
 ORIGINAL
 COPY

NOTORIZED
 UNCLASSIFIED

PROP

INPUT FORM

NUMBER OF COPIES RECEIVED
One signed copy

DESCRIPTION

Ltr. trans the following:

ACKNOWLEDGED

DO NOT REMOVE

(1-P)

PLANT NAME:
Ginna #1

ENCLOSURE

Licensee Event Report (RO 50-244/76-23) on 8/19/76 concerning incorrect piping installation for modification SM 75-9.21.

(1-P)

NOTE: IF PERSONNEL EXPOSURE IS INVOLVED SEND DIRECTLY TO KREGER/J. COLLINS

FOR ACTION/INFORMATION 9/20/76 RJL

<input checked="" type="checkbox"/> BRANCH CHIEF:	Schwencer		
<input type="checkbox"/> W/3 CYS FOR ACTION			
<input checked="" type="checkbox"/> LIC. ASST.:	Sheppard		
<input type="checkbox"/> W/1 CYS			
<input type="checkbox"/> ACRS 16 CYS HOLDING/SENT TO LA			

INTERNAL DISTRIBUTION

<input checked="" type="checkbox"/> REG FILE			
<input checked="" type="checkbox"/> NRC PDR			
<input checked="" type="checkbox"/> I & E (2)			
<input checked="" type="checkbox"/> MIPC			
<input checked="" type="checkbox"/> SCHROEDER/IPPOLITO			
<input checked="" type="checkbox"/> HOUSTON			
<input checked="" type="checkbox"/> NOVAK/CHECK			
<input checked="" type="checkbox"/> GRIMES			
<input checked="" type="checkbox"/> CASE			
<input checked="" type="checkbox"/> BUTLER			
<input checked="" type="checkbox"/> HANAUER			
<input checked="" type="checkbox"/> TEDESCO/MACCARY			
<input checked="" type="checkbox"/> EISENHUT			
<input checked="" type="checkbox"/> BAER			
<input checked="" type="checkbox"/> SHAO			
<input checked="" type="checkbox"/> VOLLMER/BUNCH			
<input checked="" type="checkbox"/> KREGER/J. COLLINS			

<input checked="" type="checkbox"/> LPDR: Rochester, N.Y.	EXTERNAL DISTRIBUTION		
<input checked="" type="checkbox"/> LPDR: Lyons, N.Y.			
<input checked="" type="checkbox"/> TIC:			
<input checked="" type="checkbox"/> NSIC:			

CONTROL NUMBER

9475

1941

... ..

...

...

...

...

(-5) (-1)

...

...

...

...

...


...




ROCHESTER GAS AND ELECTRIC CORPORATION • 89 EAST AVENUE, ROCHESTER, N.Y. 14649

LEON D. WHITE, JR.
VICE PRESIDENT

TELEPHONE
AREA CODE 716 546-2700



September 14, 1976

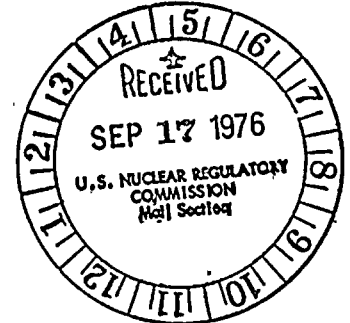

Mr. James P. O'Reilly, Director
U. S. Nuclear Regulatory Commission
Office of Inspection and Enforcement
Region I
631 Park Avenue
King of Prussia, Pennsylvania 19406

Subject: Reportable Occurrence 76-23 (30-day report), Incorrect piping
installation for modification SM 75-9.21
R. E. Ginna Nuclear Power Plant, Unit No. 1
Docket No. 50-244

Dear Mr. O'Reilly:

In accordance with Technical Specifications, Article 6.9.2b, the attached
report of Reportable Occurrence 76-23, 30-day, is hereby submitted. Two
additional copies of this letter and the attachment are enclosed.


Very truly yours,

L. D. White, Jr.

Attachment

cc: Dr. Ernst Volgenau (30)
Mr. William G. McDonald (3)

REGULATORY DOCKET FILE COPY

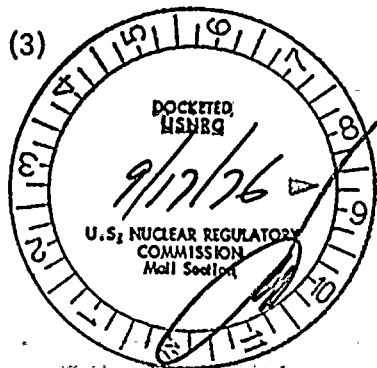

9475

NTS
RHS
L M J

3 22

DATE RECEIVED

19

LER 76-23/3L
LICENSEE EVENT REPORT

CONTROL BLOCK:

--	--	--	--	--	--	--	--	--	--

(PLEASE PRINT ALL REQUIRED INFORMATION)

LICENSEE NAME										LICENSE NUMBER										LICENSE TYPE					EVENT TYPE	
01	N	Y	R	E	G	1	0	0	-	0	0	0	0	0	-	0	0	4	1	1	1	1	0	3		
7	8	9	14	15	25	26	30	31	32																	
01		CATEGORY		REPORT TYPE	REPORT SOURCE	DOCKET NUMBER				EVENT DATE			REPORT DATE													
01	CONT			L	L	0	5	0	-	0	2	4	4	0	8	1	9	7	6	0	9	1	4	7	6	
7	8	57	58	59	60	61	68	69	74	75	80															

EVENT DESCRIPTION

02 | During review by contractor's Q.C. personnel of work documentation package, it was
 03 | determined that piping installed in S.I. Test Line during spring 1976 refueling shutdown
 04 | was 3/4" Sch-40 S stainless steel rather than 3/4" Sch 80 S stainless steel specified.
 05 | The PORC has determined that with the Sch 40 pipe section S.I. pumps would have been
 06 | capable of fulfilling their intended function. With unit(cont'd. under Additional Factors)

SYSTEM CODE		CAUSE CODE		COMPONENT CODE				PRIME COMPONENT SUPPLIER	COMPONENT MANUFACTURER			VOLATION			
07	S	F	B	P	I	P	E	X	X	A	X	9	9	9	N
7	8	9	10	11	12	17	43	44	47	48					

CAUSE DESCRIPTION

08 | Inadequate administrative controls to assure proper installation of materials. Contractor
 09 | procedures and plant procedures have been changed to provide more stringent controls
 10 | for the verification of acceptability of installed modifications prior to plant operation.

FACILITY STATUS	% POWER	OTHER STATUS		METHOD OF DISCOVERY	DISCOVERY DESCRIPTION				
11	G	0	0	0	NA	Z	QC review of work documentation		
7	8	9	10	12	13	44	45	46	80
FORM OF ACTIVITY RELEASED	CONTENT OF RELEASE	AMOUNT OF ACTIVITY			LOCATION OF RELEASE				
12	Z	Z	NA			NA			
7	8	9	10	11	44	45	80		

PERSONNEL EXPOSURES

NUMBER	TYPE	DESCRIPTION				
13	0	0	0	Z	NA	
7	8	9	11	12	13	80

PERSONNEL INJURIES

NUMBER	DESCRIPTION				
14	0	0	0	NA	
7	8	9	11	12	80

OFFSITE CONSEQUENCES

15	NA		
7	8	9	80

LOSS OR DAMAGE TO FACILITY

TYPE	DESCRIPTION			
16	Z	NA		
7	8	9	10	80

PUBLICITY

17	NA		
7	8	9	80

ADDITIONAL FACTORS

18 | (cont'd. from Event Description) shutdown contractor immediately replaced piping with
 correct material. CAR 1098 was issued for this event. (Reportable Occurrence 76-23
 19 | 30-day).

