

SAFETY INSPECTION REPORT AND COMPLIANCE INSPECTION

1. LICENSEE/LOCATION INSPECTED: Emery Sapp & Sons, Inc. 2301 I-70 Drive NW Columbia, MO 65202 REPORT NUMBER(S) 2018001		2. NRC/REGIONAL OFFICE Region III U. S. Nuclear Regulatory Commission 2443 Warrenville Road, Suite 210 Lisle, IL 60532-4352	
3. DOCKET NUMBER(S) 030-38051	4. LICENSE NUMBER(S) 24-32751-01	5. DATE(S) OF INSPECTION April 19, 2018 with in-office review through May 24, 2018	

LICENSEE:

The inspection was an examination of the activities conducted under your license as they relate to radiation safety and to compliance with the Nuclear Regulatory Commission (NRC) rules and regulations and the conditions of your license. The inspection consisted of selective examinations of procedures and representative records, interviews with personnel, and observations by the inspector. The inspection findings are as follows:

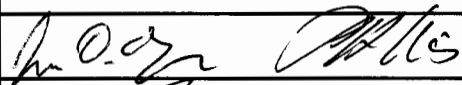

- 1. Based on the inspection findings, no violations were identified.
- 2. Previous violation(s) closed.
- 3. The violation(s), specifically described to you by the inspector as non-cited violations, are not being cited because they were self-identified, non-repetitive, and corrective action was or is being taken, and the remaining criteria in the NRC Enforcement Policy, to exercise discretion, were satisfied.

Non-cited violation(s) were discussed involving the following requirement(s):

- 4. During this inspection, certain of your activities, as described below and/or attached, were in violation of NRC requirements and are being cited in accordance with NRC Enforcement Policy. This form is a NOTICE OF VIOLATION, which may be subject to posting in accordance with 10 CFR 19.11.
(Violations and Corrective Actions)

Statement of Corrective Actions

I hereby state that, within 30 days, the actions described by me to the Inspector will be taken to correct the violations identified. This statement of corrective actions is made in accordance with the requirements of 10 CFR 2.201 (corrective steps already taken, corrective steps which will be taken, date when full compliance will be achieved). I understand that no further written response to NRC will be required, unless specifically requested.

TITLE	PRINTED NAME	SIGNATURE	DATE
LICENSEE'S REPRESENTATIVE			
NRC INSPECTOR	Jason D. Draper / Luis Nieves		5/25/18
BRANCH CHIEF	Aaron T. McCraw		5/25/18

Docket File Information
SAFETY INSPECTION REPORT AND COMPLIANCE INSPECTION

1. LICENSEE/LOCATION INSPECTED: Emery Sapp & Sons, Inc. 2301 I-70 Drive NW Columbia, MO 65202 REPORT NUMBER(S) 2018001	2. NRC/REGIONAL OFFICE Region III U. S. Nuclear Regulatory Commission 2443 Warrenville Road, Suite 210 Lisle, IL 60532-4352
--	---

3. DOCKET NUMBER(S) 030-38051	4. LICENSE NUMBER(S) 24-32751-01	5. DATE(S) OF INSPECTION April 19, 2018 with in-office review through May 24, 2018
--------------------------------------	---	---

6. INSPECTION PROCEDURES USED 87124	7. INSPECTION FOCUS AREAS 03.01-03.04, 03.06
--	---

SUPPLEMENTAL INSPECTION INFORMATION

1. PROGRAM CODE(S) 03121	2. PRIORITY 5	3. LICENSEE CONTACT Kyle Frye, RSO	4. TELEPHONE NUMBER (816) 262-0170
---------------------------------	----------------------	---	---

Main Office Inspection Next Inspection Date: 03/30/2021
 Field Office Inspection _____
 Temporary Job Site Inspection I-70 and St Hwy MM, Warrenton, MO

PROGRAM SCOPE

This was an unannounced, routine inspection of a portable gauge licensee from Columbia, MO. The authorized user (AU) was on a multi-day temporary jobsite for a new interstate overpass being constructed in Warrenton, MO. The AU was using a Troxler 3440 gauge to take density measurements. The AU stated the the gauge was stored at a nearby licensee storage facility overnight.

PERFORMANCE OBSERVATIONS

The inspectors observed the AU transport the gauge on the jobsite, use it to perform measurements, and secure it in the user's vehicle. Through interviews, the inspectors determined that the AU was knowledgeable of radiation safety and security principles with respect to their duties with the gauge. The inspectors reviewed the available documentation associated with the gauge and identified that the most recent leak test was not available at the jobsite, however, the inspectors were later able to verify that the RSO had documentation demonstrating an acceptable leak test had been performed for the gauge for the time of the inspection. The inspectors also noted that the AU did not have dosimetry, however, the licensee had performed an evaluation demonstrating that dosimetry was not required.

No violations of NRC requirements were identified as a result of this inspection.

Draper, Jason

From: Draper, Jason
Sent: Friday, May 25, 2018 9:38 AM
To: 'Kyle Frye'
Cc: Nieves Folch, Luis
Subject: NRC Inspection Report for Emery Sapp and Sons
Attachments: ESS Form 591M signed part 1.pdf

Kyle,

As we discussed on our phone call on Thursday, May 24, 2018, attached is the inspection report for the routine NRC inspection we conducted at a temporary jobsite in Warrenton, MO, on Thursday, April 19, 2018. Please review and keep this document for your records. There is no response required, though I would appreciate an email confirming that you have received the document. Let me know if you have any questions.

In accordance with 10 CFR 2.390 of the NRC's "Rules of Practice," a copy of this letter will be made available electronically for public inspection in the NRC's Public Document Room or from the NRC's Agencywide Documents Access and Management System (ADAMS), accessible from the NRC's website at <http://www.nrc.gov/reading-rm/adams.html>.

Jason Draper
Health Physicist (Inspector)
NRC/RIII/DNMS/MIB
(630) 829-9839
jason.draper@nrc.gov