



UNITED STATES
NUCLEAR REGULATORY COMMISSION
REGION IV
611 RYAN PLAZA DRIVE, SUITE 1000
ARLINGTON, TEXAS 76012

bcc to DAC:ADM:
CENTRAL FILES
PDR:HQ
LPDR
~~TIC~~
NSIC

December 21, 1979

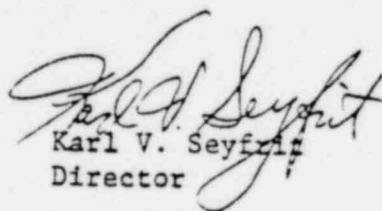
ocket No. 50-285

Omaha Public Power District
ATTN: W. C. Jones, Division Manager -
Production Operations
1623 Harney Street
Omaha, Nebraska 68102

Gentlemen:

This IE Information Notice is provided as an early notification of a possibly significant matter. It is expected that recipients will review the Information for possible applicability to their facilities. No specific action or response is requested at this time. However, we anticipate that further NRC evaluations will result in issuance of an IE Circular or Bulletin in the near future which will recommend or request specific applicant or licensee actions. If you have questions regarding the matter, please contact the Director of the appropriate NRC Regional Office.

Sincerely,


Karl V. Seyfried
Director

Enclosures:

1. IE Information Notice
No. 79-33
2. List of Recently Issued
Information Notices

cc: S. C. Stevens, Manager
Fort Calhoun Station
Post Office Box 98
Fort Calhoun, Nebraska 68102

1737 326

(D) 8001110 020

DUPLICATE

UNITED STATES
NUCLEAR REGULATORY COMMISSION
OFFICE OF INSPECTION AND ENFORCEMENT
WASHINGTON, D.C. 20555

SSINS NO.: 6870
Accession No.:

7910250 520

December 21, 1979

IE Information Notice No. 79-33

IMPROPER CLOSURE OF PRIMARY CONTAINMENT EQUIPMENT ACCESS HATCHES

Description of Circumstances:

On December 8, 1979 difficulty was experienced in establishing the required nitrogen pressure in primary containment during power range startup testing of the Browns Ferry Nuclear Plant, Unit 3, following a refueling outage. On December 9, 1979, the licensee found three loose bolts on an equipment hatch to be the cause of leakage from the primary containment. The leakage was calculated to have been ten times the allowable containment leakage rate. This hatch had previously passed a local leak rate test (LLRT) and an integrated leak rate test of the containment in November 1979. The reactor had returned to operation on December 6, 1979 from the refueling outage and had operated at power levels less than 25 percent since December 6, 1979.

A subsequent inspection by the licensee of both primary containment equipment access hatches for Unit 2 was performed. TVA reported on December 20, 1979, to the NRC that they had found six of twelve closing dogs on one hatch improperly aligned and one closing bolt not torqued. A LLRT, performed with the hatch in this condition, showed a leakage rate higher than normal but within Technical Specification limits. The second hatch on this unit was found to have eight of twelve closing dogs improperly aligned.

The licensee is in the process of inspecting the closure of both primary containment equipment access hatches on Unit 1 and is reinspecting these hatches on Unit 3.

It is anticipated that further NRC evaluation will result in issuance of an IE Circular or Bulletin in the near future which will recommend or request specific applicant or licensee actions.

This information is provided to inform licensees of a possibly significant matter. The improper closure of the primary containment access hatches resulted from a lack of procedures for torque values, sequence of torque, and alignment of the closing dogs. We expect that recipients will review the adequacy of their procedures for access hatch installation at all facilities. If installation procedures do not exist or are inadequate, inspection and local leak rate testing can be used to confirm containment penetration integrity. If you have any questions regarding this matter, please contact the Director of the appropriate NRC Regional Office.

No written response to this Information Notice is required.

1737 327

LISTING OF RECENTLY ISSUED
IE INFORMATION NOTICES

Information Notice No.	Subject	Date Issued	Issued To
79-27	Steam Generator Tube Ruptures at Two PWR Facilities	11/16/79	All power reactor facilities holding Operating Licenses (OLs) and Construction Permits (CPs)
79-28	Overloading of Structural Elements Due to Pipe Support	11/16/79	All power reactor facilities with an Operating License (OL) or Construction Permit (CP)
79-29	Loss of NonSafety-Related Reactor Coolant System Instrumentation During Operating	11/16/79	All power reactor facilities holding Operating Licenses (OLs) or Construction Permits (CPs)
79-30	Reporting of Defects and Noncompliance, 10 CFR Part 21.	12/6/79	All power reactor facilities holding Operating Licenses (OLs) and Construction Permits (CPs) and vendors inspectors inspected by LCVIP
79-31	Use of Incorrect Amplified Response Spectra (ARS)	12/13/79	All power reactor facilities holding Operating Licenses (OLs) and Construction Permits (CPs)
79-32	Separation of Electrical Cables for HPCI and ADS	12/21/79	All power reactor facilities holding Operating Licenses (OL) and Construction Permits (CPs)

Enclosure

1737 328