

TIC



UNITED STATES
NUCLEAR REGULATORY COMMISSION
REGION II
101 MARIETTA ST., N.W., SUITE 3100
ATLANTA, GEORGIA 30303

OCT 17 1979

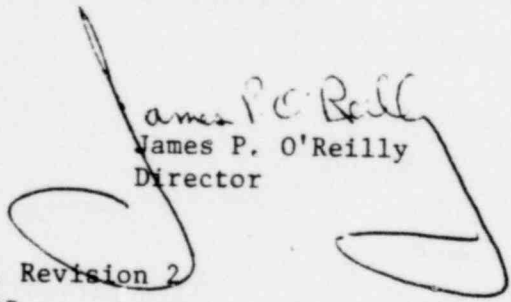
In Reply Refer To:
RII:JPO
50-413, 50-414
50-491, 50-492
50-493, 50-488
50-489, 50-490

Duke Power Company
Attn: L. C. Dail, Vice President
Design Engineering
P. O. Box 33189
Charlotte, North Carolina 28242

Gentlemen:

The enclosed Bulletin No. 79-13, Revision 2 is forwarded to you for information. No written response is required. If you desire additional information regarding this matter, please contact this office.

Sincerely,


James P. O'Reilly
Director

Enclosures:

- 1. IE Bulletin No. 79-13, Revision 2
- 2. Listing of IE Bulletins
Issued in Last Six Months

1299 298

7911070 194

OCT 17 1979

Duke Power Company

-2-

cc w/encl:

D. G. Beam, Project Manager
Post Office Box 223
Clover, South Carolina 29710

J. T. Moore, Project Manager
Post Office Box 422
Gaffney, South Carolina 29340

1299 299

SSINS: 6830
Accession No.:
7908220135

UNITED STATES
NUCLEAR REGULATORY COMMISSION
OFFICE OF INSPECTION AND ENFORCEMENT
WASHINGTON, D.C. 20555

October 16, 1979

IE Bulletin No. 79-13
Revision 2

CRACKING IN FEEDWATER SYSTEM PIPING

Description of Circumstances:

This revision to IE Bulletin No. 79-13 is based on the results of the radiographic examinations and ongoing investigation of the subject problem to date since the initial Bulletin was issued. The revision reduces in scope the number and extent of the piping system welds required to be examined. The requirements for reporting and action time frame remain unchanged.

On May 20, 1979, Indiana and Michigan Power Company notified the NRC of cracking in two feedwater lines at their D. C. Cook Unit 2 facility. The cracking was discovered following a shutdown on May 19 to investigate leakage inside containment. Leaking circumferential cracks were identified in the 16-inch feedwater elbows adjacent to two steam generator nozzle elbow welds. Subsequent radiographic examination revealed crack indications in all eight steam generator feedwater lines at this location on both Units 1 and 2.

On May 25, 1979, a letter was sent to all PWR licensees by the Office of Nuclear Reactor Regulation which informed licensees of the D. C. Cook failures and requested specific information on feedwater system design, fabrication, inspection and operating histories. To further explore the generic nature of the cracking problem, the Office of Inspection and Enforcement requested licensees of PWR plants in current outages to immediately conduct volumetric examination of certain feedwater piping welds.

As a result of these actions, several other licensees with Westinghouse steam generators reported crack indications. Southern California Edison reported on June 5, 1979, that radiographic examination revealed indications of cracking in feedwater nozzle-to-pipe welds on two of three steam generators of San Onofre Unit 1. On June 15, 1979, Carolina Power and Light reported that radiography showed crack indications in similar locations at their H. B. Robinson Unit 2. Duquesne Power and Light confirmed on June 18, 1979, that radiography has shown cracking in their B... to-vessel nozzle weld. Public Service El... June 20, 1979 that Salem Unit 1 also has... Service company decided on June 20, 1979... weld which contained questionable indicat... As of June 22, 1979 and since May 25, 1979... inspected the feedwater nozzle-to-pipe welds.

1299 300

NOTE: R1 and R2 indicates lines revised

DUPLICATE DOCUMENT

Entire document previously
entered into system under:

ANO

7908220135

No. of pages:

12

R2