



UNITED STATES  
NUCLEAR REGULATORY COMMISSION  
REGION II  
101 MARIETTA ST., N.W., SUITE 3100  
ATLANTA, GEORGIA 30303

MAR 07 1980

In Reply Refer To:

RIL:JPO

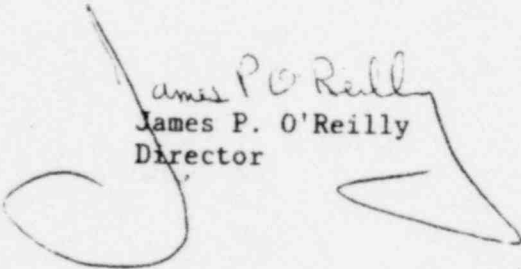
50-395

South Carolina Electric and Gas Company  
Attn: M. C. Johnson, Vice President  
Special Services and Purchasing  
P. O. Box 764  
Columbia, SC 29218

Gentlemen:

This Information Notice is provided as an early notification of a possible significant matter. It is expected that recipients will distribute this Notice to their operating personnel and will review the information for possible applicability to their facilities. No specific response is requested at this time. However, we anticipate that further NRC evaluations will result in issuance of an Addendum to IE Bulletin 79-27 in the near future which will recommend or request specific applicant or licensee actions. If you have questions regarding the matter, please contact the Director of the appropriate NRC Regional Office.

Sincerely

  
James P. O'Reilly  
Director

Enclosures:

1. IE Information Notice  
No. 80-10 w/its Enclosure
2. List of IE Information  
Notices Recently Issued

8003140404

Q

MAR 07 1980

South Carolina Electric  
and Gas Company

-2-

cc w/encl:

T. B. Conners, Jr.  
Conners, Moore and Corber  
1747 Pennsylvania Avenue, N.W.  
Washington, D.C. 20006

A. A. Smith  
Quality Assurance  
Post Office Box 8  
Jenkinsville, South Carolina 29065

O. S. Bradham, Manager  
Nuclear Operations  
Post Office Box 8  
Jenkinsville, South Carolina 29065

UNITED STATES  
NUCLEAR REGULATORY COMMISSION  
OFFICE OF INSPECTION AND ENFORCEMENT  
WASHINGTON, D.C. 20555

SSINS No.: 6870  
Accession No.:  
8002280640

March 7, 1980

IE Information Notice No. 80-10

PARTIAL LOSS OF NON-NUCLEAR INSTRUMENT SYSTEM POWER SUPPLY DURING OPERATION

Description of Circumstances:

This notice contains information regarding Crystal River Unit 3 response to a loss of non-nuclear instrumentation (NNI) as a consequence of loss of the +24 volt power supply to the NNI.

At 2:23 p.m. on February 26 with Crystal River Unit 3 at 100% power, the +24 volt power supply to the NNI was lost, due to a short to ground. This initiated a sequence of events (detailed in the enclosure) wherein the PORV opened and stayed open as a direct result of the NNI power supply loss. HPI initiated as a result of depressurization through the open PORV, and with approximately 70% of NNI inoperable or inaccurate, the operator correctly decided that there was insufficient information available to justify terminating HPI. Therefore, the pressurizer was pumped solid, one safety valve lifted, and flow through the safety valve was sufficient to rupture the RC Drain Tank rupture disk, spilling approximately forty-three thousand gallons of primary water into containment.

The Crystal River 3 event is closely related to the November 10, 1979 event at Oconee Unit 3 wherein the inverter supplying power to the Integrated Control System (ICS) and to parts of the NNI failed. That event was the subject of IE Information Notice 79-29 (November 16, 1979) which was followed by IE Bulletin 79-27 (November 30, 1979).

The CR-3 event involved loss of only part of the power available from an inverter, rather than the inverter itself, since the +24v supply is only one of several power supplies drawing power from one inverter. The effects are very similar, however, in that the ICS lost part of its input signals in both events.

The +24 volt power supply short to ground has tentatively been identified by the licensee to have occurred between knife edge connectors of a Bailey Control Company Voltage Buffer Card. The voltage buffer card was misaligned in its receptacle, and adjacent connectors carrying +24v and "common" were bent such that they contacted one another. This subsequent re-energizing of the power printed circuit card. Subsequent rev voltage buffer card which was also mi The specific circuit cards which were The connectors on these cards are sli different angle than those found on s carry part numbers 6624608A1 or 66246 more subject to misalignment.

DUPLICATE DOCUMENT

Entire document previously  
entered into system under:

ANO 8002280640

No. of pages: 13