



UNITED STATES  
NUCLEAR REGULATORY COMMISSION  
REGION IV  
611 RYAN PLAZA DRIVE, SUITE 1000  
ARLINGTON, TEXAS 76012

CENTRAL FILES  
PDR:HQ  
LPDR  
~~TIC~~  
NSIC

November 30, 1979

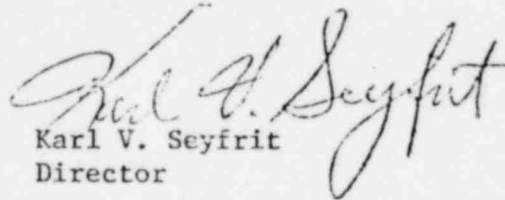
Docket No. 50-267

Public Service Company of Colorado  
ATTN: Mr. C. K. Millen  
Senior Vice President  
P. O. Box 840  
Denver, Colorado 80201

Gentlemen:

The enclosed IE Bulletin No. 79-27, is forwarded for action. A written response is required. If you desire additional information regarding this matter, please contact this office.

Sincerely,

  
Karl V. Seyfrit  
Director

Enclosures:

1. IE Bulletin No. 79-27
2. List of Recently Issued  
IE Bulletins

cc: D. W. Warembourg, Nuclear Production  
Manager  
Fort St. Vrain Nuclear Station  
P. O. Box 368  
Platteville, Colorado 80651

L. Brey, Manager, Quality Assurance

1790 314

Q 7912190 189

UNITED STATES  
NUCLEAR REGULATORY COMMISSION  
OFFICE OF INSPECTION AND ENFORCEMENT  
WASHINGTON, D.C. 20555

SSINS No.: 6820  
Accession No.:  
7910250499

IE Bulletin No. 79-27  
Date: November 30, 1979  
Page 1 of 3

LOSS OF NON-CLASS 1-E INSTRUMENTATION AND CONTROL POWER SYSTEM BUS  
DURING OPERATION

Description of Circumstances:

On November 10, 1979, an event occurred at the Oconee Power Station, Unit 3, that resulted in loss of power to a non-class 1-E 120 Vac single phase power panel that supplied power to the Integrated Control System (ICS) and the Non-Nuclear Instrumentation (NNI) System. This loss of power resulted in control system malfunctions and significant loss of information to the control room operator.

Specifically, at 3:16 p.m., with Unit 3 at 100 percent power, the main condensate pumps tripped, apparently as a result of a technician performing maintenance on the hotwell level control system. This led to reduced feedwater flow to the steam generators, which resulted in a reactor trip due to high coolant system pressure and simultaneous turbine trip at 3:16:57 p.m. At 3:17:15 p.m., the non-class 1-E inverter power supply feeding all power to the integrated control system (which provides proper coordination of the reactor, steam generator feedwater control, and turbine) and to one NNI channel tripped and failed to automatically transfer its loads from the DC power source to the regulated AC power source. The inverter tripped due to blown fuses. Loss of power to the NNI rendered control room indicators and recorders for the reactor coolant system (except for one wide-range RCS pressure recorder) and most of the secondary plant systems inoperable, causing loss of indication for systems used for decay heat removal and water addition to the reactor vessel and steam generators. Upon loss of power, all valves controlled by the ICS assumed their respective failure positions. The loss of power existed for approximately three minutes, until an operator could reach the equipment room and manually switch the inverter to the regulated AC source.

The above event was discussed in IE Information Notice No. 79-29, issued November 16, 1979.

NUREG 0600 "Investigation into the March 28, 1979 TMI Accident" also discusses TMI LER 78-021-03L whereby the RCS depressurized and Safety Injection occurred on loss of a vital bus due to inverter failure.

Actions to Be Taken by Licensees

For all power reactor facilities with completion of construction (North Anna, Sequoyah, and Zimmer):

1790 315

DUPLICATE DOCUMENT

Entire document previously  
entered into system under:

ANO 7910250499

No. of pages: 4