

ENCLOSURE
NOTICE OF VIOLATION

Compton Construction Company
Princeton, West Virginia

Docket No. 030-28920
License No. 47-24807-01

During an NRC inspection conducted on August 27, 1990 violations of NRC requirements were identified. In accordance with the "General Statement of Policy and Procedure for NRC Enforcement Actions," 10 CFR Part 2, Appendix C (1990), the violations are listed below:

- A. Condition 13 of NRC License No. 47-24807-01 requires that each sealed source containing licensed material be tested for leakage and/or contamination at intervals not to exceed six months.

Contrary to the above, leak tests had not been performed by the licensee on Troxler Gauge 3411, serial No. 12851 between the periods of April 18, 1986 and May 3, 1987, May 6, 1987 and May 28, 1989, May 30, 1989 and August 27, 1990, and Troxler Gauge 3411, serial No. 17754 between November 3, 1989 and August 27, 1990.

This is a Severity Level IV violation (Supplement VI).

- B. Condition 15 of NRC License No. 47-24807-01 requires the licensee to conduct a physical inventory every six months to account for all sealed sources received and possessed under the license.

Contrary to the above, a physical inventory had not been performed by the licensee on Troxler Gauge 3411, serial No. 12851 between the periods of April 18, 1986 and May 3, 1987, May 6, 1987 and May 28, 1989, May 30, 1989 and August 27, 1990, and Troxler Gauge 3411, serial No. 17754 between November 3, 1989 and August 27, 1990.

This is a Severity Level IV violation (Supplement VI).

- C. Condition 17 of License No. 47-24807-01 requires that licensed material be possessed and used in accordance with the statements, representations and procedures described in the license application dated September 11, 1985, and in the documents submitted in support of that application.


Item No. 3 of the license application dated September 11, 1985, states that licensed material will be stored at the Ingleside Road facility in Princeton, West Virginia.

Contrary to the above, the licensed material was being stored at the Greasy Ridge Road facility in Princeton, West Virginia.

This is a Severity Level IV violation (Supplement VI).

Pursuant to the provisions of 10 CFR 2.201, Compton Construction Company is hereby required to submit a written statement or explanation to the U.S. Nuclear Regulatory Commission, ATTN: Document Control Desk, Washington, D.C. 20555 with a copy to the Regional Administrator, Region II, within 30 days of the date of the letter transmitting this Notice of Violation (Notice). This reply should be clearly marked as a "Reply to a Notice of Violation" and should include for each violation: (1) the reason for the violation, or, if contested, the basis for disputing the violation, (2) the corrective steps that have been taken and the results achieved, (3) the corrective steps that will be taken to avoid further violations, and (4) the date when full compliance will be achieved. If an adequate reply is not received within the time specified in this Notice, an order may be issued to show cause why the license should not be modified, suspended, or revoked, or why such other action as may be proper should not be taken. Where good cause is shown, consideration will be given to extending the response time.

FOR THE NUCLEAR REGULATORY COMMISSION

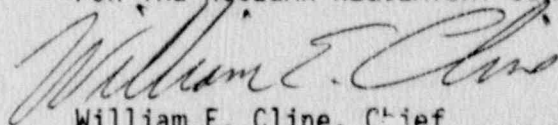

William E. Cline, Chief
Nuclear Materials Safety and
Safeguards Branch
Division of Radiation Safety
and Safeguards

Dated at Atlanta, Georgia
this 27th day of September 1990