

ENCLOSURE 1

NOTICE OF VIOLATION

Georgia Power Company
Hatch Units 1 and 2

Docket Nos. 50-321 and 50-366
License Nos. DPR-57 and NPF-5

During the NRC inspection conducted on August 4 - September 14, 1990, a violation of NRC requirements was identified. In accordance with the "General Statement of Policy and Procedures for NRC Enforcement Actions," 10 CFR Part 2, Appendix C, (1990), the violation is listed below:


10 CFR 50.72(b)(2)(ii) requires, in part, that the licensee shall notify the NRC Operations Center within four hours of any event or condition that results in manual or automatic actuation of any Engineered Safety Feature (ESF). Additionally, 10 CFR 50.73(a)(2)(iv) requires, in part, that the licensee submit a Licensee Event Report within 30 days after the discovery of any event or condition that results in manual or automatic actuation of any Engineered Safety Feature.

Contrary to the above, the licensee did not report an inadvertent automatic start of two trains of the Standby Gas Treatment system and isolation of shutdown cooling which occurred on April 26, 1990. At the time of this event, Unit 1 was shutdown for a refueling/condenser retubing outage.

This is a Severity Level IV Violation (Supplement I).

Corrective actions for the violation addressed in this Notice have been completed and the actions reviewed by NRC representatives. Therefore, no reply to the Notice is required.

FOR THE NUCLEAR REGULATORY COMMISSION

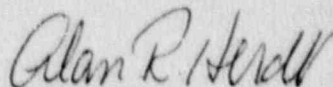

Alan R. Herdt, Chief
Reactor Projects Branch 3
Division of Reactor Projects

Dated at Atlanta, Georgia
this 2nd day of Oct. 1990