

SOUTH CAROLINA ELECTRIC & GAS COMPANY

POST OFFICE 764

COLUMBIA, SOUTH CAROLINA 29218

O. W. DIXON, JR.
VICE PRESIDENT
NUCLEAR OPERATIONS

November 19, 1982

USNRC REGION II
ATLANTA, GEORGIA
22 NOV 24 4 58

Mr. James P. O'Reilly, Director
U.S. Nuclear Regulatory Commission
Region II, Suite 3100
101 Marietta Street, N.W.
Atlanta, Georgia 30303


SUBJECT: Virgil C. Summer Nuclear Station
Docket No. 50/395
Operating License No. NPF-12
Thirty Day Written Report
LER 82-028

Dear Mr. O'Reilly:

Please find attached Licensee Event Report #82-028 for Virgil C. Summer Nuclear Station. This Thirty Day Report is required by Technical Specification 6.9.1.13.(b) as a result of entry into Action Statement (a) of Technical Specification 3.3.3.10, "Instrumentation, Loose-Part Detection Instrumentation," on October 22, 1982.

Should there be any questions, please call us at your convenience.

Very truly yours,

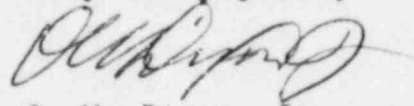

O. W. Dixon, Jr.

ARK:OWD:dwf
Attachment

cc: V. C. Summer
T. C. Nichols, Jr.
G. H. Fischer
O. W. Dixon, Jr.
H. N. Cyrus
H. T. Babb
D. A. Nauman
M. B. Whitaker, Jr.
W. A. Williams, Jr.
O. S. Bradham
R. B. Clary
M. N. Browne

A. R. Koon
H. Radin
Site QA
C. L. Ligon (NSRC)
G. J. Braddick
J. L. Skolds
J. B. Knotts, Jr.
B. A. Bursey
I&E (Washington)
Document Management Branch
INPO Records Center
NPCF
File

8211290648 821119
PDR ADOCK 05000395
S PDR

OFFICIAL COPY
IE 22

Mr. James P. O'Reilly
LER No. 82-028
Page Two
November 19, 1982

DETAILED DESCRIPTION OF EVENT

On October 22, 1982, the Plant entered Mode 2 for initial criticality with the Loose-Part Detection System inoperable with respect to Technical Specification 3.3.3.10. (Specification 3.0.4 is not applicable.)

PROBABLE CONSEQUENCES

There were no adverse consequences resulting from this event. Even though modifications were being performed, the system was in operation and functional.

CAUSE(S) OF THE OCCURRENCE

Modifications were being performed on the Loose-Part Monitoring System that were not complete at the time the Plant entered Mode 2. Therefore, the applicable surveillances had not been performed.

IMMEDIATE CORRECTIVE ACTIONS TAKEN

The modifications were completed on the system, and the applicable Technical Specification surveillance tests were performed on November 9, 1982. After a time period of system operating observation, the system was returned to operable status on November 19, 1982.

ACTION TAKEN TO PREVENT RECURRENCE

With the exception of the Technical Specification required surveillances, the licensee plans no further actions.