

LICENSEE EVENT REPORT (LER)

FACILITY NAME (1) EDWIN I. HATCH, UNIT II	DOCKET NUMBER (2) 0 5 0 0 0 3 6 6	PAGE (3) 1 OF 0 1
--	--------------------------------------	----------------------

TITLE (4)  
SURVEILLANCE PERFORMED AT THE INCORRECT FREQUENCY

EVENT DATE (5)			LER NUMBER (6)			REPORT DATE (7)			OTHER FACILITIES INVOLVED (8)		
MONTH	DAY	YEAR	YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	MONTH	DAY	YEAR	FACILITY NAMES		DOCKET NUMBER(S)
0 9	0 1	8 4	8 4	0 2	0 0	0 9	2 8	8 4			0 5 0 0 0
0 5 0 0 0											

OPERATING MODE (9) 2	THIS REPORT IS SUBMITTED PURSUANT TO THE REQUIREMENTS OF 10 CFR § (Check one or more of the following) (11)									
POWER LEVEL (10) 0 0 1	<input type="checkbox"/> 20.402(b)	<input type="checkbox"/> 20.406(c)	<input type="checkbox"/> 50.73(a)(2)(iv)	<input type="checkbox"/> 73.71(b)						
	<input type="checkbox"/> 20.406(a)(1)(i)	<input type="checkbox"/> 50.38(c)(1)	<input type="checkbox"/> 50.73(a)(2)(v)	<input type="checkbox"/> 73.71(c)						
	<input type="checkbox"/> 20.406(a)(1)(ii)	<input type="checkbox"/> 50.38(c)(2)	<input type="checkbox"/> 50.73(a)(2)(vi)	OTHER (Specify in Abstract below and in Text, NRC Form 366A)						
	<input type="checkbox"/> 20.406(a)(1)(iii)	<input checked="" type="checkbox"/> 50.73(a)(2)(ii)	<input type="checkbox"/> 50.73(a)(2)(viii)(A)							
	<input type="checkbox"/> 20.406(a)(1)(iv)	<input type="checkbox"/> 50.73(a)(2)(iii)	<input type="checkbox"/> 50.73(a)(2)(viii)(B)							
<input type="checkbox"/> 20.406(a)(1)(v)	<input type="checkbox"/> 50.73(a)(2)(iii)	<input type="checkbox"/> 50.73(a)(2)(x)								

LICENSEE CONTACT FOR THIS LER (12)

NAME	TELEPHONE NUMBER
T. L. Elton, Acting Superintendent of Regulatory Compliance	9 1 2 3 6 7 T 7 8 5 4

COMPLETE ONE LINE FOR EACH COMPONENT FAILURE DESCRIBED IN THIS REPORT (13)

CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO NPRDS	CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO NPRDS

SUPPLEMENTAL REPORT EXPECTED (14)

<input type="checkbox"/> YES (If yes, complete EXPECTED SUBMISSION DATE)	<input checked="" type="checkbox"/> NO	EXPECTED SUBMISSION DATE (15) MONTH:    DAY:    YEAR:
--	--	--

ABSTRACT (Limit to 1400 spaces, i.e., approximately fifteen single-space typewritten lines) (16)

On 09/01/84 at approximately 0930 CDT, plant personnel determined that the frequency at which containment atmosphere grab samples surveillance was being performed was incorrect. These samples had been taken every 24 hours (since the sampling began on 08/30/84 at approximately 1000 CDT); however, they should have been taken every 4 hours per a Confirmatory Order dated 07/08/83.

On 08/30/84, the Drywell Iodine Fission Product Monitor became inoperable. At this time, the shift supervisor assigned a grab sample surveillance frequency of every 24 hours per the requirements of Tech. Specs. Section 3.4.3.1, ACTION; however, this had been superceded by a Confirmatory Order dated 07/08/83 which requires a grab sample frequency of every 4 hours.

The responsible personnel realize the importance and significance of their actions, and no further corrective action is required.

8410150326 840928  
PDR ADOCK 05000366  
S PDR

LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

FACILITY NAME (1)  EDWIN I. HATCH, UNIT II	DOCKET NUMBER (2)  0   5   0   0   0   3   6   6	LER NUMBER (6)			PAGE (3)	
		YEAR 8   4	SEQUENTIAL NUMBER -   0   2   8	REVISION NUMBER -   0   0	OF	2

TEXT (If more space is required, use additional NRC Form 366A's) (17)

On 09/01/84 at approximately 0930 CDT, plant personnel determined that the frequency at which containment atmosphere grab samples surveillance was being performed was incorrect. These samples had been taken every 24 hours (since the sampling began on 08/30/84 at approximately 1000 CDT); however, they should have been taken every 4 hours per a Confirmatory Order dated 07/08/83.

On 08/30/84 at approximately 1000 CDT, the Drywell Iodine Fission Product Monitor became inoperable. At this time, the shift supervisor assigned a grab sample surveillance frequency of every 24 hours per the requirements of Tech. Specs. section 3.4.3.1, ACTION; however, this had been superceded by a Confirmatory Order dated 07/08/83 which requires a grab sample frequency of every 4 hours.

The 24 hour sampling frequency was assigned due to personnel error. The Confirmatory Order had been issued on 07/08/83 by the NRC's due to indications in the recirculation pipe. When this event occurred, the unit was starting-up following replacement of the recirculation pipe.

The responsible personnel realize the importance and significance of their actions, and no further corrective action is required.

Georgia Power Company  
Post Office Box 439  
Baxley, Georgia 31513  
Telephone 912 367-7781  
912 537-9444



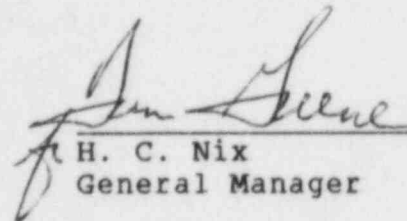
Edwin I. Hatch Nuclear Plant

September 28, 1984  
GM-84-854

PLANT E. I. HATCH  
Licensee Event Report  
Docket No. 50-366

United States Nuclear Regulatory Commission  
Document Control Desk  
Washington, D. C. 20555

Attached is Licensee Event Report No. 50-366/1984-028. This report is required by 10CFR 50.73(a)(2)(i).

  
H. C. Nix  
General Manager

JCE  
HCN/TLE/vlz

xc: R. J. Kelly  
R. E. Conway  
J. T. Beckham, Jr.  
P. D. Rice  
K. M. Gillespie  
Superintendent of Regulatory Compliance  
R. D. Baker  
Control Room  
Document Control

IE22  
||