

**Northeast  
Nuclear Energy**

Rope Ferry Rd. (Route 156), Waterford, CT 06385  
 Millstone Nuclear Power Station  
 Northeast Nuclear Energy Company  
 P.O. Box 128  
 Waterford, CT 06385-0128  
 (203) 447-1791  
 Fax (203) 444-4277  
 The Northeast Utilities System

**RE: Technical Specification 3.3.3.7.b**  
 November 9, 1995  
 MP-95-332

U. S. Nuclear Regulatory Commission  
 Document Control Desk  
 Washington, DC 20555

References: Facility Operating License No. DPR--65  
 Docket No. 50-336

This letter forwards the Special report required pursuant to Millstone Unit 2 Technical Specification 3.3.3.7.b, "Fire Detection Instrumentation." This report identifies that the fire alarm system for the Intake structure has been out of service for greater than 14 days due to troubleshooting maintenance required to locate and repair intermittent alarms.

The event is being reported in accordance with Technical Specification 6.9.2.f and Technical Specification 3.3.3.7.b. There were no safety consequences resulting from this event because the plant complied with the Action "a" of Technical Specification 3.3.3.7. Technical Specification 3.3.3.7 requires establishing a fire watch patrol within one hour to inspect affected areas once per hour.

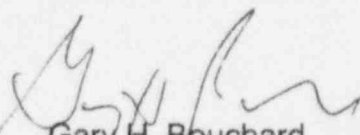
The cause of the intermittent alarms was isolated to a particular faulty detector. This detector has been replaced and associated work has been completed. The fire detection system for the Intake structure was returned to service on October 13, 1995.

We trust you find this information satisfactory.

Very truly yours,

NORTHEAST NUCLEAR ENERGY COMPANY

FOR: Donald B. Miller, Jr.  
 Senior Vice President - Millstone Station

  
 BY: Gary H. Bouchard  
 Director - Millstone Unit 2

DBM:ljs

cc: T. T. Martin Region 1 Administrator  
 P. D. Swetland, Senior Resident Inspector, Millstone Unit Nos. 1, 2, and 3  
 G. S. Vissing, NRC Project Manager, Millstone Unit No. 2

*IF 22  
 10*

9511170086 951109  
 PDR ADDCK 05000336  
 S PDR