

LICENSEE EVENT REPORT (LER)

FACILITY NAME (1) Callaway Plant Unit 1 DOCKET NUMBER (2) 050004813 PAGE (3) 1 OF 02

TITLE (4) Inadvertent Engineered Safety Features Actuations

| EVENT DATE (5) | | | LER NUMBER (6) | | | REPORT DATE (7) | | | OTHER FACILITIES INVOLVED (8) | | |
|---|-----|------|----------------|-------------------|-----------------|-----------------|-----|------|-------------------------------|--|------------------|
| MONTH | DAY | YEAR | YEAR | SEQUENTIAL NUMBER | REVISION NUMBER | MONTH | DAY | YEAR | FACILITY NAMES | | DOCKET NUMBER(S) |
| 10 | 27 | 84 | 84 | 057 | 00 | 11 | 21 | 84 | | | 05000 |
| <p>THIS REPORT IS SUBMITTED PURSUANT TO THE REQUIREMENTS OF 10 CFR §. (Check one or more of the following) (11)</p> | | | | | | | | | | | |

| | | | | | |
|-----------------------|-------------------|------------------|---|---------------------|--|
| OPERATING MODE (9) 1 | 20.402(b) | 20.406(c) | X | 50.73(a)(2)(iv) | 73.71(b) |
| POWER LEVEL (10) 0119 | 20.406(a)(1)(i) | 50.36(e)(1) | | 50.73(a)(2)(v) | 73.71(e) |
| | 20.406(a)(1)(ii) | 50.36(e)(2) | | 50.73(a)(2)(vi) | OTHER (Specify in Abstract below and in Text, NRC Form 365A) |
| | 20.406(a)(1)(iii) | 50.73(a)(2)(i) | | 50.73(a)(2)(vii)(A) | |
| | 20.406(a)(1)(iv) | 50.73(a)(2)(ii) | | 50.73(a)(2)(vii)(B) | |
| | 20.406(a)(1)(v) | 50.73(a)(2)(iii) | | 50.73(a)(2)(ix) | |

LICENSEE CONTACT FOR THIS LER (12) NAME: Michael E. Taylor - Superintendent, Operations TELEPHONE NUMBER: 314 676 1820

COMPLETE ONE LINE FOR EACH COMPONENT FAILURE DESCRIBED IN THIS REPORT (13)

| CAUSE | SYSTEM | COMPONENT | MANUFACTURER | REPORTABLE TO NRPDS | CAUSE | SYSTEM | COMPONENT | MANUFACTURER | REPORTABLE TO NRPDS |
|-------|--------|-----------|--------------|---------------------|-------|--------|-----------|--------------|---------------------|
| X | S/J | F/C | W120 | N | | | | | |

SUPPLEMENTAL REPORT EXPECTED (14) YES (If yes, complete EXPECTED SUBMISSION DATE) X NO EXPECTED SUBMISSION DATE (15)

ABSTRACT (Limit to 1400 spaces, i.e., approximately fifteen single-space typewritten lines) (16)

On 10/27/84 a Reactor Trip, Feedwater Isolation (FWIS), Auxiliary Feedwater Actuation (AFAS), and Steam Generator Blowdown Isolation (SGBDIS) occurred as a result of a low level in steam generator (S/G) "A." The required ESF equipment performed as designed during the incident.

The low S/G level occurred during the transfer of feedwater flow from the Main Feedwater (MFW) Bypass Control Valve to the MFW Control Valve. A blown fuse left the MFW Control Valve closed while the bypass valve was being closed, thus resulting in a low S/G level.

The plant was stabilized via plant procedures and the fuse replaced. The pertinent feedwater system procedure was revised to prevent similar incidents.

There was no damage to plant equipment or release of radioactivity as a result of this incident. At no time was the public health or safety threatened.

8412030329 841121
PDR ADDOCK 05000483
S PDR

IE 22
1/1

LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

| | | | | | | |
|--|-------------------------------------|----------------|-------------------|-----------------|----------|----|
| FACILITY NAME (1) Callaway Plant Unit 1 | DOCKET NUMBER (2) 0500048384 | LER NUMBER (6) | | | PAGE (3) | |
| | | YEAR | SEQUENTIAL NUMBER | REVISION NUMBER | | |
| | | 84 | 057 | 010 | 02 | OF |

TEXT: If more space is required, use additional NRC Form 365A's (17)

At 0350 CDT on 10/27/84, a Reactor Trip, Feedwater Isolation (FWIS), Auxiliary Feedwater Actuation (AFAS), and Steam Generator Blowdown Isolation (SGBDIS) occurred as a result of a low level in steam generator (S/G) "A." The plant was in Mode 1 and at 19% Reactor Power at the time of the trip. The ESF equipment performed as designed.

General Operating Procedure OTG-ZZ-00003, Plant Startup Less Than or Equal to 5% to 20% Power, requires S/G feedwater flow to be transferred from the Main Feedwater (MFW) Supply Bypass Flow Control Valves to the MFW Supply Flow Control Valves via Normal Operating Procedure OTN-AE-00001, Feedwater System. Per OTN-AE-00001, Rev. 1, the closed MFW Control Valves were placed in automatic control and the MFW Bypass Control Valves were manually closed. With feedwater flow decreasing as the MFW Bypass Valves were closing, the MFW Control Valves automatically opened to provide feedwater flow.

On 10/27/84 the operators were in the process of transferring feedwater flow during a plant startup. A blown fuse in fuse block LAEK06A de-energized air solenoids which kept MFW Flow Control Station AE-FK-0510 (Westinghouse Electric Corp., Model No. 7300 M/A) from automatically opening S/G "A" MFW Control Valve, AE-FCV-0510. S/G "A" MFW Bypass Control Valve AE-FCV-0550 had been approximately 60% closed without the automatic opening of AE-FCV-0510. S/G "A" level decreased, but AE-FCV-0550 could not be opened in a sufficient amount of time to maintain level in S/G "A." A low level in S/G "A" resulted and the Reactor Trip, FWIS, AFAS, and SGBDIS occurred at 0350.

Emergency Operating Procedures E-0, Reactor Trip or Safety Injection, and ES-0.1, Reactor Trip Recovery, were performed satisfactorily and the plant stabilized. The fuse was replaced, Reactor Trip Breakers closed, and normal feedwater restored. This plant startup was the first which required transferring flow to the MFW Control Valves. The time at which the fuse blew is unknown. The MFW Control Valves were operated successfully on 7/28/84 per Operations Surveillance Procedure OSP-AE-V02CS, MFW Control Valve Mode 5 Operability.

To prevent recurrence of this incident, OTN-AE-00001, Rev. 2, was issued on 11/13/84 to change the method of transferring feedwater flow to the MFW Control Valves. The MFW Control Valves are now manually opened while the MFW Bypass Control Valves automatically close to maintain S/G level. No further problems have been experienced similar to this incident.

There was no damage to plant equipment or release of radioactivity as a result of this incident. At no time did this event pose a threat to the public health or safety.

Previous occurrences: none

UNION ELECTRIC COMPANY
CALLAWAY PLANT

MAILING ADDRESS:
P. O. BOX 620
FULTON, MO. 65251

November 21, 1984

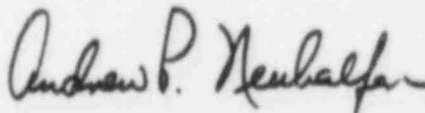
U. S. Nuclear Regulatory Commission
Document Control Desk
Washington, DC 20555

ULNRC-983

DOCKET NUMBER 50-483
CALLAWAY PLANT UNIT 1
FACILITY OPERATING LICENSE NPF-30
LICENSEE EVENT REPORT 84-057-00
INADVERTENT ENGINEERED SAFETY FEATURES ACTUATIONS

Gentlemen:

The enclosed Licensee Event Report is submitted pursuant to 10 CFR 50.73(a)(2)(iv) concerning inadvertent Engineered Safety Features actuations.

for


S. E. Miltenberger
Manager, Callaway Plant

MET/WRR/JWK/drs
Enclosure

cc: Distribution attached

IE22
7/1

cc distribution for ULNRC-983

Mr. James G. Keppler
Regional Administrator
Office of Inspection & Enforcement
U.S. Nuclear Regulatory Commission
Region III
799 Roosevelt Road
Glen Ellyn, IL 60137

American Nuclear Insurers
c/o Dottie Sherman, Library
The Exchange Suite 245
270 Farmington Aveune
Farmington, CT 06032

Records Center
Institute of Nuclear Power Operations
Suite 1500
1100 Circle 75 Parkway
Atlanta, GA 30339

NRC Resident Inspector
Missouri Public Service Commission
D. F. Schnell
J. F. McLaughlin
J. E. Davis (Z40LER)
D. W. Capone/R. P. Wendling
F. D. Field
R. L. Powers
A. C. Passwater/D. E. Shafer/D. J. Walker
G. A. Hughes
W. R. Robinson (QA Record)
M. E. Taylor
J. M. Price
R. A. McAleenan
L. K. Robertson (470)(NSRB)
Merlin Williams, Wolf Creek
SEM Chrono
3456-0021.6
3456-0260
Z40ULNRC
G56.37
N. Date