



*ITT Grinnell Corporation*  
*Executive Offices*  
*260 West Exchange Street*  
*Providence, Rhode Island 02901*  
*(401) 831-7000*

CERTIFIED MAIL - RETURN RECEIPT

September 26, 1985

Director, Office of Inspection  
and Enforcement  
U. S. Nuclear Regulatory Commission  
Washington, DC 20555

Dear Sir:

This letter provides a Part 21 report of a potential safety concern ITT Grinnell has under consideration. This report is preliminary because we do not have at this time enough information to know whether ITT Grinnell is required to file this report.

ITT Grinnell furnished to Northern States Power (NSP) four snubbers to replace four non-ITT Grinnell snubbers. The hydraulic cylinders for the ITT Grinnell snubbers, including the bearings, were furnished by Chicago Fluid Power, Roto Thrust Division.

The concern is that one bearing for use on one of the replacement snubbers has been reported to contain a hairline crack approximately 3 1/2 inches long on the ball.

The snubber is designed for use on NSP's Prairie Island Plant as replacement for the installed snubbers. A total of only four such replacement snubbers have been provided by ITT Grinnell. Each of the four snubbers utilize two bearings #SKF GEZ-312-ESB for a total of 8 bearings. These bearings were manufactured in Germany by SKF Industries, Inc. which has an office at 9800 McKnight Road, Pittsburgh, Pennsylvania 15237. The bearings are load rated at 1102.5 kips. The rated load of the snubbers is 900 kips.

8510010306 850926  
PDR ADOCK 05000282  
S PDR

IEI9  
/10

The four snubbers were each designed for 1000 kips load. Each snubber was successfully tested by ITT Grinnell at 1000 kips. No crack was observed by ITT Grinnell after these tests and before delivery, and we have no basis for believing that the crack existed before delivery.

The above numbered bearing has not been utilized in any other snubber furnished by ITT Grinnell to NSP or to any other customer.

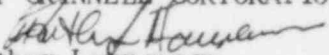
After delivery and prior to completion of installation of this snubber by NSP this bearing was visually examined by NSP personnel who observed the hairline crack and reported it to ITT Grinnell by telephone. An ITT Grinnell employee was immediately sent to the NSP site to visually verify the existence of the crack. NSP personnel reported to ITT Grinnell that they visually examined the other seven bearings in the four snubbers and saw no other cracks.

Chicago Fluid Power has been kept abreast of the situation. SKF Industries has also been informed by telephone of this crack. SKF Industries indicated during that telephone conversation that this crack is unique.

ITT Grinnell is attempting to have the bearing returned to it so that the bearing may be returned to SKF Industries for examination and evaluation.

ITT Grinnell will provide the NRC with a further report on this matter as soon as significant new information becomes available.

If you have any questions, please contact Mr. E. Beffa or myself at the above number.

Very truly yours,  
ITT GRINNELL CORPORATION  
  
Arthur Laurensen  
Corporate Quality Assurance  
Manager

AL:tar  
CC: Gerald Gore, NSP  
D. L. Henry, SKF Industries  
R. Mills, Chicago Fluid Power  
7864L