



Westinghouse
Electric Corporation

Power Generation
Group

Steam Turbine Division
Lester Branch Box 9175
Philadelphia Pennsylvania 19113

July 26, 1978

Mr. Robert O. McClintock, Chief
Materials Radiological Protection Section
U.S. Nuclear Regulatory Commission
Region 1
631 Park Avenue
King of Prussia, Pa. 19406

Dear Mr. McClintock:

Following are the corrective actions we have taken as a result of the inspection (30-6109/78-01 and 30-11713/78-01) of our radiographic facilities made by Messrs. F. Costello and J. Kinneman on June 30, 1978:

Appendix
Item A

All exposure devices have been physically secured, either by locking them in steel containers or by chaining them to structures which are anchored to the wall of the laboratory. We are having additional steel containers constructed for added security. These are scheduled for completion by August 25, 1978.

Radiographers have been instructed to secure the exposure devices at all times when they are not in use. We are in full compliance with 10CFR34.24 at the present time.

Item B

All exposure devices have been checked in accordance with the procedures in Item 7 of our "Operating and Emergency Procedures". Preventative maintenance will be performed and logged at three-month intervals. We are presently in compliance with the procedures.

781222 0120

Item C

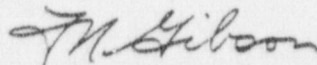
A leak test was performed on our Cobalt 60 source - Serial No. C-811 - on June 19, 1978. Leak tests will be performed on the source at intervals of six months or less. We are in compliance with 10CFR34.25(b) at the present time.

Item D

Paragraph 8 of our "Operating and Emergency Procedures" has been modified to include the requirements of 10CFR20.205(c)(1). These procedures will be followed when source changers are received. We will be in compliance with 10CFR20.205(c)(1) upon receipt of the next changer we receive from our supplier.

We will be glad to supply any additional information you may require.

Very truly yours,


F. N. Gibson
Manager, NDE