

LICENSEE EVENT REPORT (LER)

FACILITY NAME (1) South Texas, Unit 1										DOCKET NUMBER (2) 0 5 0 0 0 4 9 8				PAGE (3) 1 OF 0 3							
TITLE (4) Control Room Ventilation Actuation to Recirculation Mode Due to a Toxic Gas Monitor Detecting Paint Fumes																					
EVENT DATE (5)			LER NUMBER (6)				REPORT DATE (7)			OTHER FACILITIES INVOLVED (8)											
MONTH	DAY	YEAR	YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	MONTH	DAY	YEAR	FACILITY NAMES				DOCKET NUMBER(S)								
1	1	1	3	8	7	8	7	0	1	4	0	1	1	2	8	7	0	5	0	0	0
OPERATING MODE (9)		THIS REPORT IS SUBMITTED PURSUANT TO THE REQUIREMENTS OF 10 CFR 5. (Check one or more of the following) (11)																			
4		20.402(b)				20.406(c)				<input checked="" type="checkbox"/> 50.73(a)(2)(iv)				73.71(b)							
POWER LEVEL (10)		20.405(a)(1)(i)				50.36(c)(1)				50.73(a)(2)(v)				73.71(c)							
01010		20.405(a)(1)(ii)				50.36(c)(2)				50.73(a)(2)(vi)				OTHER (Specify in Abstract below and in Text, NRC Form 366A)							
20.405(a)(1)(iii)				50.73(a)(2)(ii)				50.73(a)(2)(viii)(A)													
20.406(a)(1)(iv)				50.73(a)(2)(iii)				50.73(a)(2)(viii)(B)													
20.406(a)(1)(v)				50.73(a)(2)(iii)				50.73(a)(2)(ix)													
LICENSEE CONTACT FOR THIS LER (12)																					
NAME Charles Ayala - Supervising Licensing Engineer										TELEPHONE NUMBER											
										AREA CODE											
										511 12 917121-18161218											
COMPLETE ONE LINE FOR EACH COMPONENT FAILURE DESCRIBED IN THIS REPORT (13)																					
CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO NRC		CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO NRC											
E																					
SUPPLEMENTAL REPORT EXPECTED (14)												EXPECTED SUBMISSION DATE (15)		MONTH	DAY	YEAR					
<input type="checkbox"/> YES (If yes, complete EXPECTED SUBMISSION DATE)												<input checked="" type="checkbox"/> NO									

ABSTRACT (Limit to 1400 spaces, i.e., approximately fifteen single space typewritten lines) (16)

At approximately 2326 hours on November 12, 1987 with Unit 1 in Mode 4 (initial startup testing), an auto-actuation of the Control Room Ventilation System to the recirculation mode occurred as a result of a toxic gas monitor detecting high levels of toxic gas. The control room ventilation actuation to recirculation mode is an Engineered Safety Feature (ESF). The Control Room Operators verified the recirculation mode damper lineup and initiated an investigation of the event. The investigation determined that the event was caused by the toxic gas monitor detecting paint fumes containing hydrocarbons which have infrared absorption characteristics similar to anhydrous ammonia and ammonia hydroxide. These are toxic gases of concern at the STPEGS. Painting of a newly installed door proved to be the source of the fumes. Painting in the vicinity has been suspended until corrective actions are implemented. The painting control procedure will be revised to include a toxic gas evaluation before painting is allowed within the Control Room Air Inlet Chase. This event represents a breakdown in the management control process.

8712310031 871218
PDR ADOCK 05000498
S DCD

NL.LER87014

LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

U.S. NUCLEAR REGULATORY COMMISSION

APPRI: LER-CMR-NR-3780-0104

EXPIRE: 5/31/89

FACILITY NAME (1)	DOCKET NUMBER (2)	LER NUMBER (6)			PAGE (3)
		YEAR	SEQUENTIAL NUMBER	PRECEDENCE NUMBER	
South Texas, Unit 1	0 5 0 0 0 4 9 8	8 7	0 1 4	0 1	0 2 OF 0 3

TEXT (If more space is required, use additional NRC Form 365A's) (17)

DESCRIPTION OF OCCURRENCE:

At approximately 2326 hours on November 12, 1987 with the Unit in Mode 4, an auto-actuation of the control room ventilation to recirculation mode occurred as a result of toxic gas monitor XE-9326 detecting high levels of toxic gas. The control room operators verified that the Control Room Ventilation System damper lineup occurred correctly and initiated an investigation to determine the cause of the event.

The immediate investigation identified that the source of the gas was fumes from painting activities in the vicinity of the monitor.

The Toxic Gas Monitoring System is a non-Class 1E system which upon detection of any one of several toxic gases provides input to the ESF and causes the Control Room Ventilation System to automatically go into a recirculation mode.

The NRC was notified of an ESF actuation pursuant to 10CFR50.72(b)(2)(ii) at 0047 hours on November 13, 1987. The safety system functioned as designed as shown by verification of the system dampers and equipment status immediately following the event. There were no adverse safety consequences as a result of the event since the Unit had not yet gone critical or produced any radioactivity. The paint fumes detected were not detrimental to the Control Room Operators.

CAUSE OF OCCURRENCE:

The investigation determined that the root cause of the event was that the administrative controls for use of paints and solvents did not address the potential for these substances to cause toxic gas monitor actuations, and did not impose adequate controls. A contributing factor was two open pipe penetrations between room 501B and the air inlet chase for the Control Room and Electrical Auxiliary Building Ventilation System. These penetrations provided a path for the paint fumes to be drawn into the inlet air chase and subsequently into the toxic gas monitors.

The fumes from the painting activity contained mineral spirit which is a mixture of aliphatic and aromatic hydrocarbons. Various alkane or alkene groups of hydrocarbons possess medium to high absorption of the same frequency of infrared light as anhydrous ammonia and ammonia hydroxide. These are toxic gases of concern at the STPEGS. The absorption of the infrared light by the mineral spirits caused the toxic gas monitors to alarm and initiate the auto-actuation of the control room ventilation to the recirculation mode.

NL.LER87014

LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

U.S. NUCLEAR REGULATORY COMMISSION

APPROVED OMB NO. 3150-0104

EXPIRES 8/31/85

FACILITY NAME (1) South Texas, Unit 1	DOCKET NUMBER (2) 0500049887	LER NUMBER (8)			PAGE (3)		
		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER			
		87	014	01	03	OF	03

TEXT (If more space is required, use additional NRC Form 366A's) (17)

CORRECTIVE ACTION:

Painting was suspended in the vicinity of the monitors until corrective actions are implemented. To prevent recurrence of this event, the following corrective actions are being taken:

1. Warning signs on doors leading into the air intake chase to warn personnel of the effect of paints and solvents on the Control Room Ventilation System have been installed.
2. The open penetrations in Room 501B will be sealed to prevent air from passing between the return air plenum and the air intake chase. The penetrations will be sealed by December 31, 1987.
3. The plant procedure controlling solvents, paints and painting processes will be revised to include controls on the use of paint solvents in areas connecting to the Control Room ventilation air supply. This procedure will be revised by January 15, 1988.

ADDITIONAL INFORMATION:

Although the South Texas Project has had a number of control room ventilation actuations to recirculation mode, this event is unique as to its root cause.

No other occurrences of similar events have occurred at the South Texas Project; however, there has been a task force formed to evaluate the design of the Toxic Gas Monitoring System.

NL.LER87014

The Light company

Houston Lighting & Power

P.O. Box 1700 Houston, Texas 77001 (713) 228-9211

December 18, 1987
ST-HL-AE-2452
File No.: G26
10CFR50.73

U. S. Nuclear Regulatory Commission
Attention: Document Control Desk
Washington, DC 20555


South Texas Project Electric Generating Station
Unit 1

Docket Nos. STN 50-498
Revision 01 to the Licensee Event Report
Regarding a Control Room Ventilation
Actuation to Recirculation Mode Due to
a Toxic Gas Monitor Detecting Paint Fumes

Reference: HL&P letter ST-HL-AF-2440, dated December 12, 1987, from
G. E. Vaughn to USNRC Document Control Desk submitting
LER 87-014 (Revision 0).

The referenced Licensee Event Report (LER No. 87-014) was submitted with
a typographical error in the text, "Corrective Action", section. The
Corrective Action item number 2 of this section should read
"...December 31, 1987." in lieu of "...December 31, 1988". The attached
revision 01 to the report corrects this error.

If you should have any questions on this matter, please contact
Mr. C.A. Ayala at (512) 972-8628.

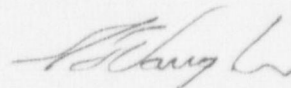

G. E. Vaughn
Vice President
Nuclear Plant Operations

GEV/JB/dlf

Attachment: Revision 01 to the Licensee Event Report Regarding a
Control Room Ventilation Actuation to
Recirculation Mode Due to a Toxic Gas Monitor
Detecting Paint Fumes.

IE22
11

Houston Lighting & Power Company

ST-HL-AE-2452
File No.: G26
Page 2

cc:

Regional Administrator, Region IV
Nuclear Regulatory Commission
611 Ryan Plaza Drive, Suite 1000
Arlington, TX 76011

N. Prasad Kadamby, Project Manager
U. S. Nuclear Regulatory Commission
7920 Norfolk Avenue
Bethesda, MD 20814

Dan R. Carpenter
Senior Resident Inspector/Operations
c/o U. S. Nuclear Regulatory Commission
P. O. Box 910
Bay City, TX 77414

J. R. Newman, Esquire
Newman & Holtzinger, P.C.
1615 L Street, N.W.
Washington, DC 20036

R. L. Range/R. P. Verret
Central Power & Light Company
P. O. Box 2121
Corpus Christi, TX 78403

R. John Miner (2 copies)
Chief Operating Officer
City of Austin Electric Utility
721 Barton Springs Road
Austin, TX 78704

R. J. Costello/M. T. Hardt
City Public Service Board
P. O. Box 1771
San Antonio, TX 78296

Rufus S. Scott
Associate General Counsel
Houston Lighting & Power Company
P. O. Box 1700
Houston, TX 77001

Revised 11/20/87