NRC-038

Submitted: May 31, 2013

RATING FACTOR 3.C.: CONTROL BOARD OPERATIONS, MANUAL CONTROL

1. Examiner comment on 303 form p. 21 of 32, related to Scenario 7, Event 3

A. FACTUAL SEQUENCE OF EVENTS

- -During the simulator scenario, event 3 was initiated at time 07:54:54 with a TE-0130 failure low.
- -As a result of this failure, TV-0130 will throttle shut, raising the actual Letdown Heat Exchanger outlet temperature.
- -At time 07:55:46, examiner noted that Carla appeared to diagnose the failure correctly. The examiner also noted that carla did not open any ARPs.
- -At time 08:00:30, referenced CVCS system P&IDs.
- -At time 08:01:54, Carla pointed to the controller, looked at stated, "the only thing we can do is call C&T to get the TE fixed."
- -At time 08:02:45, directed Carla to take manual control of TIC-0130 and monitor VCT outlet temperature.
- -When Carla initially attempted to manipulate the controller, she incorrectly pressed the "up arrow" button instead of the "down arrow" button.
- -Shortly thereafter, told Carla that the controller raises and lowers temperature, it does not open and close the valve.
- -At time 08:05:00, the LETDOWN TEMP DEMIN DIVERT alarm cleared.
- -During this sequence of events (approximately 10 minutes of simulator runtime), Carla was physically located in front of the panel with the TE-0130 controller (slightly to the "left" of the main OATC control station). As noted in a previous comment (related to scenario 7, event 1, rating factor 3.a.), P. Capehart and M. Bates held a discussion pertaining to the long duration of time that elapsed without Carla walking back to the OATC station to monitor key reactor plant parameters.

During post-scenario follow-up questions, the examiner asked what procedure guidance was used to manually control TE-130? Carla looked through the LETDOWN HX OUTLET HI TEMP ARP. During this discussion, Carla stated that she had initially pressed the "up" button, and then subsequently pressed the "down" button. The examiner asked "walk me through the diagnosis and the plant response?" Carla stated that demand goes down, causing flow through the heat exchanger to lower, it's a reverse-acting controller.

Submitted: May 31, 2013



The examiner downgraded the applicant in rating factor 3.c, which is related to the ability to take manual control of automatic functions. This competency is different from manual rod control or PORV valve operation (other errors placed in different rating factors) in that a plant parameter is controlled in automatic under normal circumstances.

The examiner considered that there were elements of rating factor 1.b demonstrated during this event. Rating factor 1.b. relates to the applicant's "...actions demonstrate an UNDERSTANDING of how the PLANT, SYSTEMS, and COMPONENTS OPERATE AND INTERACT (including set points, interlocks, and automatic actions)?" More specifically, during this event, Carla specifically stated, "there is nothing else we can do but call C&T...," demonstrating a lack of understanding that the controller <u>could</u> be operated in a manual mode. Furthermore, the SRO was then required to instruct the applicant in the correct operation of the controller, which demonstrated that the applicant had a deficiency in understanding <u>how</u> the controller operated.

•	michael Mark Phil 9.1 SRO: Ro: Carla Smith Bop:
07-24:14	Can take shift They correctly discosed DO navagements
27:48	5-c: 422 Steps
71 33	C-I' we have trup to , we can bown tempoh (migrate)
32:10	J-12: \$ 8-12 Male
36: 22	J-C'-435teps
3/ 43: 47	alans
576	R-J: Failed Stan Flow Int Takes mound central of MFRV & Prop
44.24	Q-J: 100 A's dene
52i4	- P: MIP Speed Central esterned to auto
52:36	R-J-R: Place MFRU #4 to auto.
3	
	C-5' LID Demi Diant & High LD Temp
55:46	C-T'. TI-130 " Certaily appeared & hot Carla mark aut charres"
	3 running the ARP. Carlo did not open any ARPs.
	RiPulls PIDS J-47:CR, ug etc.
01:54	C-S: The only thing we can do is contact 4T to get TE fixed.
02:45	5-C. Take manual central of TIC and munity Tong? The TIT
	J-C': That raises & laws ting it does
	not open & close value (The centralles F/ X)
	is reverse acting to she did not know how to
prise -	operate 14.) Carla actually set it at 51%. (X)
005:00	1/5 Thish Deup Denis Direct Cheered.
ж	
11 37	R-J' NSCW Cirling Fam 1 Tripped
	R-c4: AD to Bke J-R-C/7: bet W/B Tengs whileant Aleve.
	-3-

	03/27/2012
	POST SCHNEID PES
	(a) 11 -7.4°1°
	Q: Walk me Husesh Tout Tref Contral, (Phil -2,4%) Q: What was expertent? = 20F
1	Q'. What was ever long? = 20F
	Q' telet une you max 1? 'Slo Failure 1.8°F
	then 2,3 F
	E3: TE-0130 Failure
	2 Q: What procedure gendance was read to manually
land Human	house central TV-030? Touthall pressed up but
Di bran Di	trooper Central TV-030. Instrully pressed up, but
2 14 Com	a: Walking the delagnesis of plant response.
69 7017	The wast me show the constructs a plant tesponse.
On Ruck A	Denaid goes down causing How Mrogh H.X. to Come
	Reverse acting controlls.
	ES: PT-456 Failure:
	a' what were your In Op Actions.
	She went the wrong direction on PORV H.S.
	B' what actions did you take. (Master P Central in auto?)
	Springs were still in Mount - so no impact.
	Q'i labort the souther and come water when Wanter toute
	Q' What the perither were spray values in when Master to auto:
	200.4
	a: Was the BV insperable? Not aperable due to not auto closing.
	Q' What was your ? Gated Boat?
1,000 partitions	
-	
	Q' Wall me thru A & Control. What was your max At.
*	what war you tonget? ± 3 AFD Warts (0.2) Started 60-0.7
	Did tarset thous - 9 toyed at 0.2.

Appendix D	Required Operator Actions	Form ES-D-2

Op-Test No.: <u>2012-301</u> Scenario No.: 7

Event No.: 3

Time	Position	Applicant's Action or Behavior
	OATC	SUBSEQUENT OPERATOR ACTION
	0757 -	Attempt to balance charging and letdown flow.
	C	2. WHEN letdown temperature is restored, return 1-TV-0129 to the DEMIN position.
	L	IF instrument or equipment failure has occurred, initiate maintenance as required.
		COMPENSATORY OPERATOR ACTIONS
	<÷A	NONE The Note to examiner: The OATC can control cooling flow to the VCT using TV-0130. For 120 gpm letdown flow, this is normally set to 51% (note dry erase board on SS throne). It is expected the OATC will take manual control of TV-0130 to control cooling flow.
	0905	End of 17007-F04 actions. 40 11. Tag Alan Clear
	OATC	ALB07-B04 actions (LTDN HX HI TEMP DEMIN DIVERT)
		PROBABLE CAUSE
		Low Auxiliary Component Cooling Water (ACCW) flow through the Letdown Heat Exchanger.
		Low ACCW flow through the Excess Letdown Heat Exchanger or Seal Water Heat Exchanger if aligned to the Volume Control Tank (VCT).

Op-Test No.: 2012-301

Scenario No.: 7

Event No.: 3

Time	Position	Applicant's Action or Behavior
	OATC	Diagnose TE-0130 has failed low.
		Symptoms / alarms:
		ALB07-F04 LTDN HX HI TEMP DEMIN DIVERT ALB07-B04 (VOLUME CONTROL TANK OUTLET TEMP HI (delayed, or may not come in)
		Indications:
		 TE-0130 reading down scale low. TE-0130 red UP arrow – LIT. (indicates attempting to raise letdown temperature).
		Amber light on 1HS-129 LETDOWN TO DEMIN / VCT – LIT.
	OATC	ALB07-F04 response actions:
	,	AUTOMATIC ACTIONS:
		Letdown flow is diverted away from the Mixed Bed Demineralizers directly to the Reactor Coolant Filter.
	OATC	INITIAL OPERATOR ACTIONS
		1. Check letdown temperature on 1-TI-0130 on the QMCB. (failed)
		2. IF necessary, initiate 18007-C, "Chemical Volume Control System Malfunction". (not necessary, letdown is not lost)
		3. Check for ACCW normal operation. (TV-0130 not normal)



Scenario No.: 7

Event No.: 3


Time	Position	Applicant's Action or Behavior
	OATC	SUBSEQUENT OPERATOR ACTION
		Attempt to balance charging and letdown flow.
		WHEN letdown temperature is restored, return 1-TV-0129 to the DEMIN position.
		IF instrument or equipment failure has occurred, initiate maintenance as required.
		COMPENSATORY OPERATOR ACTIONS
		NONE
		Note to examiner: The OATC can control cooling flow to the VCT using TV-0130. For 120 gpm letdown flow, this is normally set to 51% (note dry erase board on SS throne). It is expected the OATC will take manual control of TV-0130 to control cooling flow.
		End of 17007-F04 actions.
	OATC	ALB07-B04 actions (LTDN HX HI TEMP DEMIN DIVERT)
		PROBABLE CAUSE
		Low Auxiliary Component Cooling Water (ACCW) flow through the Letdown Heat Exchanger.
		Low ACCW flow through the Excess Letdown Heat Exchanger or Seal Water Heat Exchanger if aligned to the Volume Control Tank (VCT).

lots of talk between ATC/SS ATC: there's nothing we can do with this besides call CET (pointing to controller) 07(10) SS directs ATC to manually control TC-130 and lower output to control the temperature . what procedural guidance to control TV-0130? failed low, which coursed to go shut, which rised evident by DIVERT value · TI-130, TE Accw value 40 temp. ops > controller not functioning · conduct of brobert

Op-Test No.: <u>2012-301</u> Scenario No.: 7

Event No.: 3

. . .

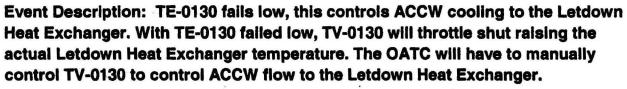

Time	Position	Applicant's Action or Behavior
	OATC	AUTOMATIC ACTIONS
		NONE
		INITIAL OPERATOR ACTIONS
		Check normal operation of ACCW and, if necessary, initiate 18022-C, "Loss of Auxiliary Component Cooling Water".
	OATC	SUBSEQUENT OPERATOR ACTIONS
	,	NOTE
		Seal water injection flow to the Reactor Coolant Pumps (RCPs) should be maintained less than 130°F.
		Monitor VCT outlet temperature using 1-TI-0116 on the QMCB.
	,	Check letdown flow using 1-FI-0132 and temperature using 1-TI-0130 on the QMCB.
		Adjust the charging or letdown flow if necessary to reduce the letdown temperature.
ė		4. Return to normal operation as soon as possible per 13006-1, "CVCS Startup and Normal Operation."
* *		IF equipment failure is indicated, initiate maintenance as required.
		COMPENSATORY OPERATOR ACTIONS
		NONE - End of 17007-B04 actions.

Submitted: May 31, 2013

Appendix D Required Operator Actions Form ES-D-2

Op-Test No.: <u>2012-301</u> Scenario No.: 7

Event No.: 3

Time	Position	Applicant's Action or Behavior		
	SS	AOP-18022-C, LOSS OF AUXILIARY COMPONENT COOLING WATER symptoms and steps.		
		Symptoms / alarms: • High temperature on any heat exchanger serviced by ACCW. Note to examiner: The SS may look at 18022-C due to the reference from ALB07-B04 if received.		
	OATC	 NOTES ACCW pumps are removed from the 4.16KV Class 1E buses following simultaneous loss of offsite power and safety injection. ACCW flow to the Seal Water Heat Exchanger is not required if RCS temperature is less than 150°F and Seal Water Heat Exchanger Return Temperature remains less than 135°F. 		

Op-Test No.: 2012-301

Scenario No.: 7

Event No.: 3

Time	Position	Applicant's Action or Behavior		
	OATC	1. Check ACCW pumps – AT LEAST ONE RUNNING. (YES)		
		2. Check ACCW SPLY HDR PRESS PI-1977 – GREATER THAN 135 PSIG. (YES)		
		3. Check if ACCW flow exists through the letdown heat exchanger. (YES)		
		• TV-0130 OPEN.		
		ALB07-D03 LTDN HX OUT HI TEMP – EXTINGUISHED.		
	OATC UO	4. Initiate the Continuous Actions Page.		
,	OATC	5. Check ACCW Surge Tank Level (IPC L2700) – GREATER THAN 20% AND STABLE OR RISING. (YES)		



Op-Test No.: 2012-301

Scenario No.: 7

Event No.: 3

Time	Position	Applicant's Action or Behavior		
	OATC	6. Check if RCPs should be stopped:		
		a. Check the following RCP parameters (using plant computer):		
	^	 Motor bearing (upper or lower radial or thrust) – GREATER THAN 195°F. 		
		Motor stator winding – GREATER THAN 311°F.		
		Seal water inlet – GREATER THAN 230°F.		
		Loss of ACCW - GREATER THAN 10 MINUTES.		
		Note to examiner: All parameters listed are met, the RCPs do NOT require stopping.		
		a. Perform the following.		
		IF any parameter limit is exceeded, THEN perform step 6.b.		
		2) Go to Step 7.		

Submitted: May 31, 2013 Mech

Appendix D Required Operator Actions Form ES-D-2



Op-Test No.: <u>2012-301</u>

Scenario No.: 7

Event No.: 3

Time	Position	Applicant's Action or Behavior		
	OATC	 7. Check RCP thermal barrier outlet valves – OPEN. (YES) HV-19051 ACCW RCP-1 THERMAL BARRIER RTN VLV HV-19053 ACCW RCP-2 THERMAL BARRIER RTN VLV HV-19055 ACCW RCP-3 THERMAL BARRIER RTN VLV HV-19057 ACCW RCP-4 THERMAL BARRIER RTN VLV HV-2041 ACCW RCPS THERMAL BARRIER RTN VLV Note to examiner: All the above listed valves are open as required. 		
	OATC	8. Check ACCW heat exchangers outlet temperature (IPC T2701) - LESS THAN 120°F. (YES)		
	OATC	 9. Check ACCW containment isolation valves – OPEN. (YES) • HV-1979 ACCW SPLY HDR ORC ISO VLV • HV-1978 ACCW SPLY HDR IRC ISOL VLV • HV-1974 ACCW RTN HDR IRC ISO VLV • HV-1975 ACCW RTN HDR ORC ISO VLV Note to examiner: All the above listed valves are open as required. 		

Submitted: May 31, 2013 Multis

Appendix D	Required Operator Actions	Form ES-D-2

Op-Test No.: 2012-301

Scenario No.: 7

Event No.: 3

Time	Position	Applicant's Action or Behavior	
	OATC	10. Check if ACCW is restored to service.	
		a. Components cooled by ACCW – TERMPERATURES RETURNING TO NORMAL. (YES)	
		b. Restore charging and letdown using 13006, CHEMICAL AND VOLUME CONTROL SYSTEM. (N/A)	
	SS	c. Return to procedure and step in effect.	
		END OF EVENT 3, proceed to EVENT 4.	

1	michael Maule Phil 9.1 SRO: Carola Smith Bop:
071 24 : 14	Cur take shift They correctly disessed DO managements
27:48	5-c: 422 Steps
71133	C-I' we have trong to, we can been tentione has (migrate)
32:10	J-R: \$ 8-12 Male
36:22	J-C'. 4 3 Steps
3/ 431 47	alons
574	R-J: Failed Str. Flew Int Takes manual central of MFRV& Rup
44:24	Q-J: 150 A's done
52:4	I P: MIP Speed Central enterned to auto
	R-J-R: Place MFRU #4 to Outs.
3,	
54152	C5: UD David Direct & High 40 Temp
	C-T: TI-130 " autaily appeared that Carla made aut alignoss"
	3 reming the APRP. Carladid not open any ARPs.
08 100 30	RiPulls PIDS J-47:CRug etc.
01:54	C-5: The only this we can do is contact 4T to get TE fixed.
02:45	5-C: Take manual central of TIC and menter Tome? To fel
	J-C': That roises & Cours tung it does
	not open & clase value. (The centralles F/ X)
	is never acting a she did not know how to
	operate 14.) Carla actually set it at 51%.
00:05:00	1/5 thick Deup Denis D'ent Churd.
11 37	R-J' NSCW Cirling Fam 1 Tripped
	R-c4: AD to Pks J-R-C4: bet W/B Tengs while ant blue.
	-16-

Appendix D	Required Operator Actions	Form ES-D-2

Op-Test No.: <u>2012-301</u> Scenario No.: 7

Event No.: 3

Time	Position	Applicant's Action or Behavior	
	OATC	SUBSEQUENT OPERATOR ACTION	
	0757 -	Attempt to balance charging and letdown flow.	
		2. WHEN letdown temperature is restored, return 1-TV-0129 to the DEMIN position.	
	L	IF instrument or equipment failure has occurred, initiate maintenance as required.	
		COMPENSATORY OPERATOR ACTIONS	
	S⇒ A	NONE The Note to examiner: The OATC can control cooling flow to the VCT using TV-0130. For 120 gpm letdown flow, this is normally set to 51% (note dry erase board on SS throne). It is expected the OATC will take manual control of TV-0130 to control cooling flow.	
	0905	End of 17007-F04 actions. 40 1. The Alan Cleard	
	OATC	ALB07-B04 actions (LTDN HX HI TEMP DEMIN DIVERT)	
		PROBABLE CAUSE	
		Low Auxiliary Component Cooling Water (ACCW) flow through the Letdown Heat Exchanger.	
		Low ACCW flow through the Excess Letdown Heat Exchanger or Seal Water Heat Exchanger if aligned to the Volume Control Tank (VCT).	