


Vogtle Unit 4 4Q/2015 Performance Summary

[Construction Action Matrix Column:](#)
[Licensee Response](#)

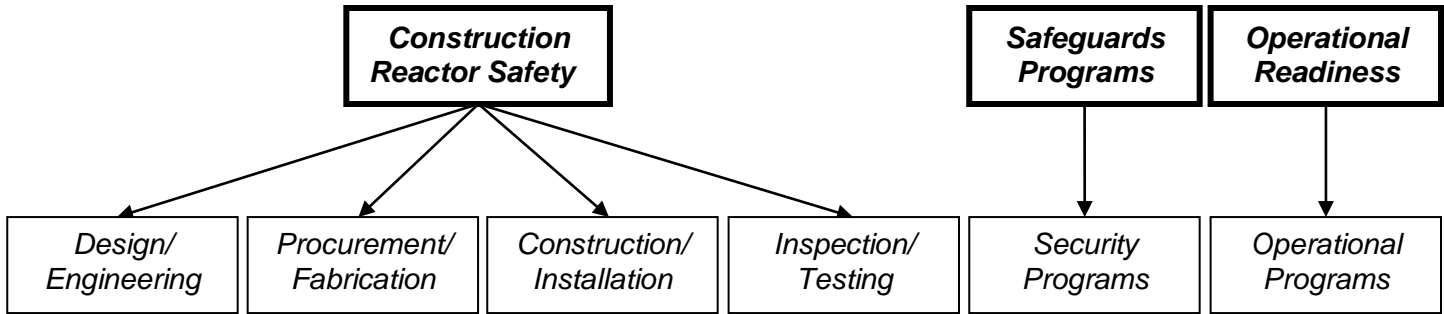

Most Significant Inspection Findings

4Q/2015	No findings this quarter	No findings this quarter	No findings this quarter	No findings this quarter	No findings this quarter	No findings this quarter
3Q/2015	No findings this quarter	No findings this quarter	No findings this quarter	No findings this quarter	No findings this quarter	No findings this quarter
2Q/2015	G	No findings this quarter	No findings this quarter	No findings this quarter	No findings this quarter	No findings this quarter
1Q/2015	No findings this quarter	No findings this quarter	G	No findings this quarter	No findings this quarter	No findings this quarter

Additional Inspection and Assessment Information

- ❖ [List of Construction Inspection Reports](#)
- ❖ [List of Construction Assessment Reports/Inspection Plans](#)

Design Engineering

Identified By: NRC

Identification Date: 06/30/2015

Significance: Green

Item Type: ITAAC Finding

Weld Allowable Stress Calculation Not in Compliance with Current Licensing Basis

Green. The inspectors identified an ITAAC finding of very low safety significance (Green) and associated non-cited violation (NCV) of Title 10 Code of Federal Regulations (CFR) Part 50, Appendix B, Criterion III, "Design Control." Southern Nuclear Operating Company (SNC), failed through their contractor Westinghouse Electric Corporation (WEC), to correctly translate design basis into specifications, drawings, procedures, and instructions to correctly translate the design basis for welded structural connections into specifications, drawings, procedures, and instructions. The licensee entered this finding in their corrective action program as condition report (CR) 10060139, Corrective Action, Prevention and Learnings (CAPAL) 100224197, and corrective action report (CAR) 2015-1597.

The inspectors determined the performance deficiency was more than minor because it represented a substantive non-conservative error in a design document that defines the technical requirements for structural welds that are important to safety. The inspectors evaluated the finding using the construction significance determination process and determined the finding was of very low safety significance (Green) because the licensee was able to demonstrate with reasonable assurance that the design function of the affected components would not be impaired by the deficiency. The finding was determined to be an ITAAC finding because it was material to the acceptance criteria of Units 3 and 4 ITAACs 760, 761, 762, and 763. The acceptance criteria of these ITAAC require that reconciliation reports, concluding the "as-built" construction conforms to the approved design, are completed for the areas associated with each ITAAC. This finding is associated with deviations from design requirements that would not have been reconciled by the licensee as required by the ITAAC. The finding had a cross-cutting aspect in the area Human Performance (Conservative Bias) because the licensee's contractor, WEC, failed to use decision making-practices that emphasized prudent choices over those that were simply allowable [H.14].

[Back to Top](#)

Procurement/Fabrication

[Back to Top](#)

Construction/Installation

Identified By: NRC

Identification Date: 03/31/2015

Significance: Green

Item Type: Construction Finding

Failure to Perform Routine Quality Control Inspections

The inspectors identified a construction finding of very low safety significance (Green) and associated non-cited violation (NCV) of 10 CFR Part 50, Appendix B, Criterion V, "Instructions, Procedures, and Drawings," for the licensee's failure to accomplish safety-related, required quality control inspections in accordance with CB&I QC inspection plan FS561-004. The licensee entered the issue in their corrective action program as condition report number 10039935.

The finding was associated with the Construction/Installation Cornerstone. The inspectors determined the performance deficiency was more than minor because the issue represented a substantive failure to

implement an adequate quality oversight function, in that these routine welding inspections were not performed by the licensee's contractor for over six months. The finding was determined to be a construction finding because it was not associated with a specific ITAAC. The inspectors determined that the finding was of very low safety significance (Green) because the finding could not be directly associated with a system or structure. This finding has a cross-cutting aspect in the area of Human Performance, Procedure Adherence because the licensee failed to ensure that individuals followed specific procedures [H.8].

[Back to Top](#)

Inspection/Testing

[Back to Top](#)

Security Programs

[Back to Top](#)

Operational Programs

[Back to Top](#)