


Vogtle Unit 4 2Q/2016 Performance Summary

[Construction Action Matrix Column:](#)
[Licensee Response](#)

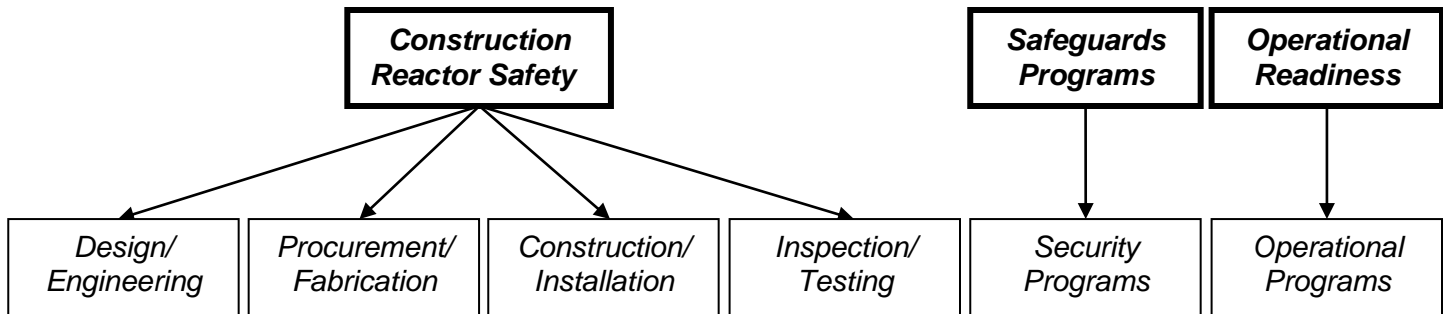

Most Significant Inspection Findings

2Q/2016	No findings this quarter	No findings this quarter	No findings this quarter	No findings this quarter	No findings this quarter	No findings this quarter
1Q/2016	G	No findings this quarter	No findings this quarter	No findings this quarter	No findings this quarter	No findings this quarter
4Q/2015	No findings this quarter	No findings this quarter	No findings this quarter	No findings this quarter	No findings this quarter	No findings this quarter
3Q/2015	No findings this quarter	No findings this quarter	No findings this quarter	No findings this quarter	No findings this quarter	No findings this quarter

Additional Inspection and Assessment Information

- ❖ [List of Construction Inspection Reports](#)
- ❖ [List of Construction Assessment Reports/Inspection Plans](#)
- ❖ [Vogtle Unit 4 Findings Archive](#)

Design Engineering

Identified By: NRC

Identification Date: 03/31/2016

Significance: Green

Item Type: ITAAC Finding

Failure to Perform AISC N690-94 Required Weld Nondestructive Examination

Green. The inspectors identified an ITAAC finding of very low safety significance (Green) and associated non-cited violation (NCV) of Title 10 of the Code of Federal Regulations (10 CFR) Part 50, Appendix B, Criterion XV, "Nonconforming Materials, Parts, or Components" for Southern Nuclear Company's (SNC) failure through their contractor Westinghouse Electric Company (WEC) to adequately review and accept nonconforming items in accordance with documented procedures. The licensee entered this finding into their corrective action program as condition reports (CR) 10180672 and 10181738.

The finding was associated with the Design / Engineering Cornerstone. The finding was considered more than minor because the performance deficiency represented a substantive failure to adequately implement a quality assurance process that rendered the quality of a structure, system, or component (SSC) indeterminate. The inspectors evaluated the finding in accordance with IMC 2519, "Construction Significance Determination Process," and determined the finding was of very low safety significance because the finding is associated with a portion of a structure (auxiliary building) assigned to the intermediate risk column of the AP1000 construction significance determination matrix and would not reasonably be expected to impact the design function of the auxiliary building. The inspectors determined that the finding represented an ITAAC finding because it was material to the acceptance criteria of VEGP Units 3 and 4 ITAAC 763, in that, if left uncorrected, the licensee may not be able to demonstrate that the acceptance criteria of these ITAAC were met. The acceptance criteria of these ITAAC require that all deviations between the as-built structures and the approved designs be reconciled to verify that the as-built structures will withstand the design basis loads without a loss of structural integrity or other safety-related functions.

The inspectors determined that the failure to adequately review and accept nonconforming items in accordance with documented procedures may have resulted in a deviation from the approved design that would not have been reconciled by the licensee. The inspectors reviewed the finding for a possible cross-cutting aspect in accordance with IMC 0613 Appendix F, "Construction Cross-Cutting Areas and Aspects," and determined the finding has a cross-cutting aspect in the Human Performance area because the licensee's contractor, WEC, failed to use decision making-practices that emphasized prudent choices over those that were simply allowable. [H.14].

[Back to Top](#)

Procurement/Fabrication

[Back to Top](#)

Construction/Installation

[Back to Top](#)

Inspection/Testing

[Back to Top](#)

Security Programs

[Back to Top](#)

Operational Programs

[Back to Top](#)