HL-16333

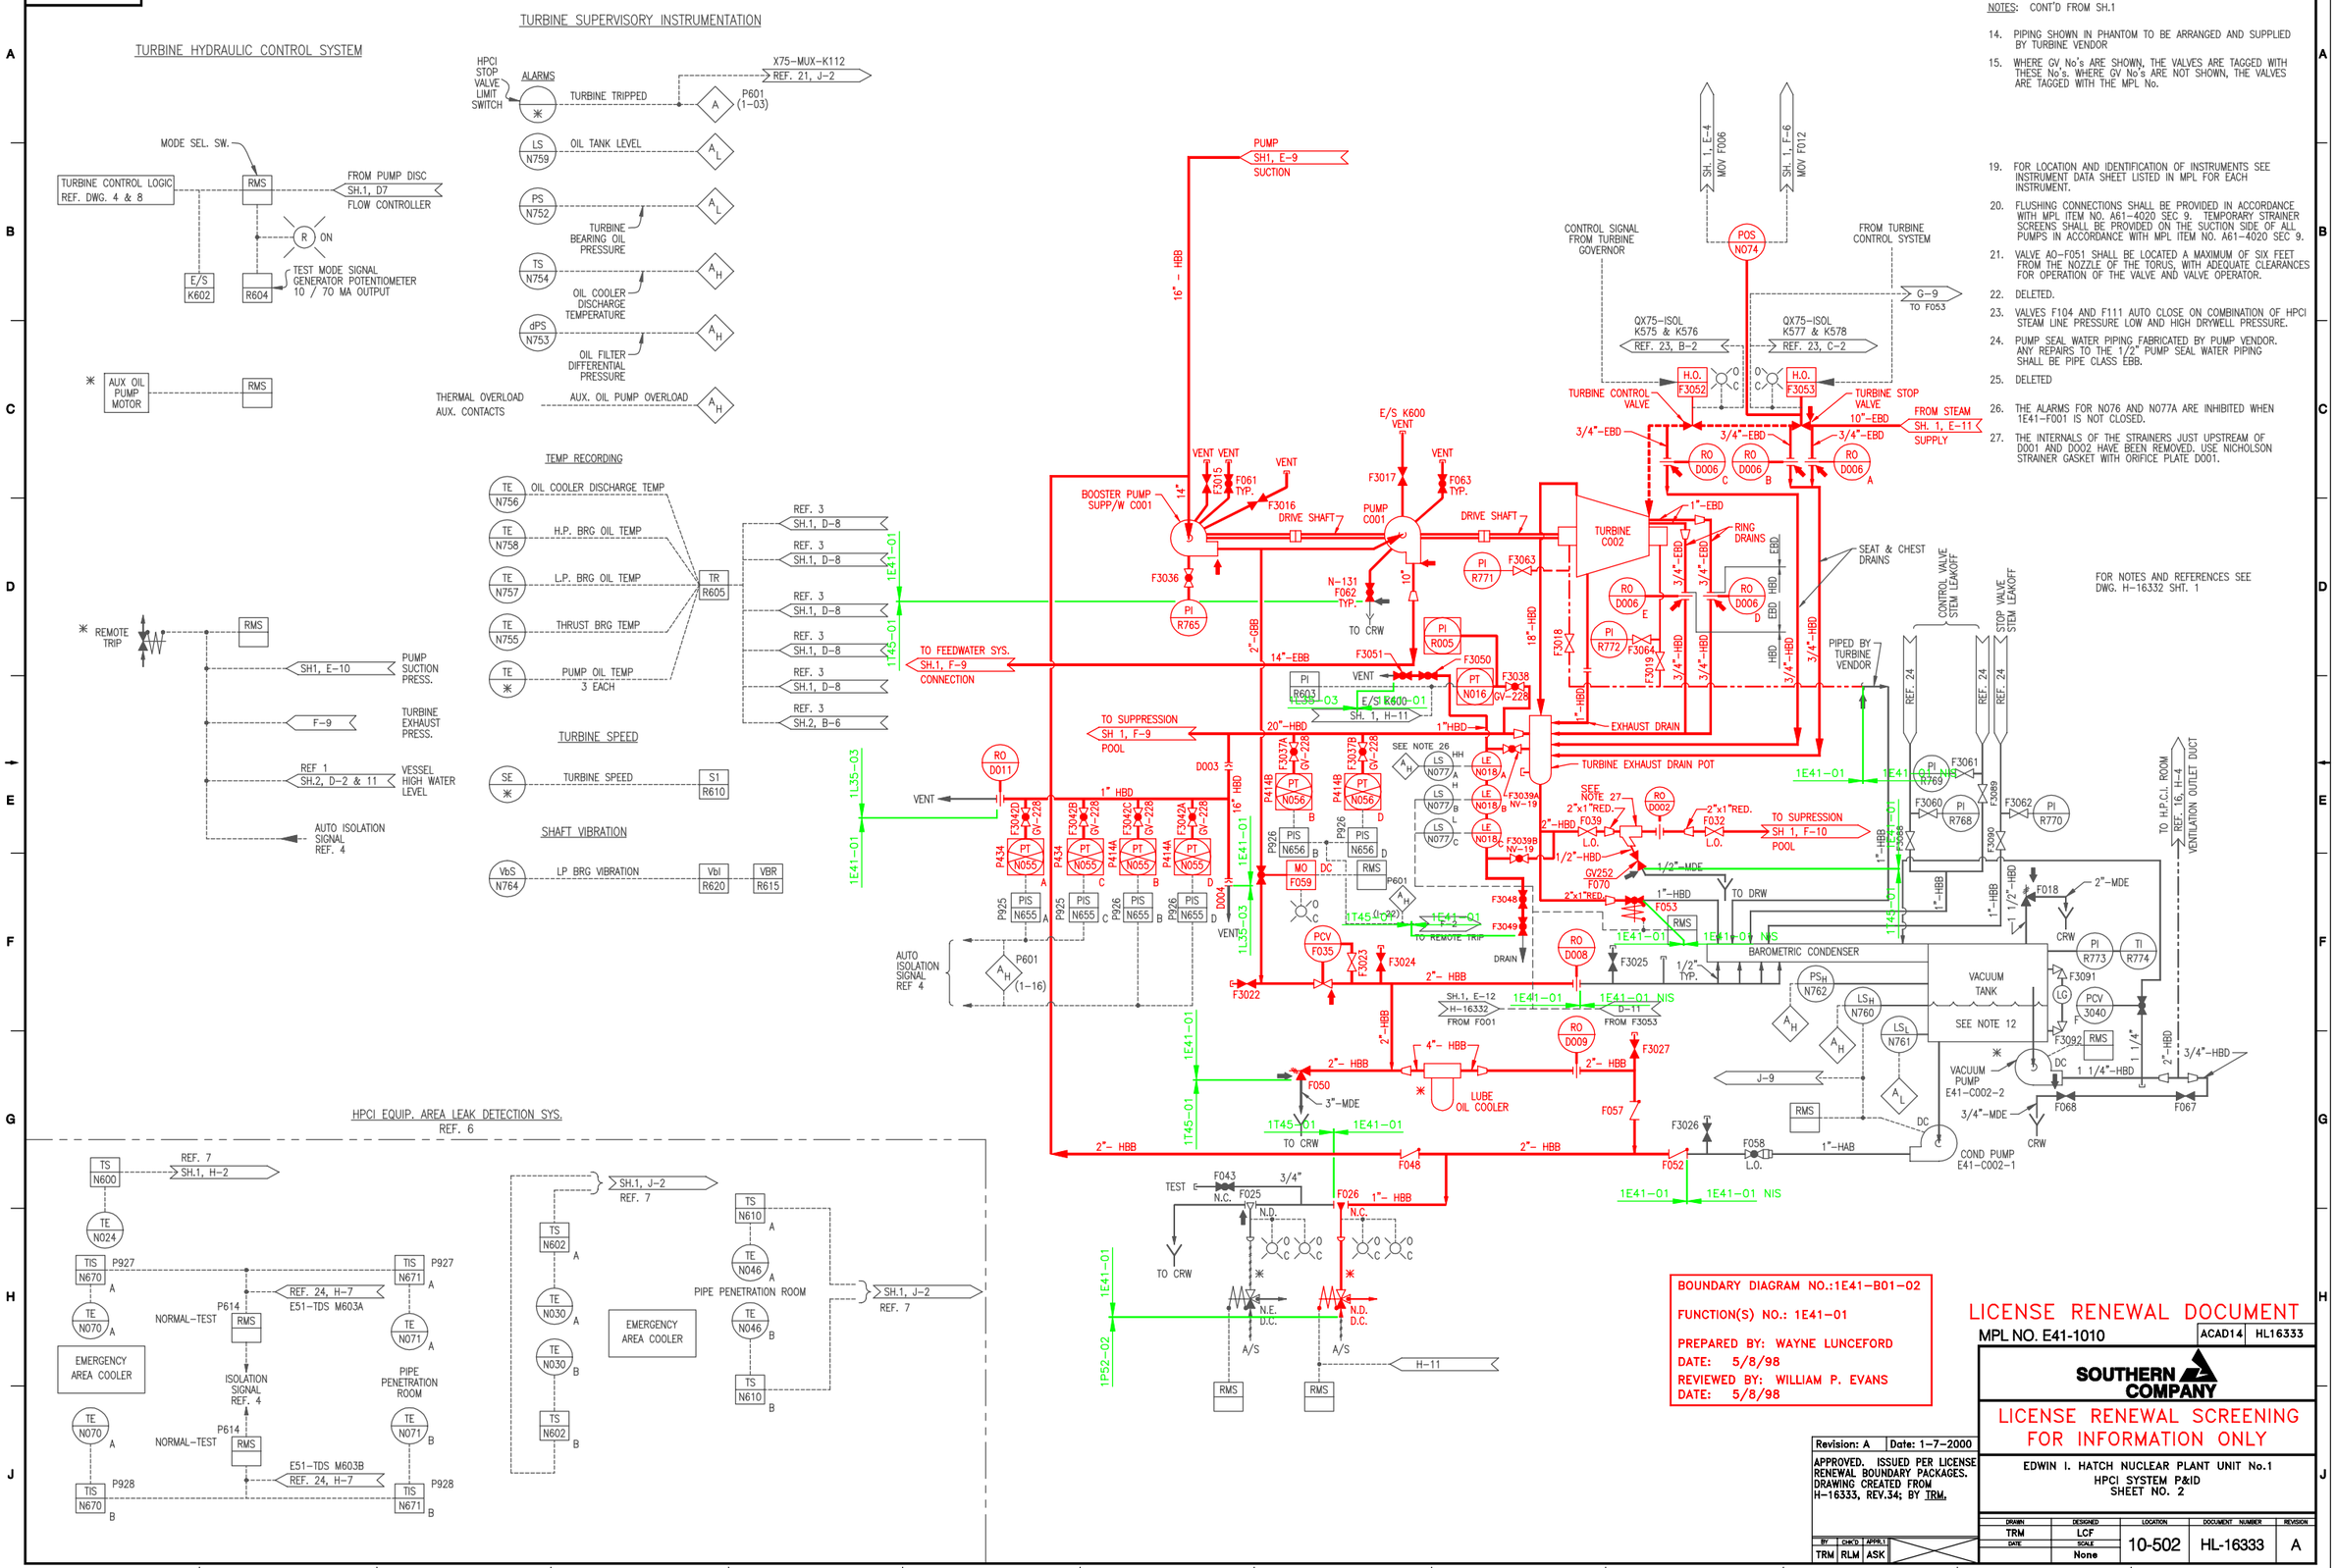

NOTES: CONT'D FROM SH.1

14. PIPING SHOWN IN PHANTOM TO BE ARRANGED AND SUPPLIED BY TURBINE VENDOR
15. WHERE GV No's ARE SHOWN, THE VALVES ARE TAGGED WITH THESE No's. WHERE GV No's ARE NOT SHOWN, THE VALVES ARE TAGGED WITH THE MPL No.
19. FOR LOCATION AND IDENTIFICATION OF INSTRUMENTS SEE INSTRUMENT DATA SHEET LISTED IN MPL FOR EACH INSTRUMENT.
20. FLUSHING CONNECTIONS SHALL BE PROVIDED IN ACCORDANCE WITH MPL ITEM NO. A61-4020 SEC 9. TEMPORARY STRAINER SCREENS SHALL BE PROVIDED ON THE SUCTION SIDE OF ALL PUMPS IN ACCORDANCE WITH MPL ITEM NO. A61-4020 SEC 9.
21. VALVE AO-F051 SHALL BE LOCATED A MAXIMUM OF SIX FEET FROM THE NOZZLE OF THE TORUS, WITH ADEQUATE CLEARANCES FOR OPERATION OF THE VALVE AND VALVE OPERATOR.
22. DELETED.
23. VALVES F104 AND F111 AUTO CLOSE ON COMBINATION OF HPCI STEAM LINE PRESSURE LOW AND HIGH DRYWELL PRESSURE.
24. PUMP SEAL WATER PIPING FABRICATED BY PUMP VENDOR. ANY REPAIRS TO THE 1/2" PUMP SEAL WATER PIPING SHALL BE PIPE CLASS EBB.
25. DELETED
26. THE ALARMS FOR N076 AND N077A ARE INHIBITED WHEN 1E41-F001 IS NOT CLOSED.
27. THE INTERNALS OF THE STRAINERS JUST UPSTREAM OF D001 AND D002 HAVE BEEN REMOVED. USE NICHOLSON STRAINER GASKET WITH ORIFICE PLATE D001.

BOUNDARY DIAGRAM NO.:1E41-B01-02

FUNCTION(S) NO.: 1E41-01

PREPARED BY: WAYNE LUNCEFORD
DATE: 5/8/98
REVIEWED BY: WILLIAM P. EVANS
DATE: 5/8/98

LICENSE RENEWAL DOCUMENT

MPL NO. E41-1010 | ACAD14 | HL16333

SOUTHERN COMPANY

LICENSE RENEWAL SCREENING FOR INFORMATION ONLY

EDWIN I. HATCH NUCLEAR PLANT UNIT No.1
HPCI SYSTEM P&ID
SHEET NO. 2

Revision: A	Date: 1-7-2000
APPROVED. ISSUED PER LICENSE RENEWAL BOUNDARY PACKAGES. DRAWING CREATED FROM H-16333, REV.34; BY TRM.	

BY	CHK'D	APPR.1
TRM	RLM	ASK

DRAWN	DESIGNED	LOCATION	DOCUMENT NUMBER	REVISION
TRM	LCF	10-502	HL-16333	A
DATE	SCALE None			