Technology Base for the ACR: FUEL CHANNELS

By Doug Rodgers, Director, Fuel Channels

Presented to US Nuclear Regulatory Commission
Office of Nuclear Reactor Regulation
September 26, 2002

AECL TECHNOLOGIES INC.

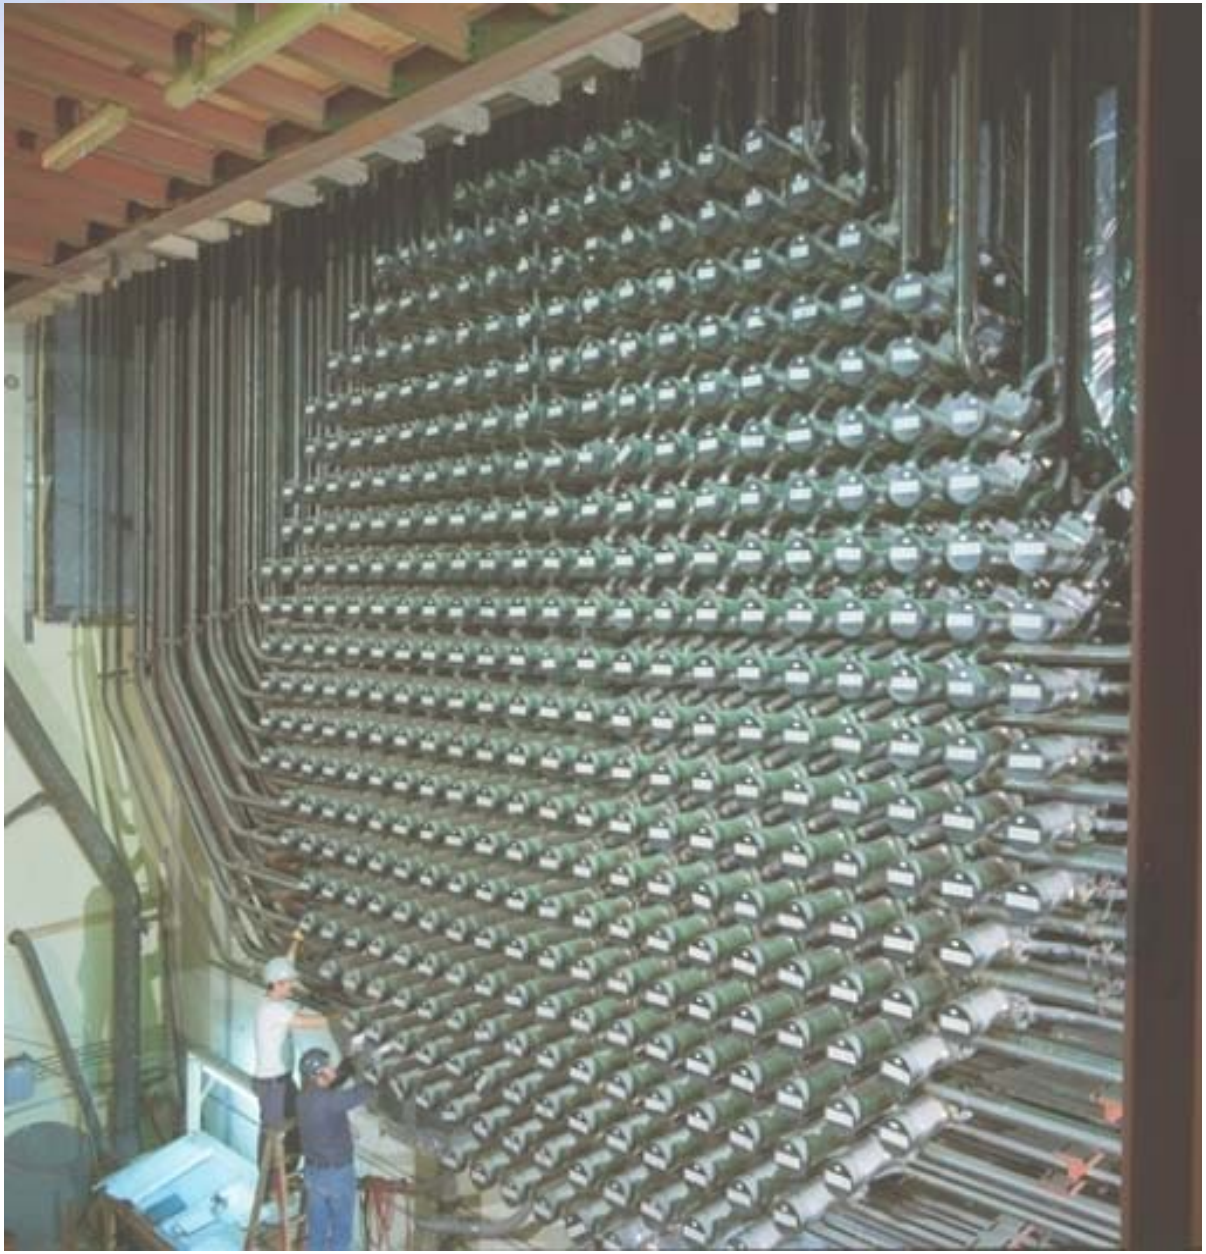

ACR FUEL CHANNEL DESIGN

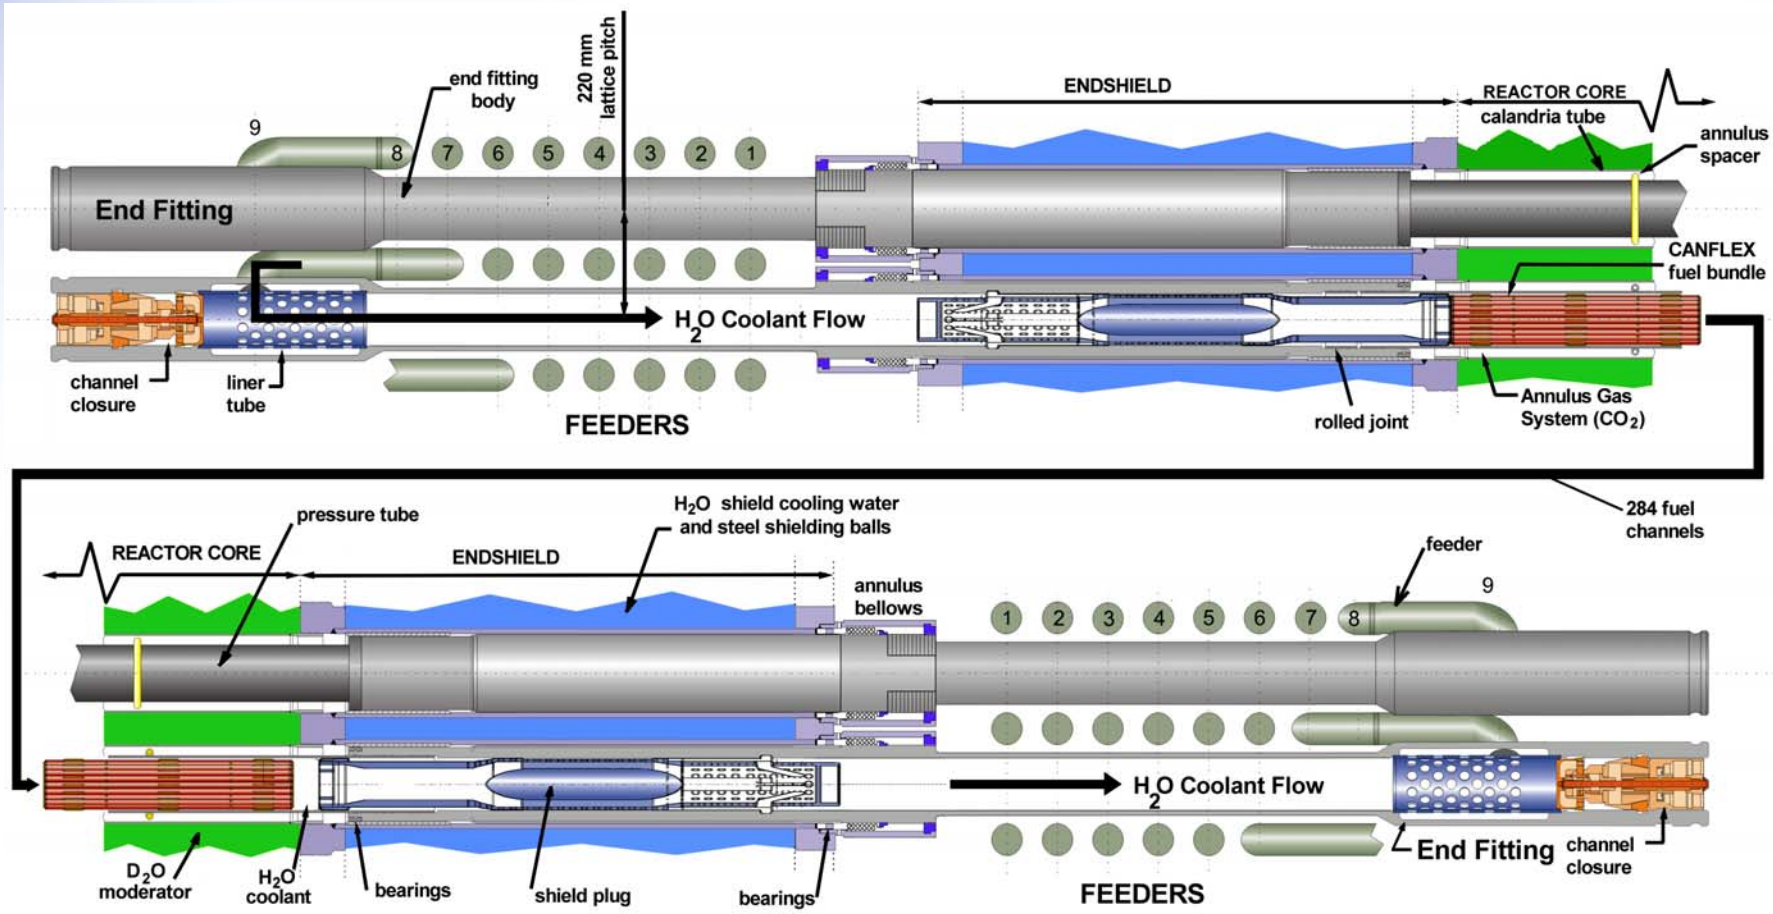

FUEL CHANNEL COMPONENTS

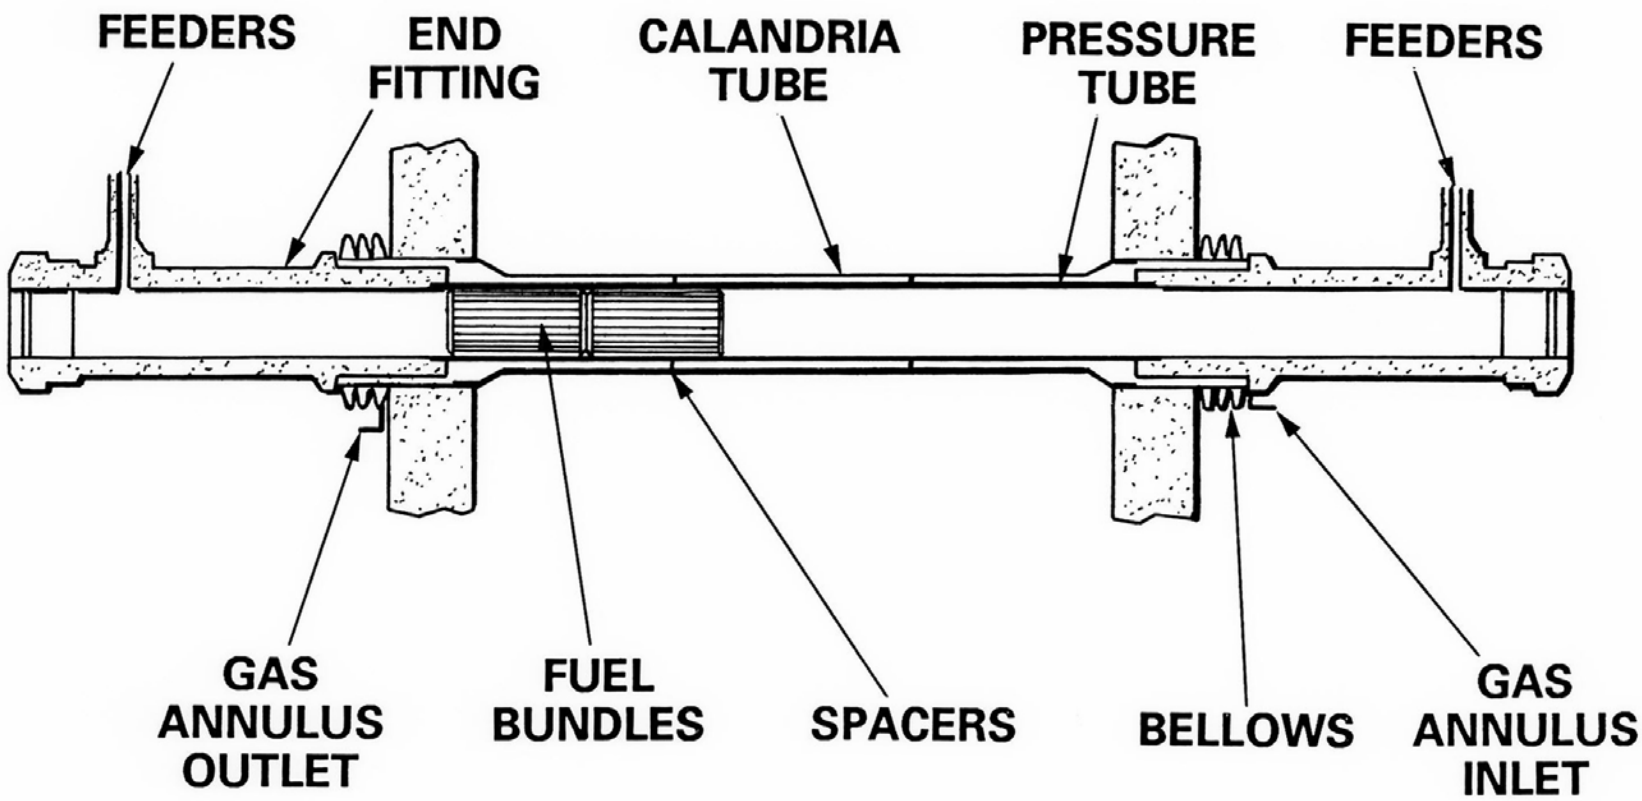

PRESSURE TUBE EVOLUTION

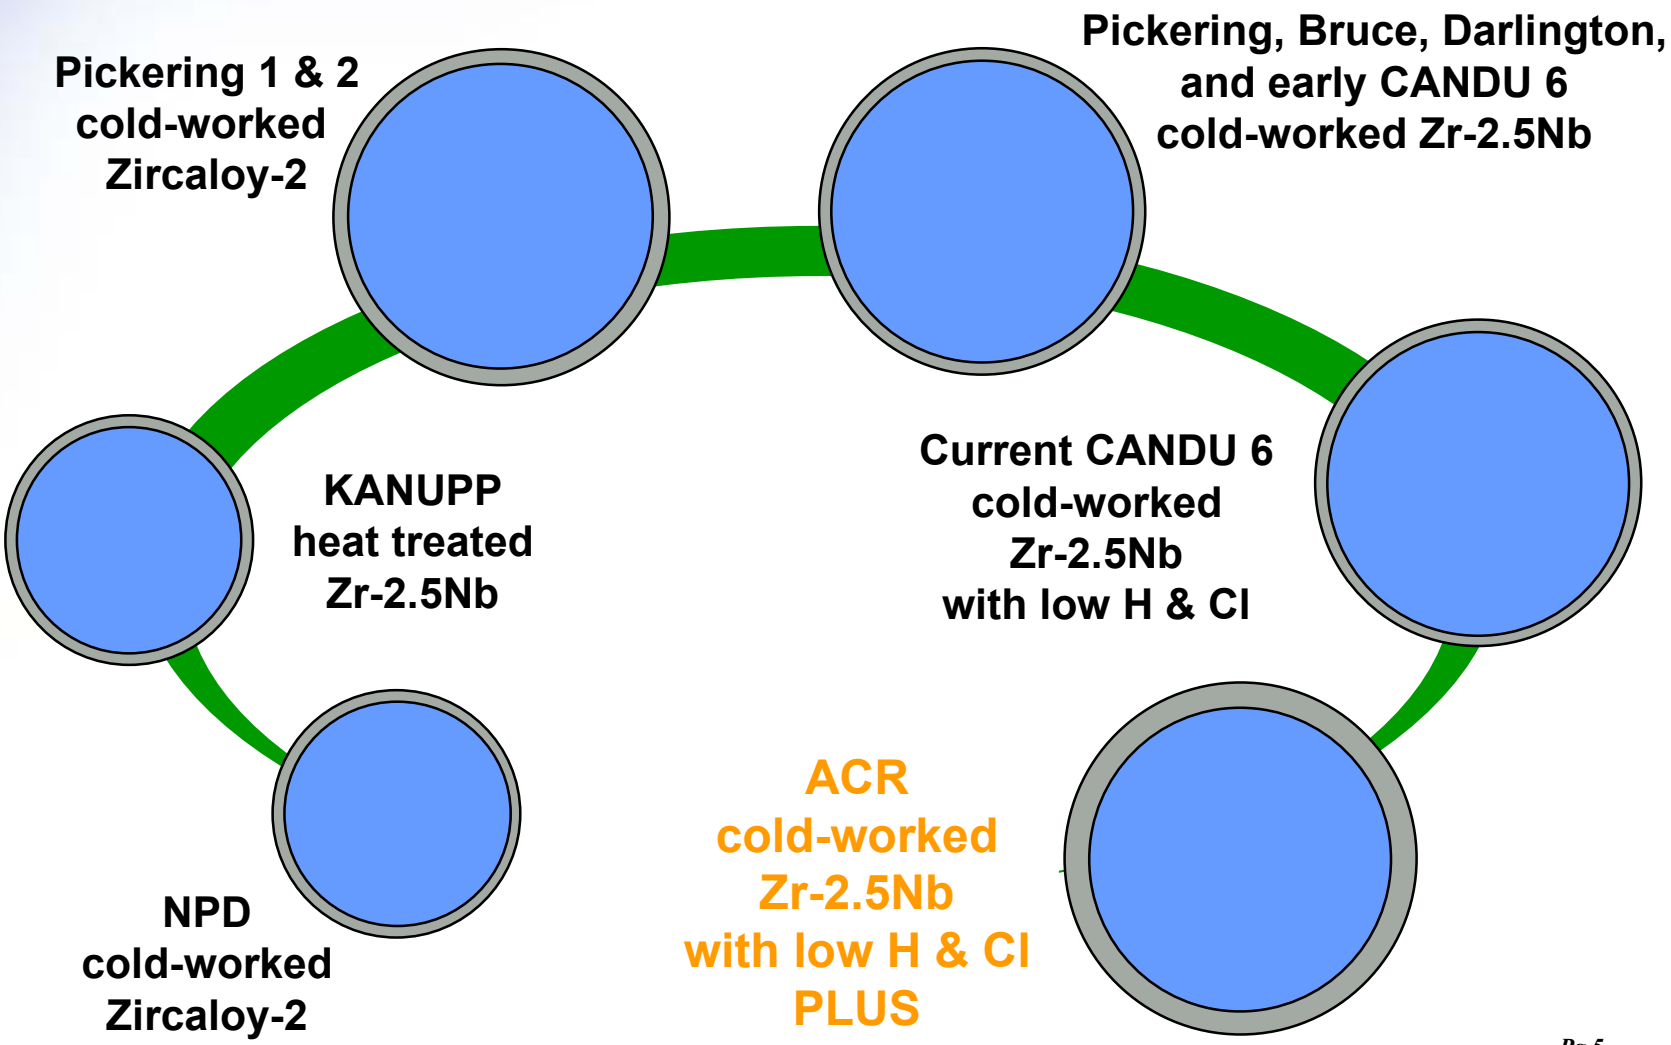

FUEL CHANNEL PERFORMANCE

- 31 CANDU reactors in 6 countries
- 208 to 480 pressure tubes per reactor
- More than 150,000 pressure tube years of equivalent full-power operation
- Only 2 pressure tube ruptures
- Less than 1 rupture per 75 thousand tube years of operation

PERFORMANCE STATISTICS

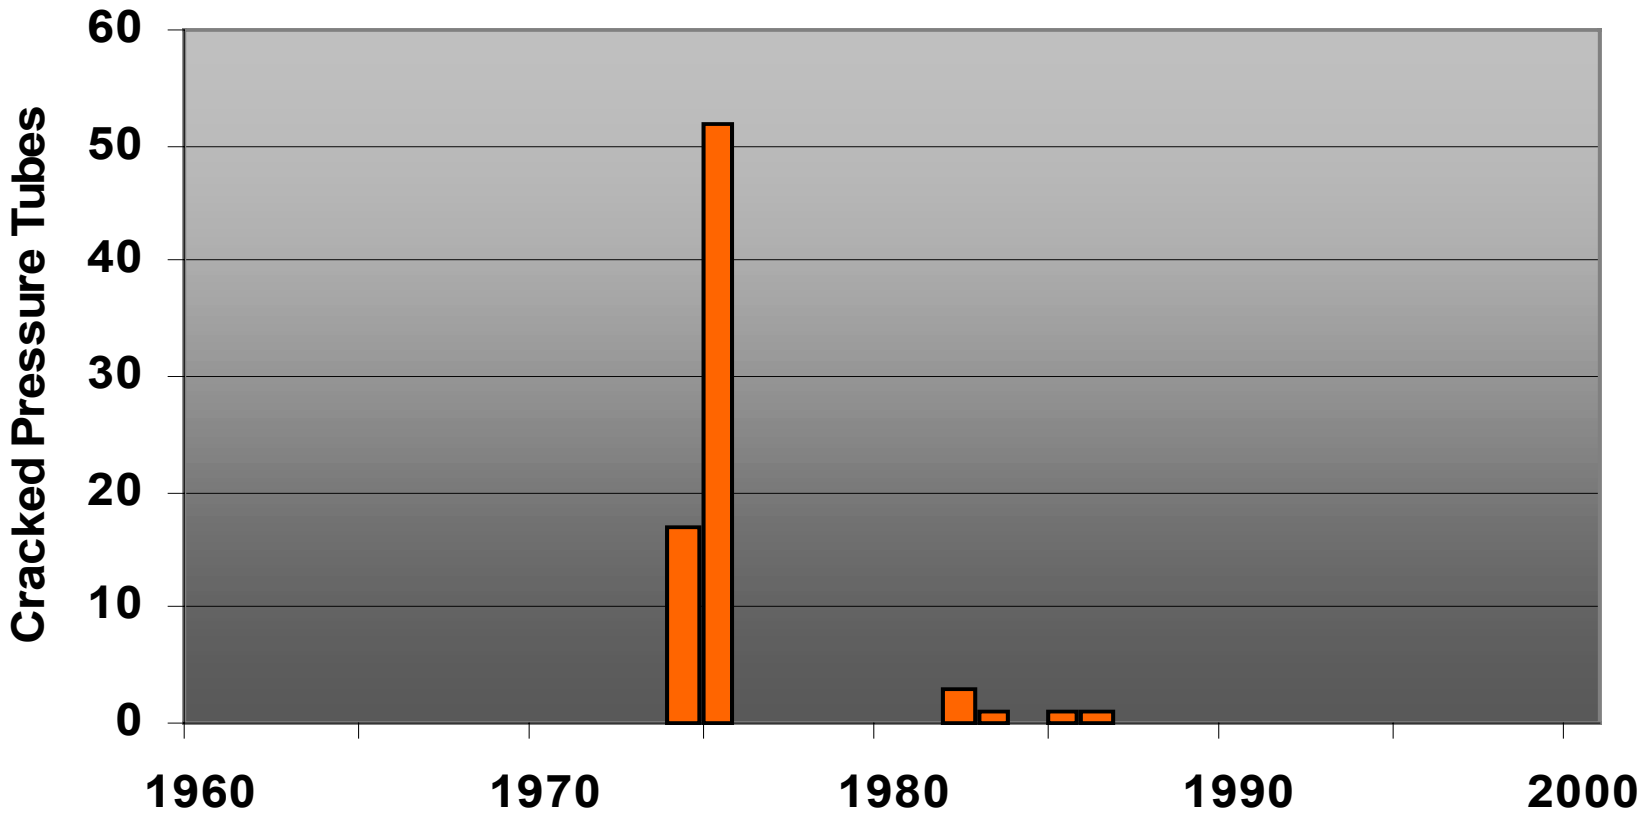

FUEL CHANNEL TECHNOLOGY

- Aging Mechanisms
- Reactor Experience
- R&D and Engineering

AGING MECHANISMS

- Delayed Hydride Cracking
- Corrosion and Hydrogen Ingress
- Dimensional Changes
- Mechanical Properties

DELAYED HYDRIDE CRACKING

- Zirconium alloys can be susceptible
- Sufficient hydrogen in the metal must be available
- Need a driving force for diffusion, e.g. a stress gradient
- Anisotropic behavior
- When conditions are met, there is the potential for Delayed Hydride Cracking (DHC)

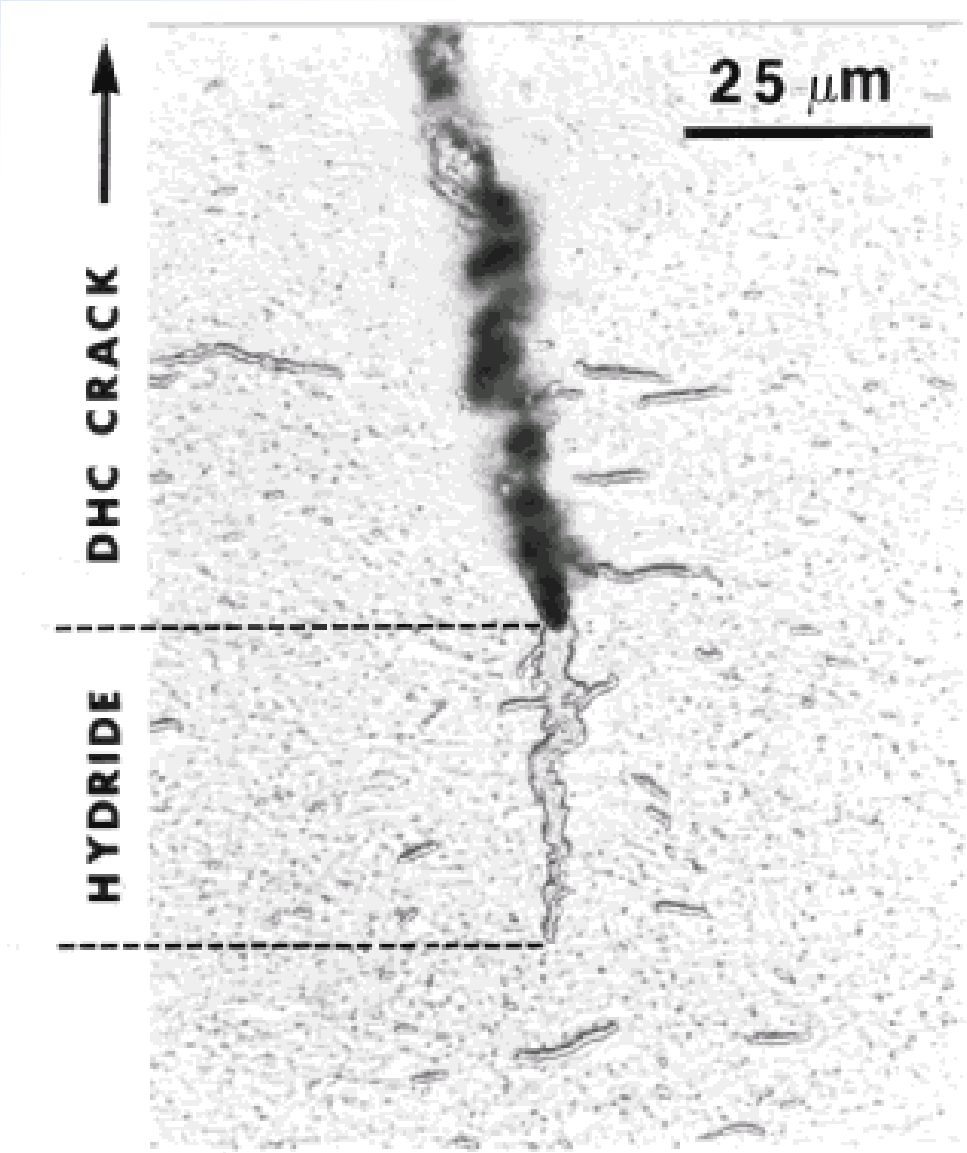
DHC CRACK
HYDRIDE
25 μm

IN-REACTOR EXPERIENCE

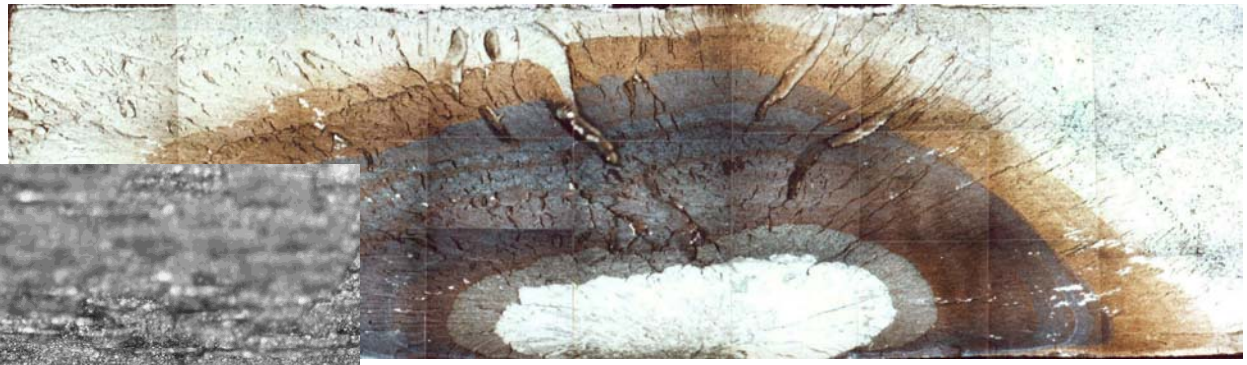

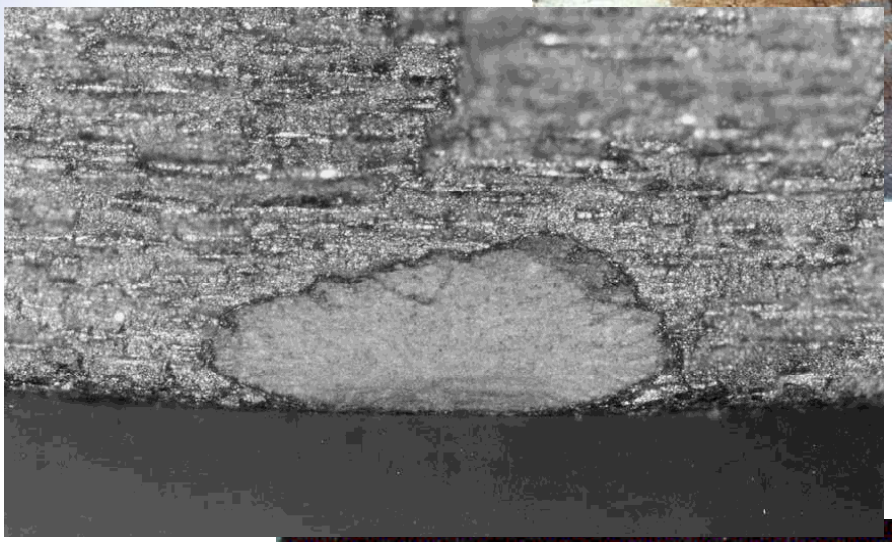

1974 & 1982

FABRICATION STRESSES

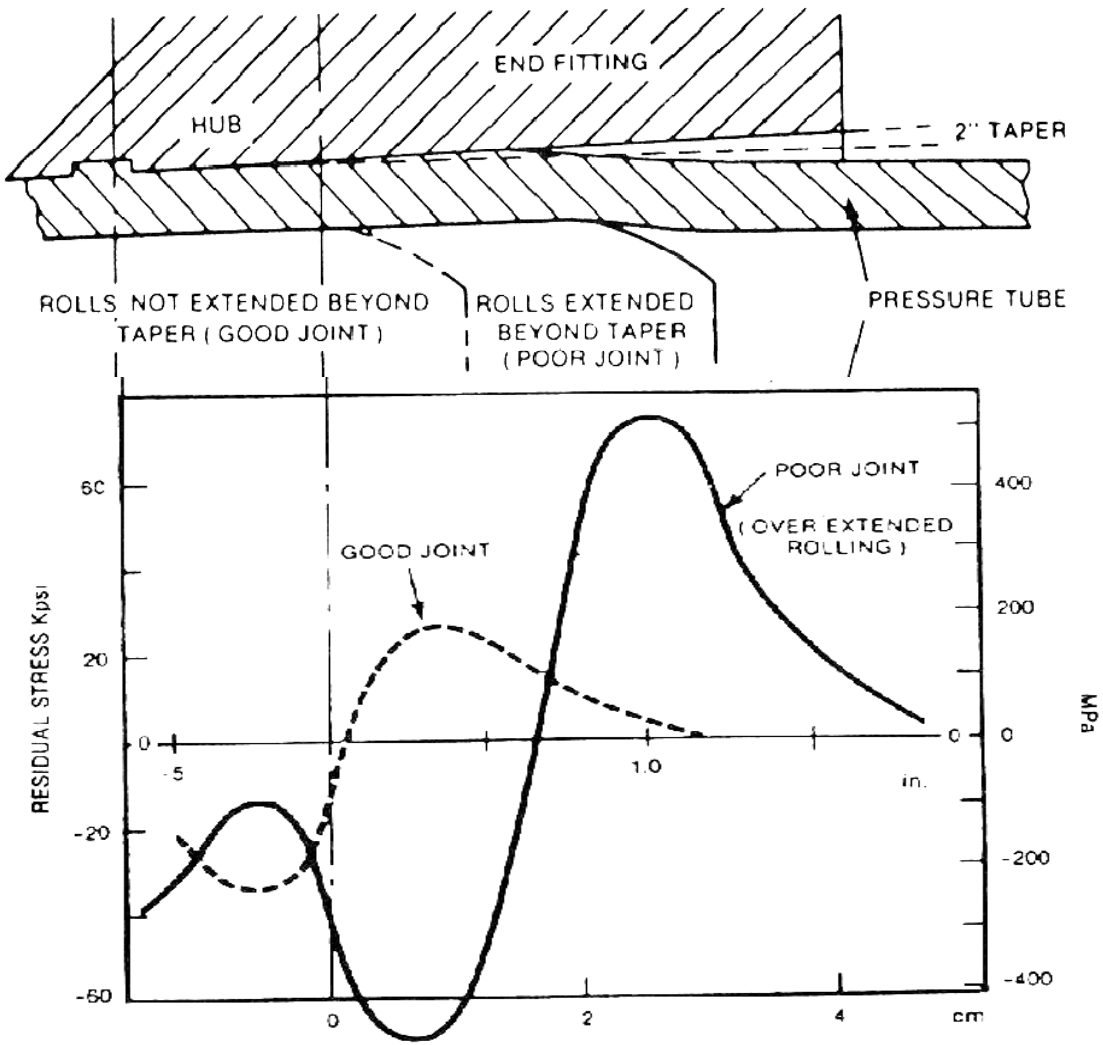

LEAK-BEFORE-BREAK DEMONSTRATED

- High residual stresses from over-rolling
- Delayed Hydride Cracking during reactor shutdowns only
- Leakage and detection
- Safe shutdown
- Replacement of pressure tubes

SOLUTIONS

- Replace cracked pressure tubes
- Stress relieve other reactors with over-rolled pressure tube joints
- Development of zero-clearance rolled joint with lower residual stresses
- Implemented in subsequent reactor constructions, e.g. all CANDU 6 reactors

LEAK-BEFORE-BREAK

$$t = (CCL - Leak\ L)/(2xV_{axial})$$

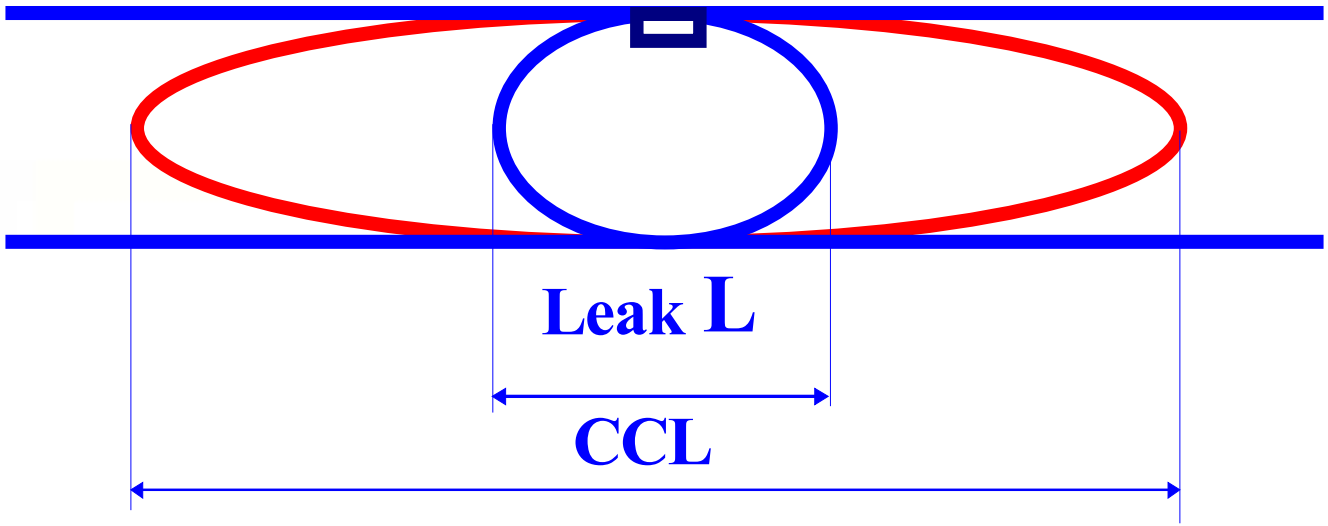

LEAKAGE EXPERIMENTS

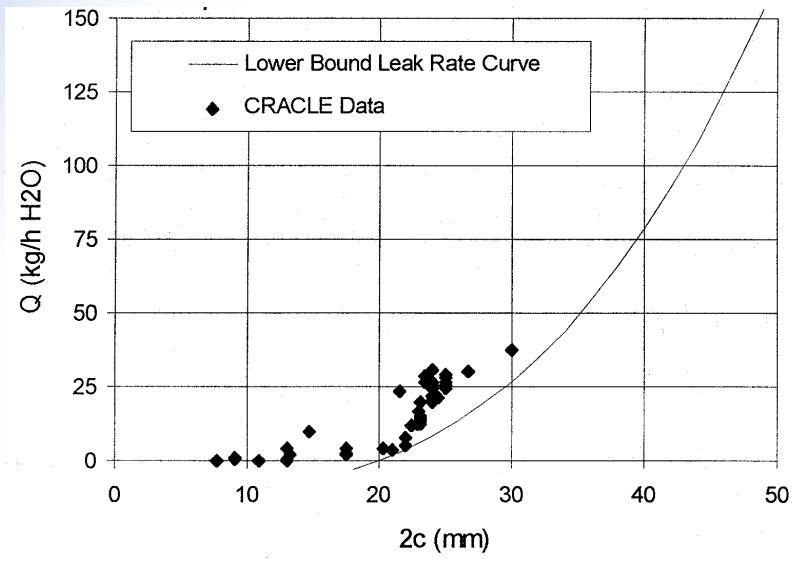

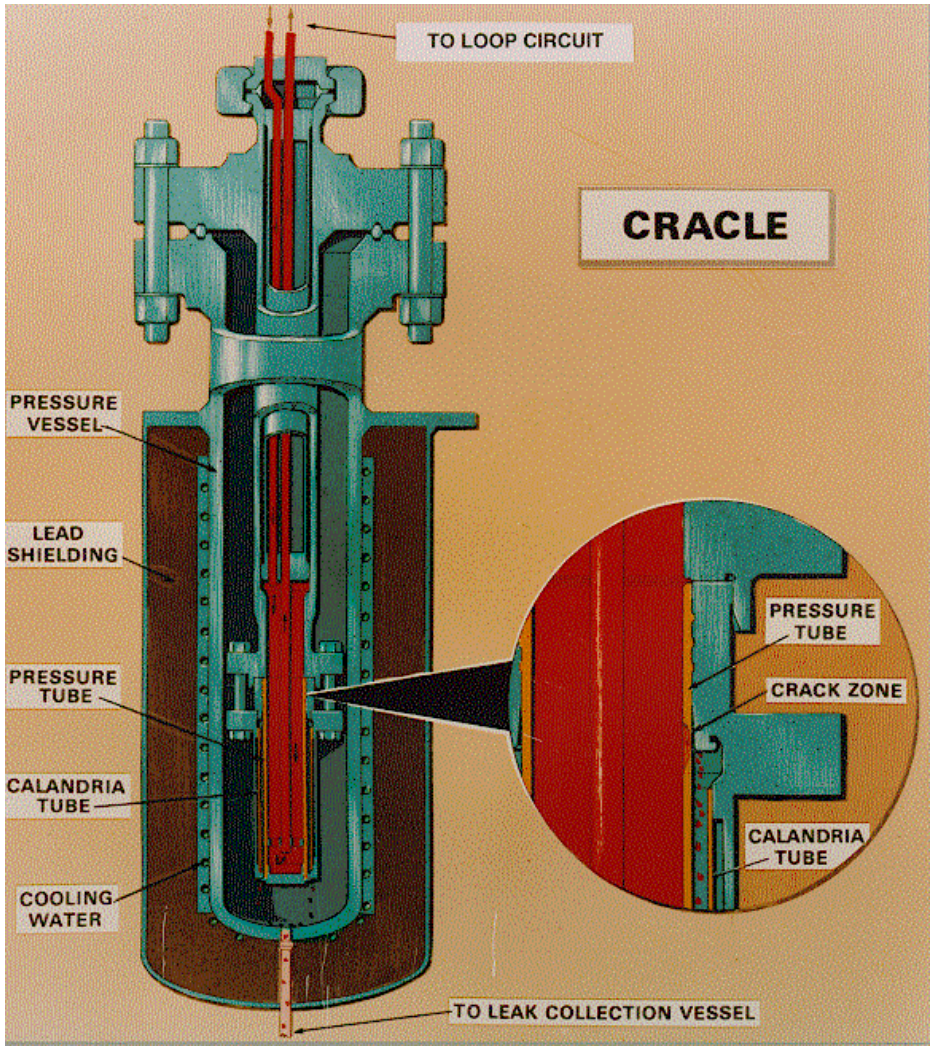

CORROSION & HYDROGEN INGRESS

- Interaction of hot coolant with zirconium
- Limited corrosion and hydrogen ingress
- Solubility limit for hydrogen in zirconium
- When the solubility limited is exceeded, there is the possibility of Delayed Hydride Cracking and changes in material properties

CORROSION & HYDROGEN INGRESS

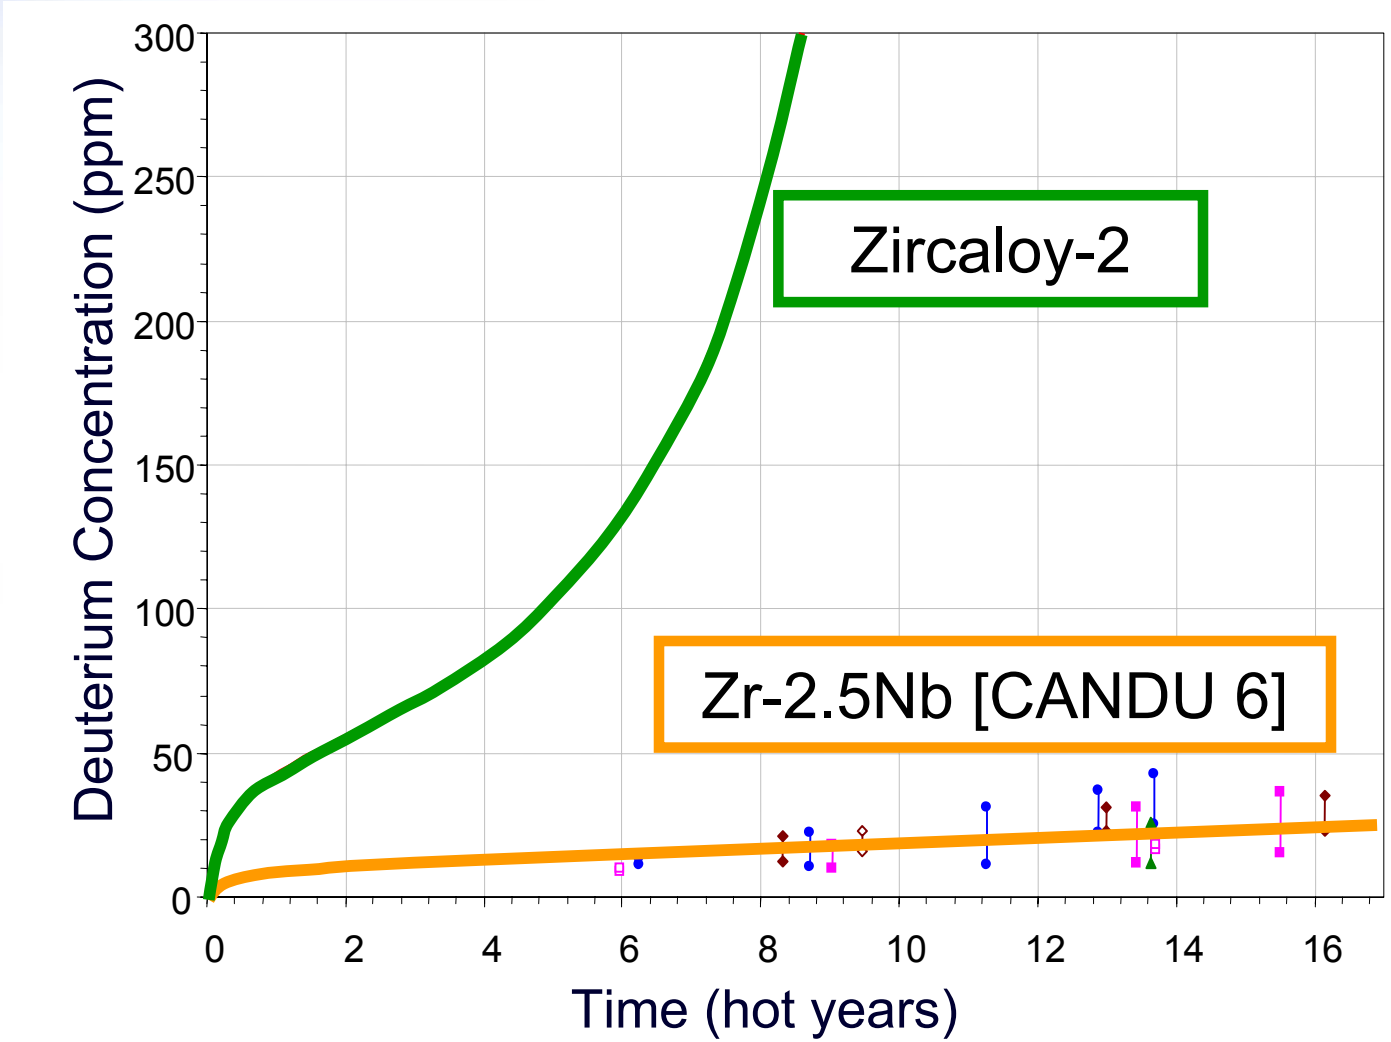

BLISTERS

1983

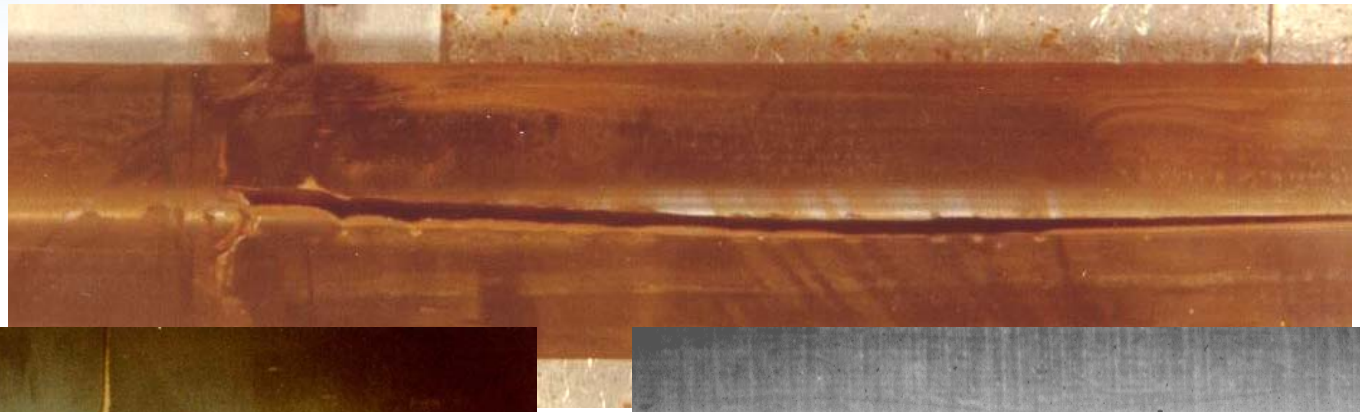

BLISTER FRACTURE

BLISTERS

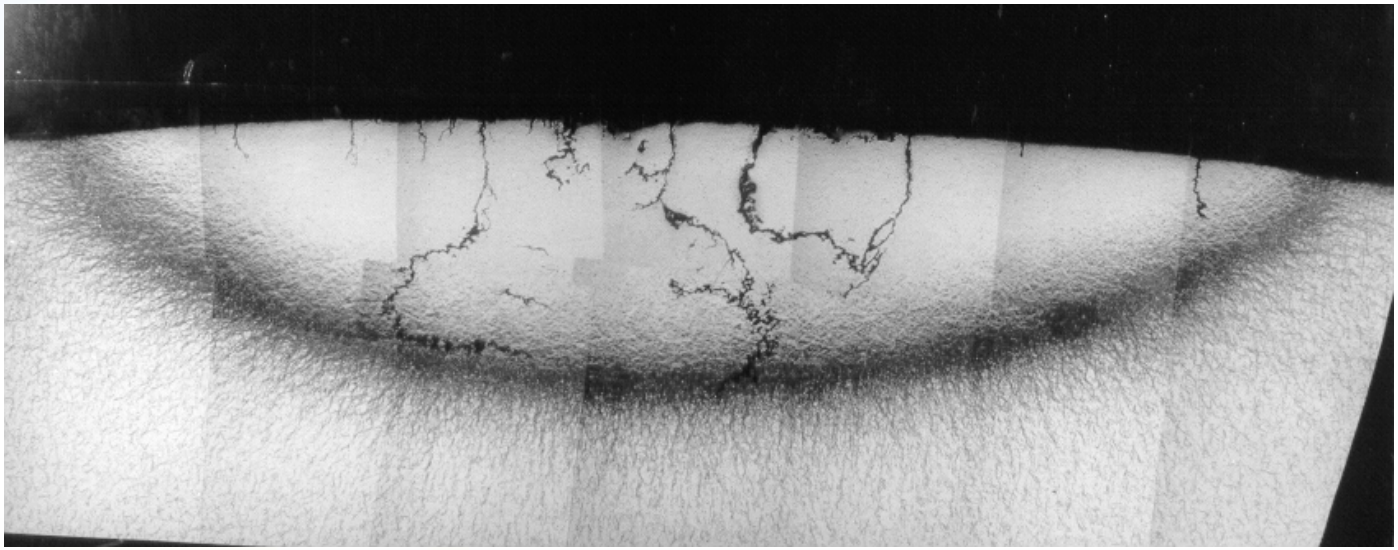

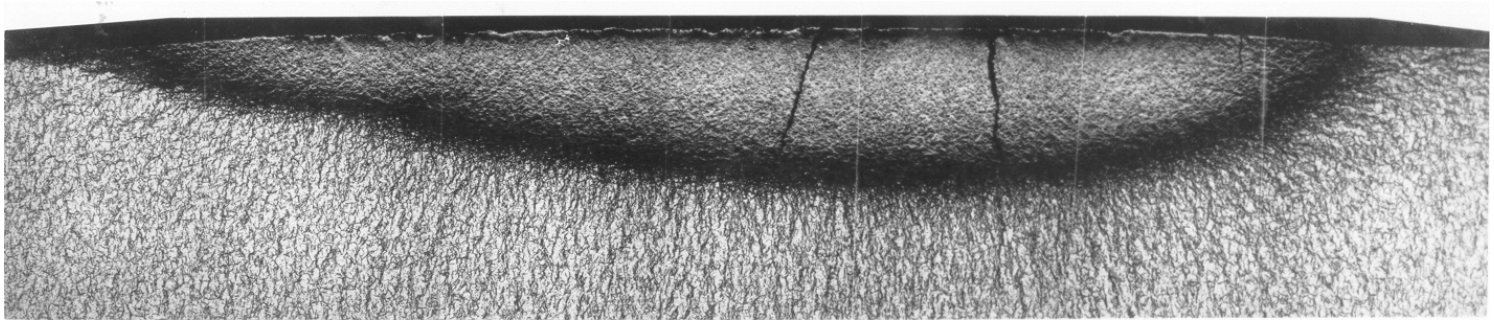

CONTACT

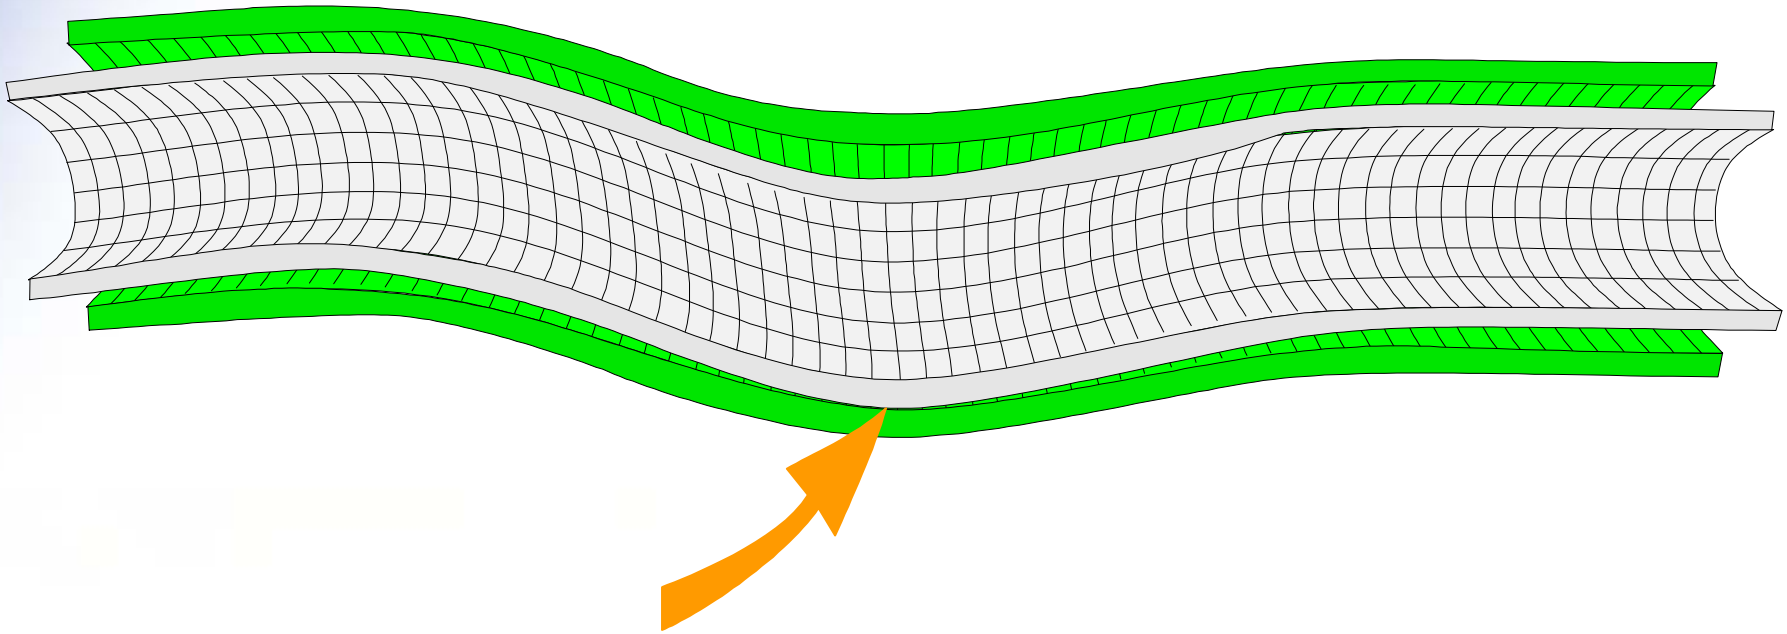

Without support from spacers, the pressure tube can sag into contact with the calandria tube

PRESSURE TUBE CONTACT

- Spacer movement (2 spacers)
- High deuterium pick-up in Zircaloy-2
- Pressure tube sagged into contact with the calandria tube creating local “cold” spots
- Hydrogen diffusion and hydride blister formation
- Cracking of several brittle blisters
- Rupture of the pressure tube
- Shutdown and replacement of the pressure tube

SOLUTIONS

High Hydrogen:

- Re-tube Zircaloy-2 reactors with Zr-2.5Nb

Spacer Movement:

- In-reactor inspections for spacer locations and hydride blisters
- Reposition spacers in operating reactors
- Assessment methodologies
- Install 4 tight-fitting spacers in new reactors

DIMENSIONAL CHANGES

Response of fuel channel to:

- Temperature
- Stress
- Neutron Flux/fluence

Change in shape:

- Length
- Diameter
- Sag

ELONGATION

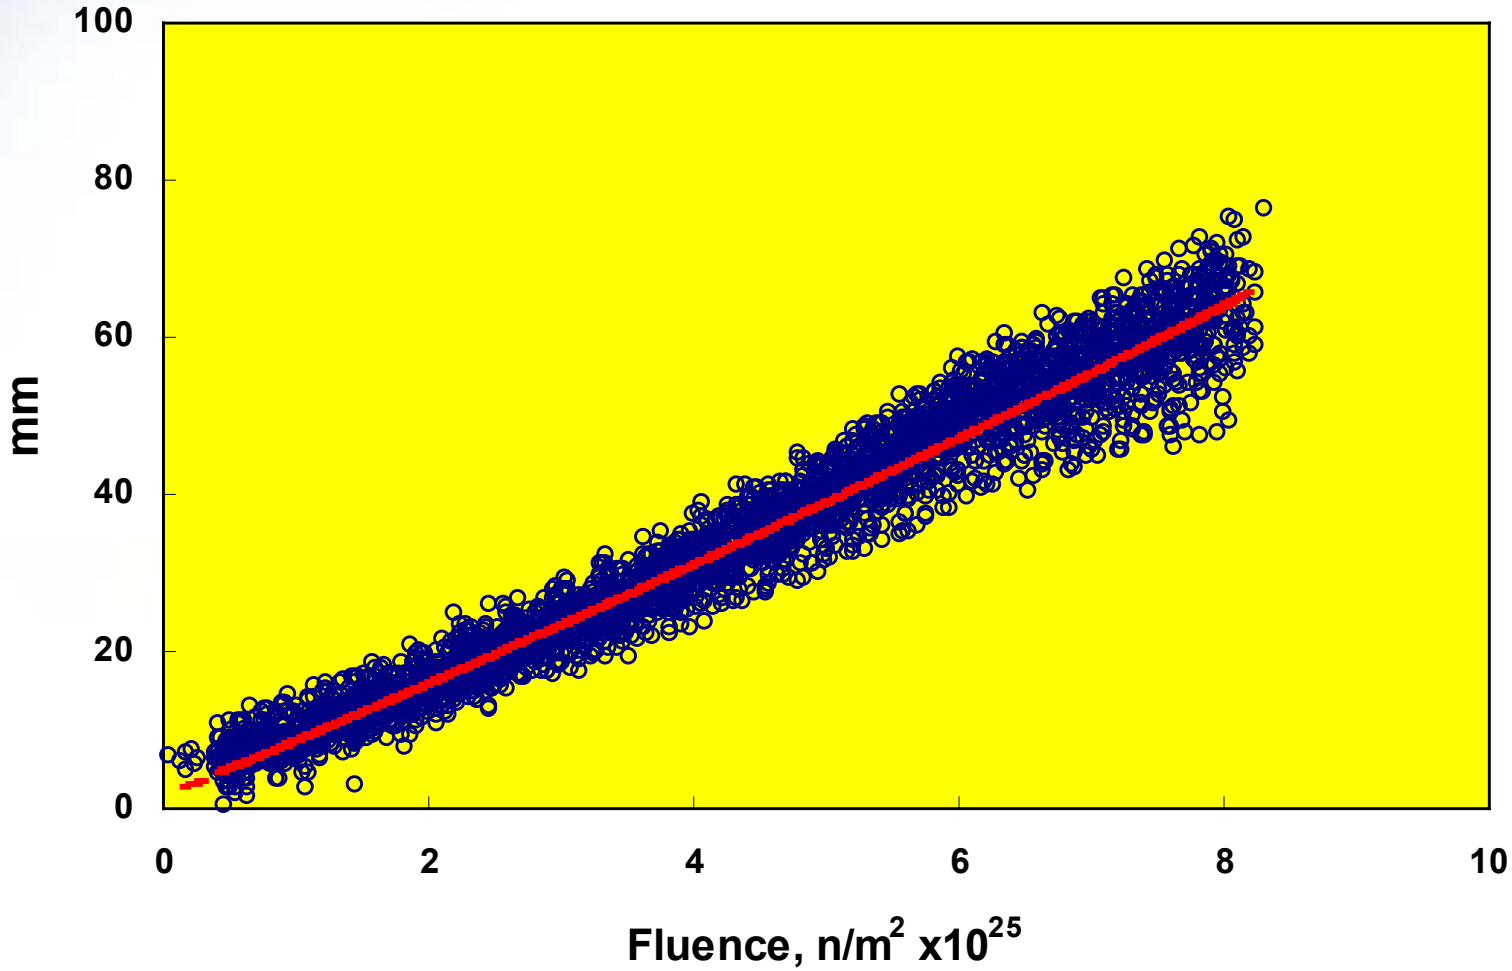

FUEL CHANNEL REPLACEMENTS

Long history for Single Fuel Channel Replacements (SFCR):

- Early 1960's at Douglas Point
- 1967 at NPD

Motivations

- Single fuel channel issue
- Material Surveillance
- PLIM / PLEX

LARGE-SCALE FUEL CHANNEL REPLACEMENTS

Pickering Units 1 and 2

- Replace Zircaloy-2 with Zr-2.5Nb
- Install 4 spacers
- Avoid high hydrogen pickup, pressure tube contact with calandria tube, and possibility of blisters

Pickering Units 3 and 4

- Replace Zr-2.5Nb with Zr-2.5Nb
- Install 4 spacers
- Avoid pressure tube contact with calandria tube and possibility of blisters
- Allow for greater pressure tube elongation

MANUFACTURING FLAW

1985

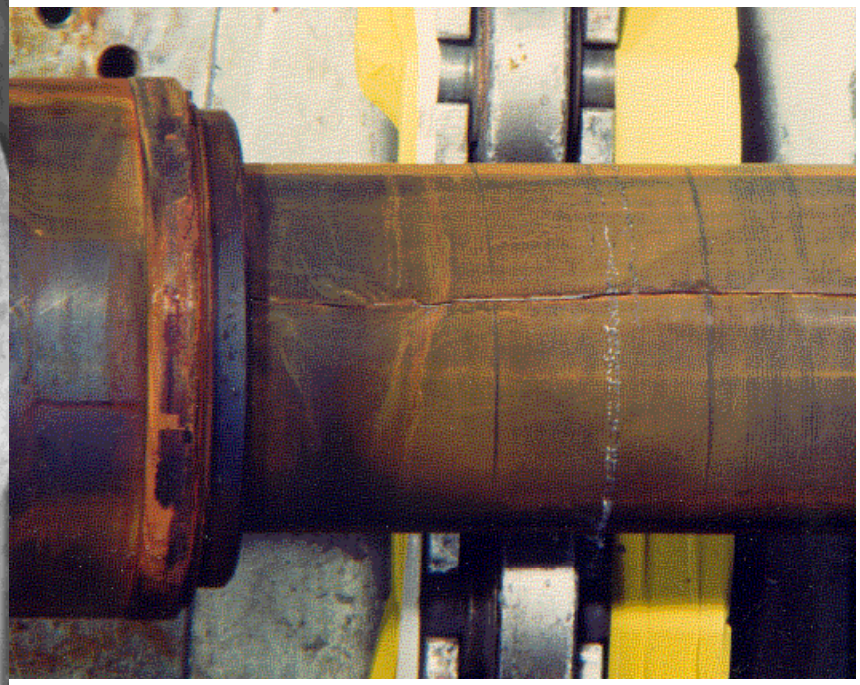

DELAYED HYDRIDE CRACKING

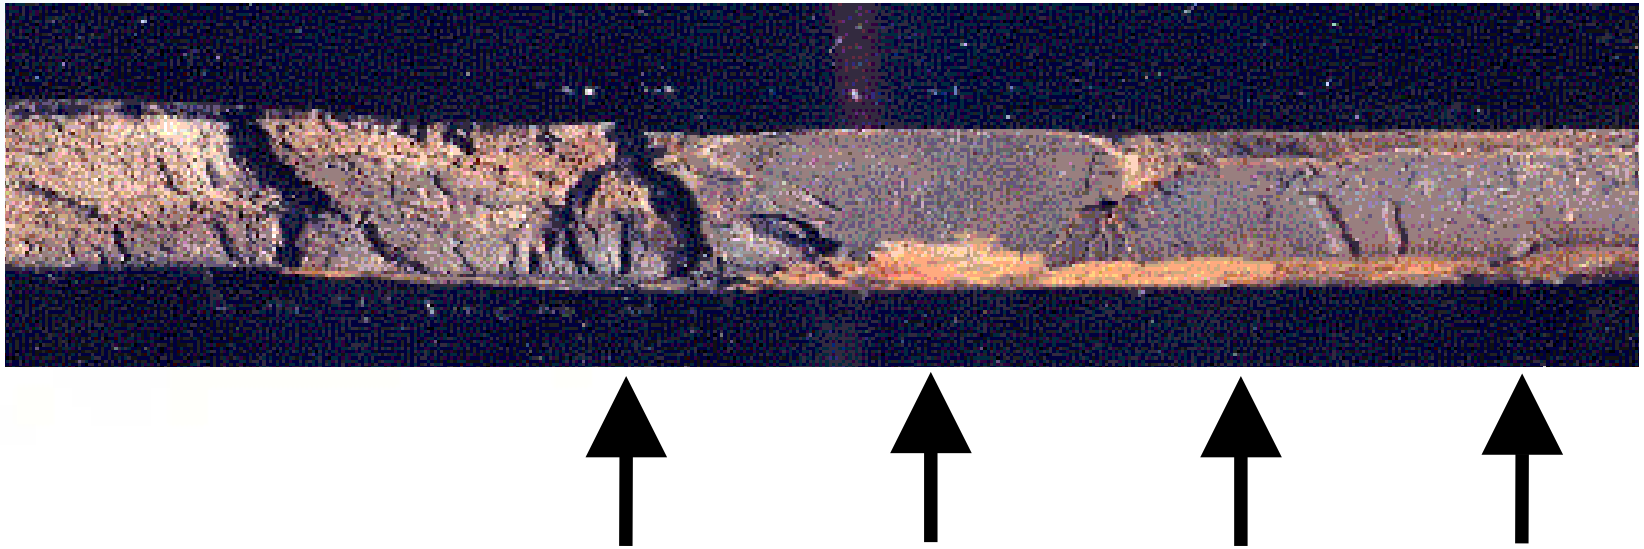

LEAK-BEFORE-BREAK DEMONSTRATED

- Residual stresses from over-rolling
- Manufacturing Flaw
- Delayed Hydride Cracking with multiple initiation sites
- Leakage and detection
- Safe shutdown

SOLUTIONS

- Replace cracked pressure tube and ruptured calandria tube
- Inspect archive material for similar manufacturing flaws
- Inspect selected tubes in operating reactors
- Adjusted manufacturing process for all subsequent reactor constructions

IN-REACTOR INSPECTION

- Non-destructive
- Volumetric inspections required by CSA Standard
- Flaw detection
- Spacer locations
- Dimensional inspection – diameter and sag

INSPECTION TOOLING

MOCK-UP TESTING

MATERIAL PROPERTIES

Changes in response to:

- Operating temperature
- Flux/Fluence
- Hydrogen Ingress
- Time

MATERIAL PROPERTIES

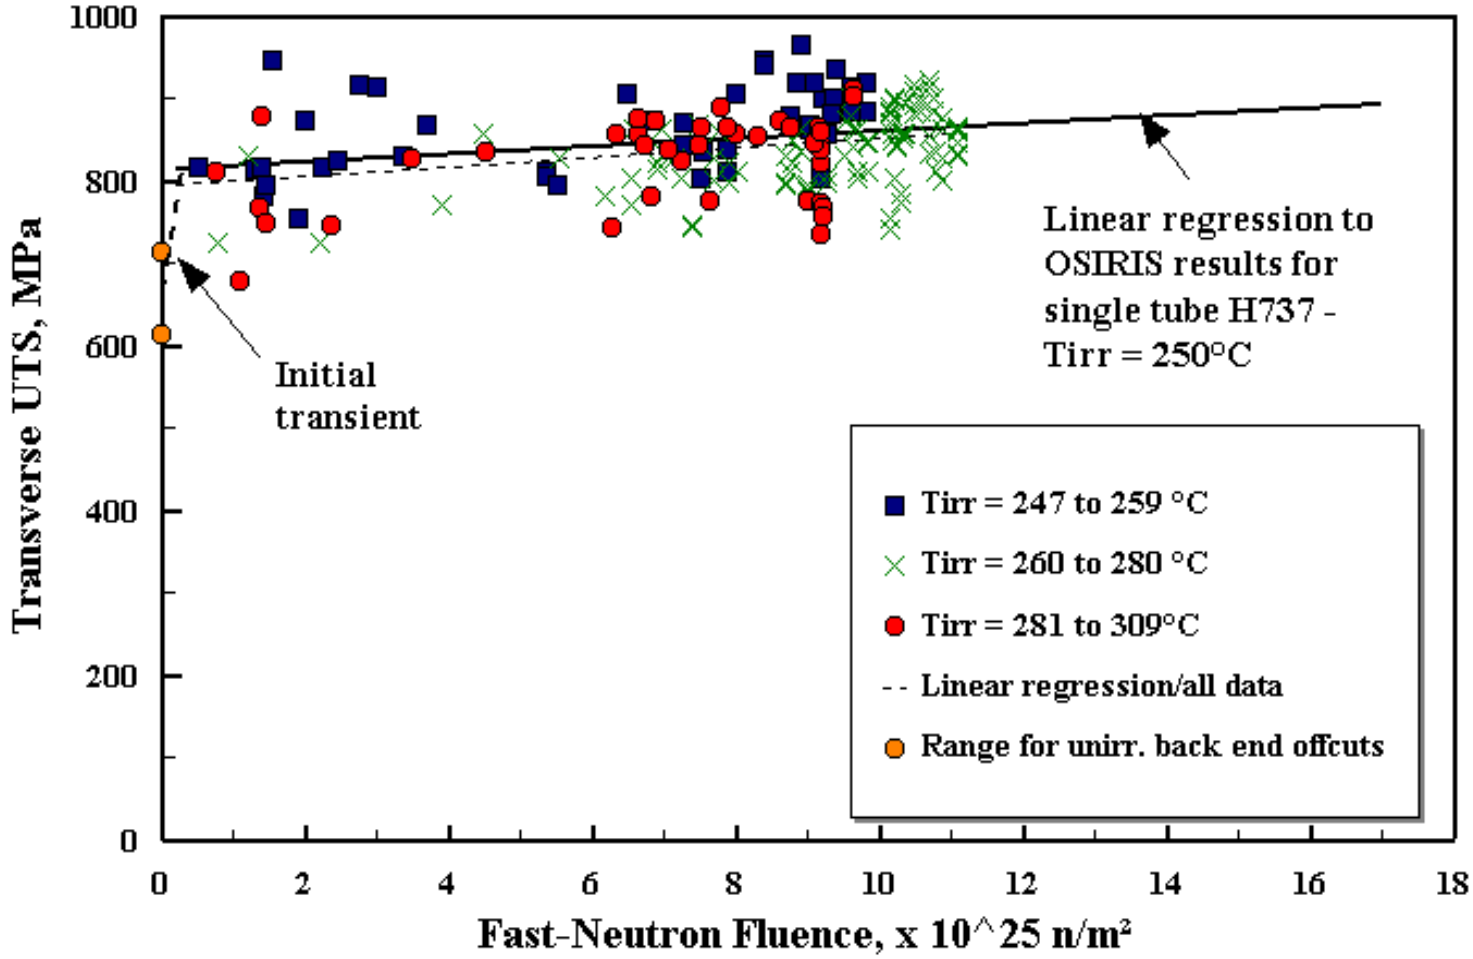

KEYS TO HIGH PEFORMANCE

- High-Quality Manufacturing
- Material Surveillance
- In-Depth Knowledge and Understanding
- In-Reactor Inspections
- Assessment Methodologies

PERFORMANCE STATISTICS

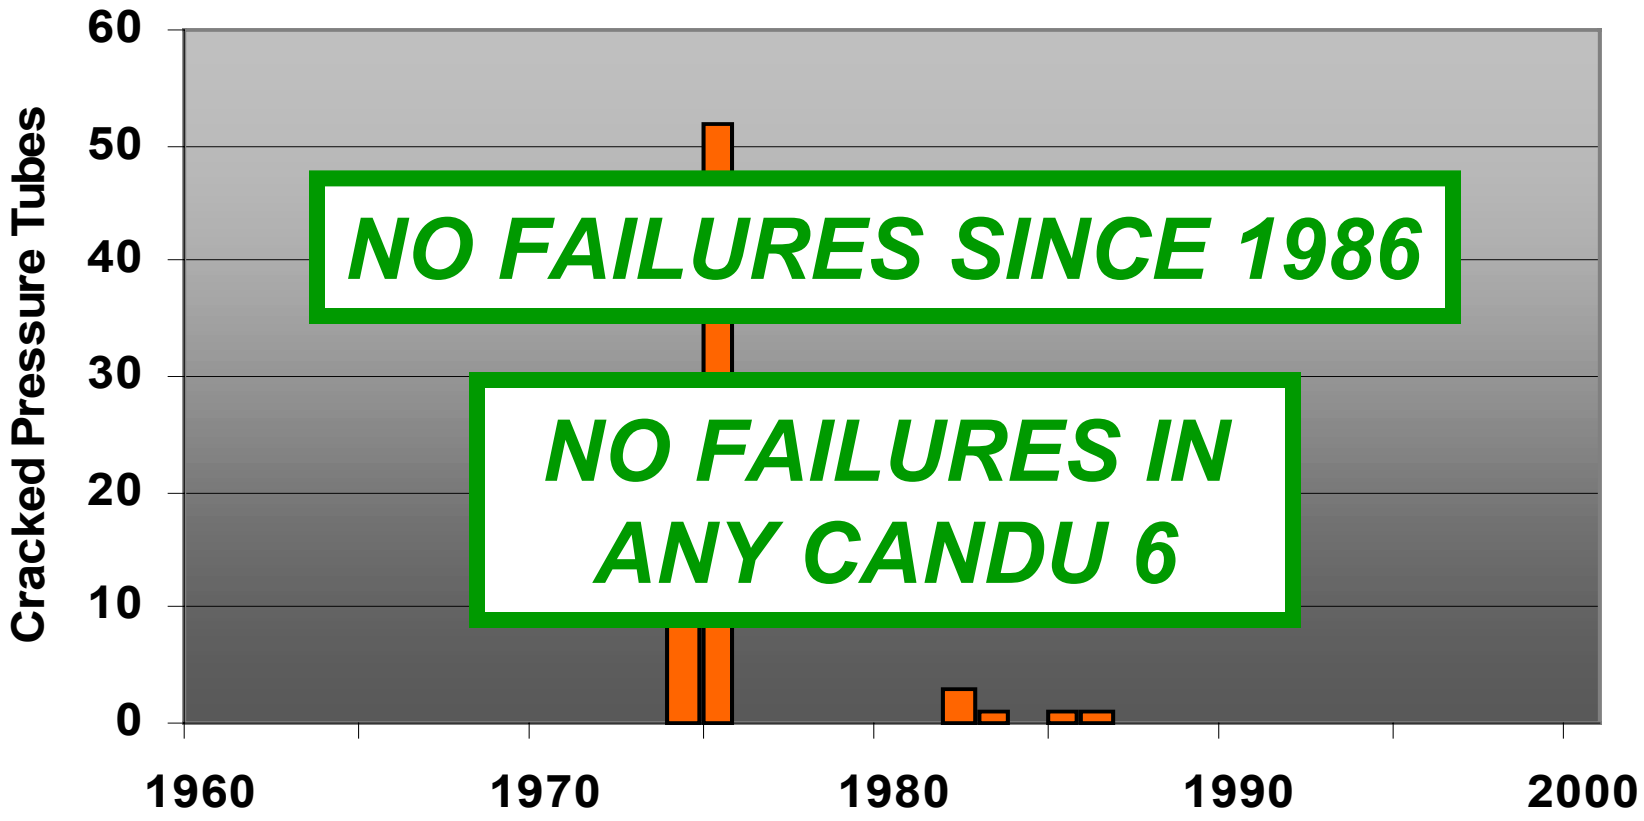

ACR-Specific R&D

– Anticipatory R&D

ACR Design

OPERATING CONDITIONS

- Slightly higher temperature
- Slightly higher internal pressure
- Slightly higher neutron flux

than CANDU 6 reactors

FUEL CHANNEL DESIGN

- Thicker pressure tube and
- Thicker calandria tube

ACR-SPECIFIC ANTICIPATORY R&D

- Fracture and Leak-Before-Break
- Deformation
- Corrosion and Hydrogen Ingress
- Calandria Tubes
- Core Integrity

Confirmation of expected behavior

ACR R&D – FRACTURE & LBB

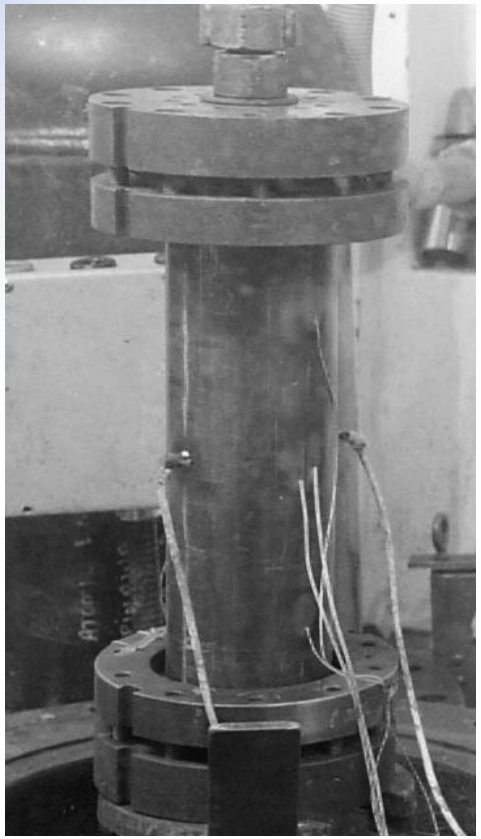

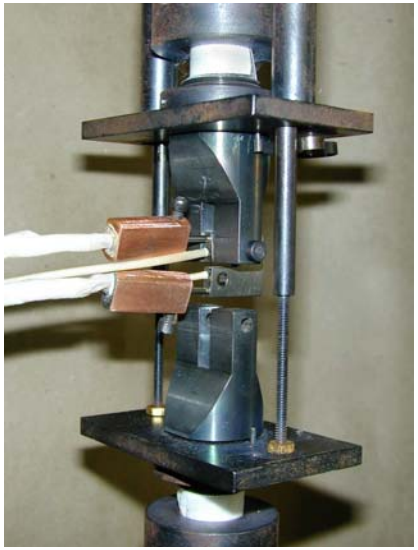

- **Material Property data:**
  - K_{IH}
  - Crack velocity
  - Penetration length
  - Leak rates
  - Critical crack length
  - Strength
- **Extension of Databases:**
  - Temperature
  - Irradiation
  - ACR specification

TYPICAL LBB ASSESSMENT

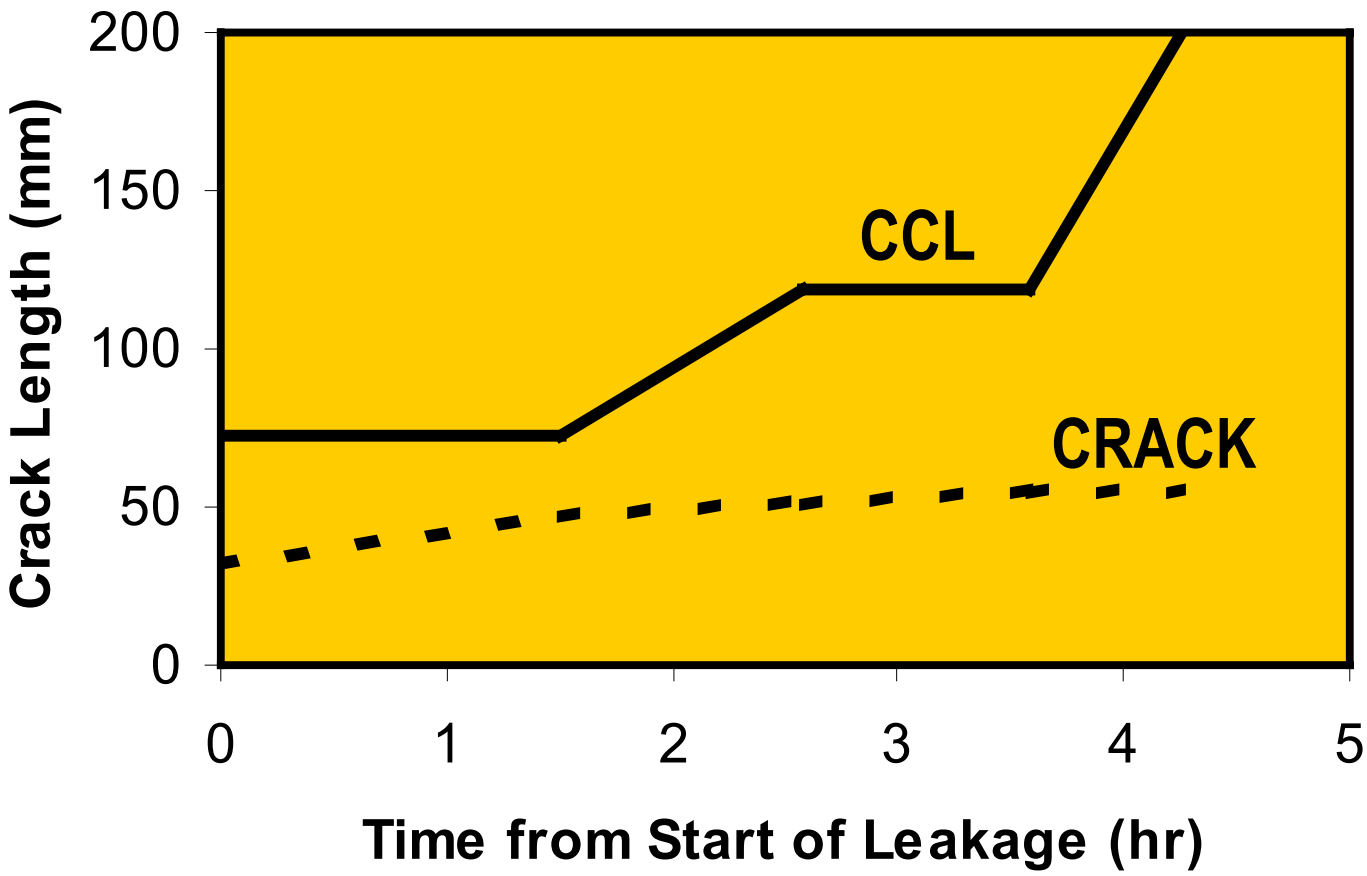

ACR R&D - DEFORMATION

- **Material Property data:**
  - **Creep and growth**
  - **Microstructure**
- **Extension of databases:**
  - **Temperature**
  - **Irradiation**
  - **ACR specification**

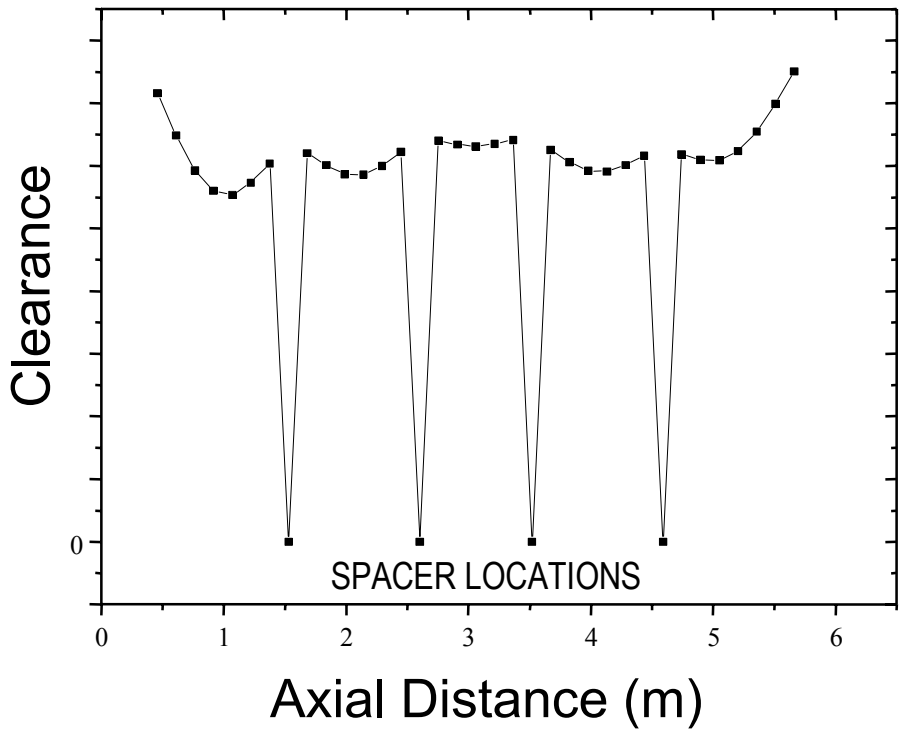

ACR R&D - CORROSION

- **Material Property data:**
  - **Oxidation**
  - **Hydrogen pick-up**
  - **Hydrogen vs. Deuterium**
- **Extension of Databases:**
  - **Temperature**
  - **Irradiation**
  - **Microstructure**
  - **ACR specification**

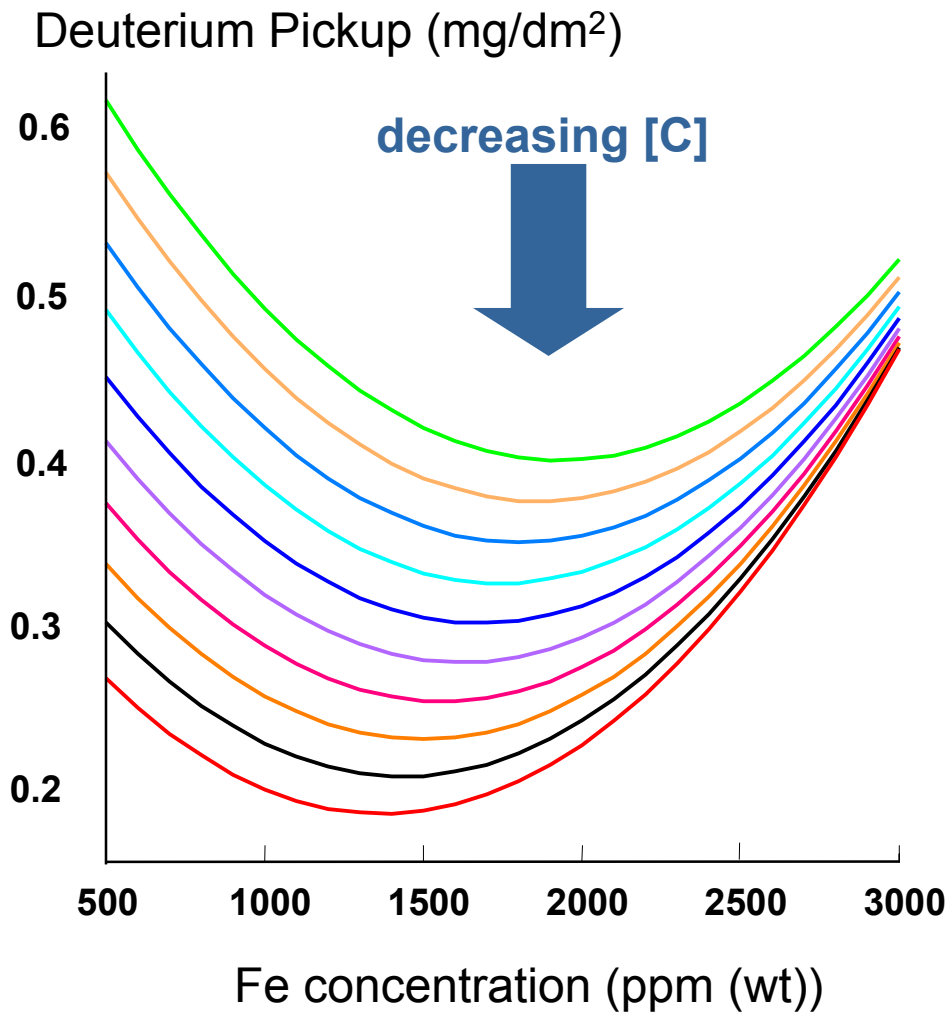

CTL-1 ROLLED JOINT TESTING

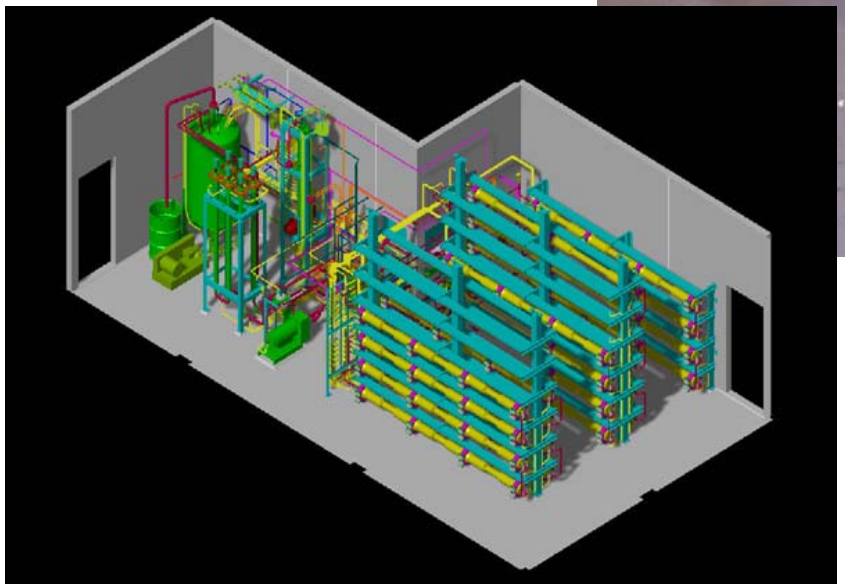

ACR R&D – CALANDRIA TUBES

Confirmation for:

- Manufacturing of thicker calandria tubes
- Mechanical properties of ACR calandria tubes
- Postulated accident performance properties

ACR FUEL CHANNEL

Assessments for 30 years:

- Based on:
  - Extrapolations of current knowledge
  - Conservative estimates of improvement benefits
- All behaviors will be acceptable:
  - DHC & Leak-Before-Break
  - Deformation, and
  - Corrosion and Hydrogen Ingress.

ANTICIPATORY R&D TO CONFIRM EXPECTATIONS

FUEL CHANNEL SUMMARY

- Well-Established R&D Program
  - Established for over 40 years – more than 2000 person-years
  - Cooperation between AECL, CANDU utilities, and others
- Proven Excellent Fuel Channel Performance
  - 2 ruptures in >150,000 pressure tube years
  - No fractures since 1986
- Extension of Existing R&D Programs for ACR
  - Temperature and pressure
  - ACR specification

AECL

TECHNOLOGIES INC.