Primary Water Stress Corrosion Crack Growth Analysis - OD SurfaceFlaw

Developed by Central Engineering Programs, Entergy Operations Inc

Developedby: J. S. Brihmadesam **Verified by: B. C. Gray**

Refrences :

1) "Stress Intensity factors for Part-through Surface cracks"; NASA TM-11707; July 1992.
2) Crack Growth of Alloy 600 Base Metal in PWR Environments; EPRI MRP Report MRP 55 Rev. 1, 2002

Arkansas Nuclear One Unit 2

Component : Reactor Vessel CEDM -"28" Degree Nozzle, Downhill Azimuth, 1.544" above Nozzle Bottom

Calculation Basis: MRP 75 th Percentile and Flaw Face Pressurized

Mean Radius -to- Thickness Ratio:- "R_m/t" -- between 1.0 and 300.0

Note : *Used the Metric form of the equation from EPRI MRP 55-Rev. 1.*
The correction is applied in the determination of the crack extension to obtain the value in inch/hr .

OD Surface Flaw

The first Required input is a location for a point on the tube elevation to define the point of interest (e.g. The top of the Blind Zone, or bottom of fillet weld etc.). This reference point is necessar to evaluate the stress distribution on the flaw both for the initial flaw and for a growing flaw. This is defined as the reference point. Enter a number (inch) that represnets the reference point elevation measured upward from the nozzle end.

$$Ref_{Point} := 1.544$$

To place the flaw with repsect to the reference point, the flaw tips and center can be located as follows:

1) ***The Upper "c- tip" located at the reference point (Enter 1)***
2) ***The Center of the flaw at the reference point (Enter 2)***
3) ***The lower "c- tip" located at the reference point (Enter 3).***

$$Val := 2$$

Upper Limit to be selected for stress distribution (e.g. Weld bottom). This is the elevation from Nozzle Bottom. Enter this value below

$UL_{Strs.Dist} := 1.704$ Upper Axial Extent for Stress Distribution to be used in the Analysis (Axial distance above nozzle bottom)

Input Data :-

$L := 0.32$ Initial Flaw Length

$a_0 := 0.661 \cdot 0.12$ Initial Flaw Depth

$od := 4.05$ Tube OD

$id := 2.728$ Tube ID

$P_{Int} := 2.235$ Design Operating Pressure (internal)

$Years := 4$ Number of Operating Years

$I_{lim} := 1500$ Iteration limit for Crack Growth loop

$T := 604$ Estimate of Operating Temperature

$\alpha_{0c} := 2.67 \cdot 10^{-12}$ Constant in MRP PWSCC Model for I-600 Wrought @ 617 deg. F

$Q_g := 31.0$ Thermal activation Energy for Crack Growth {MRP)

$T_{ref} := 617$ Reference Temperature for normalizing Data deg. F

$$R_o := \frac{od}{2} \qquad R_{id} := \frac{id}{2} \qquad t := R_o - R_{id} \qquad R_m := R_{id} + \frac{t}{2} \qquad Tim_{opr} := Years \cdot 365 \cdot 24$$

$$CF_{inhr} := 1.417 \cdot 10^5 \qquad C_{blk} := \frac{Tim_{opr}}{I_{lim}} \qquad Prnt_{blk} := \left| \frac{I_{lim}}{50} \right| \qquad c_0 := \frac{L}{2} \qquad R_t := \frac{R_m}{t}$$

$$C_{01} := e^{\left[\frac{-Q_g}{1.103 \cdot 10^{-3}} \cdot \left(\frac{1}{T+459.67} - \frac{1}{T_{ref}+459.67}\right)\right] \cdot \alpha_{0c}}$$ Temperature Correction for Coefficient Alpha

$C_0 := C_{01}$ 75 th percentile MRP-55 Revision 1

Stress Input Data

Input all available Nodal stress data in the table below. The column designations are as follows:
Column "0" = Axial distance from minumum to maximum recorded on data sheet(inches)
Column "1" = ID Stress data at each Elevation (ksi)
Column "2" = Quarter Thickness Stress data at each Elevation (ksi)
Column "3" = Mid Thickness Stress data at each Elevation (ksi)
Column "4" = Three Quarter Thickness Stress data at each Elevation (ksi)
Column "5" = OD Stress data at each Elevation (ksi)

AllData :=

	0	1	2	3	4	5
0	0	-17.41	-13.55	-11.11	-8.88	-6.63
1	0.46	-8.49	-6.31	-4.92	-3.71	-2.54
2	0.83	0.09	0.18	0.11	0.19	0.28
3	1.13	7.03	6.95	6.31	5.21	4.65
4	1.36	8.22	10.95	10.85	9.51	5.65
5	1.55	13.27	16.41	16.06	17.13	25.26
6	1.7	20.63	22.24	25.41	43.58	53.78
7	1.83	29.04	28.83	31.29	53.55	64.08
8	1.95	33.95	30.93	36.41	61.6	71.01
9	2.07	29.59	31.79	40.54	64.61	76.42
10	2.19	23.26	29.74	41.2	64.19	79.63

$AXLen := AllData^{\langle 0 \rangle}$ $ID_{All} := AllData^{\langle 1 \rangle}$ $OD_{All} := AllData^{\langle 5 \rangle}$

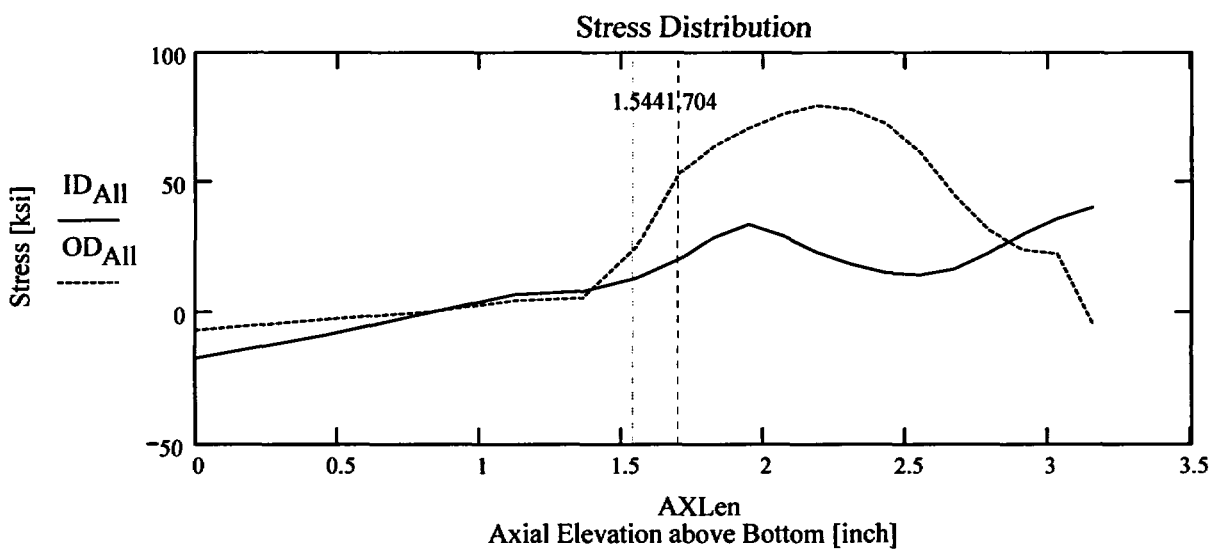

Observing the stress distribution select the region in the table above labeled $Data_{All}$ that represents the region of interest. This needs to be done especially for distributions that have a large compressive stress at the nozzle bottom and high tensile stresses at the J-weld location. Copy the selection in the above table , click on the "Data" statement below and delete it from the edit menu. Type "Data and the Mathcad "equal" sign (Shift-Colon) then insert the same to the right of the Mathcad Equals sign below (paste symbol).

$$Data := \begin{pmatrix} 0 & -17.414 & -13.552 & -11.113 & -8.884 & -6.628 \\ 0.461 & -8.494 & -6.31 & -4.924 & -3.706 & -2.541 \\ 0.83 & 0.089 & 0.179 & 0.11 & 0.186 & 0.284 \\ 1.126 & 7.025 & 6.953 & 6.314 & 5.208 & 4.646 \\ 1.363 & 8.215 & 10.954 & 10.85 & 9.512 & 5.646 \\ 1.552 & 13.266 & 16.41 & 16.061 & 17.131 & 25.256 \\ 1.704 & 20.627 & 22.237 & 25.413 & 43.58 & 53.784 \\ 1.825 & 29.036 & 28.83 & 31.285 & 53.547 & 64.082 \\ 1.946 & 33.945 & 30.929 & 36.407 & 61.6 & 71.01 \\ 2.066 & 29.591 & 31.788 & 40.536 & 64.612 & 76.418 \\ 2.187 & 23.26 & 29.738 & 41.2 & 64.193 & 79.626 \end{pmatrix}$$

$Axl := Data^{\langle 0 \rangle}$ $MD := Data^{\langle 3 \rangle}$ $ID := Data^{\langle 1 \rangle}$ $TQ := Data^{\langle 4 \rangle}$ $QT := Data^{\langle 2 \rangle}$ $OD := Data^{\langle 5 \rangle}$

$R_{ID} := regress(Axl, ID, 3)$ $R_{QT} := regress(Axl, QT, 3)$

$R_{OD} := regress(Axl, OD, 3)$

$R_{MD} := regress(Axl, MD, 3)$ $R_{TQ} := regress(Axl, TQ, 3)$

$$FL_{Cntr} := \begin{cases} Ref_{Point} - c_0 & \text{if } Val = 1 \\ Ref_{Point} & \text{if } Val = 2 \\ Ref_{Point} + c_0 & \text{otherwise} \end{cases}$$

Flaw center Location Location above Nozzle Bottom

$U_{Tip} := FL_{Cntr} + c_0$

$$Inc_{Strs.avg} := \frac{UL_{Strs.Dist} - U_{Tip}}{20}$$

No User Input is required beyond this Point

Sat Aug 09 10:21:18 AM 2003

$Prop_{Length} = 0$

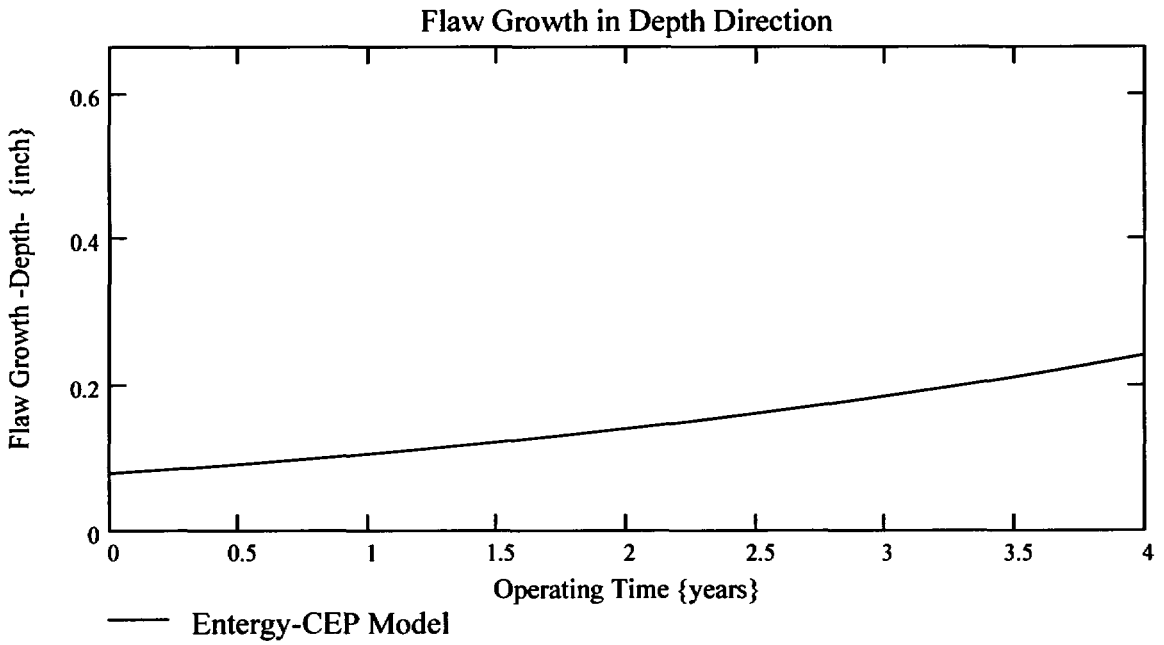

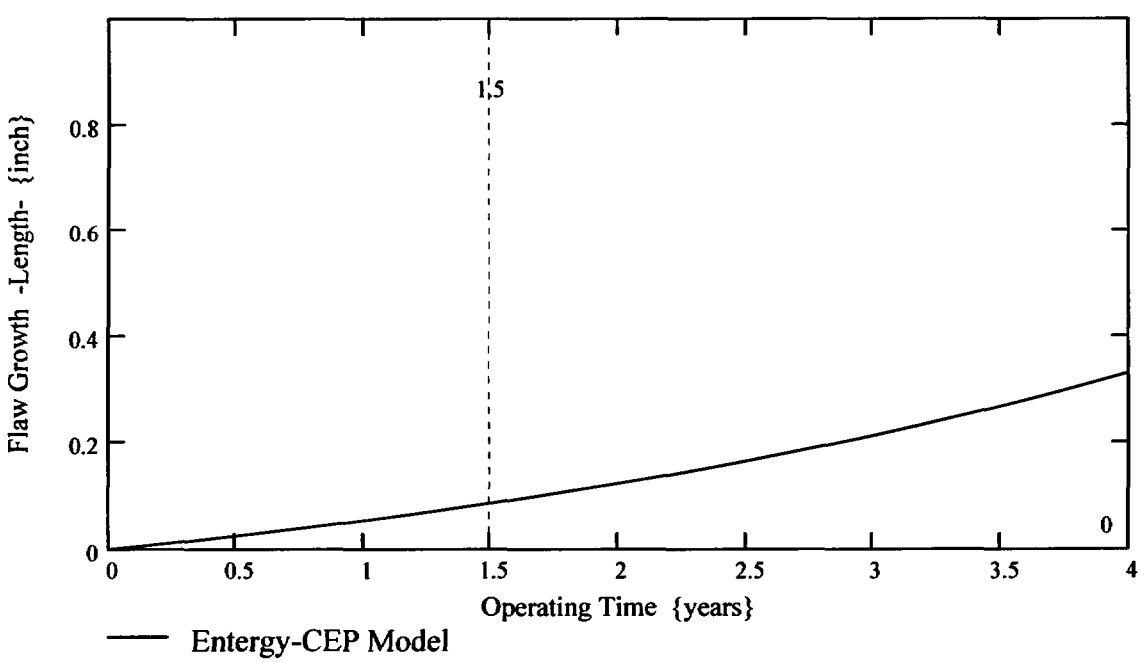

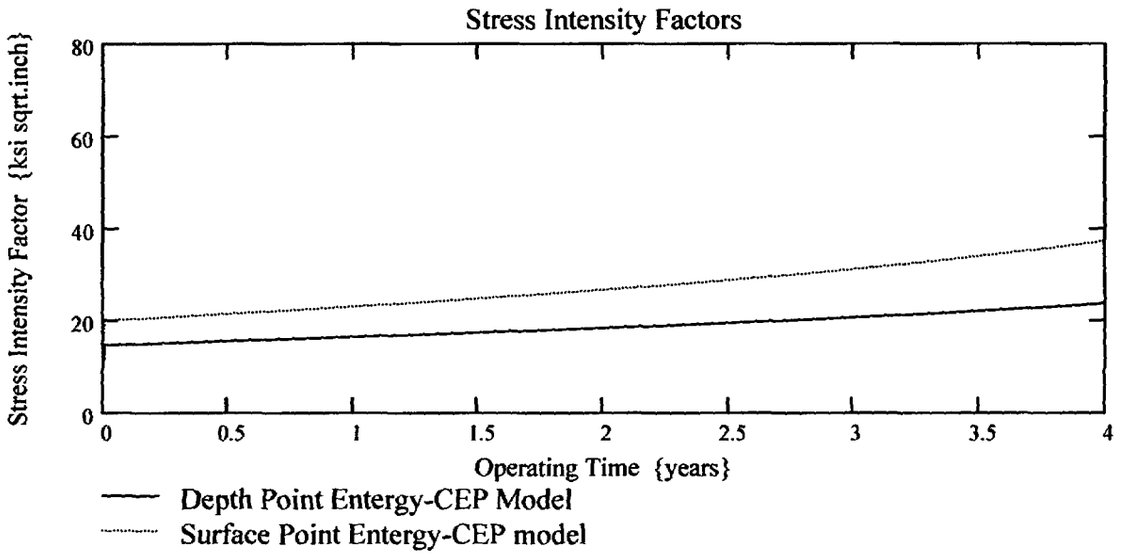
Stress Intensity Factors
Stress Intensity Factor {ksi sqrt.inch}
80
60
40
20
0
0
0.5
1
1.5
2
2.5
3
3.5
4
Operating Time {years}
Depth Point Entergy-CEP Model
Surface Point Entergy-CEP model

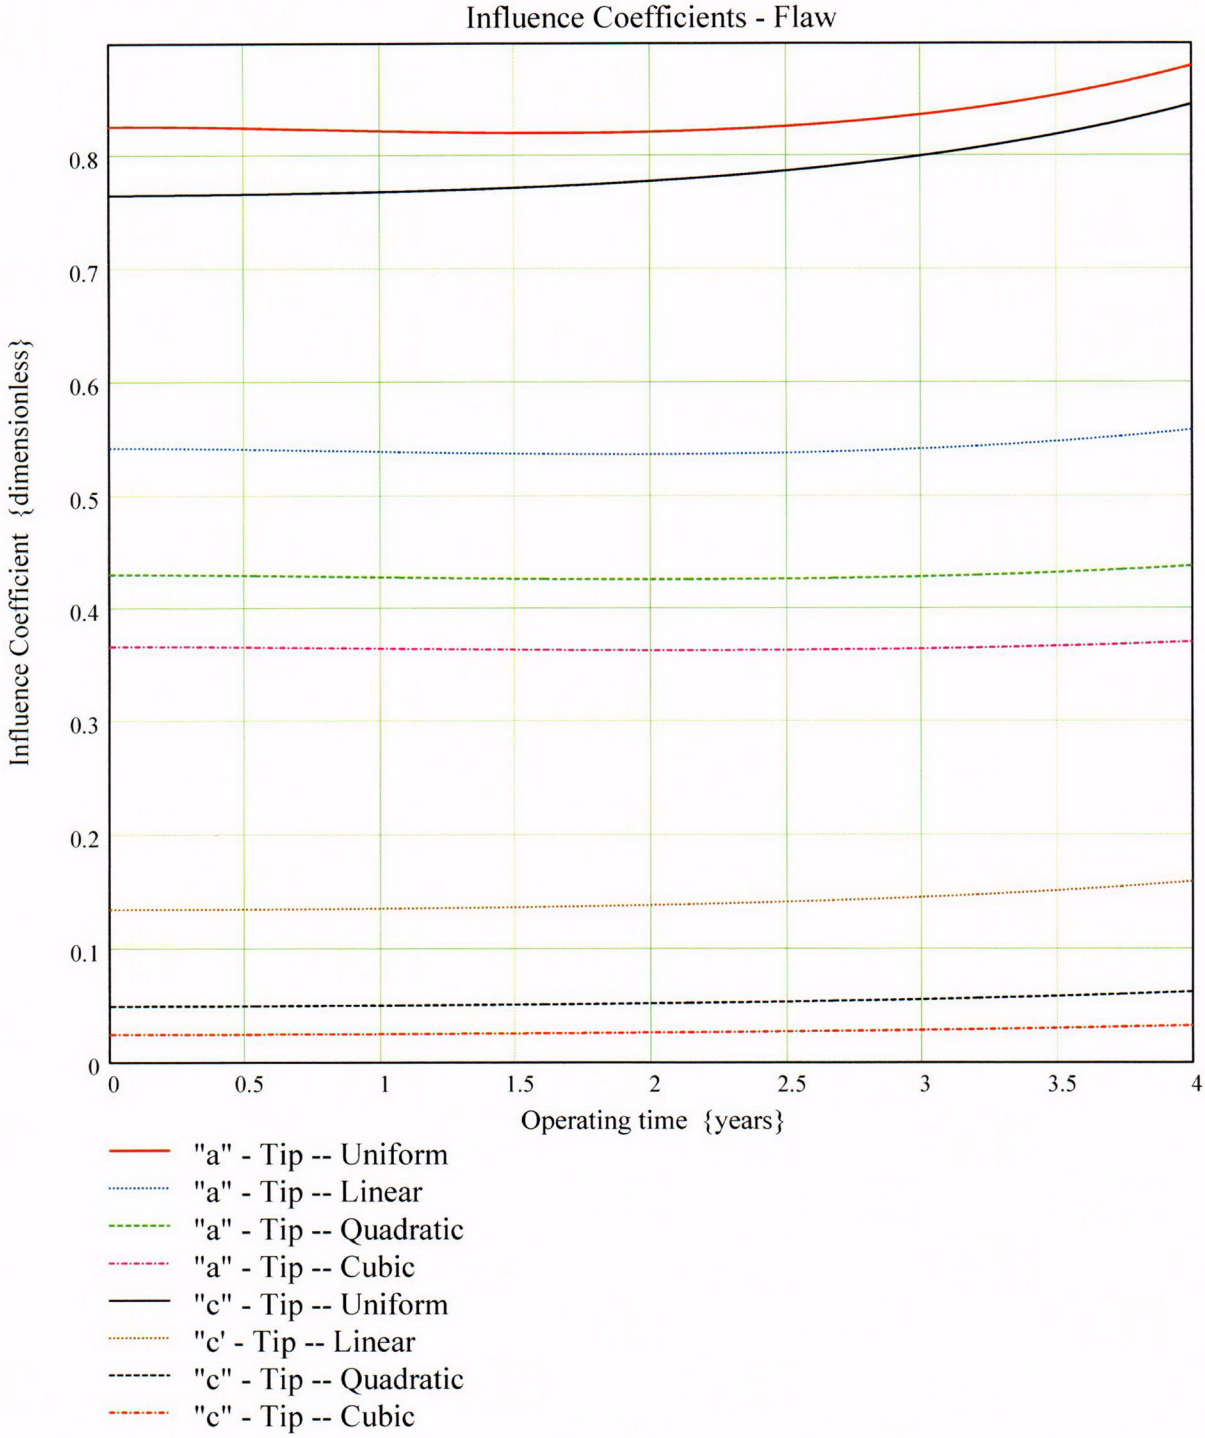
Influence Coefficients - Flaw
Influence Coefficient {dimensionless}
0
0.1
0.2
0.3
0.4
0.5
0.6
0.7
0.8
0
0.5
1
1.5
2
2.5
3
3.5
4
Operating time {years}
"a" - Tip -- Uniform
"a" - Tip -- Linear
"a" - Tip -- Quadratic
"a" - Tip -- Cubic
"c" - Tip -- Uniform
"c' - Tip -- Linear
"c" - Tip -- Quadratic
"c" - Tip -- Cubic

$CGR_{sambi_{(k,8)}}$ =

0.827
0.827
0.827
0.827
0.827
0.827
0.827
0.827
0.827
0.827
0.827
0.827
0.827
0.827
0.827
0.827

$CGR_{sambi_{(k,6)}}$ =

15.529
19.971
19.978
19.986
19.994
20.002
20.009
20.017
20.025
20.033
20.04
20.048
20.056
20.064
20.072
20.079

$CGR_{sambi_{(k,5)}}$ =

11.322
14.55
14.555
14.56
14.565
14.57
14.575
14.58
14.585
14.59
14.595
14.6
14.605
14.61
14.615
14.62

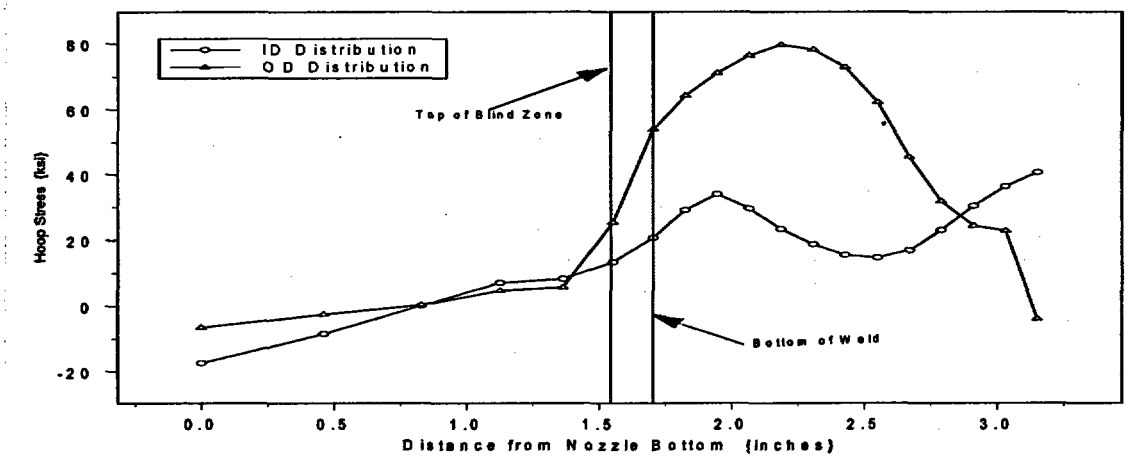
ID Distribution
OD Distribution
Top of Blind Zone
Bottom of Weld
Hoop Stress (ksi)
80
60
40
20
0
-20
0.0
0.5
1.0
1.5
2.0
2.5
3.0
Distance from Nozzle Bottom (inches)

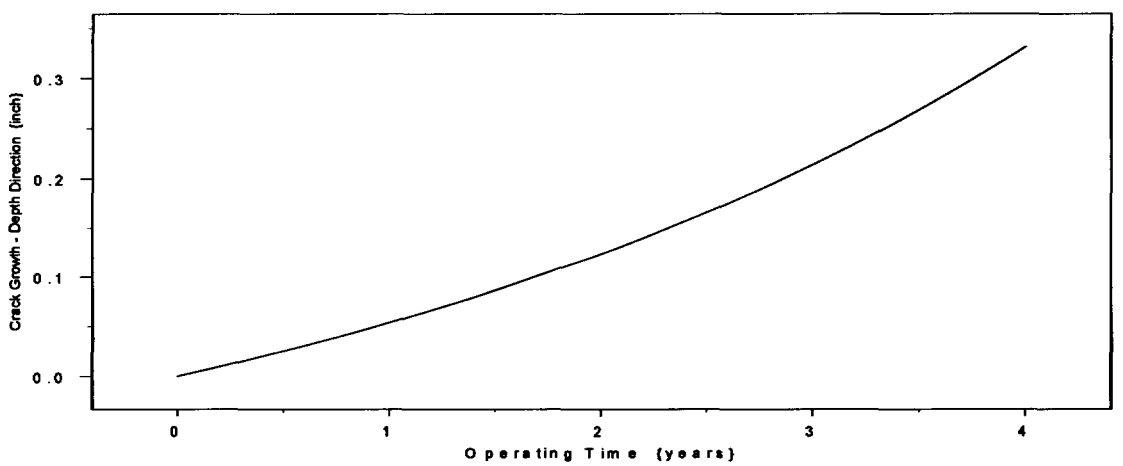
Crack Growth - Depth Direction (inch)
0.3
0.2
0.1
0.0
0
1
2
3
4
Operating Time (years)

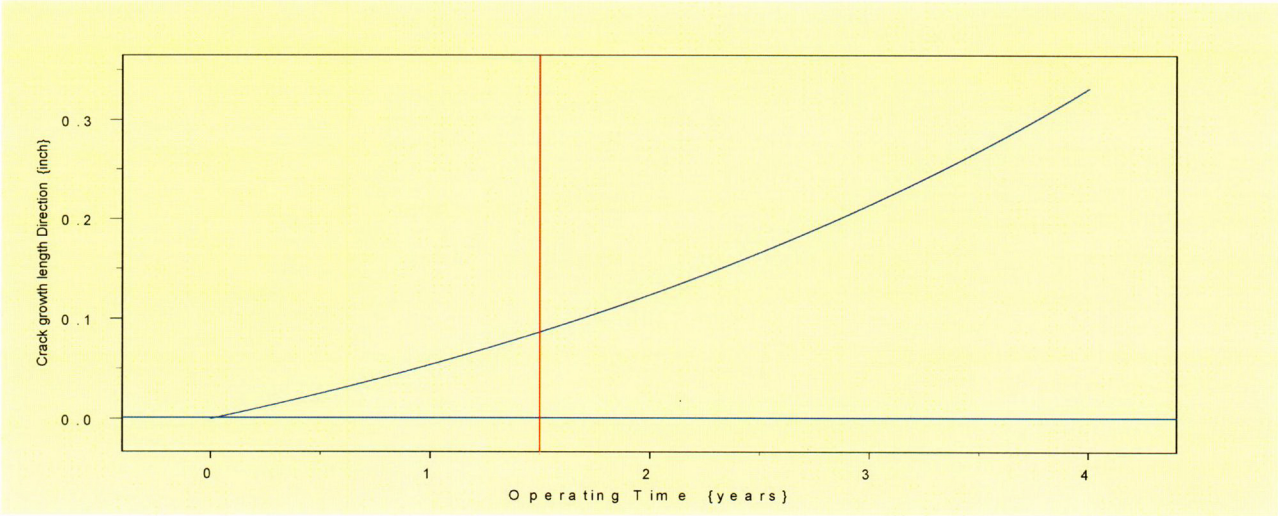
Crack growth length Direction {inch}
0.3
0.2
0.1
0.0
0
1
2
3
4
Operating Time {years}

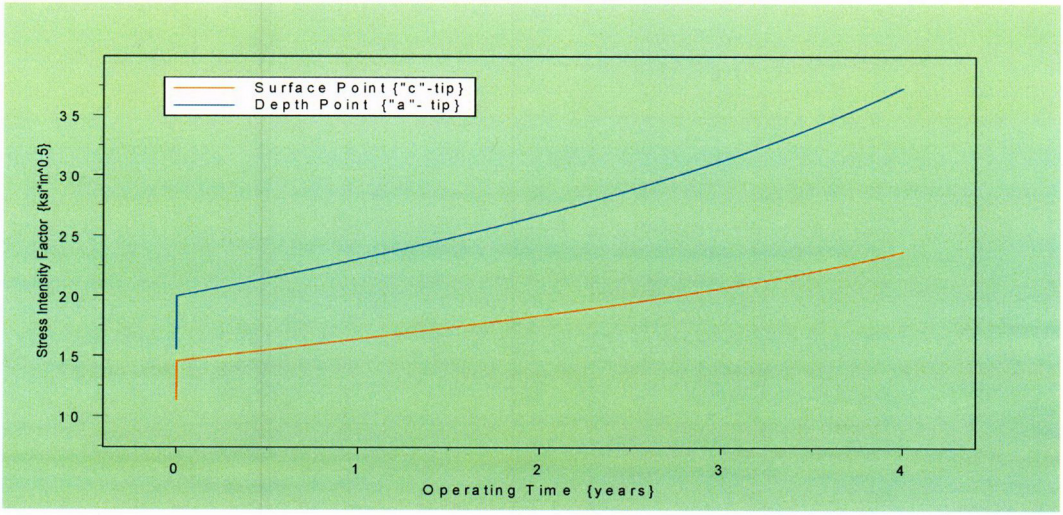
Surface Point {"c"-tip}
Depth Point {"a"- tip}
Stress Intensity Factor {ksi*in^0.5}
35
30
25
20
15
10
0
1
2
3
4
Operating Time {years}

Stress Corrosion Crack Growth Analysis Throughwall flaw

Developed by Central Engineering Programs, Entergy Operations Inc

Developedby: J. S. Brihmadesam **Verified by: B. C. Gray**

Note : Only for use when $R_{outside}/t$ is between 2.0 and 5.0 (Thickwall Cylinder)

Refrences :

1) ASME PVP paper PVP-350, Page 143; 1997 {Fracture Mechanics Model}
2) Crack Growth of Alloy 600 Base Metal in PWR Environments; EPRI MRP Report MRP 55 Rev. 1, 2002

Arkansas Nuclear One Unit 2

Component : Reactor Vessel CEDM -"28"Degree Nozzle, Downhill Azimuth, 1.544 inch above Nozzle Bottom

Calculation Reference: MRP 75 th Percentile and Flaw Pressurized

Note : *Used the Metric form of the equation from EPRI MRP 55-Rev. 1.*
The correction is applied in the determination of the crack extension to obtain the value in inch/hr.

Through Wall Axial Flaw

The first Input is to locate the Reference Line (eg. top of the Blind Zone). The throughwall flaw "Upper Tip" is located at the Reference Line.

Enter the elevation of the Reference Line (eg.Blind Zone) above the nozzle bottom in inches.

$BZ := 1.544$ Location of Blind Zone above nozzle bottom (inch)

The Second Input is the Upper Limit for the evaluation, which is the bottom of the fillet weld leg. This is shown on the Excel spread sheet as weld bottom. Enter this dimension (measured from nozzle bottom) below.

$UL_{Strs.Dist} := 1.704$ Upper axial Extent for Stress Distribution to be used in the analysis (Axial distance above nozzle bottom)

Input Data :-

$L := 0.25$	Initial Flaw Length TW axial (Based on 10 Ksi average stress)
$od := 4.05$	Tube OD
$id := 2.728$	Tube ID
$P_{Int} := 2.235$	Design Operating Pressure (internal)
$Years := 4$	Number of Operating Years
$I_{lim} := 1500$	Iteration limit for Crack Growth loop
$T := 604$	Estimate of Operating Temperature
$v := 0.307$	Poissons ratio @ 600 F
$\alpha_{0c} := 2.67 \cdot 10^{-12}$	Constant in MRP PWSCC Model for I-600 Wrought @ 617 deg. F
$Q_g := 31.0$	Thermal activation Energy for Crack Growth {MRP)
$T_{ref} := 617$	Reference Temperature for normalizing Data deg. F

$$C_0 := e^{\left[\frac{-Q_g}{1.103 \cdot 10^{-3}} \cdot \left(\frac{1}{T+459.67} - \frac{1}{T_{ref}+459.67}\right)\right]} \cdot \alpha_{0c} \qquad Tim_{opr} := Years \cdot 365 \cdot 24$$

$$R_o := \frac{od}{2} \qquad R_i := \frac{id}{2} \qquad t := R_o - R_i \qquad R_m := R_i + \frac{t}{2} \qquad CF_{inhr} := 1.417 \cdot 10^5$$

$$C_{blk} := \frac{Tim_{opr}}{I_{lim}} \qquad Prnt_{blk} := \left|\frac{I_{lim}}{50}\right| \qquad l := \frac{L}{2}$$

Stress Distribution in the tube. The outside surface is the reference surface for all analysis in accordance with the reference.

Stress Input Data

Import the Required data from applicable Excel spread Sheet. The column designations are as follows:
Cloumn "0" = Axial distance from Minimum to Maximum recorded on the data sheet (inches)
Column "1" = ID Stress data at each Elevation (ksi)
Column "5" = OD Stress data at each Elevation (ksi)

$Data_{All} :=$

	0	1	2	3	4	5
0	0	-17.41	-13.55	-11.11	-8.88	-6.63
1	0.46	-8.49	-6.31	-4.92	-3.71	-2.54
2	0.83	0.09	0.18	0.11	0.19	0.28
3	1.13	7.03	6.95	6.31	5.21	4.65
4	1.36	8.22	10.95	10.85	9.51	5.65
5	1.55	13.27	16.41	16.06	17.13	25.26
6	1.7	20.63	22.24	25.41	43.58	53.78
7	1.83	29.04	28.83	31.29	53.55	64.08
8	1.95	33.95	30.93	36.41	61.6	71.01
9	2.07	29.59	31.79	40.54	64.61	76.42
10	2.19	23.26	29.74	41.2	64.19	79.63
11	2.31	18.69	27.73	41.29	61.78	78.12

$AllAxl := Data_{All}^{\langle 0 \rangle}$ $AllID := Data_{All}^{\langle 1 \rangle}$ $AllOD := Data_{All}^{\langle 5 \rangle}$

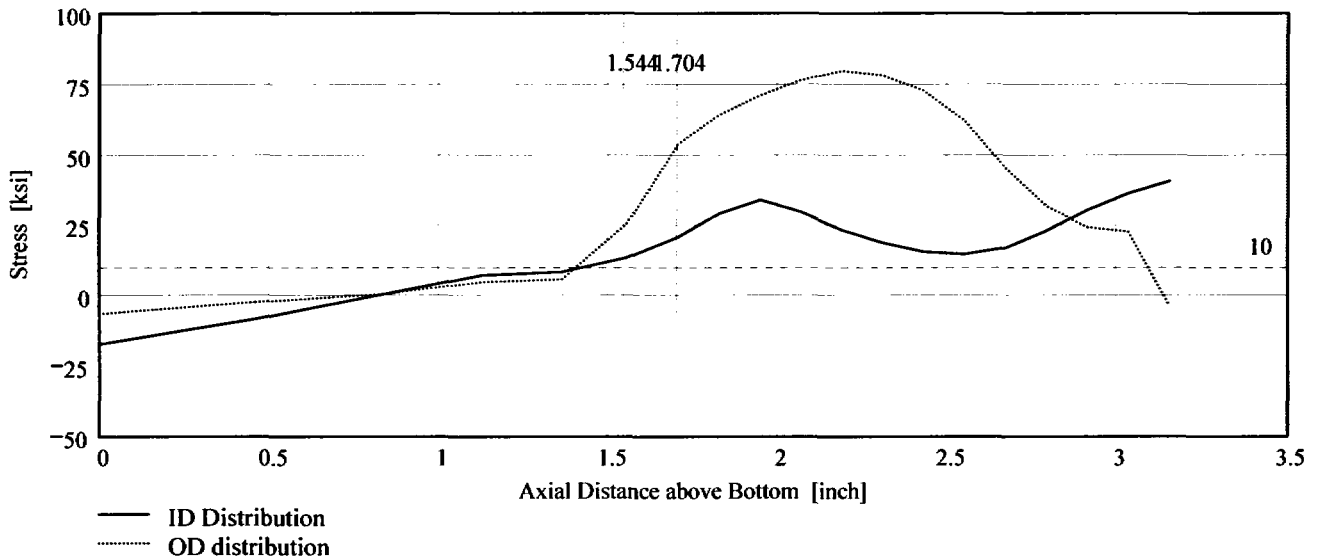

Observing the stress distribution select the region in the table above labeled $Data_{All}$ that represents the region of interest. This needs to be done especially for distributions that have a large compressive stress at the nozzle bottom and high tensile stresses at the J-weld location. Copy the selection in the above table , click on the "Data" statement below and delete it from the edit menu. Type "Data and the Mathcad "equal" sign (Shift-Colon) then insert the same to the right of the Mathcad Equals sign below (paste symbol).

$$Data := \begin{pmatrix} 0 & -17.414 & -13.552 & -11.113 & -8.884 & -6.628 \\ 0.461 & -8.494 & -6.31 & -4.924 & -3.706 & -2.541 \\ 0.83 & 0.089 & 0.179 & 0.11 & 0.186 & 0.284 \\ 1.126 & 7.025 & 6.953 & 6.314 & 5.208 & 4.646 \\ 1.363 & 8.215 & 10.954 & 10.85 & 9.512 & 5.646 \\ 1.552 & 13.266 & 16.41 & 16.061 & 17.131 & 25.256 \\ 1.704 & 20.627 & 22.237 & 25.413 & 43.58 & 53.784 \\ 1.825 & 29.036 & 28.83 & 31.285 & 53.547 & 64.082 \\ 1.946 & 33.945 & 30.929 & 36.407 & 61.6 & 71.01 \\ 2.066 & 29.591 & 31.788 & 40.536 & 64.612 & 76.418 \\ 2.187 & 23.26 & 29.738 & 41.2 & 64.193 & 79.626 \\ 2.308 & 18.689 & 27.734 & 41.29 & 61.777 & 78.117 \end{pmatrix}$$

$Axl := Data^{\langle 0 \rangle}$ $ID := Data^{\langle 1 \rangle}$ $OD := Data^{\langle 5 \rangle}$

$R_{ID} := regress(Axl, ID, 3)$ $R_{OD} := regress(Axl, OD, 3)$

$FL_{Cntr} := BZ - l$ Flaw Center above Nozzle Bottom

$$Inc_{Strs.avg} := \frac{UL_{Strs.Dist} - BZ}{20}$$

No User Input required beyond this Point

Sat Aug 09 11:44:49 AM 2003

$Prop_{Length} = 0.16$

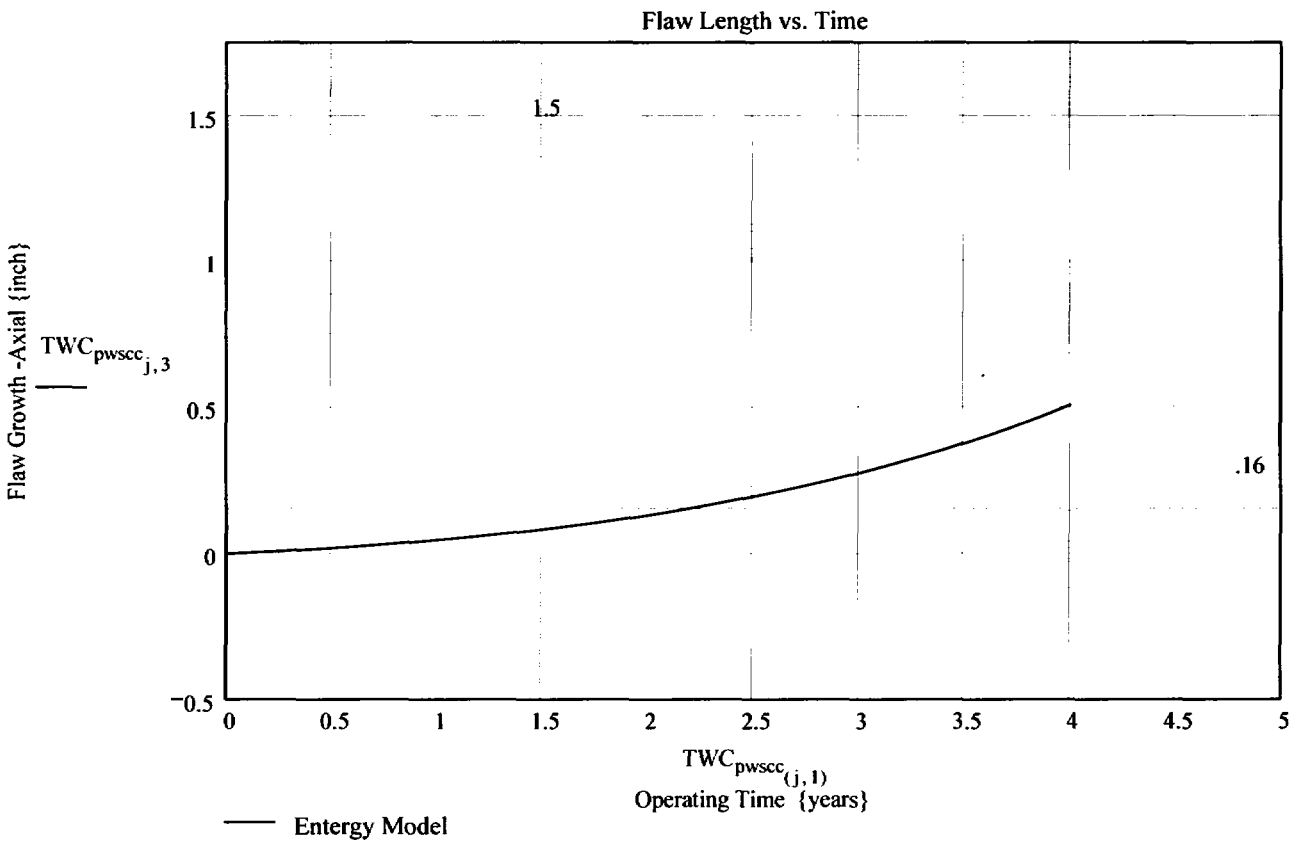

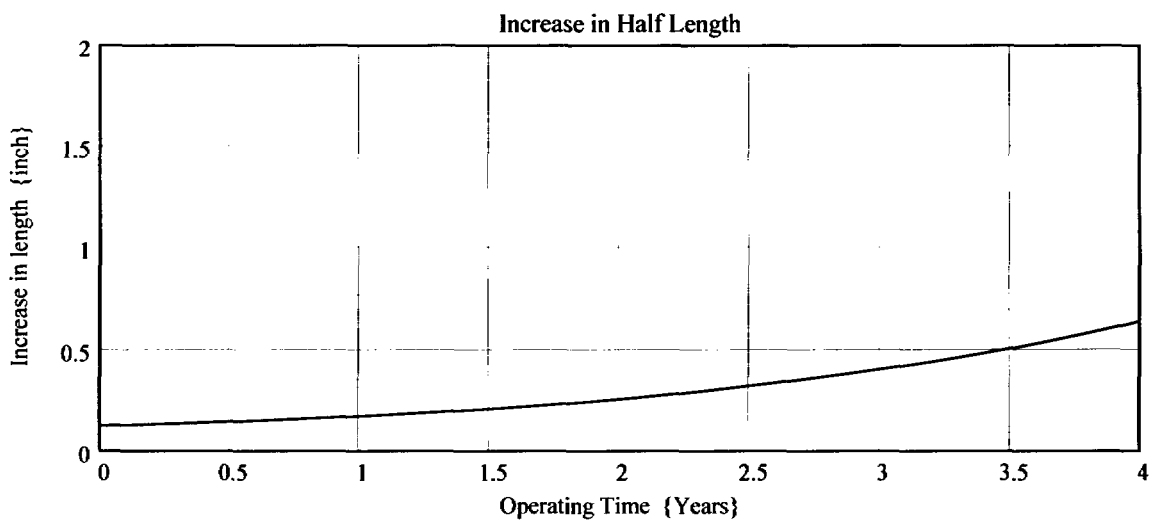

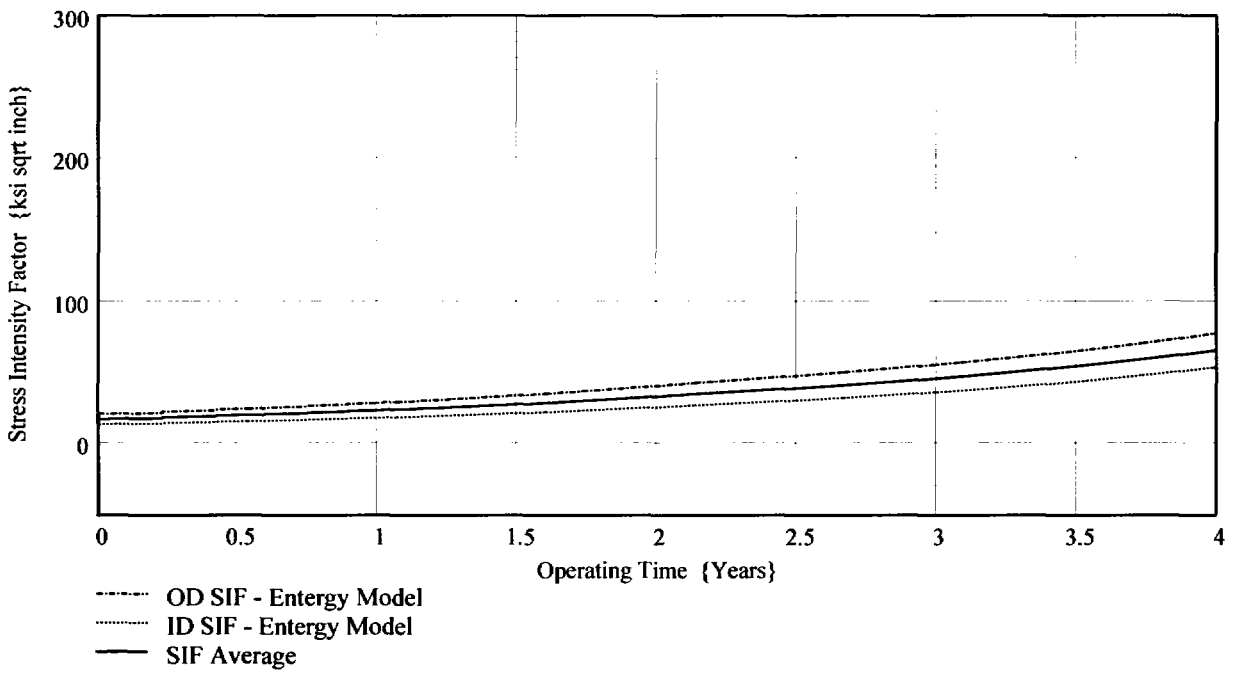
300
200
100
0
Stress Intensity Factor {ksi sqrt inch}
0
0.5
1
1.5
2
2.5
3
3.5
4
Operating Time {Years}
OD SIF - Entergy Model
ID SIF - Entergy Model
SIF Average

$TWC_{pwscc_{(j,6)}}$ =

19.249
20.707
20.715
20.724
20.732
20.741
20.749
20.758
20.766
20.774
20.783
20.791
20.8
20.808
20.817
20.826

$TWC_{pwscc_{(j,7)}}$ =

12.744
13.424
13.43
13.436
13.442
13.447
13.453
13.459
13.465
13.471
13.476
13.482
13.488
13.494
13.5
13.506

$TWC_{pwscc_{(j,8)}}$ =

16.124
17.198
17.205
17.212
17.22
17.227
17.234
17.242
17.249
17.257
17.264
17.271
17.279
17.286
17.293
17.301

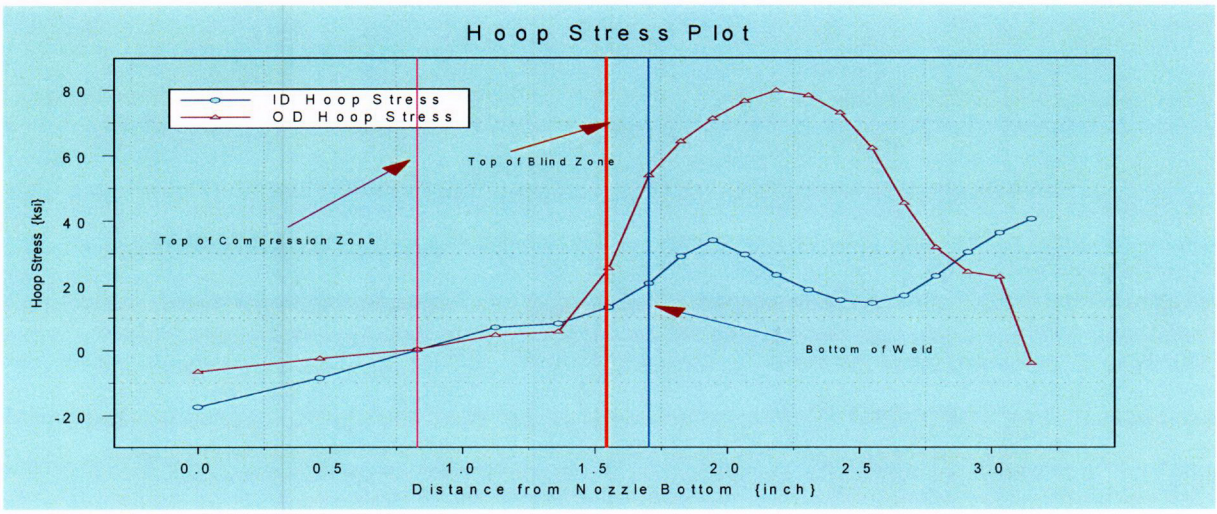
Hoop Stress Plot
ID Hoop Stress
OD Hoop Stress
Top of Blind Zone
Top of Compression Zone
Bottom of Weld
Hoop Stress (ksi)
80
60
40
20
0
-20
0.0
0.5
1.0
1.5
2.0
2.5
3.0
Distance from Nozzle Bottom (inch)

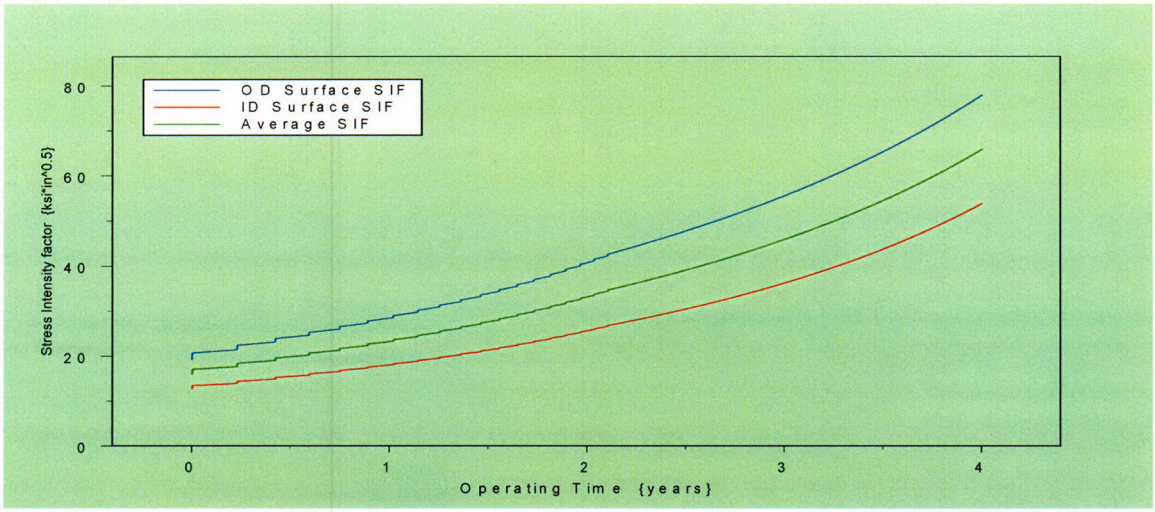
OD Surface SIF
ID Surface SIF
Average SIF
Stress Intensity factor (ksi*in^0.5)
80
60
40
20
0
0
1
2
3
4
Operating Time (years)

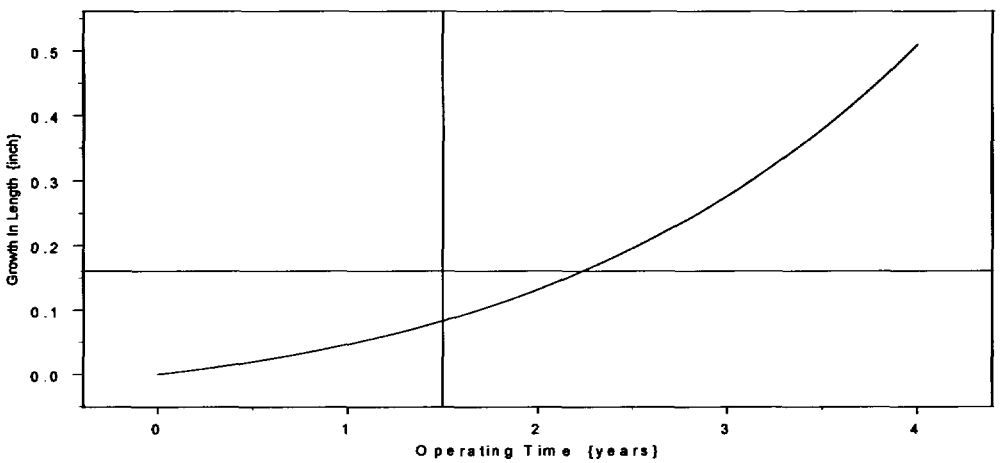
0.5
0.4
0.3
0.2
0.1
0.0
Growth in Length (inch)
0
1
2
3
4
Operating Time (years)

Primary Water Stress Corrosion Crack Growth Analysis ID flaw;
Developed by Central Engineering Porgrams, Entergy Operations Inc.

Developed by: J. S. Brihmadesam ***Verified by: B. C. Gray***

Refrences :

1) "Stress Intensity factors for Part-through Surface cracks"; NASA TM-11707; July 1992.
2) Crack Growth of Alloy 600 Base Metal in PWR Environments; EPRI MRP Report MRP 55 Rev. 1, 2002

Arkansas Nuclear One Unit 2

Component : Reactor Vessel CEDM -"28" Degree Nozzle, UPhill Azimuth, 1.544" above Nozzle Bottom

Calculation Basis: MRP 75 th Percentile and Flaw Face Pressurized

Mean Radius -to- Thickness Ratio:- "R_m/t" – between 1.0 and 300.0

Note : ***Used the Metric form of the equation from EPRI MRP 55-Rev. 1.***
The correction is applied in the determination of the crack extension to obtain the value in inch/hr .

ID Surface Flaw

The first Required input is a location for a point on the tube elevation to define the point of interest (e.g. The top of the Blind Zone, or bottom of fillet weld etc.). This reference point is necessar to evaluate the stress distribution on the flaw both for the initial flaw and for a growing flaw. This is defined as the reference point. Enter a number (inch) that represnets the reference point elevation measured upward from the nozzle end.

$$Ref_{Point} := 1.544$$

To place the flaw with repsect to the reference point, the flaw tips and center can be located as follows:

1) The Upper "c- tip" located at the reference point (Enter 1)
2) The Center of the flaw at the reference point (Enter 2)
3) The lower "c- tip" located at the reference point (Enter 3).

$$Val := 2$$

The Input Below is the Upper Limit for the evaluation, which is the bottom of the fillet weld leg. This is shown on the Excel spread sheet as weld bottom. Enter this dimension (measured from nozzle bottom) below.

$UL_{Strs.Dist} := 4.268$ Upper axial Extent for Stress Distribution to be used in the Analysis (Axial distance above nozzle bottom).

Input Data :-

$L := 0.32$ Initial Flaw Length (Twice detectable length)

$a_0 := 0.661 \cdot 0.07$ Initial Flaw Depth (Minimum Detecteble Depth was 5% TW)

$od := 4.05$ Tube OD

$id := 2.728$ Tube ID

$P_{Int} := 2.235$ Design Operating Pressure (internal)

$Years := 4$ Number of Operating Years

$I_{lim} := 1500$ Iteration limit for Crack Growth loop

$T := 604$ Estimate of Operating Temperature

$\alpha_{0c} := 2.67 \cdot 10^{-12}$ Constant in MRP PWSCC Model for I-600 Wrought @ 617 deg. F

$Q_g := 31.0$ Thermal activation Energy for Crack Growth (MRP)

$T_{ref} := 617$ Reference Temperature for normalizing Data deg. F

$R_o := \frac{od}{2}$ $R_{id} := \frac{id}{2}$ $t := R_o - R_{id}$ $R_m := R_{id} + \frac{t}{2}$ $Tim_{opr} := Years \cdot 365 \cdot 24$

$CF_{inhr} := 1.417 \cdot 10^5$ $C_{blk} := \frac{Tim_{opr}}{I_{lim}}$ $Prnt_{blk} := \left| \frac{I_{lim}}{50} \right|$ $c_0 := \frac{L}{2}$ $R_t := \frac{R_m}{t}$

$C_{01} := e^{\left[\frac{-Q_g}{1.103 \cdot 10^{-3}} \cdot \left(\frac{1}{T+459.67} - \frac{1}{T_{ref}+459.67}\right)\right] \cdot \alpha_{0c}}$ Temperature Correction for Coefficient Alpha

$C_0 := C_{01}$ 75 th percentile MRP-55 Revision 1

Stress Input Data

Input all available Nodal stress data in the table below. The column designations are as follows:
Column "0" = Axial distance from minimum to maximum recorded on data sheet (inches)
Column "1" = ID Stress data at each Elevation (ksi)
Cloumn "2" = Quarter Thickness Stress data at each Elevation (ksi)
Cloumn "3" = Mid Thickness Stress data at each Elevation (ksi)
Column "4" = Three quarter Thickness Stress data at each Elevation (ksi)
Column "5" = OD Stress data at each Elevation (ksi)

AllData :=

	0	1	2	3	4	5
0	0	-9.03	-5.86	-4.25	-2.69	-1.03
1	1.15	-6.76	-6.74	-7.24	-7.66	-7.8
2	2.08	7.97	1.74	-6.23	-11.85	-16.39
3	2.82	23.85	21.76	8.56	-6.39	-17.65
4	3.41	43.99	38.07	29.83	13.47	-1.63
5	3.89	47.95	41.75	35.45	33.32	35.85
6	4.27	43.76	39.21	38.4	53.02	57.54
7	4.38	40.77	36.24	41.27	61.45	62.19
8	4.49	39.28	35.33	44.86	64.2	63.9
9	4.6	36.02	35.39	46.84	64.32	62.93

$AXLen := AllData^{\langle 0 \rangle}$ $ID_{All} := AllData^{\langle 1 \rangle}$ $OD_{All} := AllData^{\langle 5 \rangle}$

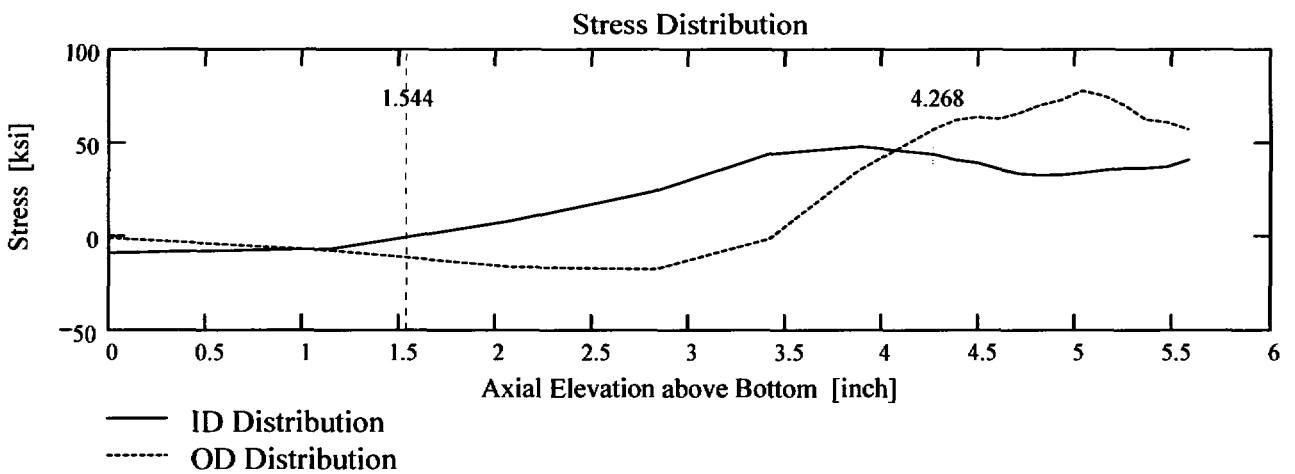

Observing the stress distribution select the region in the table above labeled $Data_{All}$ that represents the region of interest. This needs to be done especially for distributions that have a large compressive stress at the nozzle bottom and high tensile stresses at the J-weld location. Higlight the region in the above table representing the region to be selected (click on the first cell for selection and drag the mouse whilst holding the left mosue button down. Once this is done click the right mouse button and select "Copy Selection"; this will copy the selected area on to the clipboard. Then click on the "Matrix" below (to the right of the dtat statement) to highlight the entire matrix and delete it from the edit menu. When the Mathcad input symbol appears, use the paste function in the tool bar to paste the selection.

$$Data := \begin{pmatrix} 0 & -9.034 & -5.855 & -4.246 & -2.689 & -1.031 \\ 1.154 & -6.761 & -6.739 & -7.237 & -7.662 & -7.803 \\ 2.078 & 7.965 & 1.742 & -6.23 & -11.848 & -16.387 \\ 2.819 & 23.851 & 21.763 & 8.555 & -6.39 & -17.647 \\ 3.412 & 43.99 & 38.072 & 29.826 & 13.47 & -1.632 \\ 3.888 & 47.954 & 41.753 & 35.453 & 33.324 & 35.846 \\ 4.268 & 43.756 & 39.214 & 38.4 & 53.023 & 57.543 \\ 4.377 & 40.773 & 36.237 & 41.27 & 61.453 & 62.189 \\ 4.486 & 39.277 & 35.327 & 44.863 & 64.204 & 63.895 \end{pmatrix}$$

$Axl := Data^{\langle 0 \rangle}$ $MD := Data^{\langle 3 \rangle}$ $ID := Data^{\langle 1 \rangle}$ $TQ := Data^{\langle 4 \rangle}$ $QT := Data^{\langle 2 \rangle}$ $OD := Data^{\langle 5 \rangle}$

$R_{ID} := regress(Axl, ID, 3)$ $R_{QT} := regress(Axl, QT, 3)$

$R_{OD} := regress(Axl, OD, 3)$

$R_{MD} := regress(Axl, MD, 3)$ $R_{TQ} := regress(Axl, TQ, 3)$

$$FL_{Cntr} := \begin{cases} Ref_{Point} - c_0 & \text{if } Val = 1 \\ Ref_{Point} & \text{if } Val = 2 \\ Ref_{Point} + c_0 & \text{otherwise} \end{cases}$$

Flaw center Location above Nozzle Bottom

$$U_{Tip} := FL_{Cntr} + c_0$$

$$Inc_{Strs.avg} := \frac{UL_{Strs.Dist} - U_{Tip}}{20}$$

No User Input is required beyond this Point

Sat Aug 09 10:59:39 AM 2003

$Prop_{Length} = 2.564$

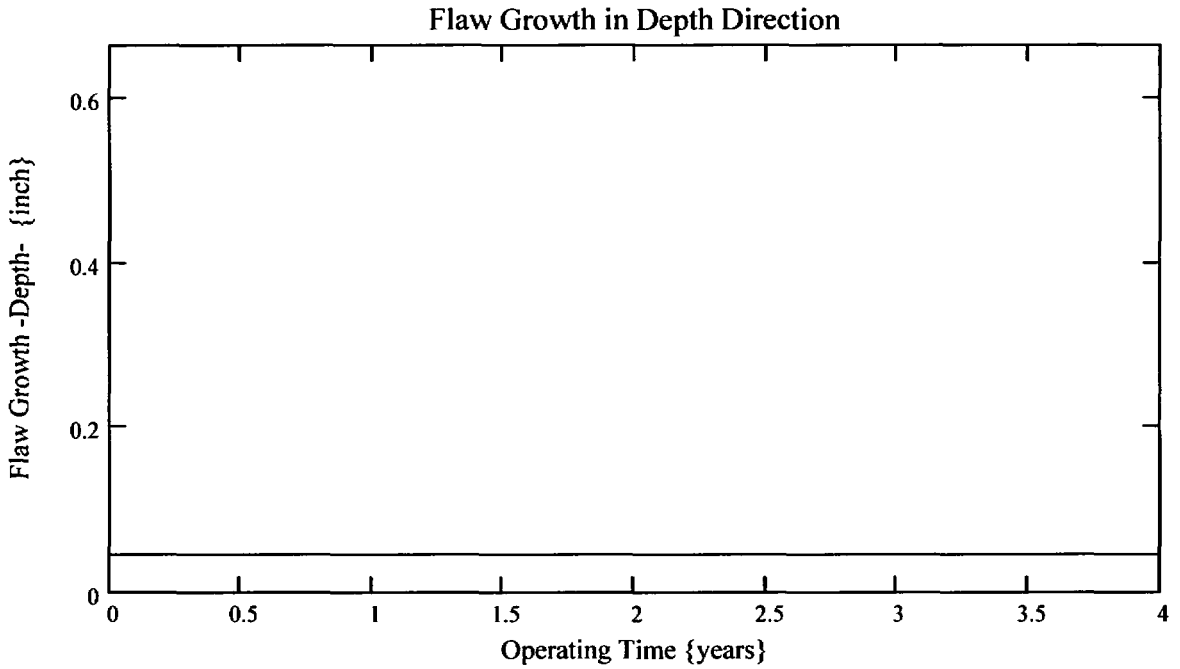

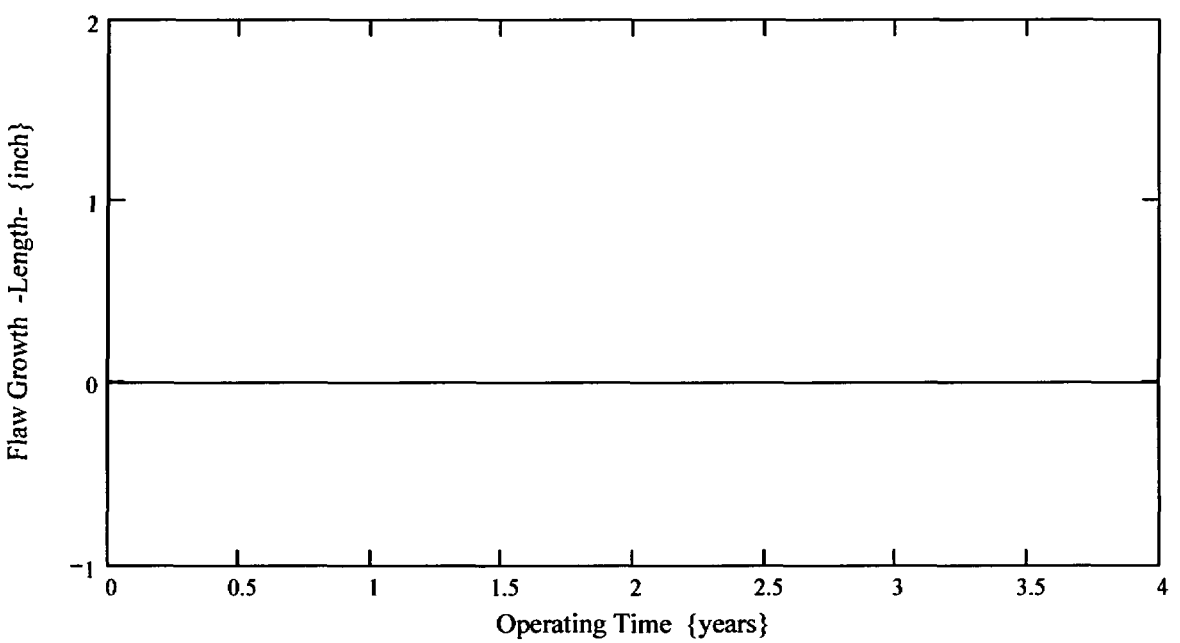

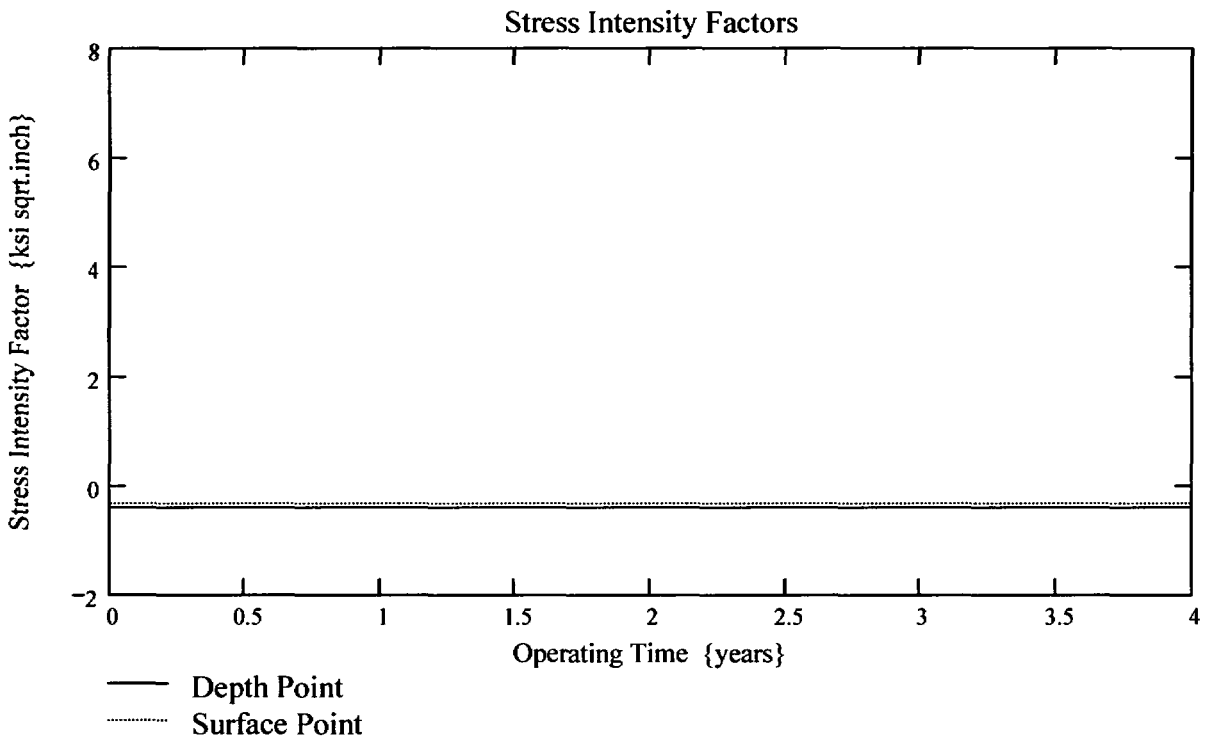
Stress Intensity Factors
Stress Intensity Factor {ksi sqrt.inch}
8
6
4
2
0
−2
0
0.5
1
1.5
2
2.5
3
3.5
4
Operating Time {years}
Depth Point
Surface Point

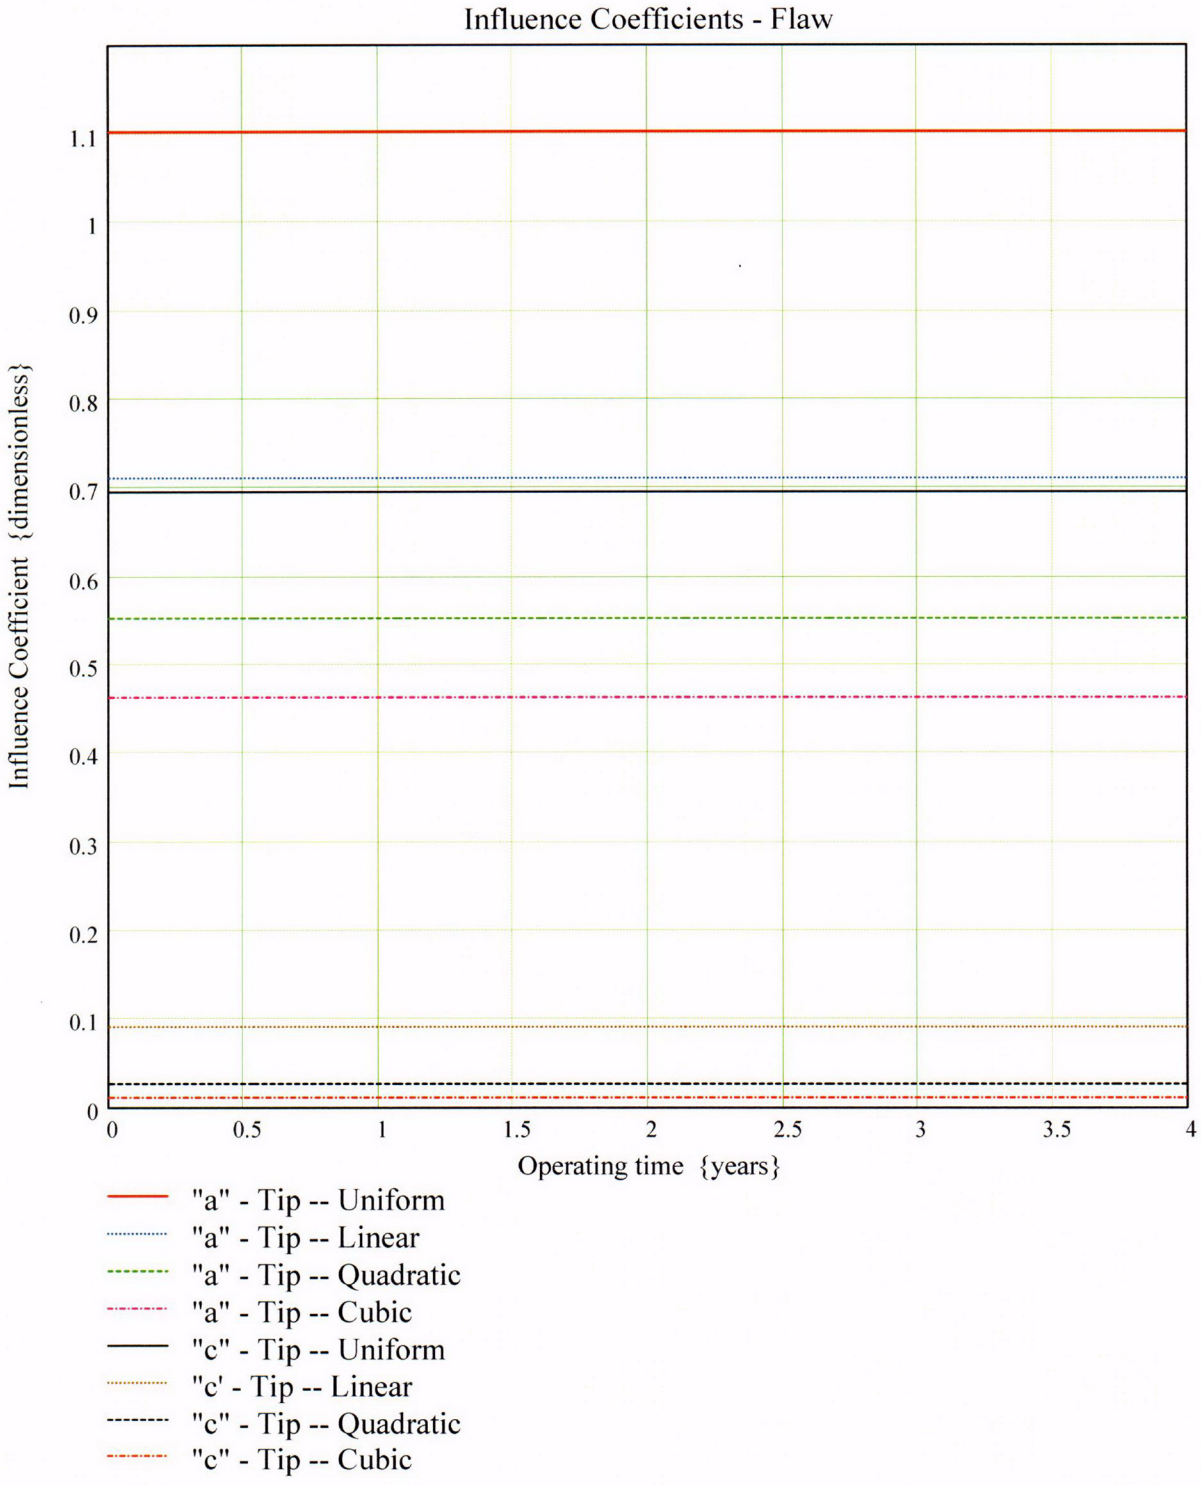
Influence Coefficients - Flaw
Influence Coefficient {dimensionless}
1.1
1
0.9
0.8
0.7
0.6
0.5
0.4
0.3
0.2
0.1
0
0
0.5
1
1.5
2
2.5
3
3.5
4
Operating time {years}
"a" - Tip -- Uniform
"a" - Tip -- Linear
"a" - Tip -- Quadratic
"a" - Tip -- Cubic
"c" - Tip -- Uniform
"c' - Tip -- Linear
"c" - Tip -- Quadratic
"c" - Tip -- Cubic

$CGR_{sambi_{(k,8)}}$ =

1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103

$CGR_{sambi_{(k,6)}}$ =

-0.323
-0.323
-0.323
-0.323
-0.323
-0.323
-0.323
-0.323
-0.323
-0.323
-0.323
-0.323
-0.323
-0.323
-0.323
-0.323
-0.323

$CGR_{sambi_{(k,5)}}$ =

-0.397
-0.397
-0.397
-0.397
-0.397
-0.397
-0.397
-0.397
-0.397
-0.397
-0.397
-0.397
-0.397
-0.397
-0.397
-0.397
-0.397

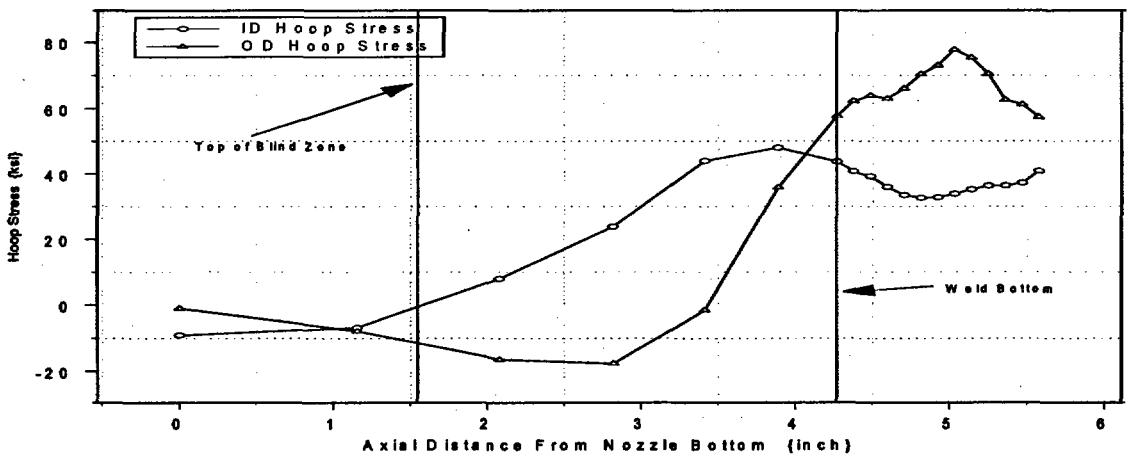
ID Hoop Stress
OD Hoop Stress
Top of Blind Zone
Weld Bottom
Hoop Stress (ksi)
80
60
40
20
0
-20
0
1
2
3
4
5
6
Axial Distance From Nozzle Bottom (inch)

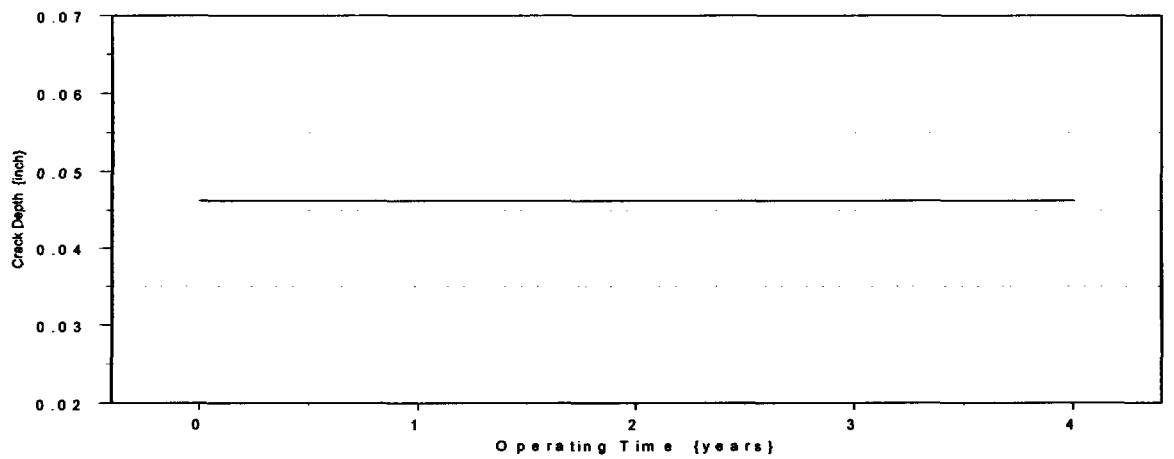
0.07
0.06
0.05
0.04
0.03
0.02
Crack Depth (inch)
0
1
2
3
4
Operating Time (years)

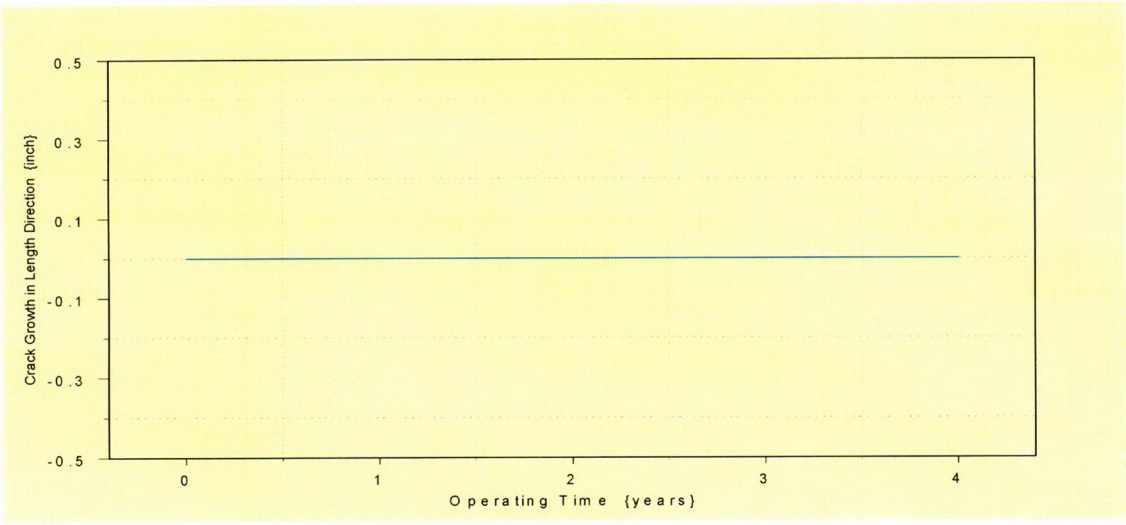
0.5
0.3
0.1
-0.1
-0.3
-0.5
Crack Growth in Length Direction {inch}
0
1
2
3
4
Operating Time {years}

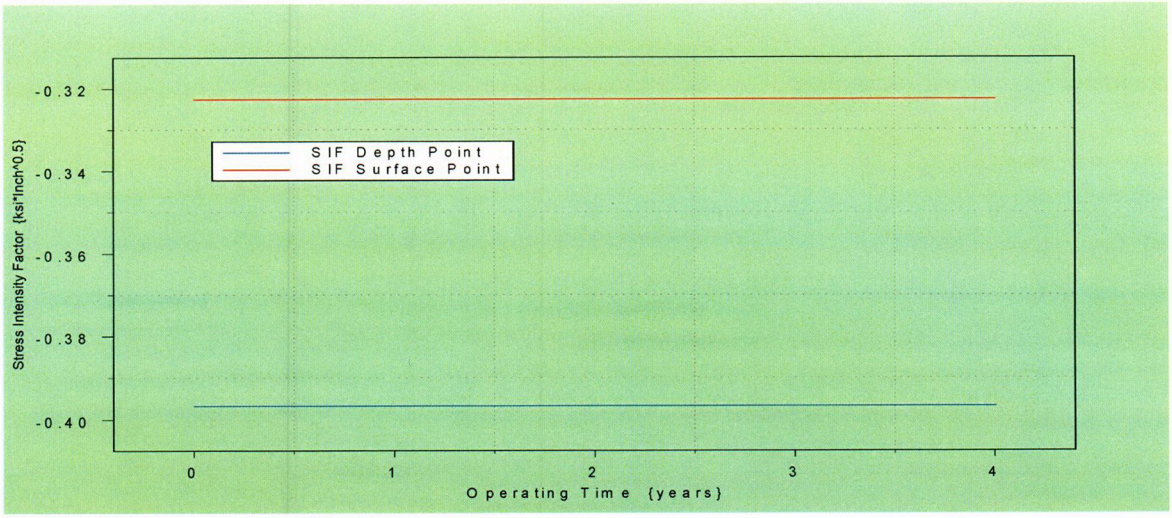
-0.32
-0.34
-0.36
-0.38
-0.40
Stress Intensity Factor (ksi*inch^0.5)
SIF Depth Point
SIF Surface Point
0
1
2
3
4
Operating Time {years}

Primary Water Stress Corrosion Crack Growth Analysis - OD SurfaceFlaw

Developed by Central Engineering Programs, Entergy Operations Inc

Developedby: J. S. Brihmadesam **Verified by: B. C. Gray**

Refrences :

1) "Stress Intensity factors for Part-through Surface cracks"; NASA TM-11707; July 1992.
2) Crack Growth of Alloy 600 Base Metal in PWR Environments; EPRI MRP Report MRP 55 Rev. 1, 2002

Arkansas Nuclear One Unit 2

Component : Reactor Vessel CEDM -"28" Degree Nozzle, Uphill Azimuth, 1.544" above Nozzle Bottom

Calculation Basis: MRP 75 th Percentile and Flaw Face Pressurized

Mean Radius -to- Thickness Ratio:- "R_m/t" -- between 1.0 and 300.0

Note : ***Used the Metric form of the equation from EPRI MRP 55-Rev. 1.***
The correction is applied in the determination of the crack extension to obtain the value in inch/hr .

OD Surface Flaw

The first Required input is a location for a point on the tube elevation to define the point of interest (e.g. The top of the Blind Zone, or bottom of fillet weld etc.). This reference point is necessar to evaluate the stress distribution on the flaw both for the initial flaw and for a growing flaw. This is defined as the reference point. Enter a number (inch) that represnets the reference point elevation measured upward from the nozzle end.

$$Ref_{Point} := 1.544$$

To place the flaw with repsect to the reference point, the flaw tips and center can be located as follows:

1) The Upper "c- tip" located at the reference point (Enter 1)
2) The Center of the flaw at the reference point (Enter 2)
3) The lower "c- tip" located at the reference point (Enter 3).

$$Val := 2$$

Upper Limit to be selected for stress distribution (e.g. Weld bottom). This is the elevation from Nozzle Bottom. Enter this value below

$UL_{Strs.Dist} := 4.268$ Upper Axial Extent for Stress Distribution to be used in the Analysis (Axial distance above nozzle bottom)

Input Data :-

$L := 0.32$ Initial Flaw Length

$a_0 := 0.661 \cdot 0.12$ Initial Flaw Depth

$od := 4.05$ Tube OD

$id := 2.728$ Tube ID

$P_{Int} := 2.235$ Design Operating Pressure (internal)

$Years := 4$ Number of Operating Years

$I_{lim} := 1500$ Iteration limit for Crack Growth loop

$T := 604$ Estimate of Operating Temperature

$\alpha_{0c} := 2.67 \cdot 10^{-12}$ Constant in MRP PWSCC Model for I-600 Wrought @ 617 deg. F

$Q_g := 31.0$ Thermal activation Energy for Crack Growth {MRP)

$T_{ref} := 617$ Reference Temperature for normalizing Data deg. F

$R_o := \frac{od}{2}$ $R_{id} := \frac{id}{2}$ $t := R_o - R_{id}$ $R_m := R_{id} + \frac{t}{2}$ $Tim_{opr} := Years \cdot 365 \cdot 24$

$CF_{inhr} := 1.417 \cdot 10^5$ $C_{blk} := \frac{Tim_{opr}}{I_{lim}}$ $Prnt_{blk} := \left| \frac{I_{lim}}{50} \right|$ $c_0 := \frac{L}{2}$ $R_t := \frac{R_m}{t}$

$$C_{01} := e^{\left[\frac{-Q_g}{1.103 \cdot 10^{-3}} \cdot \left(\frac{1}{T+459.67} - \frac{1}{T_{ref}+459.67}\right)\right]} \cdot \alpha_{0c}$$ Temperature Correction for Coefficient Alpha

$C_0 := C_{01}$ 75 th percentile MRP-55 Revision 1

Stress Input Data

Input all available Nodal stress data in the table below. The column designations are as follows:
Column "0" = Axial distance from minumum to maximum recorded on data sheet(inches)
Column "1" = ID Stress data at each Elevation (ksi)
Column "2" = Quarter Thickness Stress data at each Elevation (ksi)
Column "3" = Mid Thickness Stress data at each Elevation (ksi)
Column "4" = Three Quarter Thickness Stress data at each Elevation (ksi)
Column "5" = OD Stress data at each Elevation (ksi)

AllData :=

	0	1	2	3	4	5
0	0	-9.03	-5.86	-4.25	-2.69	-1.03
1	1.15	-6.76	-6.74	-7.24	-7.66	-7.8
2	2.08	7.97	1.74	-6.23	-11.85	-16.39
3	2.82	23.85	21.76	8.56	-6.39	-17.65
4	3.41	43.99	38.07	29.83	13.47	-1.63
5	3.89	47.95	41.75	35.45	33.32	35.85
6	4.27	43.76	39.21	38.4	53.02	57.54
7	4.38	40.77	36.24	41.27	61.45	62.19
8	4.49	39.28	35.33	44.86	64.2	63.9
9	4.6	36.02	35.39	46.84	64.32	62.93

$AXLen := AllData^{\langle 0 \rangle}$ $ID_{All} := AllData^{\langle 1 \rangle}$ $OD_{All} := AllData^{\langle 5 \rangle}$

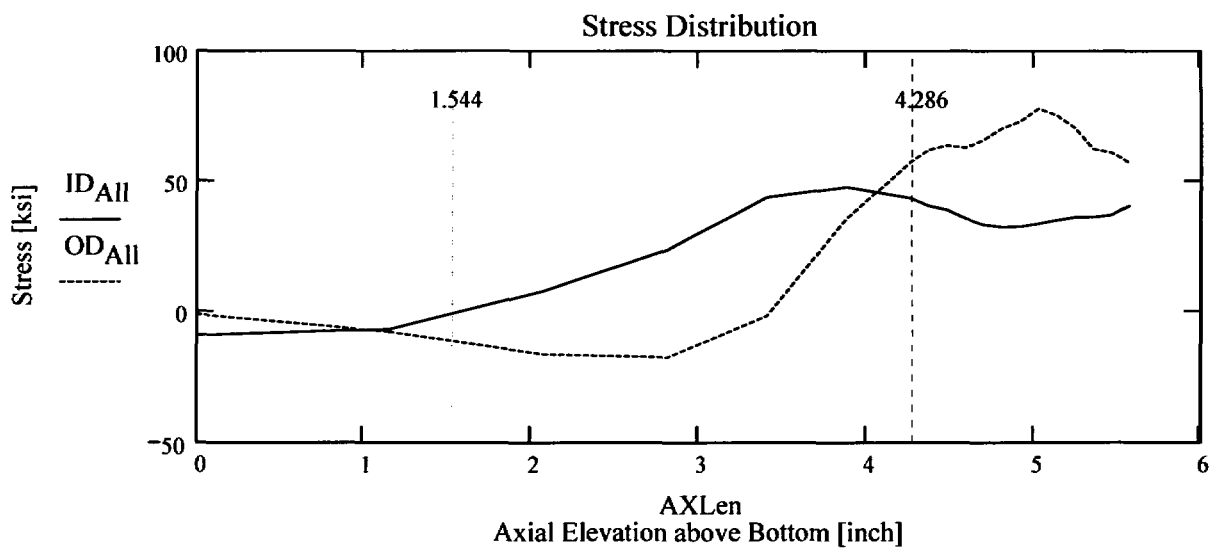

Observing the stress distribution select the region in the table above labeled $Data_{All}$ that represents the region of interest. This needs to be done especially for distributions that have a large compressive stress at the nozzle bottom and high tensile stresses at the J-weld location. Copy the selection in the above table , click on the "Data" statement below and delete it from the edit menu. Type "Data and the Mathcad "equal" sign (Shift-Colon) then insert the same to the right of the Mathcad Equals sign below (paste symbol).

$$Data := \begin{pmatrix} 0 & -9.034 & -5.855 & -4.246 & -2.689 & -1.031 \\ 1.154 & -6.761 & -6.739 & -7.237 & -7.662 & -7.803 \\ 2.078 & 7.965 & 1.742 & -6.23 & -11.848 & -16.387 \\ 2.819 & 23.851 & 21.763 & 8.555 & -6.39 & -17.647 \\ 3.412 & 43.99 & 38.072 & 29.826 & 13.47 & -1.632 \\ 3.888 & 47.954 & 41.753 & 35.453 & 33.324 & 35.846 \\ 4.268 & 43.756 & 39.214 & 38.4 & 53.023 & 57.543 \\ 4.377 & 40.773 & 36.237 & 41.27 & 61.453 & 62.189 \\ 4.486 & 39.277 & 35.327 & 44.863 & 64.204 & 63.895 \end{pmatrix}$$

$Axl := Data^{\langle 0 \rangle}$ $MD := Data^{\langle 3 \rangle}$ $ID := Data^{\langle 1 \rangle}$ $TQ := Data^{\langle 4 \rangle}$ $QT := Data^{\langle 2 \rangle}$ $OD := Data^{\langle 5 \rangle}$

$R_{ID} := regress(Axl, ID, 3)$ $R_{QT} := regress(Axl, QT, 3)$

$R_{OD} := regress(Axl, OD, 3)$

$R_{MD} := regress(Axl, MD, 3)$ $R_{TQ} := regress(Axl, TQ, 3)$

$$FL_{Cntr} := \begin{cases} Ref_{Point} - c_0 & \text{if } Val = 1 \\ Ref_{Point} & \text{if } Val = 2 \\ Ref_{Point} + c_0 & \text{otherwise} \end{cases}$$

Flaw center Location Location above Nozzle Bottom

$U_{Tip} := FL_{Cntr} + c_0$

$$Inc_{Strs.avg} := \frac{UL_{Strs.Dist} - U_{Tip}}{20}$$

No User Input is required beyond this Point

Sat Aug 09 10:21:18 AM 2003

$Prop_{Length} = 2.564$

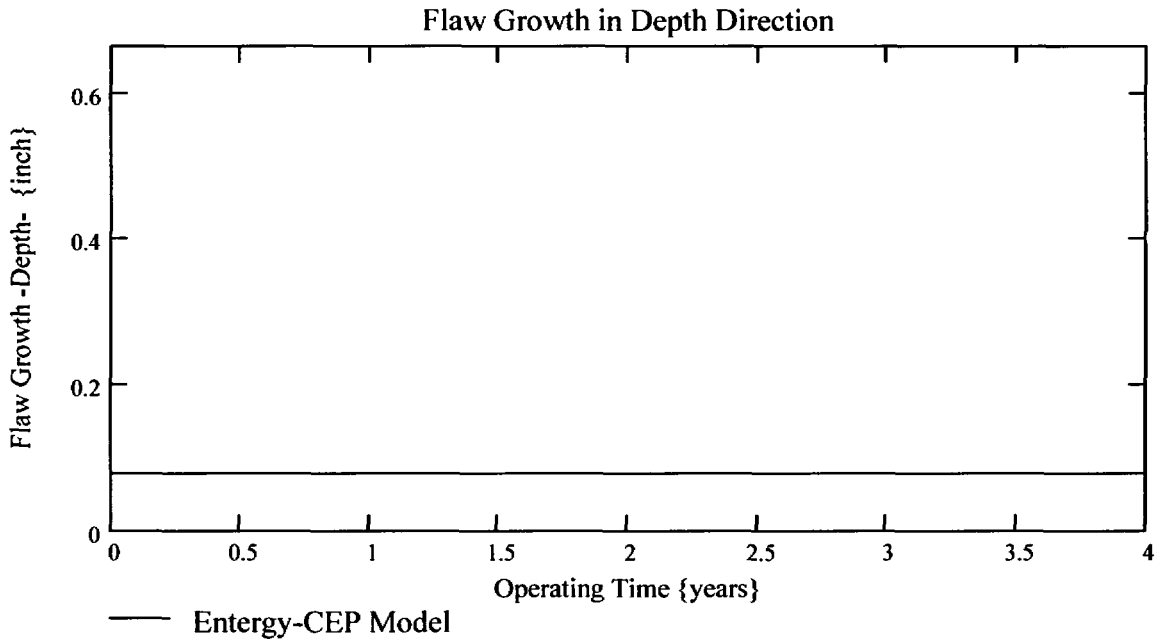

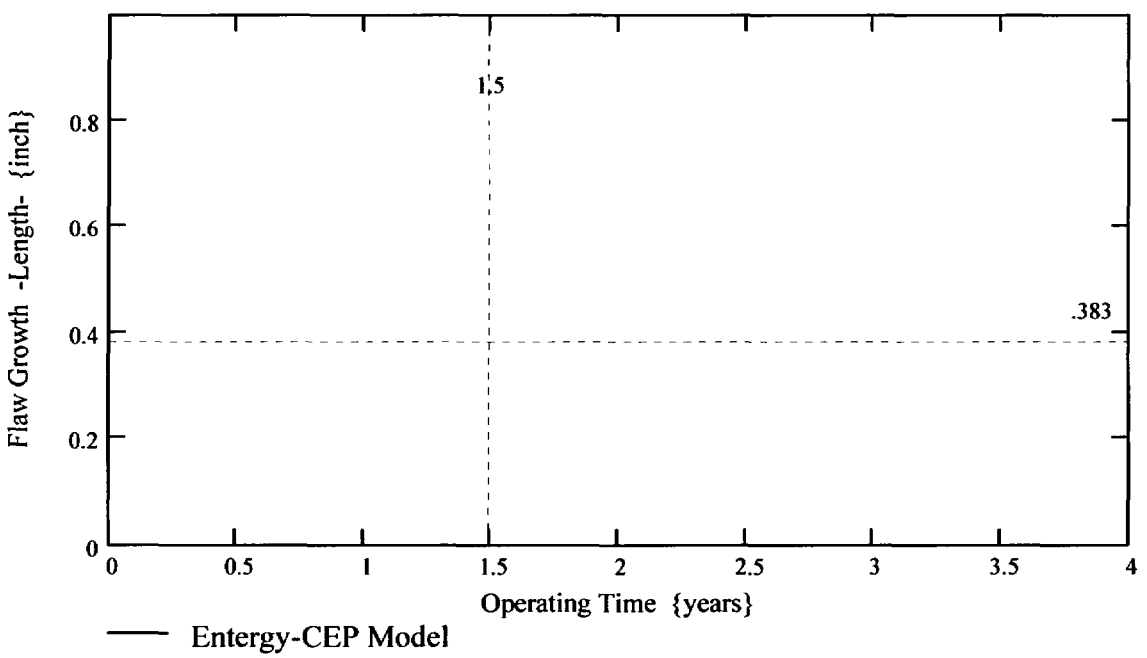

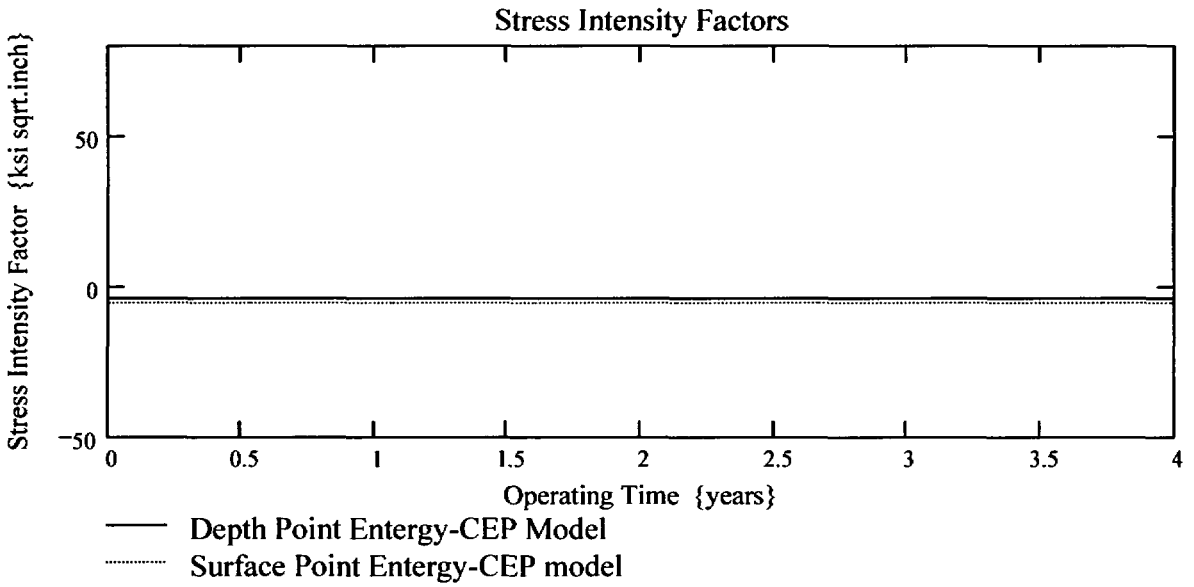
Stress Intensity Factors
Stress Intensity Factor {ksi sqrt.inch}
50
0
−50
0
0.5
1
1.5
2
2.5
3
3.5
4
Operating Time {years}
Depth Point Entergy-CEP Model
Surface Point Entergy-CEP model

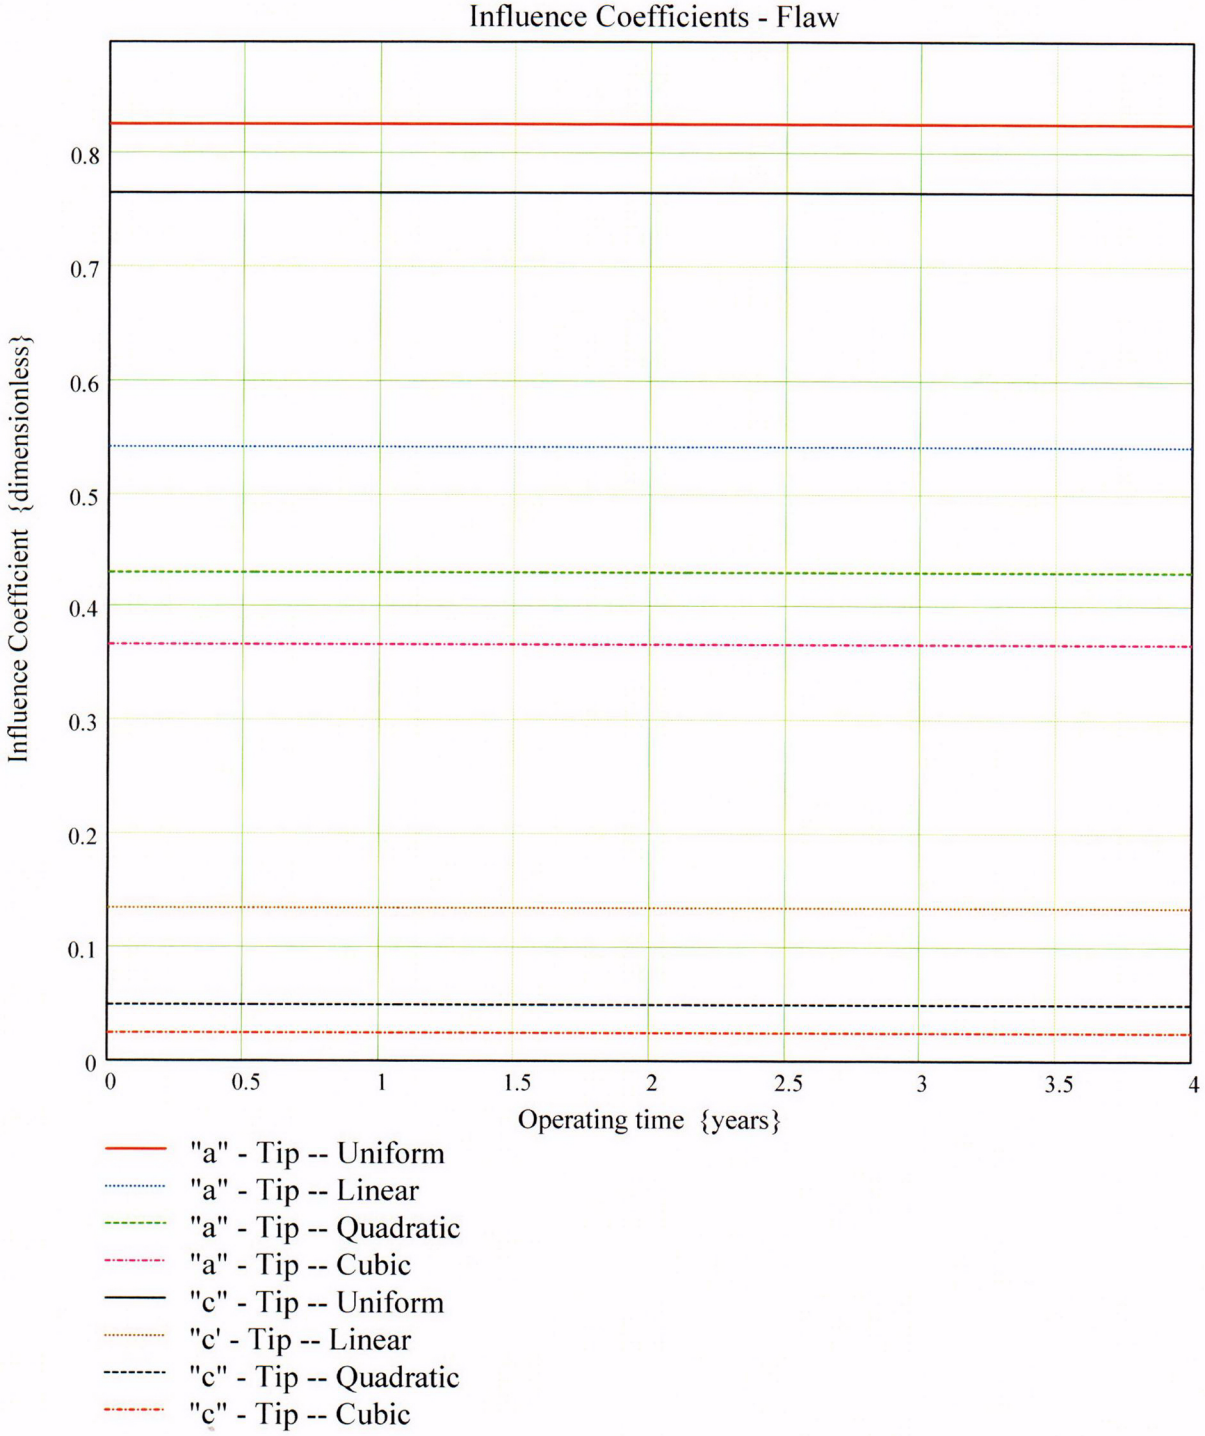

Developed by:
J. S. Brihmadesam

Verified by:
B. C. Gray

C06

$CGR_{sambi_{(k,8)}}$ =

0.827
0.827
0.827
0.827
0.827
0.827
0.827
0.827
0.827
0.827
0.827
0.827
0.827
0.827
0.827
0.827
0.827

$CGR_{sambi_{(k,6)}}$ =

-5.284
-5.284
-5.284
-5.284
-5.284
-5.284
-5.284
-5.284
-5.284
-5.284
-5.284
-5.284
-5.284
-5.284
-5.284
-5.284
-5.284

$CGR_{sambi_{(k,5)}}$ =

-3.812
-3.812
-3.812
-3.812
-3.812
-3.812
-3.812
-3.812
-3.812
-3.812
-3.812
-3.812
-3.812
-3.812
-3.812
-3.812
-3.812

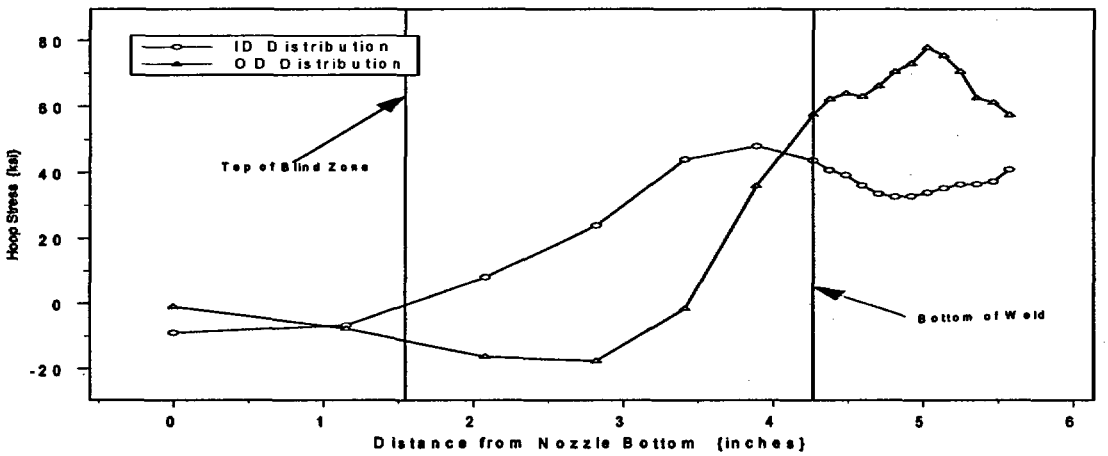
ID Distribution
OD Distribution
Top of Blind Zone
Bottom of Weld
Hoop Stress (ksi)
80
60
40
20
0
-20
0
1
2
3
4
5
6
Distance from Nozzle Bottom (inches)

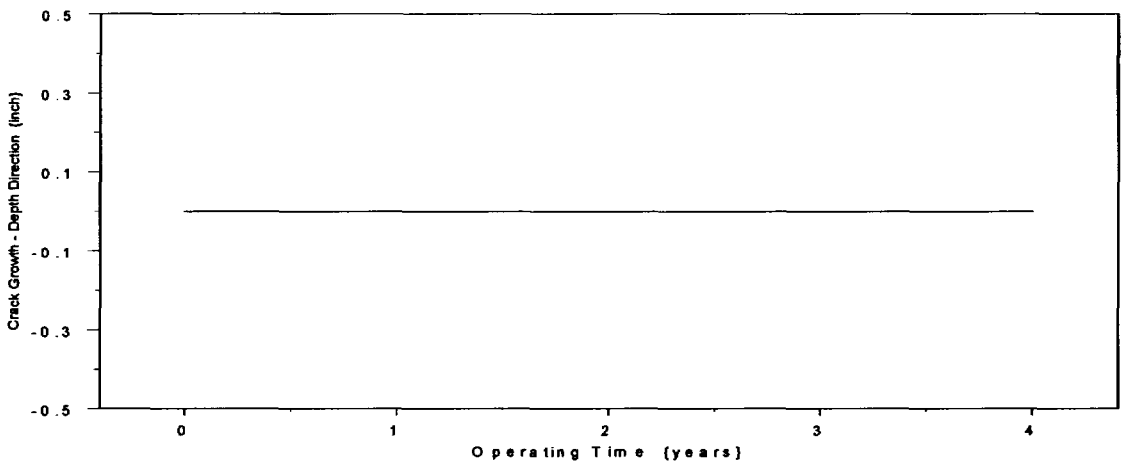
Crack Growth - Depth Direction (inch)
0.5
0.3
0.1
-0.1
-0.3
-0.5
0
1
2
3
4
Operating Time (years)

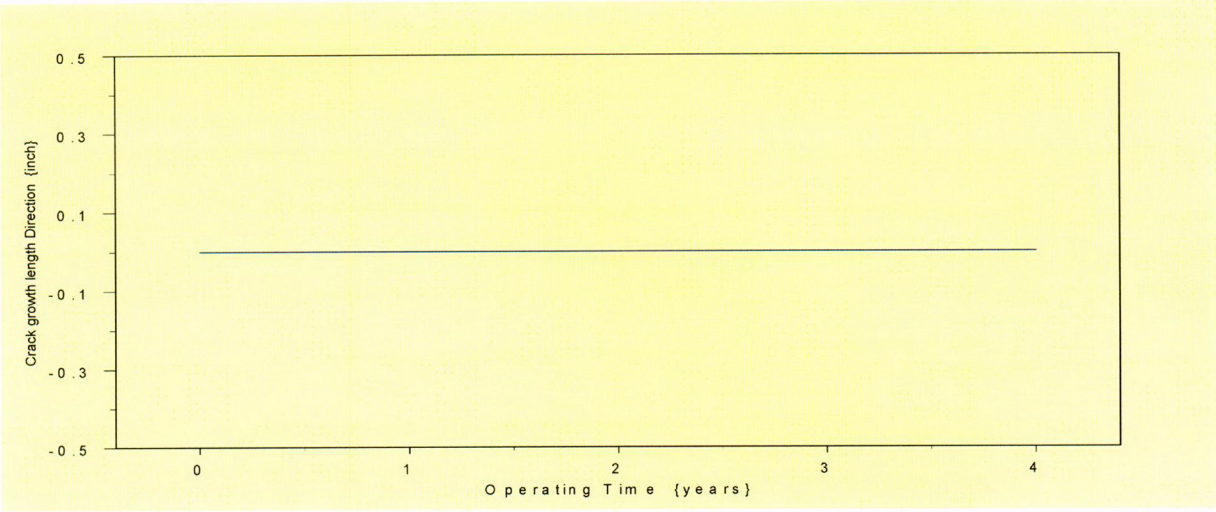
0.5
0.3
0.1
-0.1
-0.3
-0.5
Crack growth length Direction {inch}
0
1
2
3
4
Operating Time {years}

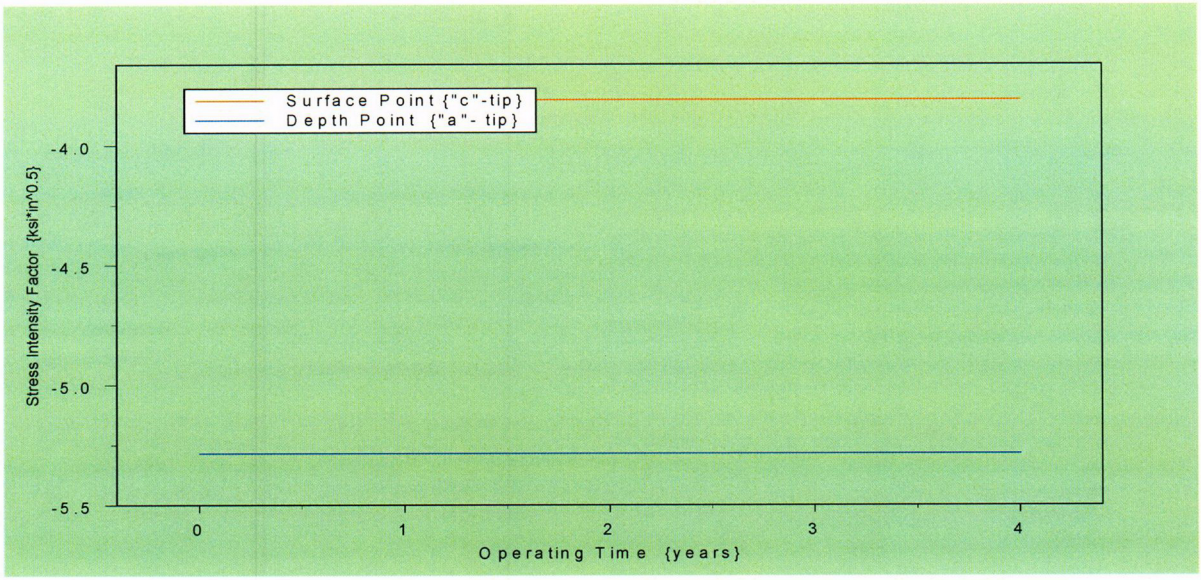
Surface Point {"c"-tip}
Depth Point {"a"-tip}
-4.0
-4.5
-5.0
-5.5
Stress Intensity Factor {ksi*in^0.5}
0
1
2
3
4
Operating Time {years}

Stress Corrosion Crack Growth Analysis Throughwall flaw

Developed by Central Engineering Programs, Entergy Operations Inc

Developedby: J. S. Brihmadesam **Verified by: B. C. Gray**

Note : Only for use when $R_{outside}/t$ is between 2.0 and 5.0 (Thickwall Cylinder)

Refrences :

1) ASME PVP paper PVP-350, Page 143; 1997 {Fracture Mechanics Model}
2) Crack Growth of Alloy 600 Base Metal in PWR Environments; EPRI MRP Report MRP 55 Rev. 1, 2002

Arkansas Nuclear One Unit 2

Component : Reactor Vessel CEDM -"28"Degree Nozzle, Uphill Azimuth, 1.544 inch above Nozzle Bottom

Calculation Reference: MRP 75 th Percentile and Flaw Pressurized

Note : *Used the Metric form of the equation from EPRI MRP 55-Rev. 1.*
The correction is applied in the determination of the crack extension to obtain the value in inch/hr.

Through Wall Axial Flaw

The first Input is to locate the Reference Line (eg. top of the Blind Zone). The throughwall flaw "Upper Tip" is located at the Reference Line.

Enter the elevation of the Reference Line (eg.Blind Zone) above the nozzle bottom in inches.

$BZ := 1.544$ Location of Blind Zone above nozzle bottom (inch)

The Second Input is the Upper Limit for the evaluation, which is the bottom of the fillet weld leg. This is shown on the Excel spread sheet as weld bottom. Enter this dimension (measured from nozzle bottom) below.

$UL_{Strs.Dist} := 4.268$ Upper axial Extent for Stress Distribution to be used in the analysis (Axial distance above nozzle bottom)

Input Data :-

$L := 0.25$	Initial Flaw Length TW axial (Based on 10 Ksi average stress)
$od := 4.05$	Tube OD
$id := 2.728$	Tube ID
$P_{Int} := 2.235$	Design Operating Pressure (internal)
$Years := 4$	Number of Operating Years
$I_{lim} := 1500$	Iteration limit for Crack Growth loop
$T := 604$	Estimate of Operating Temperature
$v := 0.307$	Poissons ratio @ 600 F
$\alpha_{0c} := 2.67 \cdot 10^{-12}$	Constant in MRP PWSCC Model for I-600 Wrought @ 617 deg. F
$Q_g := 31.0$	Thermal activation Energy for Crack Growth {MRP)
$T_{ref} := 617$	Reference Temperature for normalizing Data deg. F

$$C_0 := e^{\left[\frac{-Q_g}{1.103 \cdot 10^{-3}} \cdot \left(\frac{1}{T+459.67} - \frac{1}{T_{ref}+459.67}\right)\right]} \cdot \alpha_{0c} \qquad Tim_{opr} := Years \cdot 365 \cdot 24$$

$$R_o := \frac{od}{2} \qquad R_i := \frac{id}{2} \qquad t := R_o - R_i \qquad R_m := R_i + \frac{t}{2} \qquad CF_{inhr} := 1.417 \cdot 10^5$$

$$C_{blk} := \frac{Tim_{opr}}{I_{lim}} \qquad Prnt_{blk} := \left|\frac{I_{lim}}{50}\right| \qquad l := \frac{L}{2}$$

Stress Distribution in the tube. The outside surface is the reference surface for all analysis in accordance with the reference.

Stress Input Data

Import the Required data from applicable Excel spread Sheet. The column designations are as follows:
Cloumn "0" = Axial distance from Minimum to Maximum recorded on the data sheet (inches)
Column "1" = ID Stress data at each Elevation (ksi)
Column "5" = OD Stress data at each Elevation (ksi)

$Data_{All} :=$

	0	1	2	3	4	5
0	0	-9.03	-5.86	-4.25	-2.69	-1.03
1	1.15	-6.76	-6.74	-7.24	-7.66	-7.8
2	2.08	7.97	1.74	-6.23	-11.85	-16.39
3	2.82	23.85	21.76	8.56	-6.39	-17.65
4	3.41	43.99	38.07	29.83	13.47	-1.63
5	3.89	47.95	41.75	35.45	33.32	35.85
6	4.27	43.76	39.21	38.4	53.02	57.54
7	4.38	40.77	36.24	41.27	61.45	62.19
8	4.49	39.28	35.33	44.86	64.2	63.9
9	4.6	36.02	35.39	46.84	64.32	62.93
10	4.7	33.54	36.17	48.06	64.48	66.03
11	4.81	32.63	36.62	47.78	67.61	70.36

$AllAxl := Data_{All}^{\langle 0 \rangle}$ $AllID := Data_{All}^{\langle 1 \rangle}$ $AllOD := Data_{All}^{\langle 5 \rangle}$

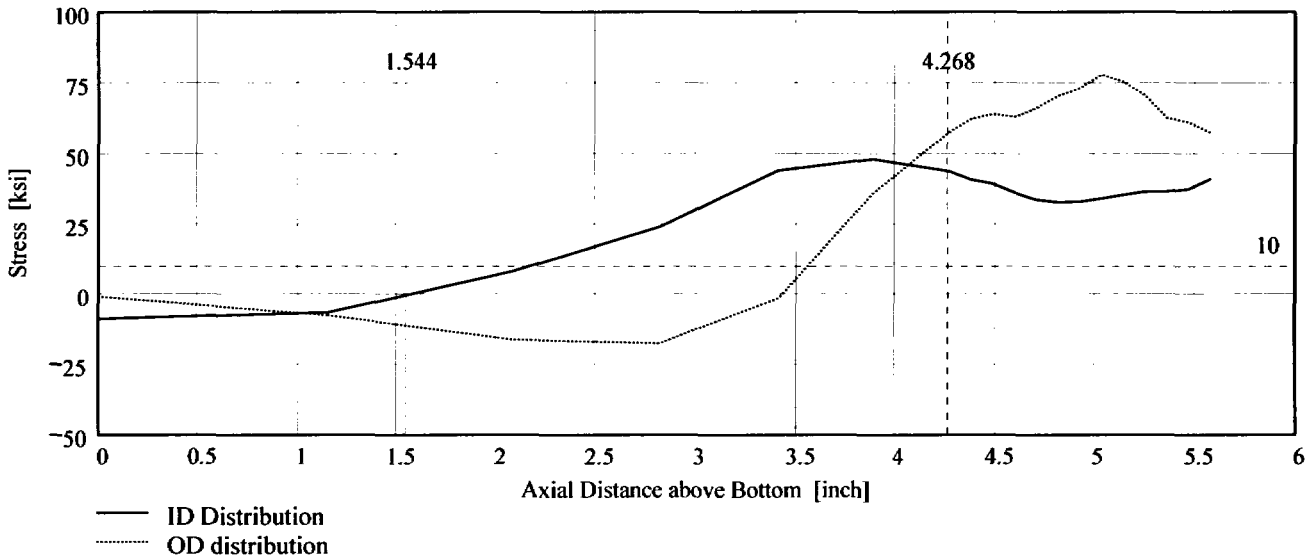

Observing the stress distribution select the region in the table above labeled $Data_{All}$ that represents the region of interest. This needs to be done especially for distributions that have a large compressive stress at the nozzle bottom and high tensile stresses at the J-weld location. Copy the selection in the above table , click on the "Data" statement below and delete it from the edit menu. Type "Data and the Mathcad "equal" sign (Shift-Colon) then insert the same to the right of the Mathcad Equals sign below (paste symbol).

$$Data := \begin{pmatrix} 0 & -9.034 & -5.855 & -4.246 & -2.689 & -1.031 \\ 1.154 & -6.761 & -6.739 & -7.237 & -7.662 & -7.803 \\ 2.078 & 7.965 & 1.742 & -6.23 & -11.848 & -16.387 \\ 2.819 & 23.851 & 21.763 & 8.555 & -6.39 & -17.647 \\ 3.412 & 43.99 & 38.072 & 29.826 & 13.47 & -1.632 \\ 3.888 & 47.954 & 41.753 & 35.453 & 33.324 & 35.846 \\ 4.268 & 43.756 & 39.214 & 38.4 & 53.023 & 57.543 \\ 4.377 & 40.773 & 36.237 & 41.27 & 61.453 & 62.189 \\ 4.486 & 39.277 & 35.327 & 44.863 & 64.204 & 63.895 \\ 4.595 & 36.022 & 35.389 & 46.842 & 64.323 & 62.934 \\ 4.704 & 33.54 & 36.173 & 48.06 & 64.483 & 66.03 \\ 4.813 & 32.631 & 36.616 & 47.779 & 67.612 & 70.356 \end{pmatrix}$$

$Axl := Data^{\langle 0 \rangle}$ $ID := Data^{\langle 1 \rangle}$ $OD := Data^{\langle 5 \rangle}$

$R_{ID} := regress(Axl, ID, 3)$ $R_{OD} := regress(Axl, OD, 3)$

$FL_{Cntr} := BZ - l$ Flaw Center above Nozzle Bottom

$$Inc_{Strs.avg} := \frac{UL_{Strs.Dist} - BZ}{20}$$

No User Input required beyond this Point

Sat Aug 09 11:44:49 AM 2003

$Prop_{Length} = 2.724$

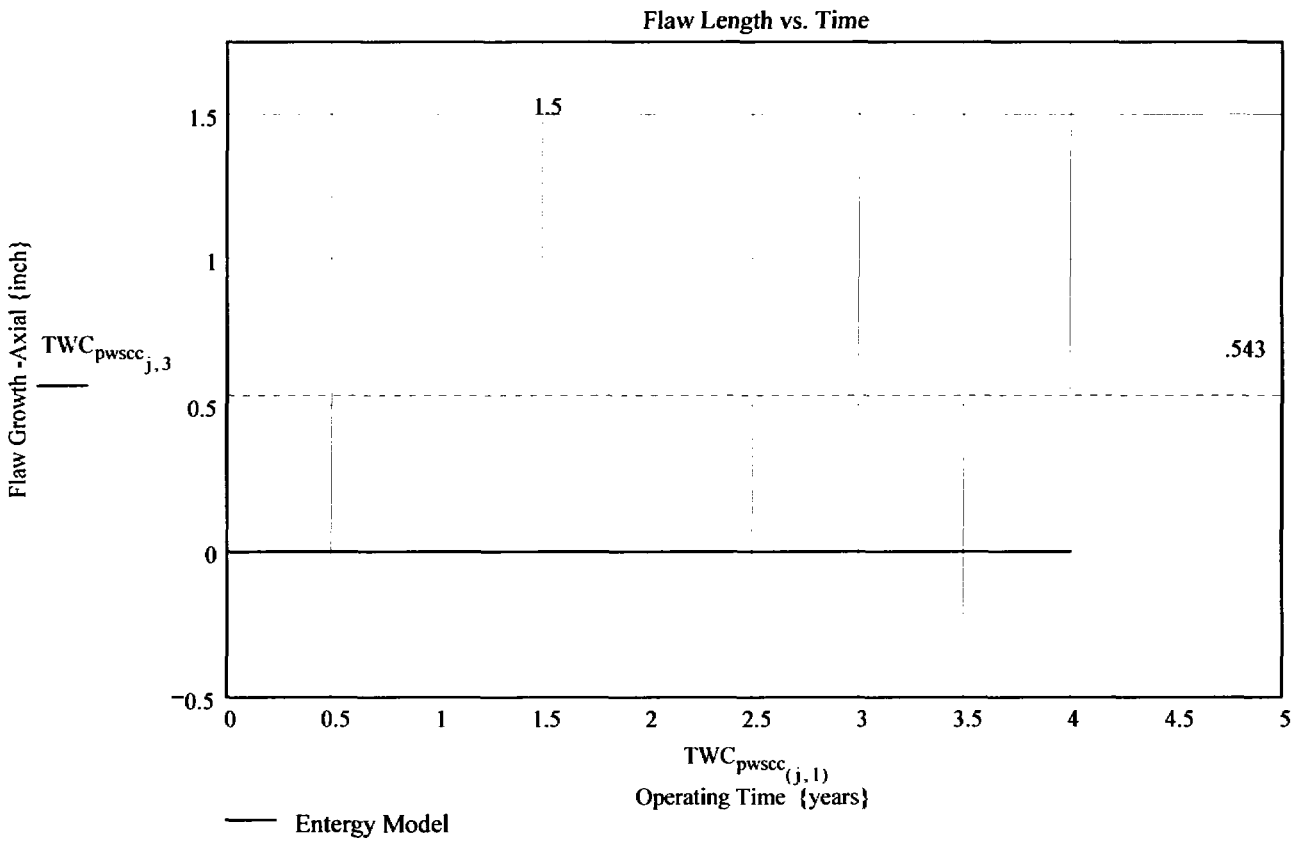

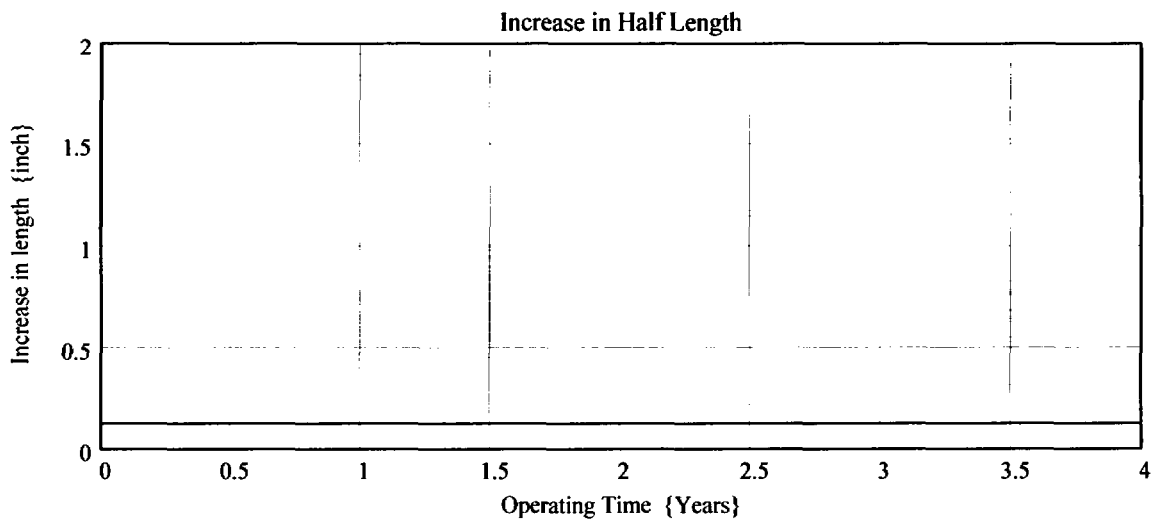

Developed by: *Verified by:*

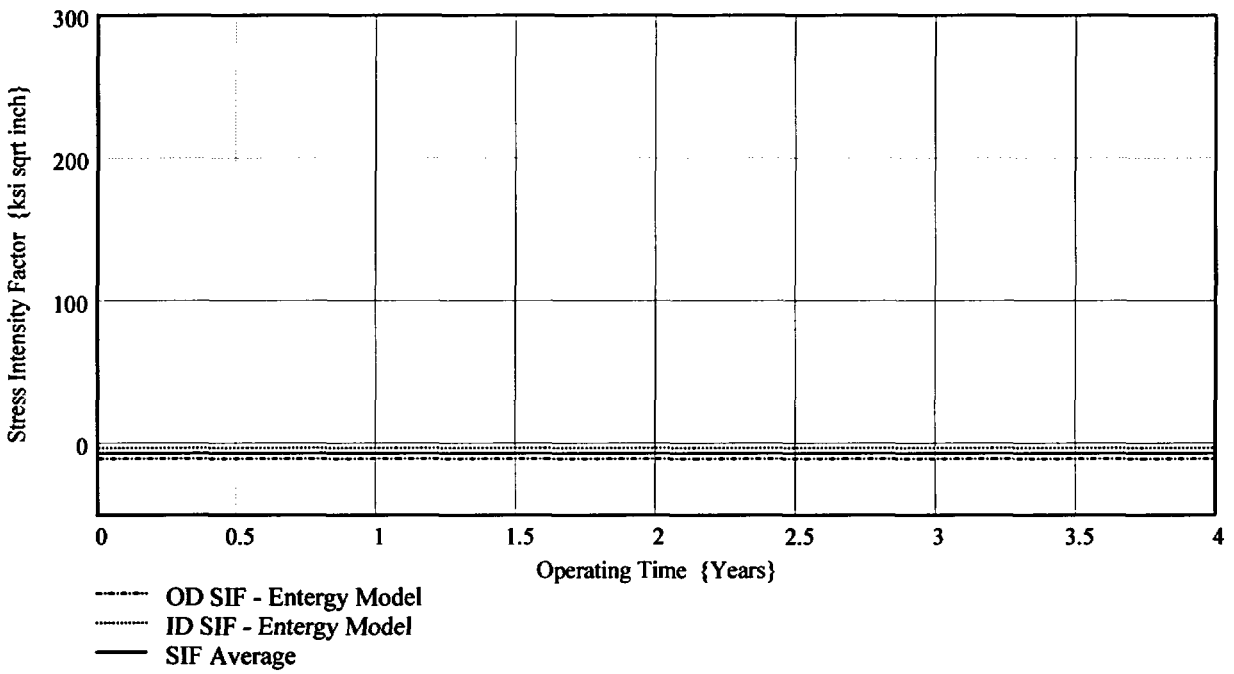
300
200
100
0
Stress Intensity Factor {ksi sqrt inch}
0
0.5
1
1.5
2
2.5
3
3.5
4
Operating Time {Years}
OD SIF - Entergy Model
ID SIF - Entergy Model
SIF Average

$TWC_{pwscc_{(j,6)}}$ =

-10.322
-10.322
-10.322
-10.322
-10.322
-10.322
-10.322
-10.322
-10.322
-10.322
-10.322
-10.322
-10.322
-10.322
-10.322
-10.322

$TWC_{pwscc_{(j,7)}}$ =

-2.923
-2.923
-2.923
-2.923
-2.923
-2.923
-2.923
-2.923
-2.923
-2.923
-2.923
-2.923
-2.923
-2.923
-2.923
-2.923

$TWC_{pwscc_{(j,8)}}$ =

-6.63
-6.63
-6.63
-6.63
-6.63
-6.63
-6.63
-6.63
-6.63
-6.63
-6.63
-6.63
-6.63
-6.63
-6.63
-6.63

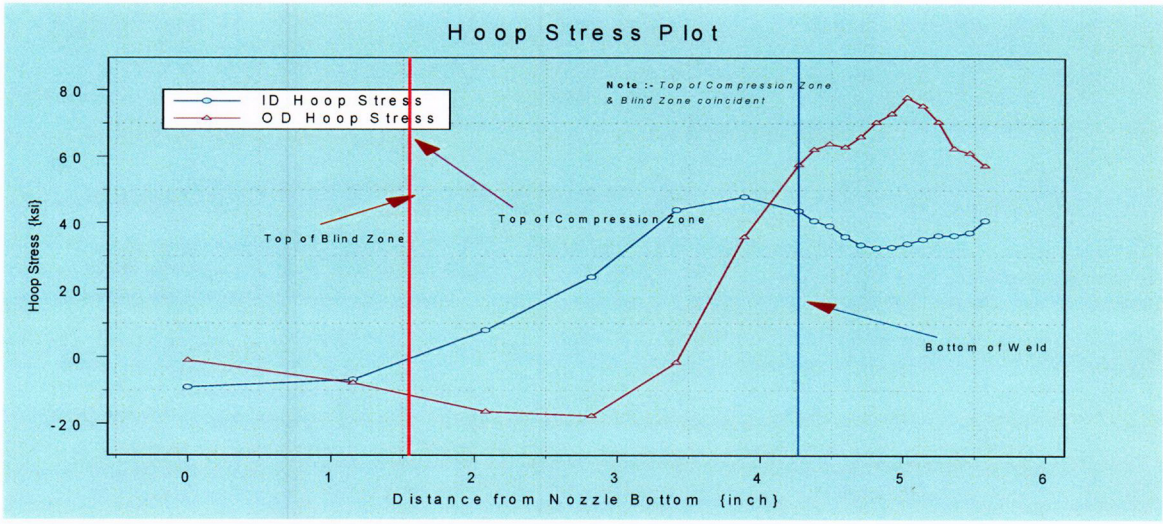

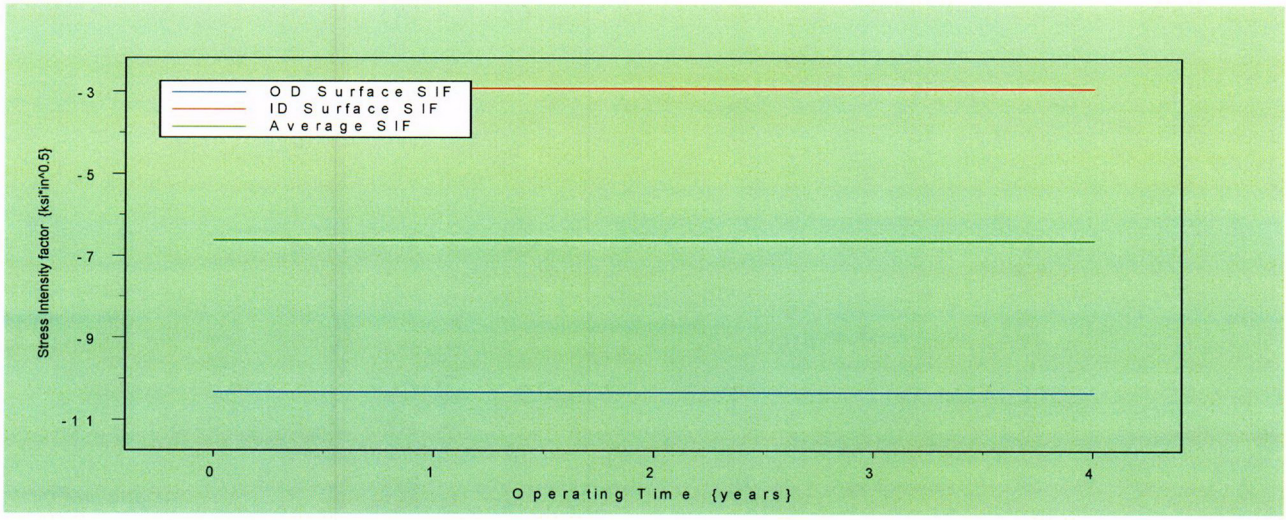

Developed by:

Verified by:

C08

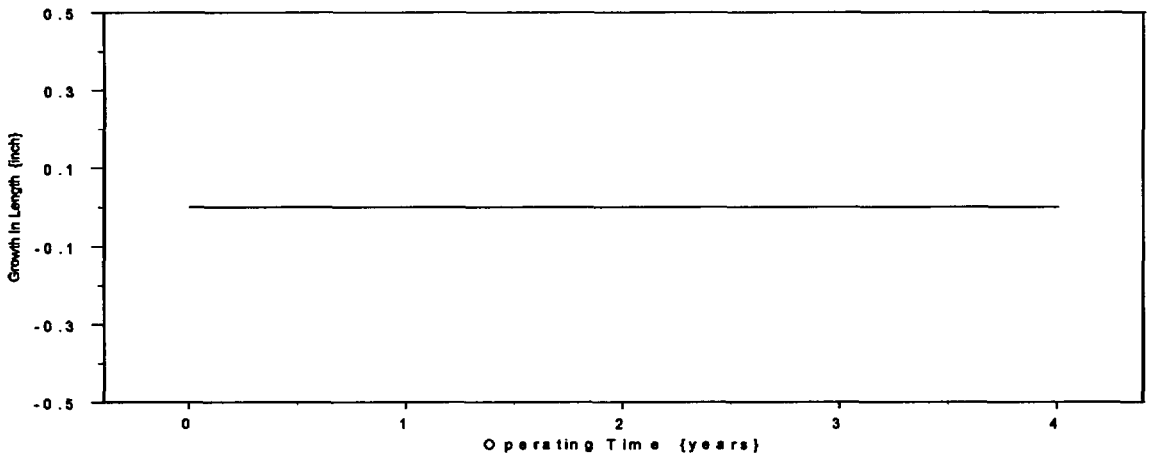
0.5
0.3
0.1
-0.1
-0.3
-0.5
Growth in Length (inch)
0
1
2
3
4
Operating Time (years)

Primary Water Stress Corrosion Crack Growth Analysis ID flaw;
Developed by Central Engineering Porgrams, Entergy Operations Inc.

Developed by: J. S. Brihmadesam ***Verified by: B. C. Gray***

Refrences :

1) "Stress Intensity factors for Part-through Surface cracks"; NASA TM-11707; July 1992.
2) Crack Growth of Alloy 600 Base Metal in PWR Environments; EPRI MRP Report MRP 55 Rev. 1, 2002

Arkansas Nuclear One Unit 2

Component : Reactor Vessel CEDM -"28" Degree Nozzle, Mid-Plane Azimuth, 1.544" above Nozzle Bottom

Calculation Basis: MRP 75 th Percentile and Flaw Face Pressurized

Mean Radius -to- Thickness Ratio:- "R_m/t" -- between 1.0 and 300.0

Note : ***Used the Metric form of the equation from EPRI MRP 55-Rev. 1.***
The correction is applied in the determination of the crack extension to obtain the value in inch/hr .

ID Surface Flaw

The first Required input is a location for a point on the tube elevation to define the point of interest (e.g. The top of the Blind Zone, or bottom of fillet weld etc.). This reference point is necessar to evaluate the stress distribution on the flaw both for the initial flaw and for a growing flaw. This is defined as the reference point. Enter a number (inch) that represnets the reference point elevation measured upward from the nozzle end.

$$Ref_{Point} := 1.544$$

To place the flaw with repsect to the reference point, the flaw tips and center can be located as follows:

1) The Upper "c- tip" located at the reference point (Enter 1)
2) The Center of the flaw at the reference point (Enter 2)
3) The lower "c- tip" located at the reference point (Enter 3).

$$Val := 2$$

The Input Below is the Upper Limit for the evaluation, which is the bottom of the fillet weld leg. This is shown on the Excel spread sheet as weld bottom. Enter this dimension (measured from nozzle bottom) below.

$UL_{Strs.Dist} := 2.999$ Upper axial Extent for Stress Distribution to be used in the Analysis (Axial distance above nozzle bottom).

Input Data :-

$L := 0.32$ Initial Flaw Length (Twice detectable length)

$a_0 := 0.661 \cdot 0.07$ Initial Flaw Depth (Minimum Detecteble Depth was 5% TW)

$od := 4.05$ Tube OD

$id := 2.728$ Tube ID

$P_{Int} := 2.235$ Design Operating Pressure (internal)

$Years := 4$ Number of Operating Years

$I_{lim} := 1500$ Iteration limit for Crack Growth loop

$T := 604$ Estimate of Operating Temperature

$\alpha_{0c} := 2.67 \cdot 10^{-12}$ Constant in MRP PWSCC Model for I-600 Wrought @ 617 deg. F

$Q_g := 31.0$ Thermal activation Energy for Crack Growth (MRP)

$T_{ref} := 617$ Reference Temperature for normalizing Data deg. F

$$R_o := \frac{od}{2} \qquad R_{id} := \frac{id}{2} \qquad t := R_o - R_{id} \qquad R_m := R_{id} + \frac{t}{2} \qquad Tim_{opr} := Years \cdot 365 \cdot 24$$

$$CF_{inhr} := 1.417 \cdot 10^5 \qquad C_{blk} := \frac{Tim_{opr}}{I_{lim}} \qquad Prnt_{blk} := \left| \frac{I_{lim}}{50} \right| \qquad c_0 := \frac{L}{2} \qquad R_t := \frac{R_m}{t}$$

$$C_{01} := e^{\left[\frac{-Q_g}{1.103 \cdot 10^{-3}} \cdot \left(\frac{1}{T+459.67} - \frac{1}{T_{ref}+459.67}\right)\right] \cdot \alpha_{0c}}$$ Temperature Correction for Coefficient Alpha

$C_0 := C_{01}$ 75 th percentile MRP-55 Revision 1

Stress Input Data

Input all available Nodal stress data in the table below. The column designations are as follows:
Column "0" = Axial distance from minimum to maximum recorded on data sheet (inches)
Column "1" = ID Stress data at each Elevation (ksi)
Cloumn "2" = Quarter Thickness Stress data at each Elevation (ksi)
Cloumn "3" = Mid Thickness Stress data at each Elevation (ksi)
Column "4" = Three quarter Thickness Stress data at each Elevation (ksi)
Column "5" = OD Stress data at each Elevation (ksi)

AllData :=

	0	1	2	3	4	5
0	0	2.08	-0.87	-2.96	-4.82	-6.75
1	0.81	0.09	-2.37	-4.27	-6	-7.55
2	1.46	5.28	1.69	-0.79	-2.49	-3.47
3	1.98	16.88	12.42	9.56	6.91	4.32
4	2.4	24.14	20.89	18.11	16.59	14.51
5	2.73	26.96	22.67	20.69	24.84	33.52
6	3	23.28	20.9	21.71	37.11	47.4
7	3.11	17.16	17.1	20.74	41.09	51.76
8	3.23	11.72	14.42	21.34	43.54	53.69
9	3.34	6	11.11	20.91	43.83	54.15
10	3.46	1.44	8.09	20.38	43.02	57.02
11	3.57	-2.17	5.89	19.93	42.41	56.41
12	3.69	-4.72	4.86	19.99	40.42	58.85

$AXLen := AllData^{\langle 0 \rangle}$ $ID_{All} := AllData^{\langle 1 \rangle}$ $OD_{All} := AllData^{\langle 5 \rangle}$

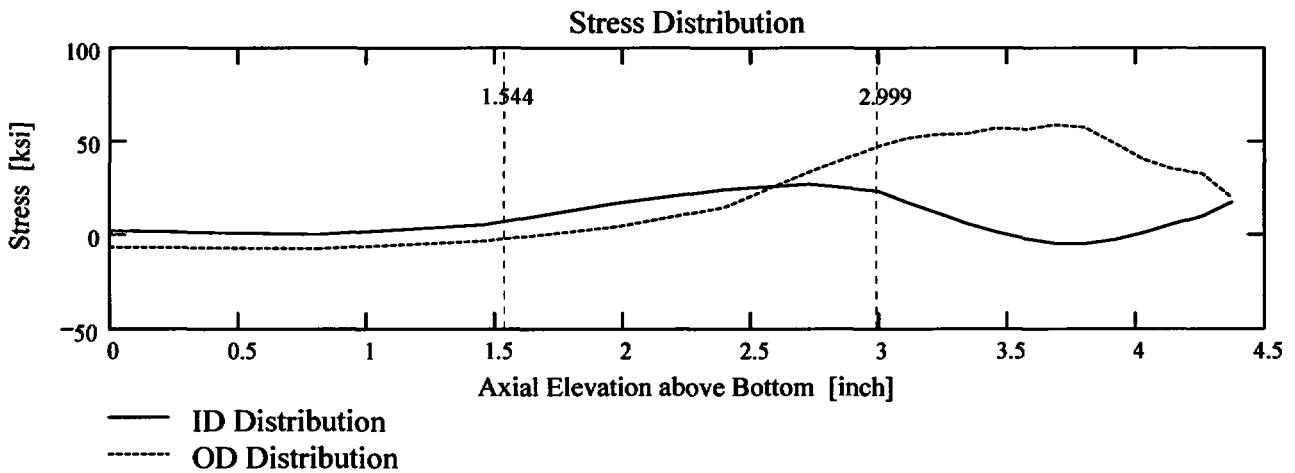

Observing the stress distribution select the region in the table above labeled $Data_{All}$ that represents the region of interest. This needs to be done especially for distributions that have a large compressive stress at the nozzle bottom and high tensile stresses at the J-weld location. Higlight the region in the above table representing the region to be selected (click on the first cell for selection and drag the mouse whilst holding the left mosue button down. Once this is done click the right mouse button and select "Copy Selection"; this will copy the selected area on to the clipboard. Then click on the "Matrix" below (to the right of the dtat statement) to highlight the entire matrix and delete it from the edit menu. When the Mathcad input symbol appears, use the paste function in the tool bar to paste the selection.

$$Data := \begin{pmatrix} 0 & 2.079 & -0.875 & -2.96 & -4.82 & -6.75 \\ 0.811 & 0.091 & -2.37 & -4.267 & -6.004 & -7.552 \\ 1.46 & 5.283 & 1.686 & -0.786 & -2.49 & -3.469 \\ 1.98 & 16.881 & 12.419 & 9.564 & 6.907 & 4.319 \\ 2.397 & 24.144 & 20.894 & 18.115 & 16.59 & 14.513 \\ 2.731 & 26.962 & 22.672 & 20.686 & 24.842 & 33.523 \\ 2.999 & 23.279 & 20.902 & 21.706 & 37.111 & 47.395 \\ 3.113 & 17.161 & 17.101 & 20.743 & 41.091 & 51.762 \\ 3.228 & 11.722 & 14.424 & 21.34 & 43.543 & 53.688 \\ 3.343 & 6.004 & 11.108 & 20.912 & 43.833 & 54.154 \\ 3.457 & 1.439 & 8.085 & 20.38 & 43.021 & 57.025 \\ 3.572 & -2.175 & 5.891 & 19.929 & 42.405 & 56.415 \\ 3.687 & -4.725 & 4.858 & 19.994 & 40.425 & 58.85 \end{pmatrix}$$

$Axl := Data^{\langle 0 \rangle}$ $MD := Data^{\langle 3 \rangle}$ $ID := Data^{\langle 1 \rangle}$ $TQ := Data^{\langle 4 \rangle}$ $QT := Data^{\langle 2 \rangle}$ $OD := Data^{\langle 5 \rangle}$

$R_{ID} := regress(Axl, ID, 3)$ $R_{QT} := regress(Axl, QT, 3)$

$R_{OD} := regress(Axl, OD, 3)$

$R_{MD} := regress(Axl, MD, 3)$ $R_{TQ} := regress(Axl, TQ, 3)$

$$FL_{Cntr} := \begin{cases} Ref_{Point} - c_0 & \text{if } Val = 1 \\ Ref_{Point} & \text{if } Val = 2 \\ Ref_{Point} + c_0 & \text{otherwise} \end{cases}$$

Flaw center Location above Nozzle Bottom

$$U_{Tip} := FL_{Cntr} + c_0$$

$$Inc_{Strs.avg} := \frac{UL_{Strs.Dist} - U_{Tip}}{20}$$

No User Input is required beyond this Point

Sat Aug 09 10:59:39 AM 2003

$Prop_{Length} = 1.295$

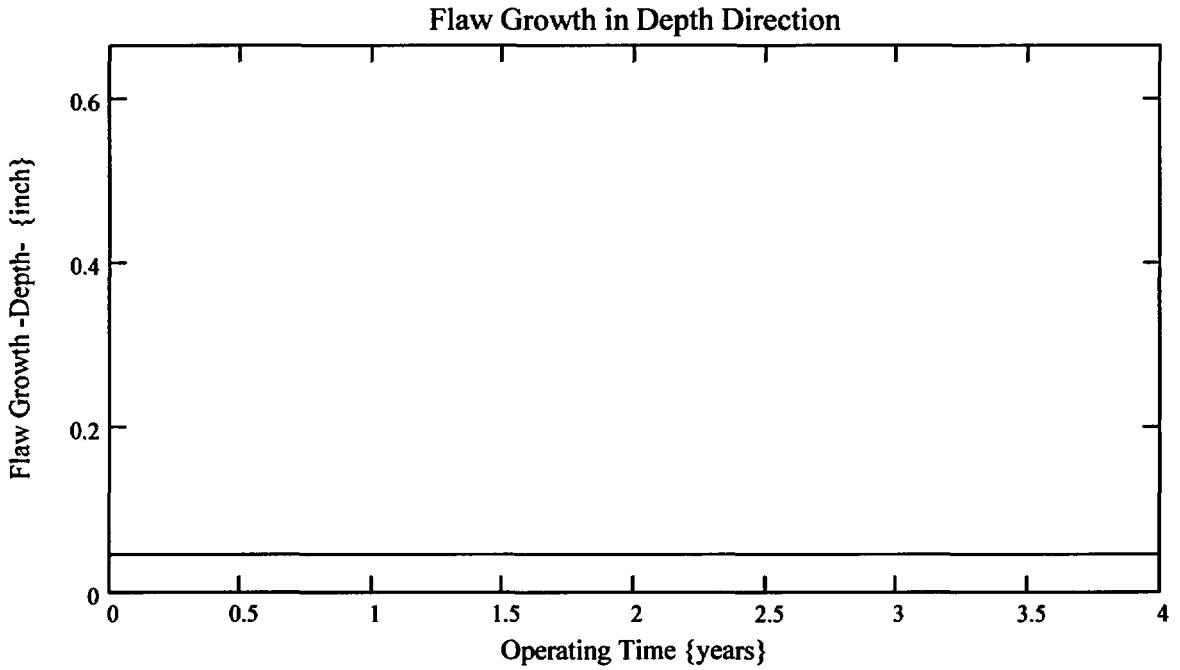

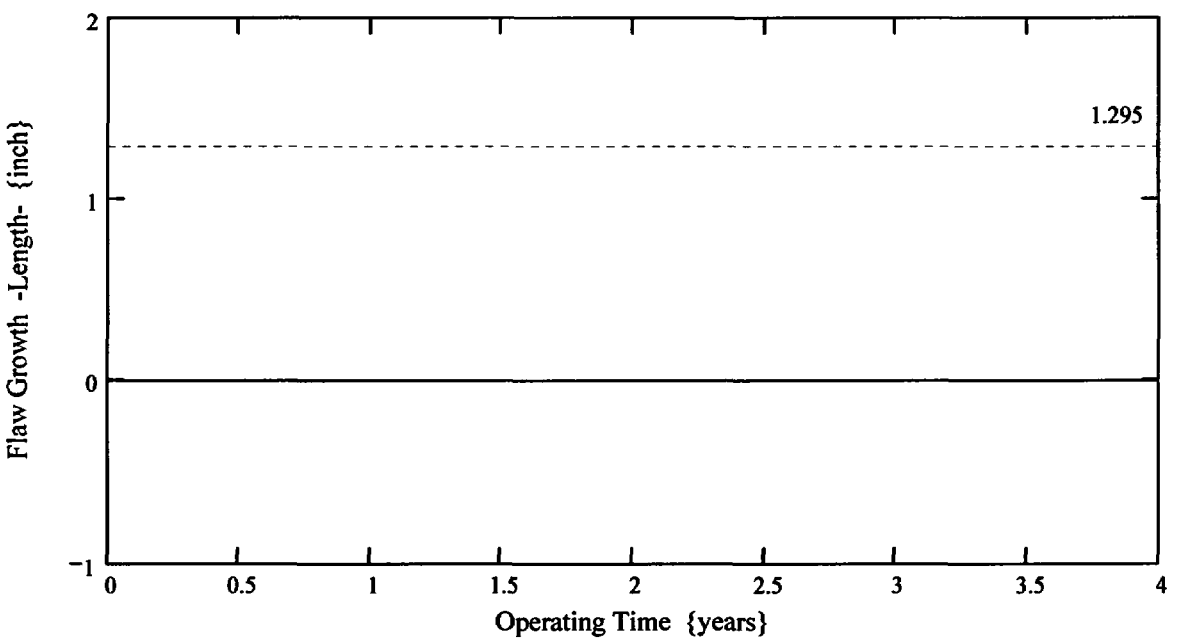

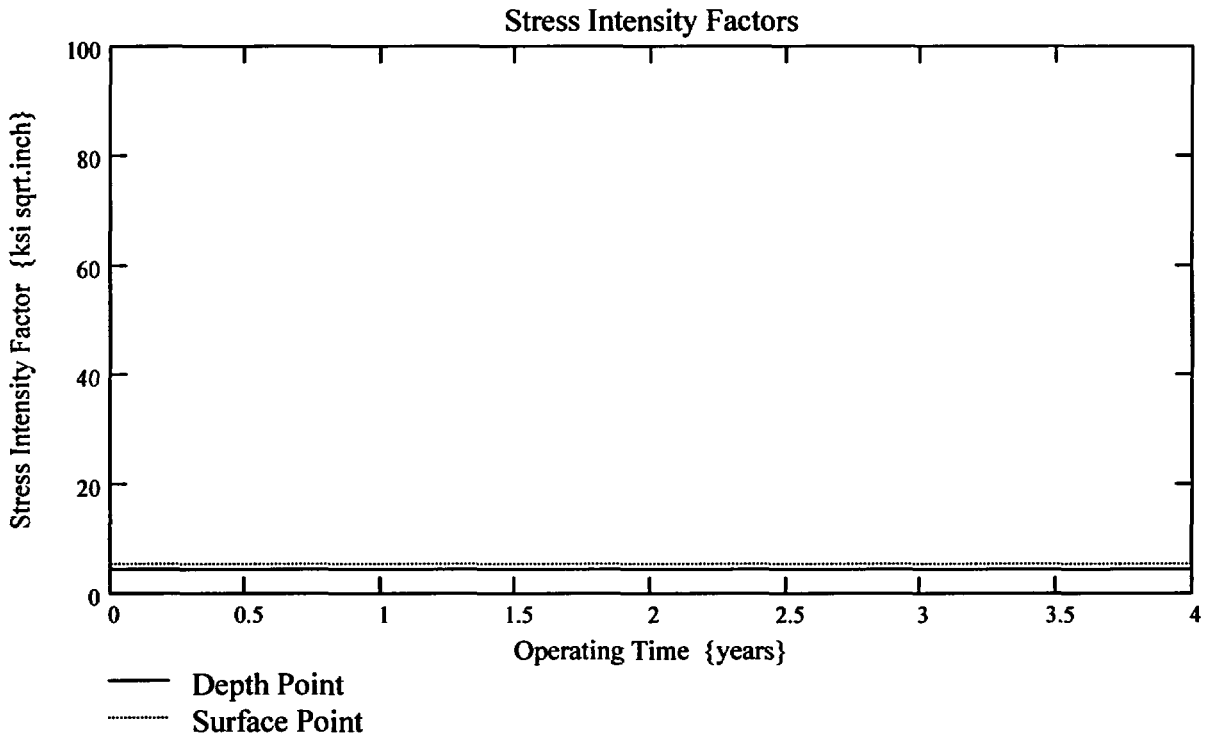
Stress Intensity Factors
Stress Intensity Factor {ksi sqrt.inch}
100
80
60
40
20
0
0
0.5
1
1.5
2
2.5
3
3.5
4
Operating Time {years}
Depth Point
Surface Point

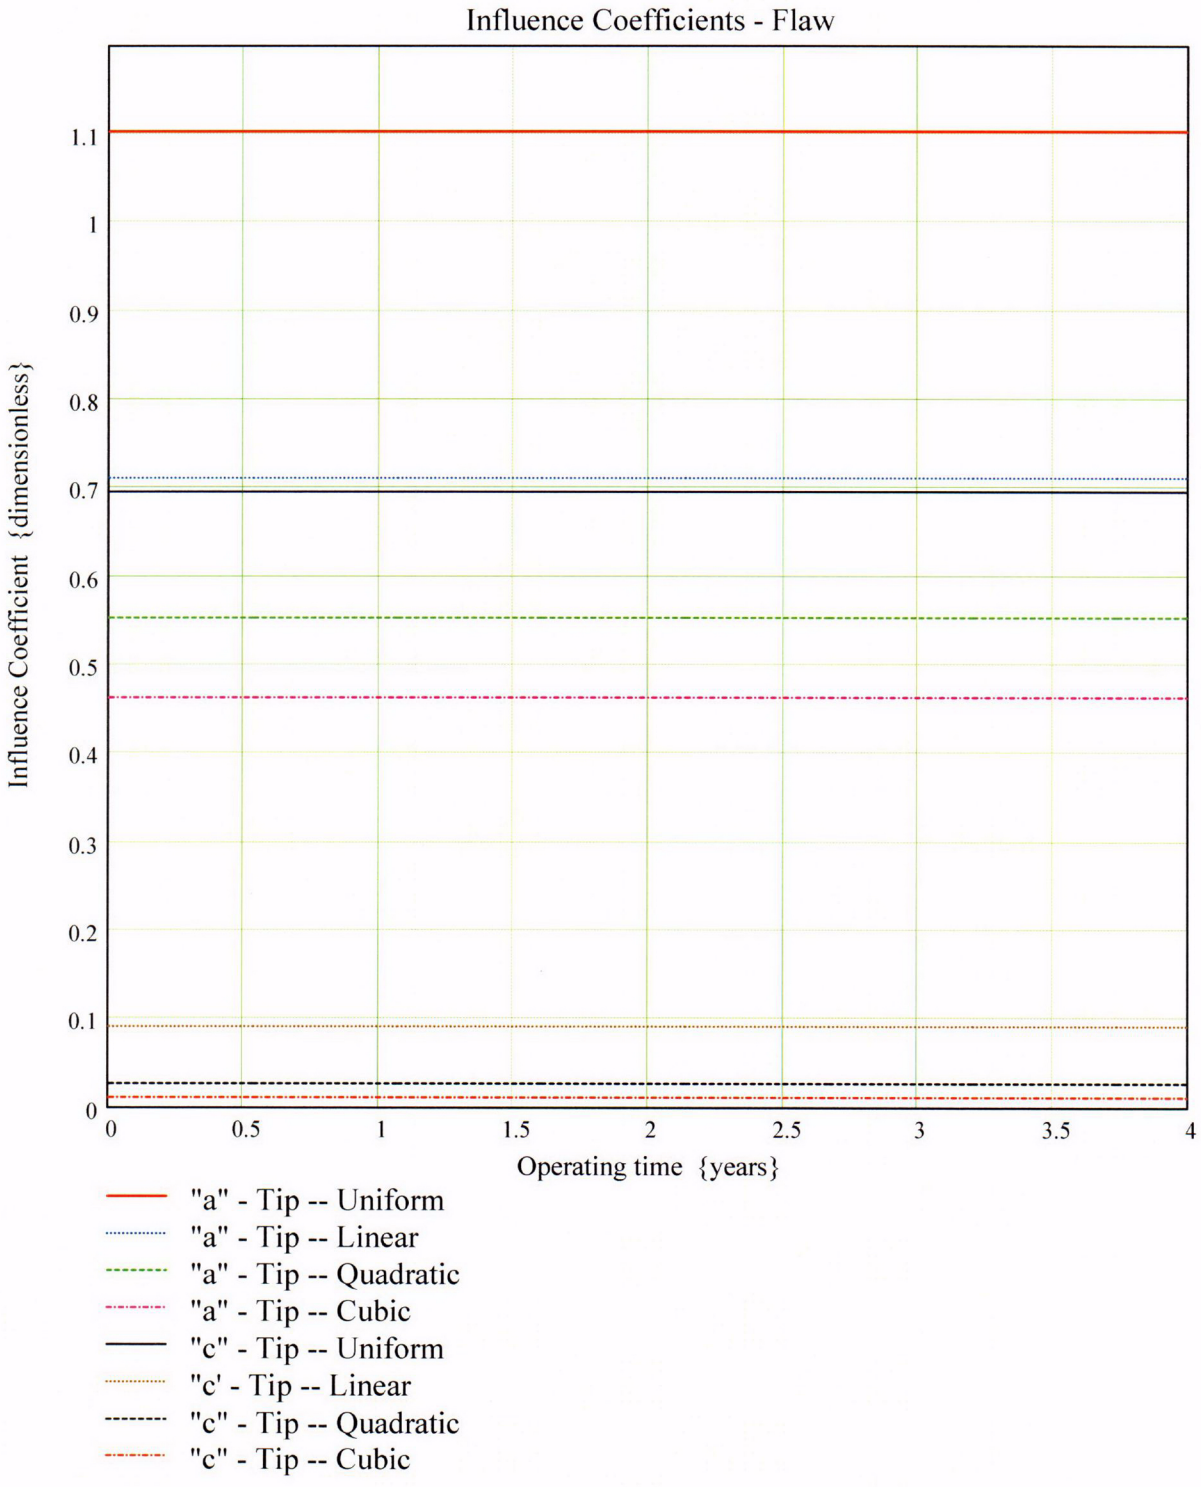
Influence Coefficients - Flaw
Influence Coefficient {dimensionless}
1.1
1
0.9
0.8
0.7
0.6
0.5
0.4
0.3
0.2
0.1
0
0
0.5
1
1.5
2
2.5
3
3.5
4
Operating time {years}
"a" - Tip -- Uniform
"a" - Tip -- Linear
"a" - Tip -- Quadratic
"a" - Tip -- Cubic
"c" - Tip -- Uniform
"c' - Tip -- Linear
"c" - Tip -- Quadratic
"c" - Tip -- Cubic

$CGR_{sambi_{(k,8)}}$ =

1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103

$CGR_{sambi_{(k,6)}}$ =

5.43
5.43
5.43
5.43
5.43
5.43
5.43
5.43
5.43
5.43
5.43
5.43
5.43
5.43
5.43
5.43
5.43
5.43

$CGR_{sambi_{(k,5)}}$ =

4.419
4.419
4.419
4.419
4.419
4.419
4.419
4.419
4.419
4.419
4.419
4.419
4.419
4.419
4.419
4.419
4.419
4.419

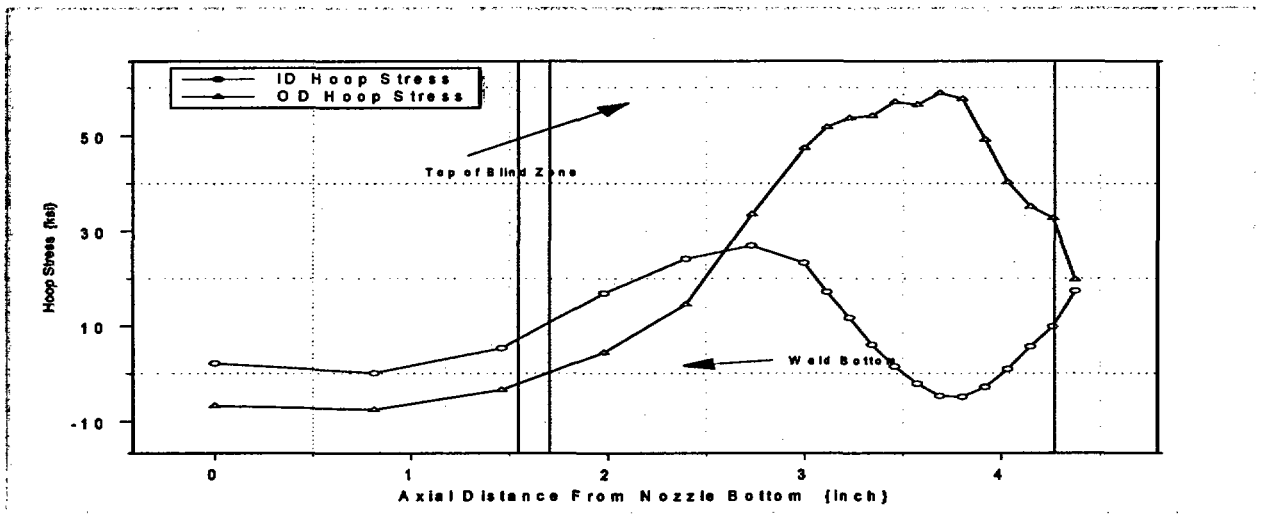
ID Hoop Stress
OD Hoop Stress
Top of Blind Zone
Weld Bottom
Hoop Stress (ksi)
50
30
10
-10
0
1
2
3
4
Axial Distance From Nozzle Bottom (inch)

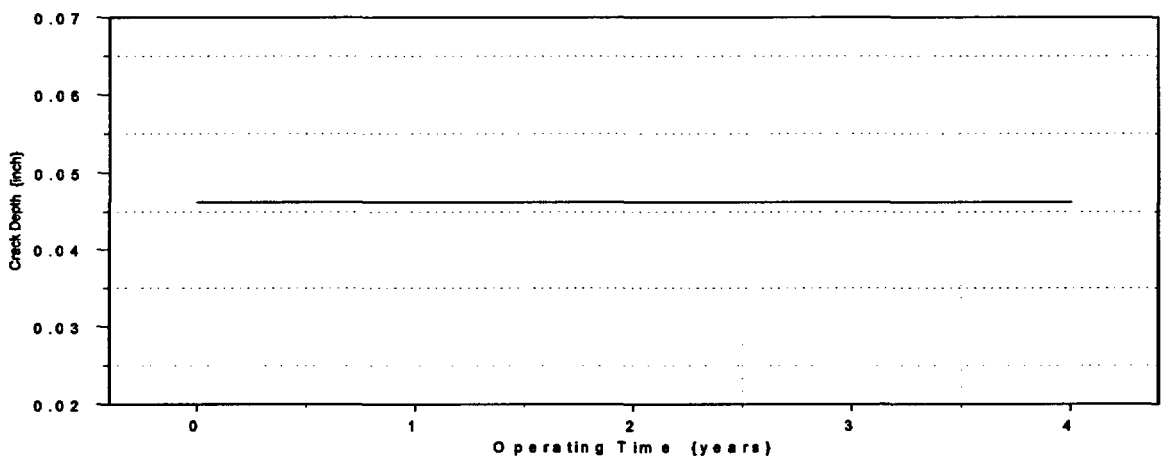
0.07
0.06
0.05
0.04
0.03
0.02
Crack Depth (inch)
0
1
2
3
4
Operating Time (years)

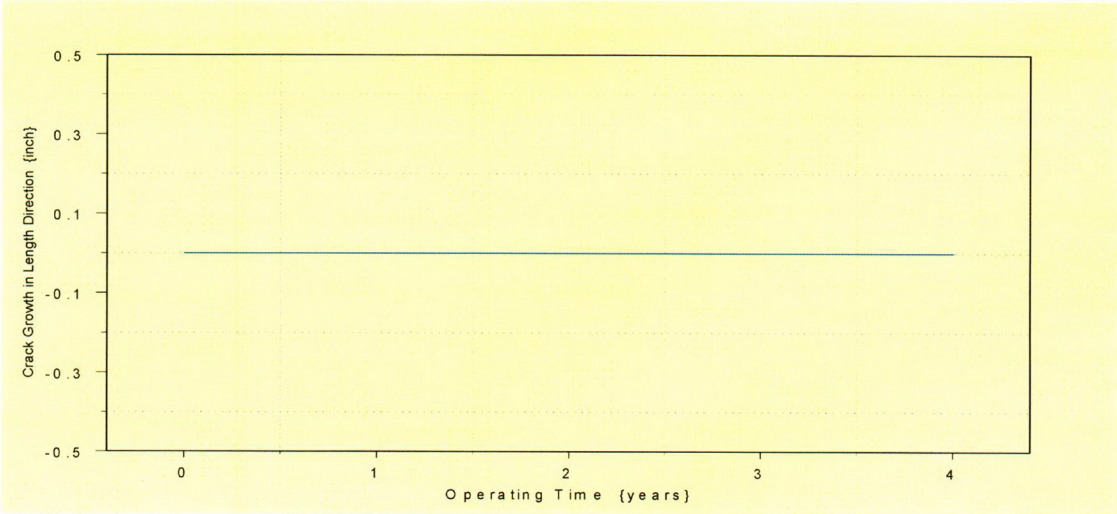

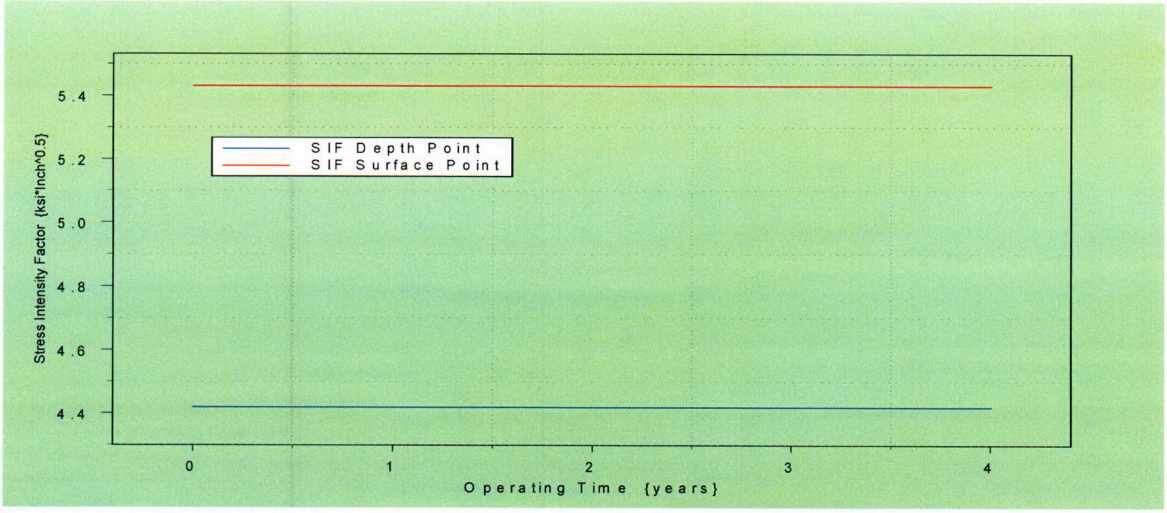

Developed by:
J. S. Brihmadesam

Verified by:
B. C. Gray

Primary Water Stress Corrosion Crack Growth Analysis - OD SurfaceFlaw

Developed by Central Engineering Programs, Entergy Operations Inc

Developedby: J. S. Brihmadesam **Verified by: B. C. Gray**

Refrences :

1) "Stress Intensity factors for Part-through Surface cracks"; NASA TM-11707; July 1992.
2) Crack Growth of Alloy 600 Base Metal in PWR Environments; EPRI MRP Report MRP 55 Rev. 1, 2002

Arkansas Nuclear One Unit 2

Component : Reactor Vessel CEDM -"28" Degree Nozzle, Mid-Plane Azimuth, 1.544" above Nozzle Bottom

Calculation Basis: MRP 75 th Percentile and Flaw Face Pressurized

Mean Radius -to- Thickness Ratio:- "R_m/t" -- between 1.0 and 300.0

Note : ***Used the Metric form of the equation from EPRI MRP 55-Rev. 1.***
The correction is applied in the determination of the crack extension to obtain the value in inch/hr .

OD Surface Flaw

The first Required input is a location for a point on the tube elevation to define the point of interest (e.g. The top of the Blind Zone, or bottom of fillet weld etc.). This reference point is necessar to evaluate the stress distribution on the flaw both for the initial flaw and for a growing flaw. This is defined as the reference point. Enter a number (inch) that represnets the reference point elevation measured upward from the nozzle end.

$$Ref_{Point} := 1.544$$

To place the flaw with repsect to the reference point, the flaw tips and center can be located as follows:

1) The Upper "c- tip" located at the reference point (Enter 1)
2) The Center of the flaw at the reference point (Enter 2)
3) The lower "c- tip" located at the reference point (Enter 3).

$$Val := 2$$

Upper Limit to be selected for stress distribution (e.g. Weld bottom). This is the elevation from Nozzle Bottom. Enter this value below

$UL_{Strs.Dist} := 2.999$ Upper Axial Extent for Stress Distribution to be used in the Analysis (Axial distance above nozzle bottom)

Input Data :-

$L := 0.32$ Initial Flaw Length

$a_0 := 0.661 \cdot 0.12$ Initial Flaw Depth

$od := 4.05$ Tube OD

$id := 2.728$ Tube ID

$P_{Int} := 2.235$ Design Operating Pressure (internal)

$Years := 4$ Number of Operating Years

$I_{lim} := 1500$ Iteration limit for Crack Growth loop

$T := 604$ Estimate of Operating Temperature

$\alpha_{0c} := 2.67 \cdot 10^{-12}$ Constant in MRP PWSCC Model for I-600 Wrought @ 617 deg. F

$Q_g := 31.0$ Thermal activation Energy for Crack Growth {MRP)

$T_{ref} := 617$ Reference Temperature for normalizing Data deg. F

$R_o := \frac{od}{2}$ $R_{id} := \frac{id}{2}$ $t := R_o - R_{id}$ $R_m := R_{id} + \frac{t}{2}$ $Tim_{opr} := Years \cdot 365 \cdot 24$

$CF_{inhr} := 1.417 \cdot 10^5$ $C_{blk} := \frac{Tim_{opr}}{I_{lim}}$ $Prnt_{blk} := \left| \frac{I_{lim}}{50} \right|$ $c_0 := \frac{L}{2}$ $R_t := \frac{R_m}{t}$

$$C_{01} := e^{\left[\frac{-Q_g}{1.103 \cdot 10^{-3}} \cdot \left(\frac{1}{T+459.67} - \frac{1}{T_{ref}+459.67}\right)\right]} \cdot \alpha_{0c}$$ Temperature Correction for Coefficient Alpha

$C_0 := C_{01}$ 75 th percentile MRP-55 Revision 1

Stress Input Data

Input all available Nodal stress data in the table below. The column designations are as follows:
Column "0" = Axial distance from minumum to maximum recorded on data sheet(inches)
Column "1" = ID Stress data at each Elevation (ksi)
Column "2" = Quarter Thickness Stress data at each Elevation (ksi)
Column "3" = Mid Thickness Stress data at each Elevation (ksi)
Column "4" = Three Quarter Thickness Stress data at each Elevation (ksi)
Column "5" = OD Stress data at each Elevation (ksi)

AllData :=

	0	1	2	3	4	5
0	0	2.08	-0.87	-2.96	-4.82	-6.75
1	0.81	0.09	-2.37	-4.27	-6	-7.55
2	1.46	5.28	1.69	-0.79	-2.49	-3.47
3	1.98	16.88	12.42	9.56	6.91	4.32
4	2.4	24.14	20.89	18.11	16.59	14.51
5	2.73	26.96	22.67	20.69	24.84	33.52
6	3	23.28	20.9	21.71	37.11	47.4
7	3.11	17.16	17.1	20.74	41.09	51.76
8	3.23	11.72	14.42	21.34	43.54	53.69
9	3.34	6	11.11	20.91	43.83	54.15
10	3.46	1.44	8.09	20.38	43.02	57.02
11	3.57	-2.17	5.89	19.93	42.41	56.41
12	3.69	-4.72	4.86	19.99	40.42	58.85
13	3.8	-4.92	4.88	20.34	38.45	57.62

$AXLen := AllData^{\langle 0 \rangle}$ $ID_{All} := AllData^{\langle 1 \rangle}$ $OD_{All} := AllData^{\langle 5 \rangle}$

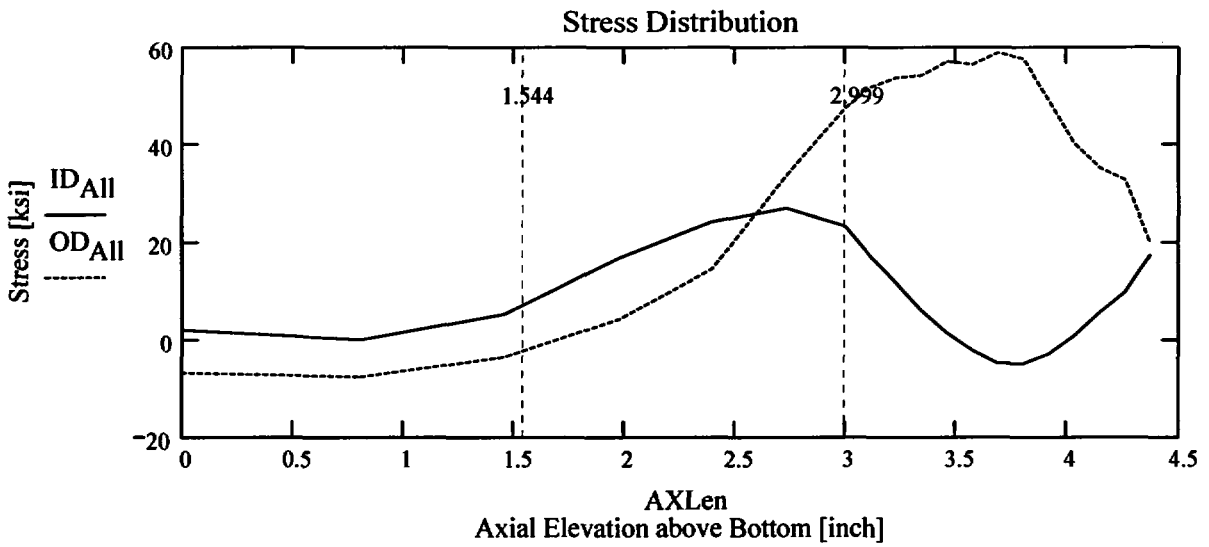

Observing the stress distribution select the region in the table above labeled $Data_{All}$ that represents the region of interest. This needs to be done especially for distributions that have a large compressive stress at the nozzle bottom and high tensile stresses at the J-weld location. Copy the selection in the above table , click on the "Data" statement below and delete it from the edit menu. Type "Data and the Mathcad "equal" sign (Shift-Colon) then insert the same to the right of the Mathcad Equals sign below (paste symbol).

$$Data := \begin{pmatrix} 0 & 2.079 & -0.875 & -2.96 & -4.82 & -6.75 \\ 0.811 & 0.091 & -2.37 & -4.267 & -6.004 & -7.552 \\ 1.46 & 5.283 & 1.686 & -0.786 & -2.49 & -3.469 \\ 1.98 & 16.881 & 12.419 & 9.564 & 6.907 & 4.319 \\ 2.397 & 24.144 & 20.894 & 18.115 & 16.59 & 14.513 \\ 2.731 & 26.962 & 22.672 & 20.686 & 24.842 & 33.523 \\ 2.999 & 23.279 & 20.902 & 21.706 & 37.111 & 47.395 \\ 3.113 & 17.161 & 17.101 & 20.743 & 41.091 & 51.762 \\ 3.228 & 11.722 & 14.424 & 21.34 & 43.543 & 53.688 \\ 3.343 & 6.004 & 11.108 & 20.912 & 43.833 & 54.154 \\ 3.457 & 1.439 & 8.085 & 20.38 & 43.021 & 57.025 \\ 3.572 & -2.175 & 5.891 & 19.929 & 42.405 & 56.415 \\ 3.687 & -4.725 & 4.858 & 19.994 & 40.425 & 58.85 \end{pmatrix}$$

$Axl := Data^{\langle 0 \rangle}$ $MD := Data^{\langle 3 \rangle}$ $ID := Data^{\langle 1 \rangle}$ $TQ := Data^{\langle 4 \rangle}$ $QT := Data^{\langle 2 \rangle}$ $OD := Data^{\langle 5 \rangle}$

$R_{ID} := regress(Axl, ID, 3)$ $R_{QT} := regress(Axl, QT, 3)$

$R_{OD} := regress(Axl, OD, 3)$

$R_{MD} := regress(Axl, MD, 3)$ $R_{TQ} := regress(Axl, TQ, 3)$

$$FL_{Cntr} := \begin{cases} Ref_{Point} - c_0 & \text{if } Val = 1 \\ Ref_{Point} & \text{if } Val = 2 \\ Ref_{Point} + c_0 & \text{otherwise} \end{cases}$$

Flaw center Location Location above Nozzle Bottom

$U_{Tip} := FL_{Cntr} + c_0$

$$Inc_{Strs.avg} := \frac{UL_{Strs.Dist} - U_{Tip}}{20}$$

No User Input is required beyond this Point

Sat Aug 09 10:21:18 AM 2003

$Prop_{Length} = 1.295$

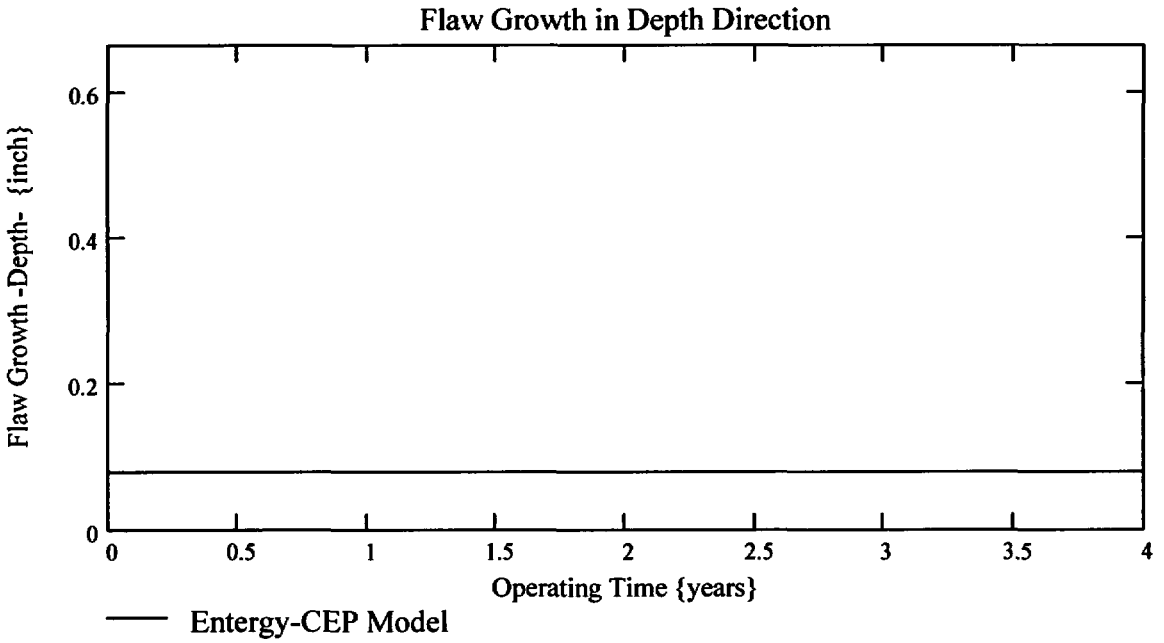

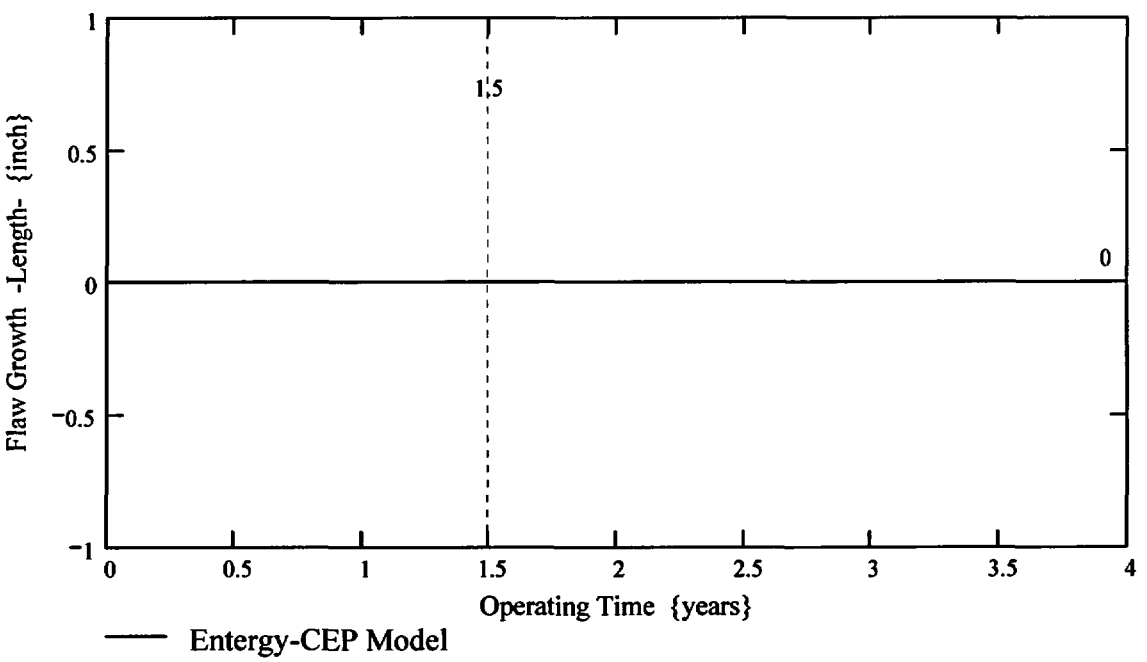

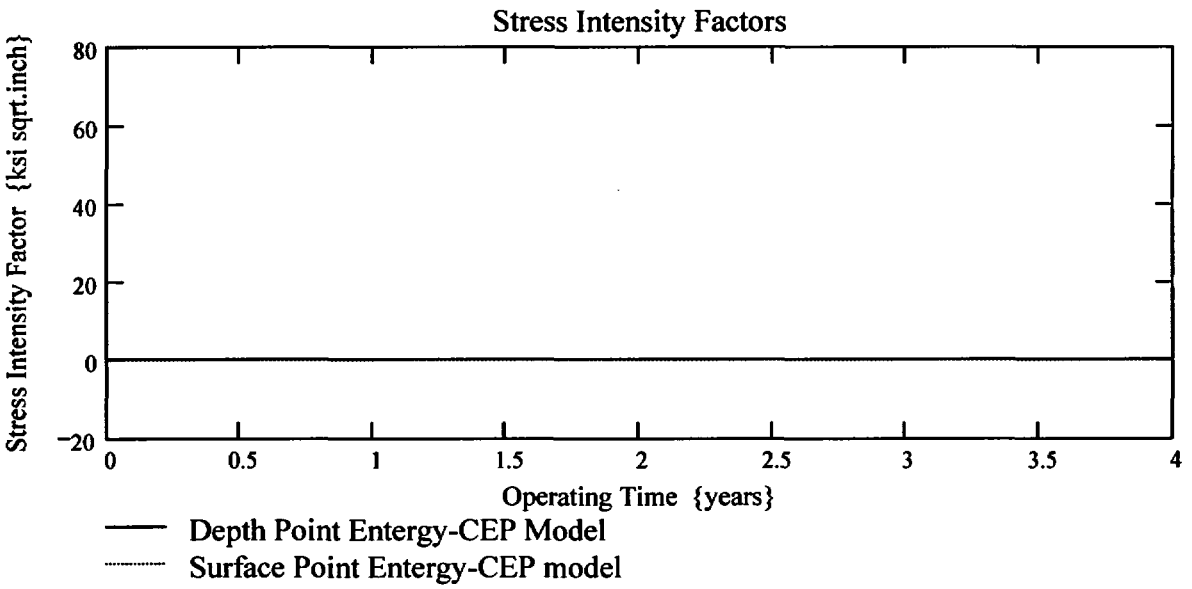
Stress Intensity Factors
Stress Intensity Factor {ksi sqrt.inch}
80
60
40
20
0
−20
0
0.5
1
1.5
2
2.5
3
3.5
4
Operating Time {years}
Depth Point Entergy-CEP Model
Surface Point Entergy-CEP model

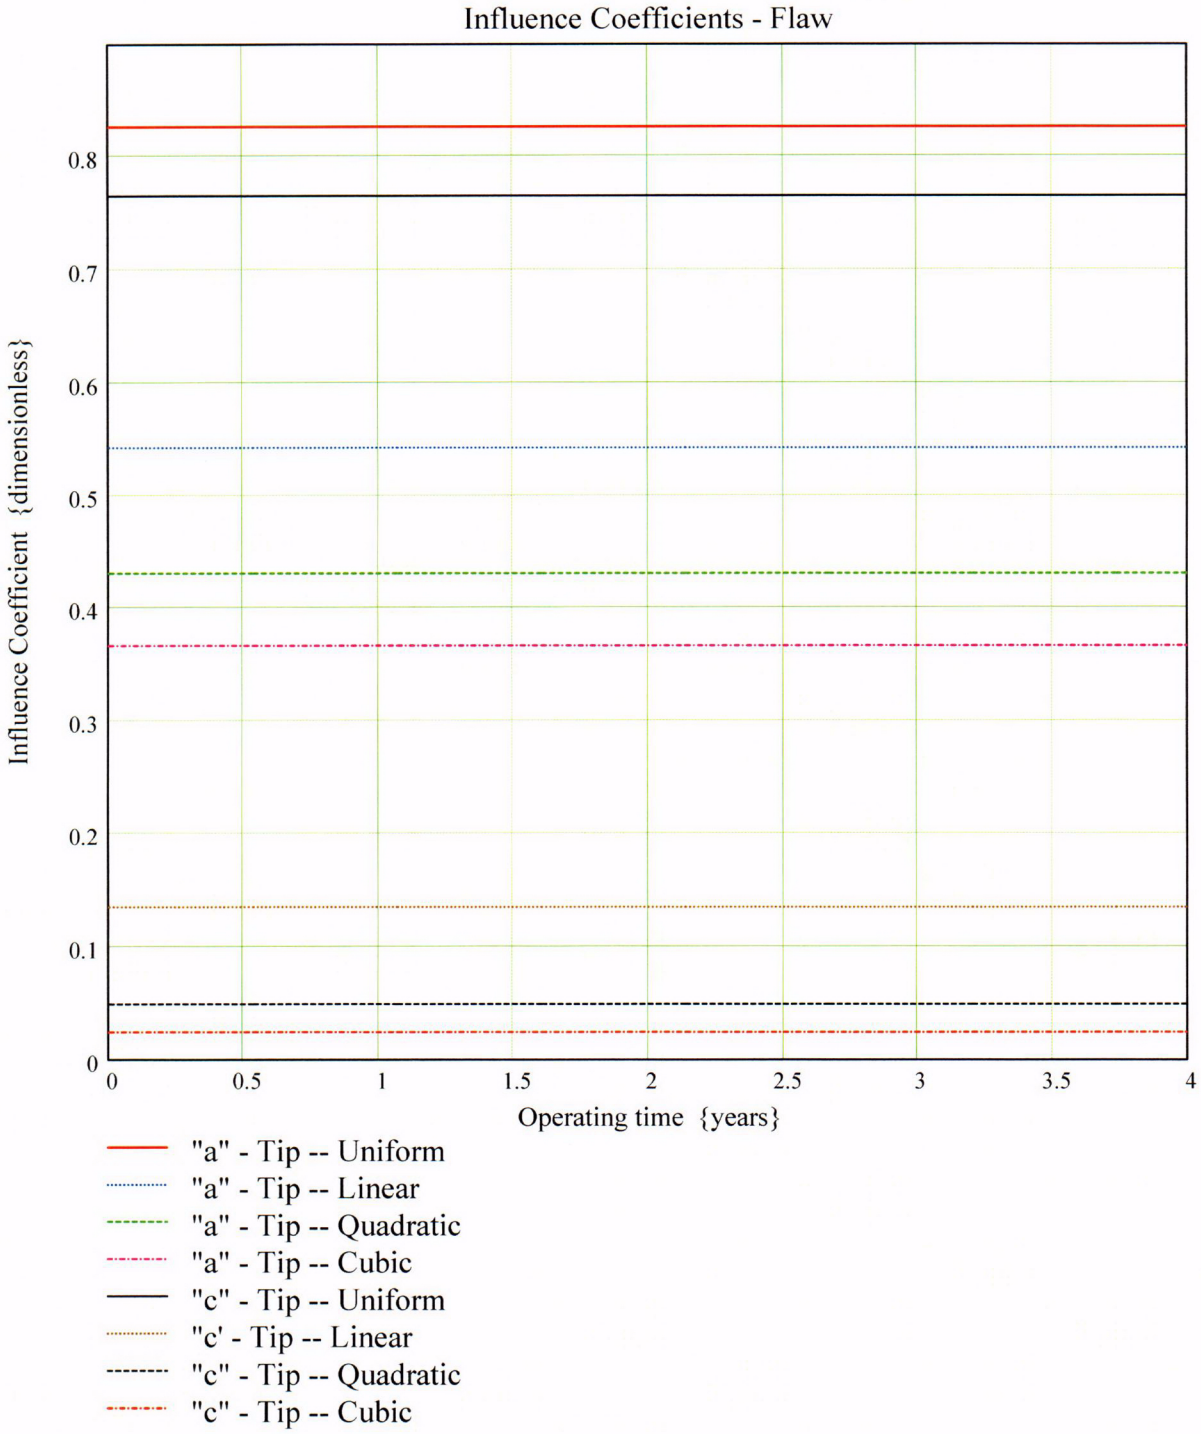
Influence Coefficients - Flaw
Influence Coefficient {dimensionless}
0
0.1
0.2
0.3
0.4
0.5
0.6
0.7
0.8
0
0.5
1
1.5
2
2.5
3
3.5
4
Operating time {years}
"a" - Tip -- Uniform
"a" - Tip -- Linear
"a" - Tip -- Quadratic
"a" - Tip -- Cubic
"c" - Tip -- Uniform
"c' - Tip -- Linear
"c" - Tip -- Quadratic
"c" - Tip -- Cubic

$CGR_{sambi_{(k,8)}}$ =

0.827
0.827
0.827
0.827
0.827
0.827
0.827
0.827
0.827
0.827
0.827
0.827
0.827
0.827
0.827
0.827
0.827

$CGR_{sambi_{(k,6)}}$ =

-0.017
-0.017
-0.017
-0.017
-0.017
-0.017
-0.017
-0.017
-0.017
-0.017
-0.017
-0.017
-0.017
-0.017
-0.017
-0.017
-0.017

$CGR_{sambi_{(k,5)}}$ =

0.133
0.133
0.133
0.133
0.133
0.133
0.133
0.133
0.133
0.133
0.133
0.133
0.133
0.133
0.133
0.133
0.133

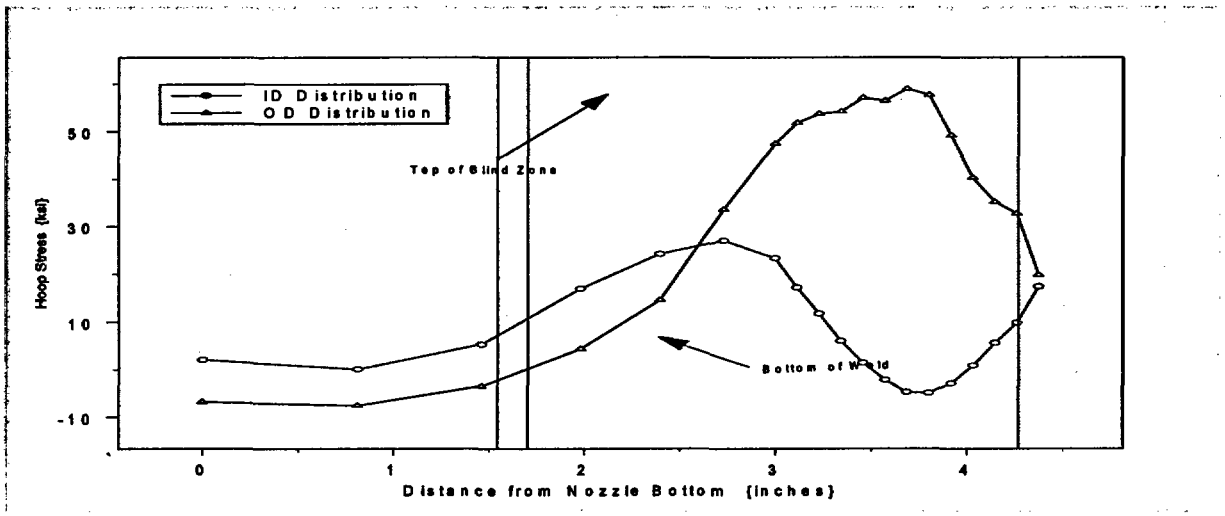

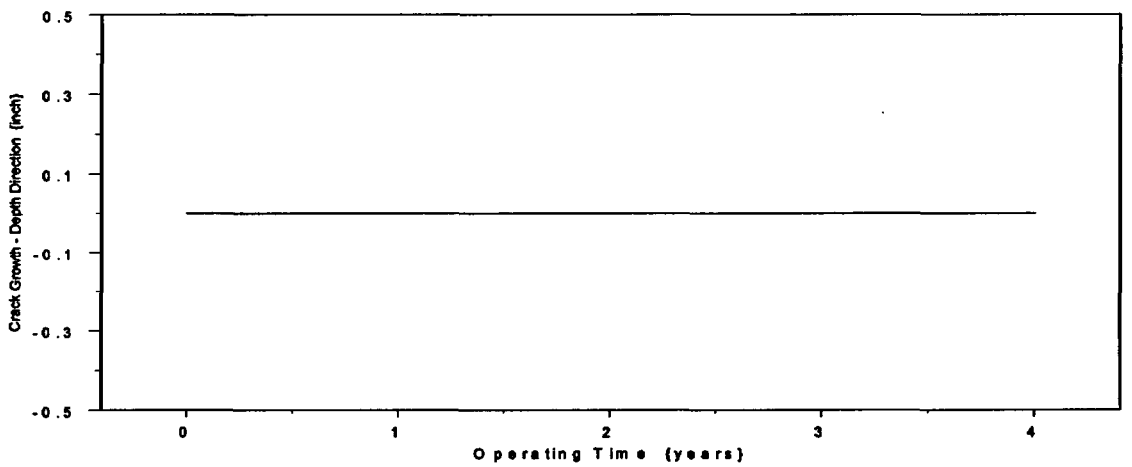

Developed by:
J. S. Brihmadesam

Verified by:
B. C. Gray

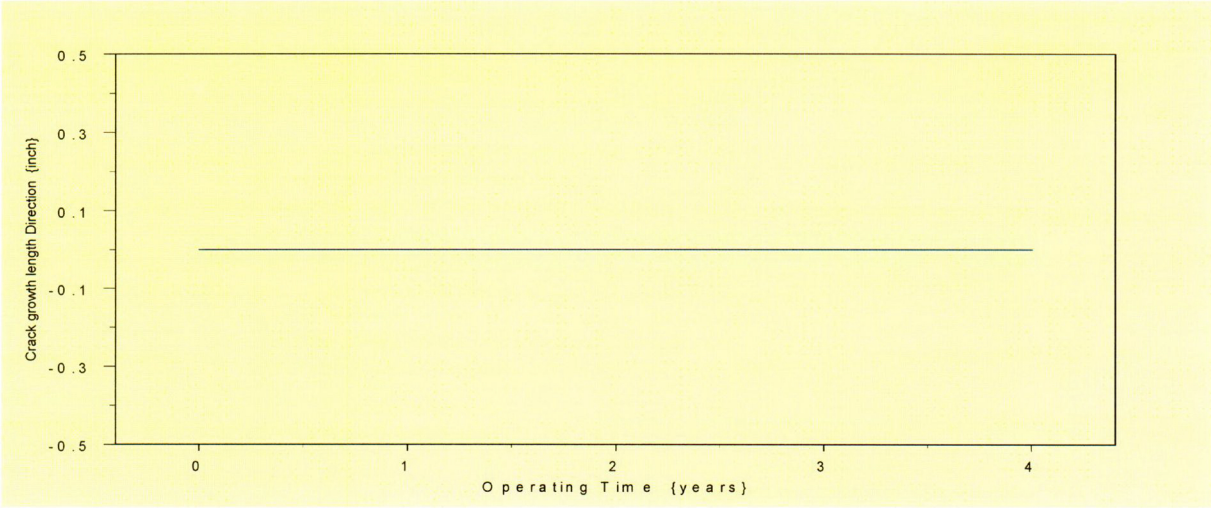
0.5
0.3
0.1
-0.1
-0.3
-0.5
Crack growth length Direction {inch}
0
1
2
3
4
Operating Time {years}

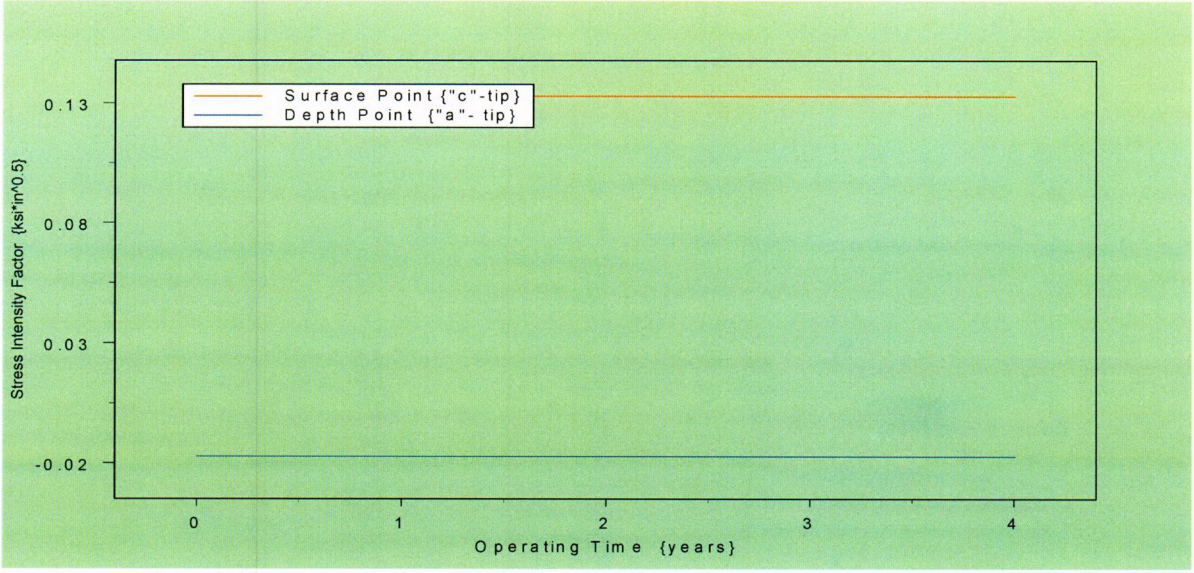
Surface Point {"c"-tip}
Depth Point {"a"- tip}
0.13
0.08
0.03
-0.02
Stress Intensity Factor {ksi*in^0.5}
0
1
2
3
4
Operating Time {years}

Stress Corrosion Crack Growth Analysis Throughwall flaw

Developed by Central Engineering Programs, Entergy Operations Inc

Developedby: J. S. Brihmadesam **Verified by: B. C. Gray**

Note : Only for use when $R_{outside}/t$ is between 2.0 and 5.0 (Thickwall Cylinder)

Refrences :

1) ASME PVP paper PVP-350, Page 143; 1997 {Fracture Mechanics Model}
2) Crack Growth of Alloy 600 Base Metal in PWR Environments; EPRI MRP Report MRP 55 Rev. 1, 2002

Arkansas Nuclear One Unit 2

Component : Reactor Vessel CEDM -"28"Degree Nozzle, Mid-Plane Azimuth, 1.544 inch above Nozzle Bottom

Calculation Reference: MRP 75 th Percentile and Flaw Pressurized

Note : *Used the Metric form of the equation from EPRI MRP 55-Rev. 1.*
The correction is applied in the determination of the crack extension to obtain the value in inch/hr.

Through Wall Axial Flaw

The first Input is to locate the Reference Line (eg. top of the Blind Zone). The throughwall flaw "Upper Tip" is located at the Reference Line.

Enter the elevation of the Reference Line (eg.Blind Zone) above the nozzle bottom in inches.

$BZ := 1.544$ Location of Blind Zone above nozzle bottom (inch)

The Second Input is the Upper Limit for the evaluation, which is the bottom of the fillet weld leg. This is shown on the Excel spread sheet as weld bottom. Enter this dimension (measured from nozzle bottom) below.

$UL_{Strs.Dist} := 2.999$ Upper axial Extent for Stress Distribution to be used in the analysis (Axial distance above nozzle bottom)

Input Data :-

$L := 0.25$ Initial Flaw Length TW axial (Based on 10 Ksi average stress)

$od := 4.05$ Tube OD

$id := 2.728$ Tube ID

$P_{Int} := 2.235$ Design Operating Pressure (internal)

$Years := 4$ Number of Operating Years

$I_{lim} := 1500$ Iteration limit for Crack Growth loop

$T := 604$ Estimate of Operating Temperature

$v := 0.307$ Poissons ratio @ 600 F

$\alpha_{0c} := 2.67 \cdot 10^{-12}$ Constant in MRP PWSCC Model for I-600 Wrought @ 617 deg. F

$Q_g := 31.0$ Thermal activation Energy for Crack Growth {MRP)

$T_{ref} := 617$ Reference Temperature for normalizing Data deg. F

$$C_0 := e^{\left[\frac{-Q_g}{1.103 \cdot 10^{-3}} \cdot \left(\frac{1}{T+459.67} - \frac{1}{T_{ref}+459.67}\right)\right]} \cdot \alpha_{0c}$$

$Tim_{opr} := Years \cdot 365 \cdot 24$

$R_o := \frac{od}{2}$ $R_i := \frac{id}{2}$ $t := R_o - R_i$ $R_m := R_i + \frac{t}{2}$ $CF_{inhr} := 1.417 \cdot 10^5$

$C_{blk} := \frac{Tim_{opr}}{I_{lim}}$ $Prnt_{blk} := \left|\frac{I_{lim}}{50}\right|$ $l := \frac{L}{2}$

Stress Distribution in the tube. The outside surface is the reference surface for all analysis in accordance with the reference.

Stress Input Data

Import the Required data from applicable Excel spread Sheet. The column designations are as follows:
Cloumn "0" = Axial distance from Minimum to Maximum recorded on the data sheet (inches)
Column "1" = ID Stress data at each Elevation (ksi)
Column "5" = OD Stress data at each Elevation (ksi)

$Data_{All} :=$

	0	1	2	3	4	5
0	0	2.08	-0.87	-2.96	-4.82	-6.75
1	0.81	0.09	-2.37	-4.27	-6	-7.55
2	1.46	5.28	1.69	-0.79	-2.49	-3.47
3	1.98	16.88	12.42	9.56	6.91	4.32
4	2.4	24.14	20.89	18.11	16.59	14.51
5	2.73	26.96	22.67	20.69	24.84	33.52
6	3	23.28	20.9	21.71	37.11	47.4
7	3.11	17.16	17.1	20.74	41.09	51.76
8	3.23	11.72	14.42	21.34	43.54	53.69
9	3.34	6	11.11	20.91	43.83	54.15
10	3.46	1.44	8.09	20.38	43.02	57.02
11	3.57	-2.17	5.89	19.93	42.41	56.41

$AllAxl := Data_{All}^{\langle 0 \rangle}$ $AllID := Data_{All}^{\langle 1 \rangle}$ $AllOD := Data_{All}^{\langle 5 \rangle}$

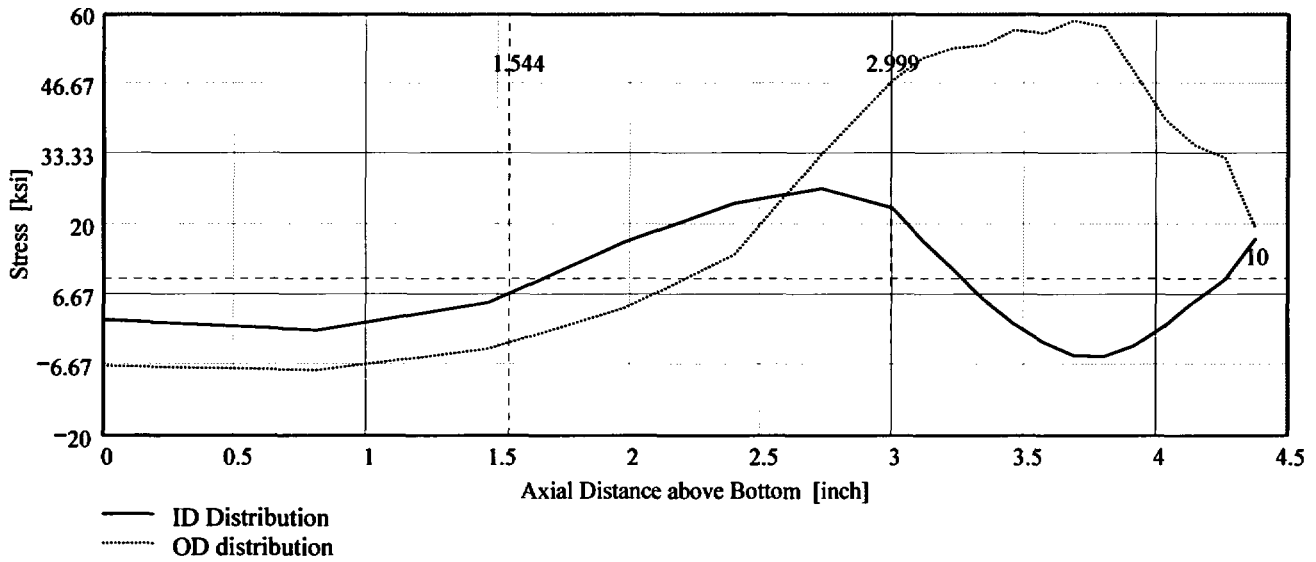

Observing the stress distribution select the region in the table above labeled $Data_{All}$ that represents the region of interest. This needs to be done especially for distributions that have a large compressive stress at the nozzle bottom and high tensile stresses at the J-weld location. Copy the selection in the above table , click on the "Data" statement below and delete it from the edit menu. Type "Data and the Mathcad "equal" sign (Shift-Colon) then insert the same to the right of the Mathcad Equals sign below (paste symbol).

$$Data := \begin{pmatrix} 0 & 2.079 & -0.875 & -2.96 & -4.82 & -6.75 \\ 0.811 & 0.091 & -2.37 & -4.267 & -6.004 & -7.552 \\ 1.46 & 5.283 & 1.686 & -0.786 & -2.49 & -3.469 \\ 1.98 & 16.881 & 12.419 & 9.564 & 6.907 & 4.319 \\ 2.397 & 24.144 & 20.894 & 18.115 & 16.59 & 14.513 \\ 2.731 & 26.962 & 22.672 & 20.686 & 24.842 & 33.523 \\ 2.999 & 23.279 & 20.902 & 21.706 & 37.111 & 47.395 \\ 3.113 & 17.161 & 17.101 & 20.743 & 41.091 & 51.762 \\ 3.228 & 11.722 & 14.424 & 21.34 & 43.543 & 53.688 \\ 3.343 & 6.004 & 11.108 & 20.912 & 43.833 & 54.154 \\ 3.457 & 1.439 & 8.085 & 20.38 & 43.021 & 57.025 \end{pmatrix}$$

$Axl := Data^{\langle 0 \rangle}$ $ID := Data^{\langle 1 \rangle}$ $OD := Data^{\langle 5 \rangle}$

$R_{ID} := regress(Axl, ID, 3)$ $R_{OD} := regress(Axl, OD, 3)$

$FL_{Cntr} := BZ - l$ Flaw Center above Nozzle Bottom

$$Inc_{Strs.avg} := \frac{UL_{Strs.Dist} - BZ}{20}$$

No User Input required beyond this Point

Sat Aug 09 11:44:49 AM 2003

$Prop_{Length} = 1.455$

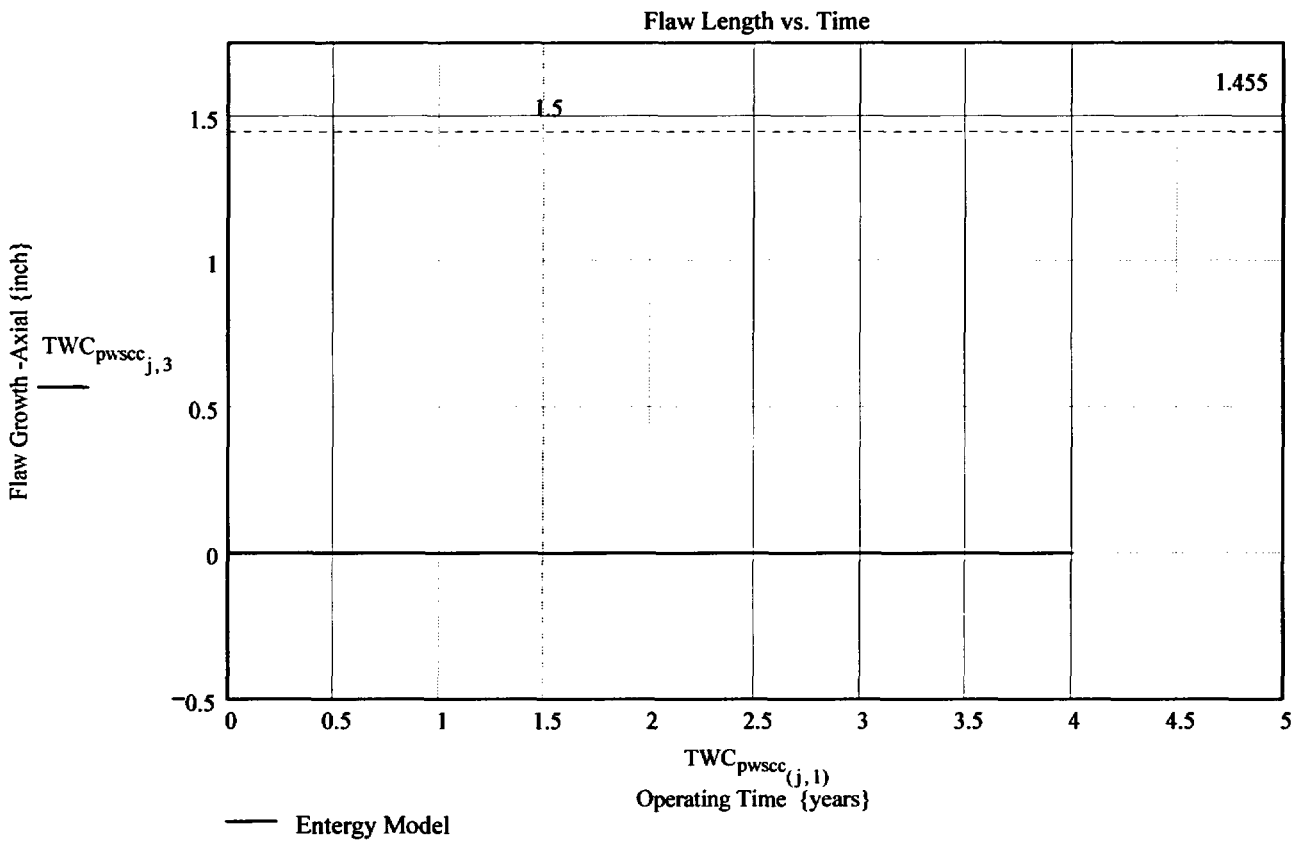

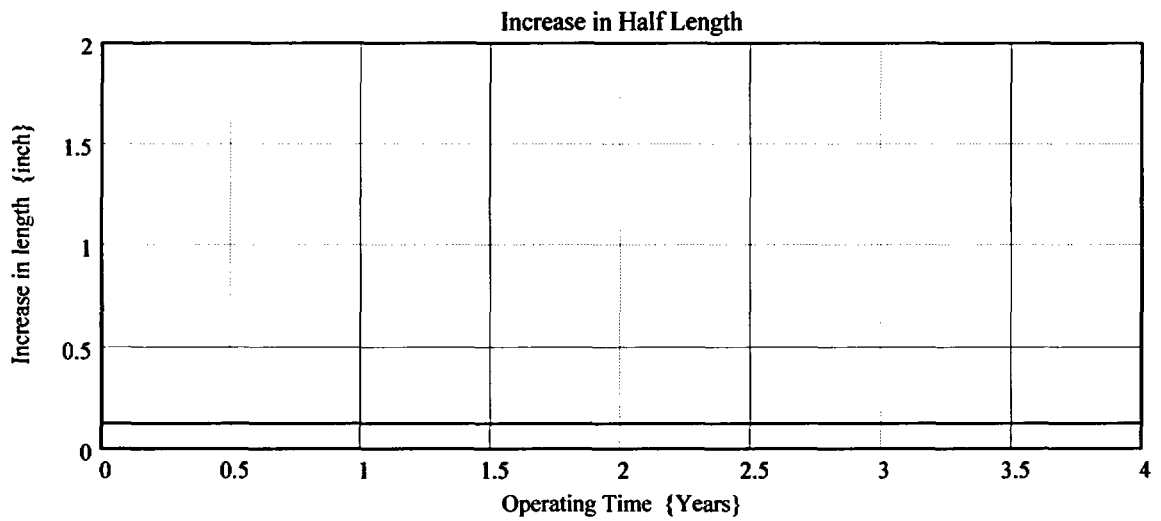

Developed by: *Verified by:*

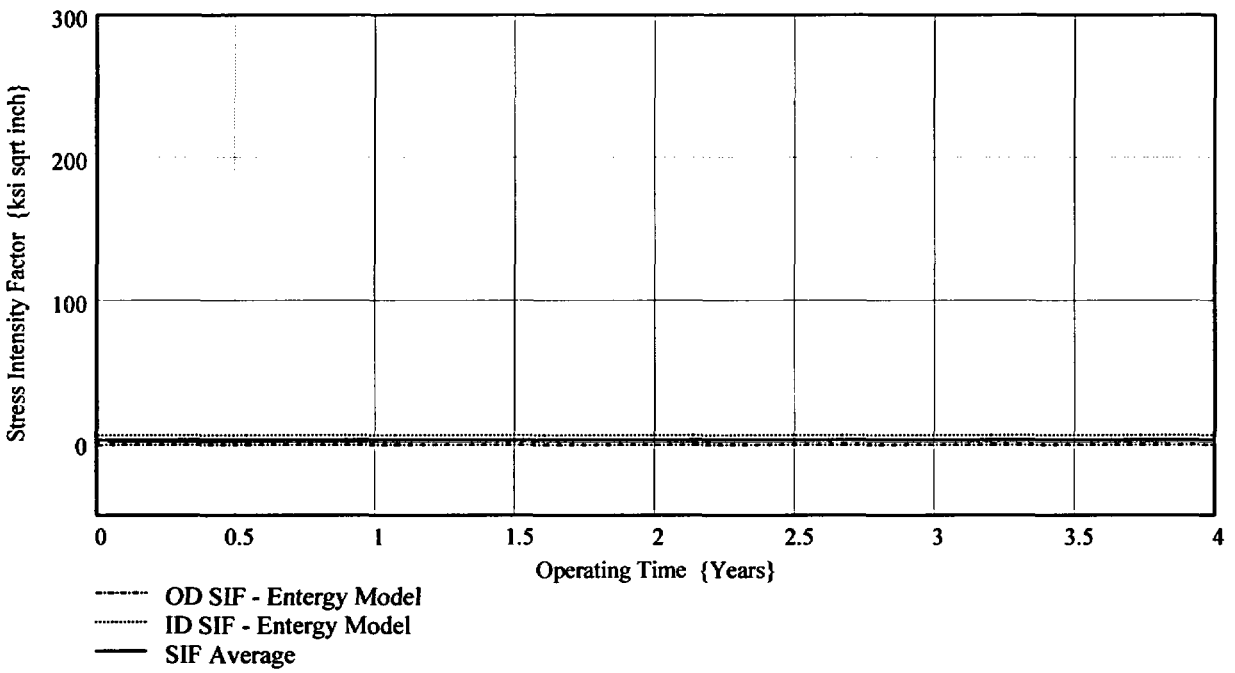
300
200
100
0
Stress Intensity Factor {ksi sqrt inch}
0
0.5
1
1.5
2
2.5
3
3.5
4
Operating Time {Years}
OD SIF - Entergy Model
ID SIF - Entergy Model
SIF Average

$TWC_{pwscc_{(j,6)}}$ =

-1.027
-1.027
-1.027
-1.027
-1.027
-1.027
-1.027
-1.027
-1.027
-1.027
-1.027
-1.027
-1.027
-1.027
-1.027
-1.027

$TWC_{pwscc_{(j,7)}}$ =

5.625
5.625
5.625
5.625
5.625
5.625
5.625
5.625
5.625
5.625
5.625
5.625
5.625
5.625
5.625
5.625

$TWC_{pwscc_{(j,8)}}$ =

2.389
2.389
2.389
2.389
2.389
2.389
2.389
2.389
2.389
2.389
2.389
2.389
2.389
2.389
2.389
2.389

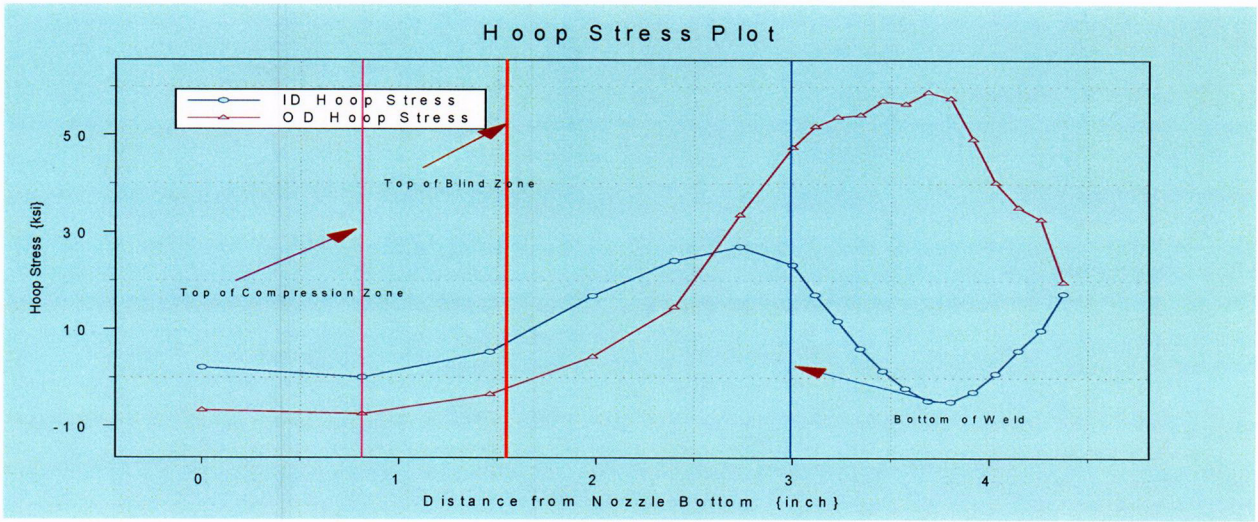
Hoop Stress Plot
ID Hoop Stress
OD Hoop Stress
Top of Blind Zone
Top of Compression Zone
Bottom of Weld
Hoop Stress {ksi}
50
30
10
-10
0
1
2
3
4
Distance from Nozzle Bottom {inch}

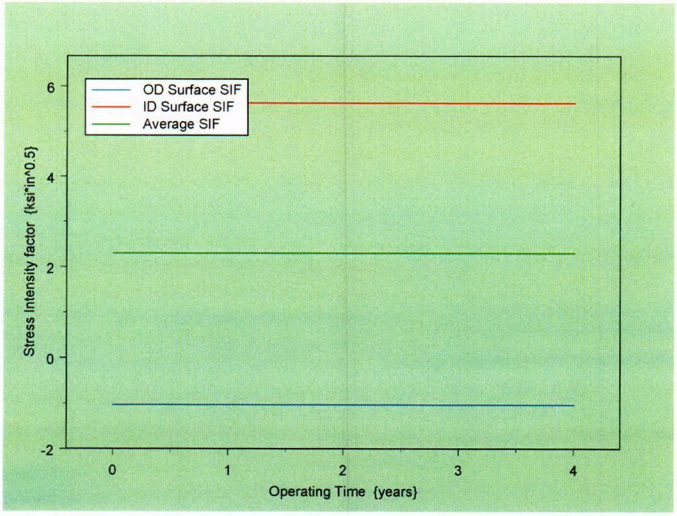
OD Surface SIF
ID Surface SIF
Average SIF
Stress Intensity factor {ksi*in^0.5}
6
4
2
0
-2
0
1
2
3
4
Operating Time {years}

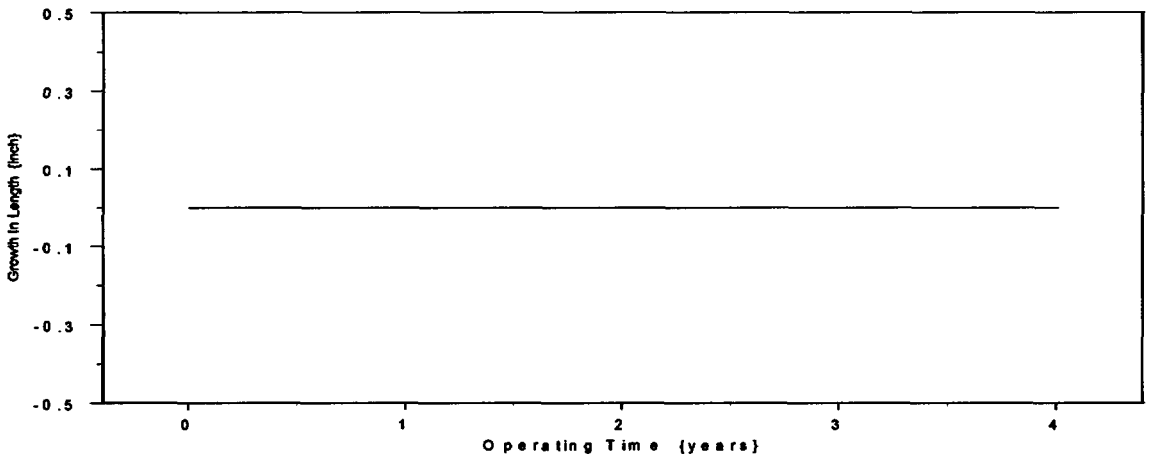
0.5
0.3
0.1
-0.1
-0.3
-0.5
Growth in Length (inch)
0
1
2
3
4
Operating Time (years)

Primary Water Stress Corrosion Crack Growth Analysis ID flaw;
Developed by Central Engineering Porgrams, Entergy Operations Inc.

Developed by: J. S. Brihmadesam ***Verified by: B. C. Gray***

Refrences :

1) "Stress Intensity factors for Part-through Surface cracks"; NASA TM-11707; July 1992.
2) Crack Growth of Alloy 600 Base Metal in PWR Environments; EPRI MRP Report MRP 55 Rev. 1, 2002

Arkansas Nuclear One Unit 2

Component : Reactor Vessel CEDM -"49" Degree Nozzle, Downhill Azimuth, 1.544" above Nozzle Bottom

Calculation Basis: MRP 75 th Percentile and Flaw Face Pressurized

Mean Radius -to- Thickness Ratio:- "R_m/t" -- between 1.0 and 300.0

Note : ***Used the Metric form of the equation from EPRI MRP 55-Rev. 1.***
The correction is applied in the determination of the crack extension to obtain the value in inch/hr.

ID Surface Flaw

The first Required input is a location for a point on the tube elevation to define the point of interest (e.g. The top of the Blind Zone, or bottom of fillet weld etc.). This reference point is necessar to evaluate the stress distribution on the flaw both for the initial flaw and for a growing flaw. This is defined as the reference point. Enter a number (inch) that represnets the reference point elevation measured upward from the nozzle end.

$$Ref_{Point} := 1.544$$

To place the flaw with repsect to the reference point, the flaw tips and center can be located as follows:

1) The Upper "c- tip" located at the reference point (Enter 1)
2) The Center of the flaw at the reference point (Enter 2)
3) The lower "c- tip" located at the reference point (Enter 3).

$$Val := 2$$

The Input Below is the Upper Limit for the evaluation, which is the bottom of the fillet weld leg. This is shown on the Excel spread sheet as weld bottom. Enter this dimension (measured from nozzle bottom) below.

$UL_{Strs.Dist} := 1.889$ Upper axial Extent for Stress Distribution to be used in the Analysis (Axial distance above nozzle bottom).

Input Data :-

$L := 0.32$	Initial Flaw Length (Twice detectable length)
$a_0 := 0.661 \cdot 0.07$	Initial Flaw Depth (Minimum Detecteble Depth was 5% TW)
$od := 4.05$	Tube OD
$id := 2.728$	Tube ID
$P_{Int} := 2.235$	Design Operating Pressure (internal)
$Years := 4$	Number of Operating Years
$I_{lim} := 1500$	Iteration limit for Crack Growth loop
$T := 604$	Estimate of Operating Temperature
$\alpha_{0c} := 2.67 \cdot 10^{-12}$	Constant in MRP PWSCC Model for I-600 Wrought @ 617 deg. F
$Q_g := 31.0$	Thermal activation Energy for Crack Growth {MRP)
$T_{ref} := 617$	Reference Temperature for normalizing Data deg. F

$$R_o := \frac{od}{2} \qquad R_{id} := \frac{id}{2} \qquad t := R_o - R_{id} \qquad R_m := R_{id} + \frac{t}{2} \qquad Tim_{opr} := Years \cdot 365 \cdot 24$$

$$CF_{inhr} := 1.417 \cdot 10^5 \qquad C_{blk} := \frac{Tim_{opr}}{I_{lim}} \qquad Prnt_{blk} := \left| \frac{I_{lim}}{50} \right| \qquad c_0 := \frac{L}{2} \qquad R_t := \frac{R_m}{t}$$

$$C_{01} := e^{\left[\frac{-Q_g}{1.103 \cdot 10^{-3}} \cdot \left(\frac{1}{T+459.67} - \frac{1}{T_{ref}+459.67}\right)\right] \cdot \alpha_{0c}}$$ Temperature Correction for Coefficient Alpha

$$C_0 := C_{01}$$ 75 th percentile MRP-55 Revision 1

Stress Input Data

Input all available Nodal stress data in the table below. The column designations are as follows:
Column "0" = Axial distance from minimum to maximum recorded on data sheet (inches)
Column "1" = ID Stress data at each Elevation (ksi)
Cloumn "2" = Quarter Thickness Stress data at each Elevation (ksi)
Cloumn "3" = Mid Thickness Stress data at each Elevation (ksi)
Column "4" = Three quarter Thickness Stress data at each Elevation (ksi)
Column "5" = OD Stress data at each Elevation (ksi)

AllData :=

	0	1	2	3	4	5
0	0	-28.32	-18.3	-12.16	-6.2	-0.02
1	0.35	-18.79	-12.49	-6.61	-1.37	3.65
2	0.63	-17.84	-10.52	-4.41	-0.48	2.08
3	0.85	-20.52	-12.97	-5.9	-0.87	-1.54
4	1.03	-19.66	-11.83	-5.29	0.23	1.46
5	1.18	-17.2	-10.59	-0.52	16.33	21.02
6	1.29	-8.02	-2.2	10.46	32.66	37.29
7	1.44	4.78	9.56	24.9	38.18	54.09
8	1.59	13.25	18.57	35.28	52.81	66.52
9	1.74	16	22.02	39.19	62.95	75
10	1.89	15.86	23.14	40.23	64.33	74.87

$AXLen := AllData^{\langle 0 \rangle}$ $ID_{All} := AllData^{\langle 1 \rangle}$ $OD_{All} := AllData^{\langle 5 \rangle}$

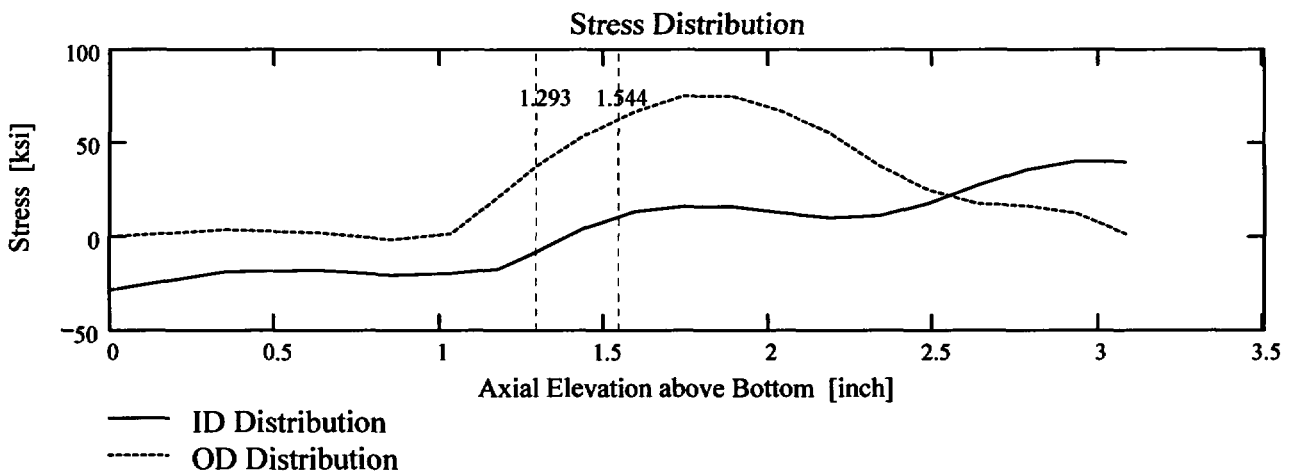

Observing the stress distribution select the region in the table above labeled $Data_{All}$ that represents the region of interest. This needs to be done especially for distributions that have a large compressive stress at the nozzle bottom and high tensile stresses at the J-weld location. Higlight the region in the above table representing the region to be selected (click on the first cell for selection and drag the mouse whilst holding the left mosue button down. Once this is done click the right mouse button and select "Copy Selection"; this will copy the selected area on to the clipboard. Then click on the "Matrix" below (to the right of the dtat statement) to highlight the entire matrix and delete it from the edit menu. When the Mathcad input symbol appears, use the paste function in the tool bar to paste the selection.

$$Data := \begin{pmatrix} 0 & -28.324 & -18.299 & -12.16 & -6.201 & -0.021 \\ 0.35 & -18.794 & -12.495 & -6.607 & -1.366 & 3.655 \\ 0.63 & -17.838 & -10.518 & -4.407 & -0.477 & 2.08 \\ 0.854 & -20.517 & -12.968 & -5.902 & -0.874 & -1.536 \\ 1.034 & -19.663 & -11.831 & -5.288 & 0.227 & 1.46 \\ 1.178 & -17.203 & -10.587 & -0.515 & 16.326 & 21.019 \\ 1.293 & -8.023 & -2.205 & 10.461 & 32.658 & 37.289 \\ 1.442 & 4.778 & 9.557 & 24.903 & 38.177 & 54.089 \\ 1.591 & 13.252 & 18.569 & 35.278 & 52.808 & 66.517 \\ 1.74 & 16.001 & 22.017 & 39.194 & 62.945 & 75.001 \\ 1.889 & 15.857 & 23.14 & 40.235 & 64.335 & 74.874 \end{pmatrix}$$

$Axl := Data^{\langle 0 \rangle}$ $MD := Data^{\langle 3 \rangle}$ $ID := Data^{\langle 1 \rangle}$ $TQ := Data^{\langle 4 \rangle}$ $QT := Data^{\langle 2 \rangle}$ $OD := Data^{\langle 5 \rangle}$

$R_{ID} := regress(Axl, ID, 3)$ $R_{QT} := regress(Axl, QT, 3)$

$R_{OD} := regress(Axl, OD, 3)$

$R_{MD} := regress(Axl, MD, 3)$ $R_{TQ} := regress(Axl, TQ, 3)$

$$FL_{Cntr} := \begin{cases} Ref_{Point} - c_0 & \text{if } Val = 1 \\ Ref_{Point} & \text{if } Val = 2 \\ Ref_{Point} + c_0 & \text{otherwise} \end{cases}$$

Flaw center Location above Nozzle Bottom

$$U_{Tip} := FL_{Cntr} + c_0$$

$$Inc_{Strs.avg} := \frac{UL_{Strs.Dist} - U_{Tip}}{20}$$

No User Input is required beyond this Point

Sat Aug 09 10:59:39 AM 2003

$Prop_{Length} = 0.185$

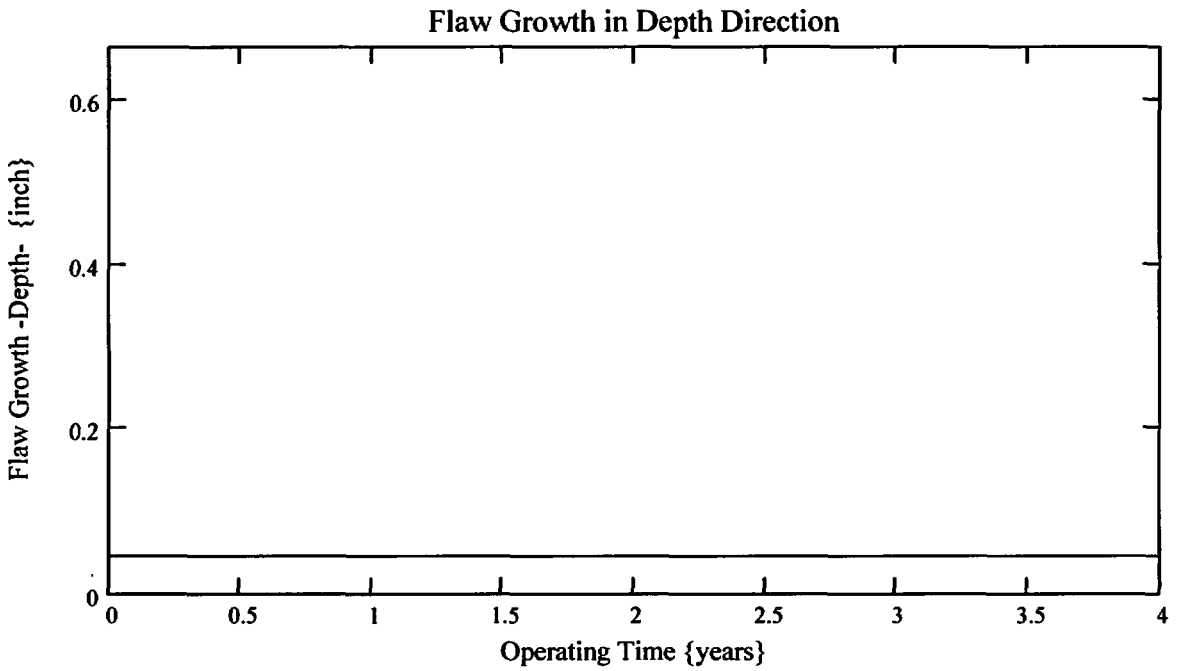

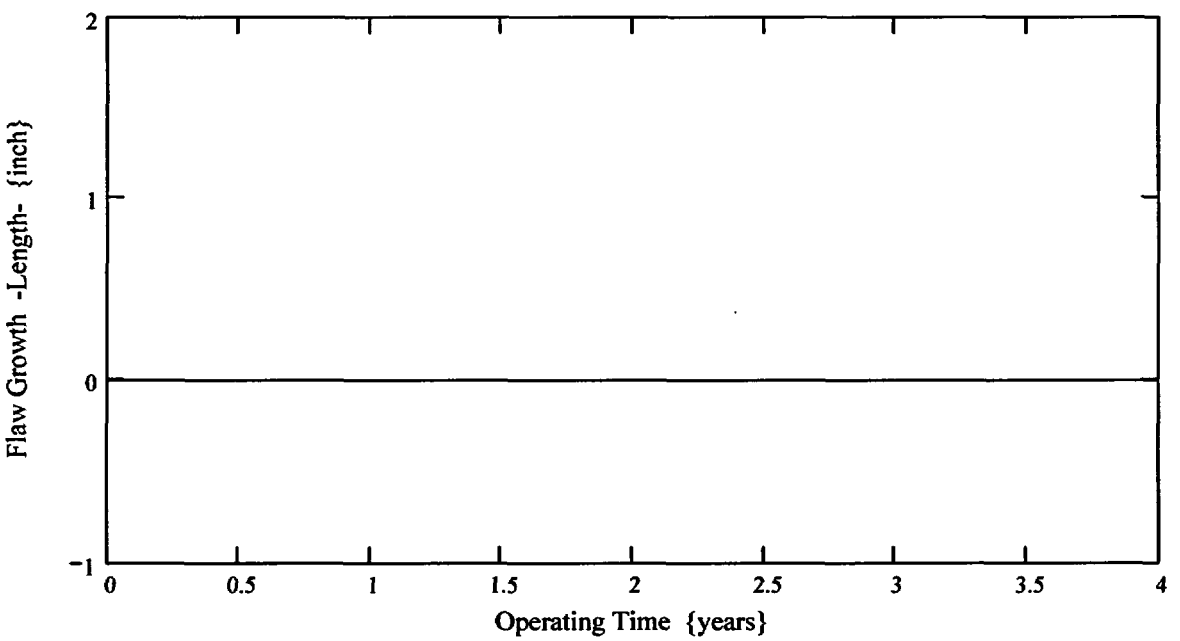

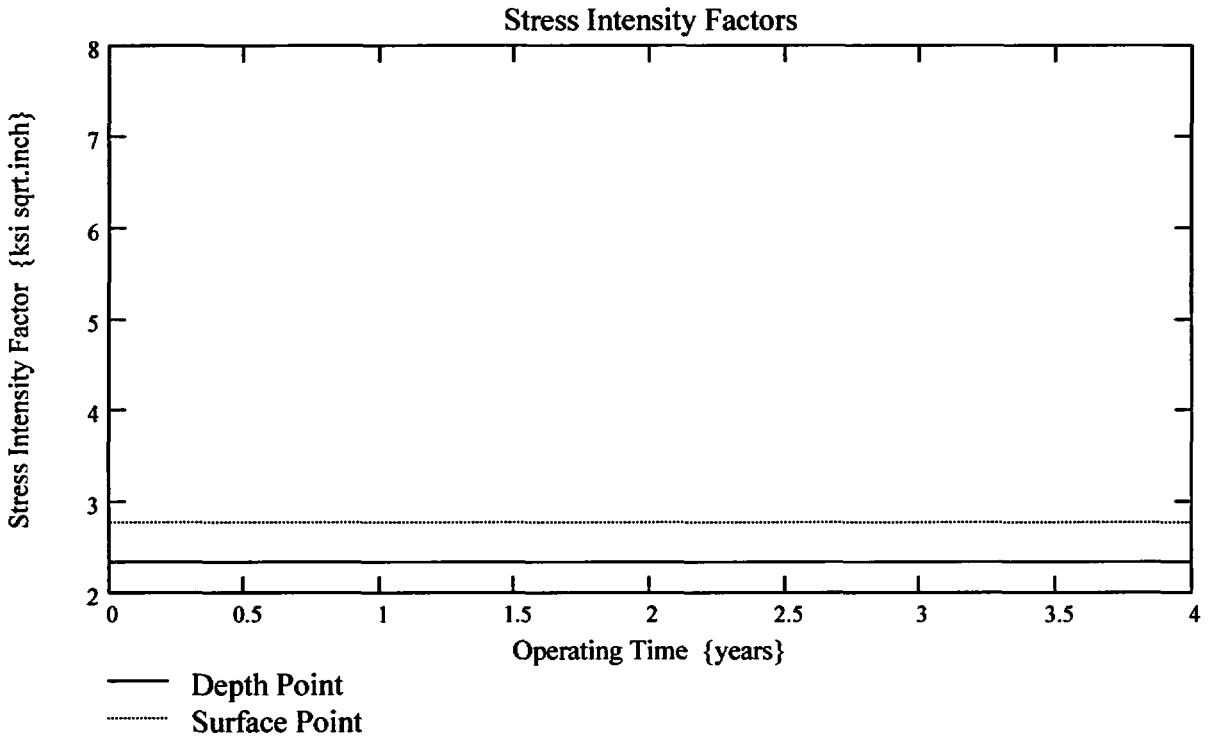
Stress Intensity Factors
Stress Intensity Factor {ksi sqrt.inch}
8
7
6
5
4
3
2
0
0.5
1
1.5
2
2.5
3
3.5
4
Operating Time {years}
Depth Point
Surface Point

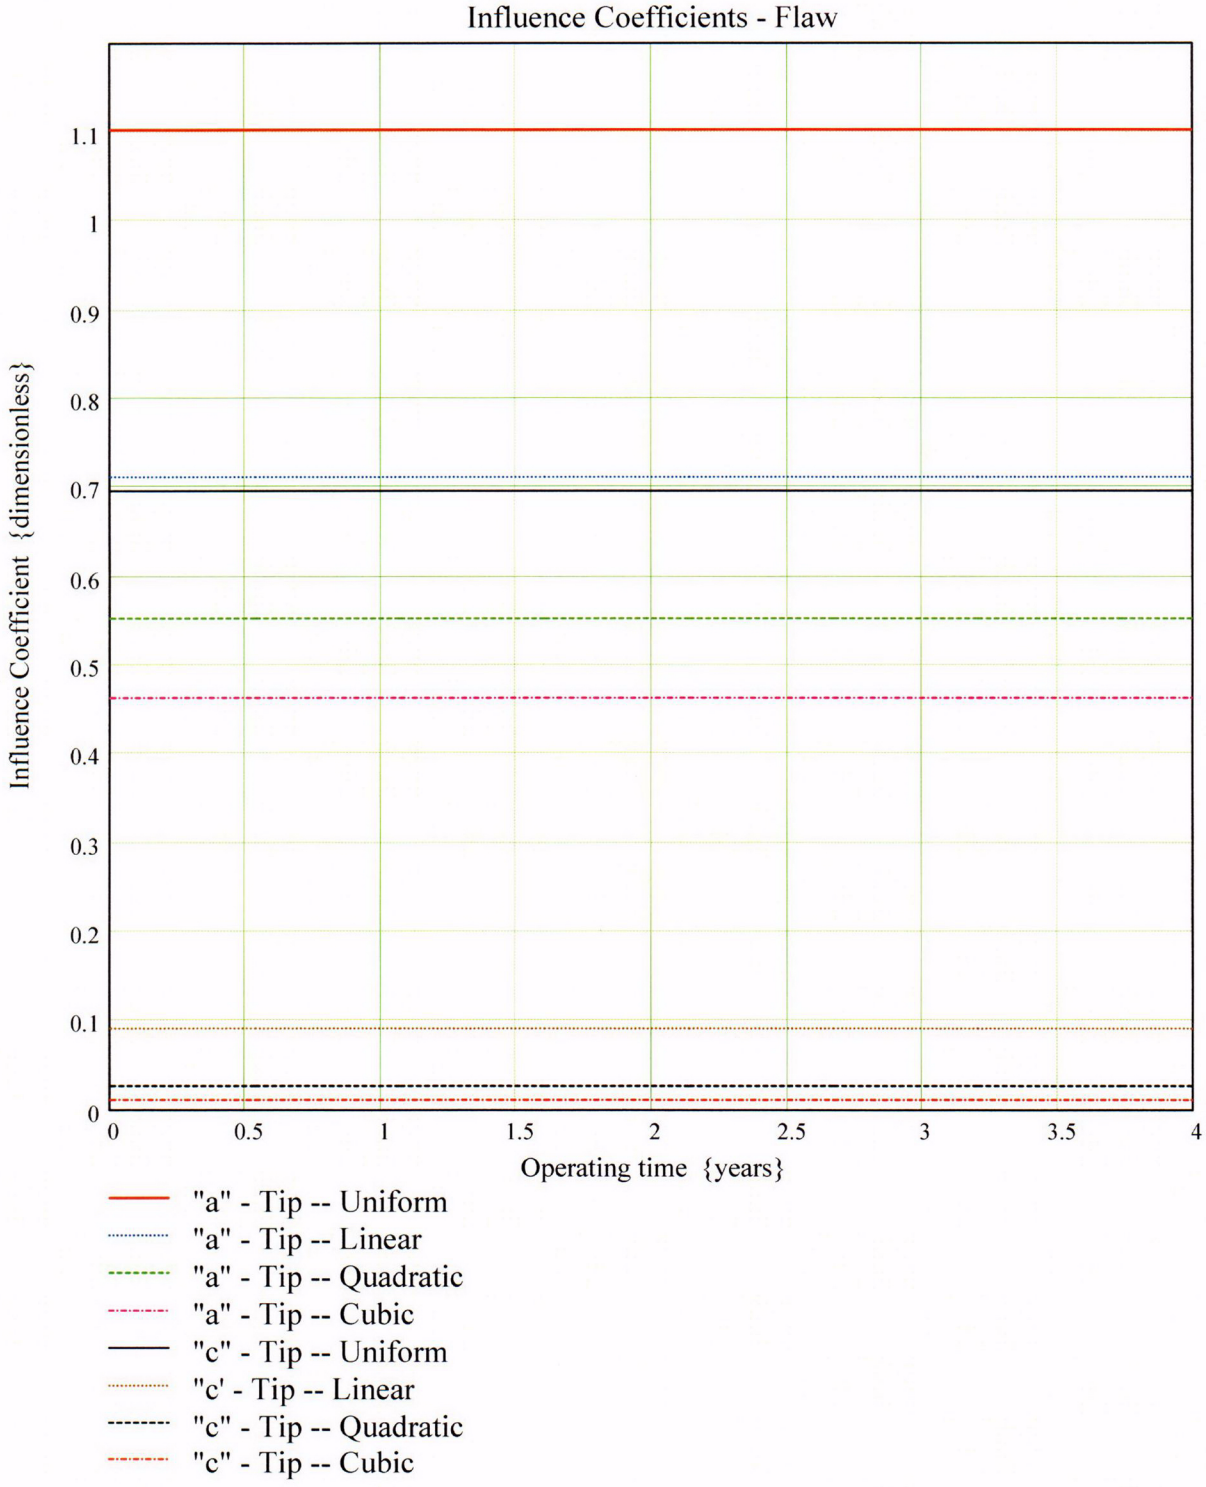
Influence Coefficients - Flaw
Influence Coefficient {dimensionless}
1.1
1
0.9
0.8
0.7
0.6
0.5
0.4
0.3
0.2
0.1
0
0
0.5
1
1.5
2
2.5
3
3.5
4
Operating time {years}
"a" - Tip -- Uniform
"a" - Tip -- Linear
"a" - Tip -- Quadratic
"a" - Tip -- Cubic
"c" - Tip -- Uniform
"c' - Tip -- Linear
"c" - Tip -- Quadratic
"c" - Tip -- Cubic

$CGR_{sambi_{(k,8)}}$ =

1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103

$CGR_{sambi_{(k,6)}}$ =

2.778
2.778
2.778
2.778
2.778
2.778
2.778
2.778
2.778
2.778
2.778
2.778
2.778
2.778
2.778
2.778
2.778

$CGR_{sambi_{(k,5)}}$ =

2.34
2.34
2.34
2.34
2.34
2.34
2.34
2.34
2.34
2.34
2.34
2.34
2.34
2.34
2.34
2.34
2.34

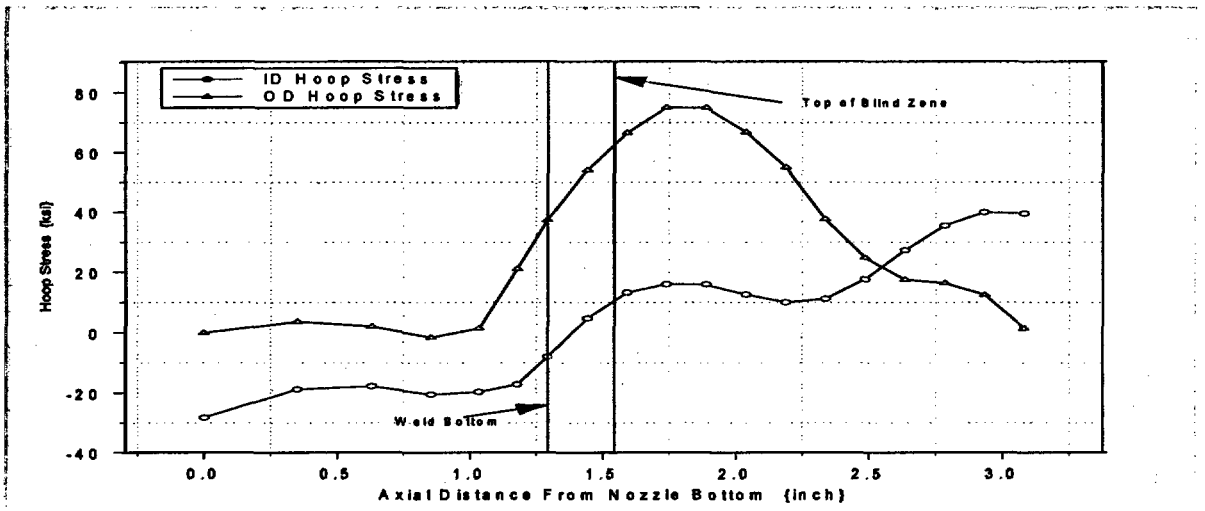
ID Hoop Stress
OD Hoop Stress
Top of Blind Zone
Weld Bottom
Hoop Stress (ksi)
80
60
40
20
0
-20
-40
0.0
0.5
1.0
1.5
2.0
2.5
3.0
Axial Distance From Nozzle Bottom (inch)

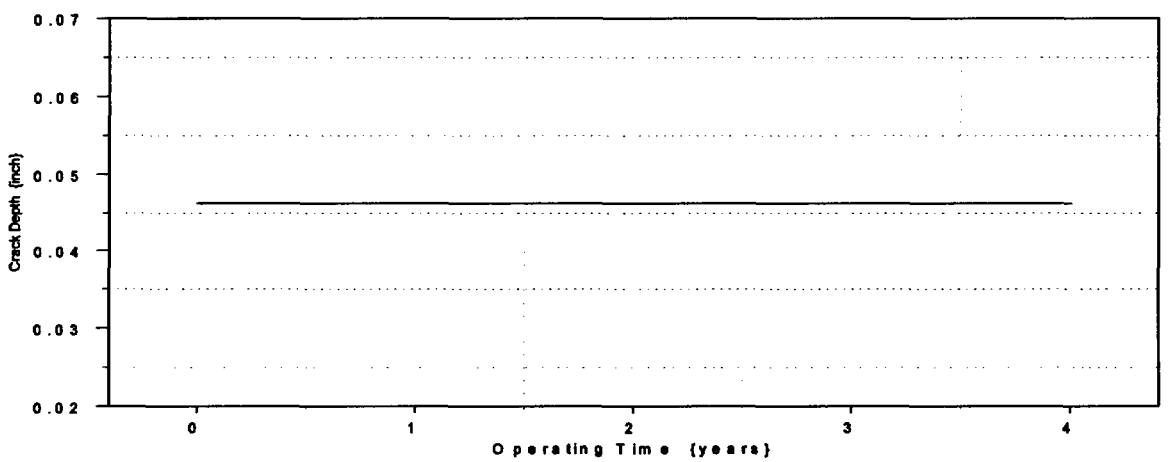
Crack Depth (inch)
0.07
0.06
0.05
0.04
0.03
0.02
0
1
2
3
4
Operating Time (years)

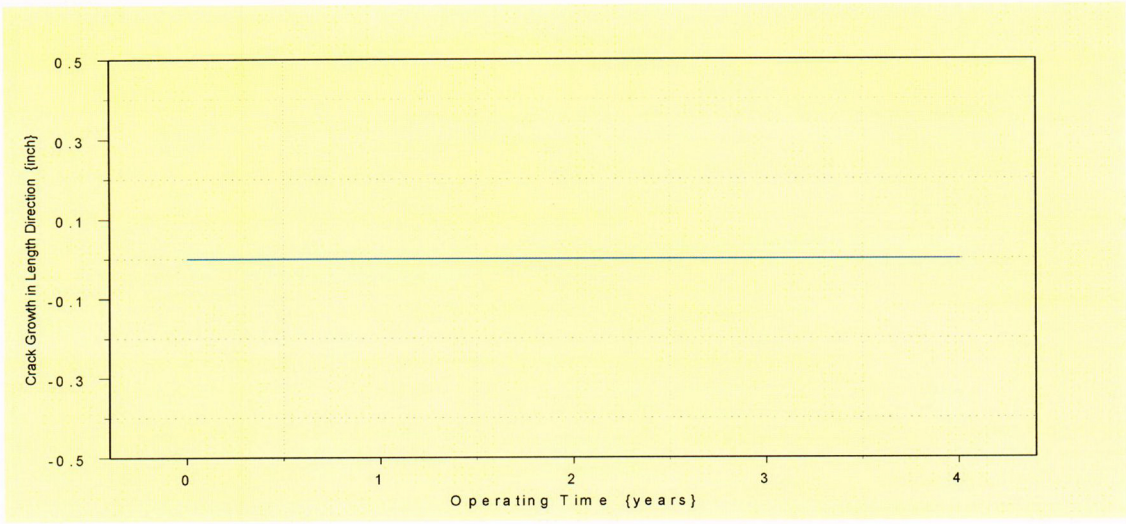
0.5
0.3
0.1
-0.1
-0.3
-0.5
Crack Growth in Length Direction {inch}
0
1
2
3
4
Operating Time {years}

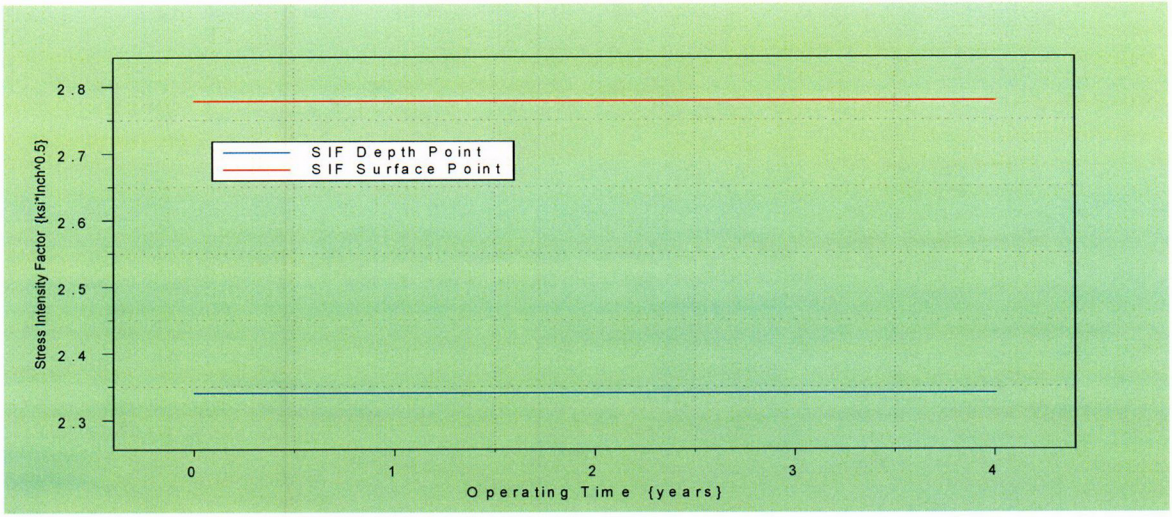
2.8
2.7
2.6
2.5
2.4
2.3
Stress Intensity Factor {ksi*inch^0.5}
SIF Depth Point
SIF Surface Point
0
1
2
3
4
Operating Time {years}

Primary Water Stress Corrosion Crack Growth Analysis ID flaw;
Developed by Central Engineering Porgrams, Entergy Operations Inc.

Developed by: J. S. Brihmadesam ***Verified by: B. C. Gray***

Refrences :

1) "Stress Intensity factors for Part-through Surface cracks"; NASA TM-11707; July 1992.
2) Crack Growth of Alloy 600 Base Metal in PWR Environments; EPRI MRP Report MRP 55 Rev. 1, 2002

Arkansas Nuclear One Unit 2

Component : Reactor Vessel CEDM -"49" Degree Nozzle, Uphill Azimuth, 1.544" above Nozzle Bottom

Calculation Basis: MRP 75 th Percentile and Flaw Face Pressurized

Mean Radius -to- Thickness Ratio:- "R_m/t" -- between 1.0 and 300.0

Note : *Used the Metric form of the equation from EPRI MRP 55-Rev. 1.*
The correction is applied in the determination of the crack extension to obtain the value in inch/hr .

ID Surface Flaw

The first Required input is a location for a point on the tube elevation to define the point of interest (e.g. The top of the Blind Zone, or bottom of fillet weld etc.). This reference point is necessar to evaluate the stress distribution on the flaw both for the initial flaw and for a growing flaw. This is defined as the reference point. Enter a number (inch) that represnets the reference point elevation measured upward from the nozzle end.

$$Ref_{Point} := 1.544$$

To place the flaw with repsect to the reference point, the flaw tips and center can be located as follows:

1) ***The Upper "c- tip" located at the reference point (Enter 1)***
2) ***The Center of the flaw at the reference point (Enter 2)***
3) ***The lower "c- tip" located at the reference point (Enter 3).***

$$Val := 2$$

The Input Below is the Upper Limit for the evaluation, which is the bottom of the fillet weld leg. This is shown on the Excel spread sheet as weld bottom. Enter this dimension (measured from nozzle bottom) below.

$UL_{Strs.Dist} := 6.628$ Upper axial Extent for Stress Distribution to be used in the Analysis (Axial distance above nozzle bottom).

Input Data :-

$L := 0.32$ Initial Flaw Length (Twice detectable length)

$a_0 := 0.661 \cdot 0.07$ Initial Flaw Depth (Minimum Detecteble Depth was 5% TW)

$od := 4.05$ Tube OD

$id := 2.728$ Tube ID

$P_{Int} := 2.235$ Design Operating Pressure (internal)

$Years := 4$ Number of Operating Years

$I_{lim} := 1500$ Iteration limit for Crack Growth loop

$T := 604$ Estimate of Operating Temperature

$\alpha_{0c} := 2.67 \cdot 10^{-12}$ Constant in MRP PWSCC Model for I-600 Wrought @ 617 deg. F

$Q_g := 31.0$ Thermal activation Energy for Crack Growth (MRP)

$T_{ref} := 617$ Reference Temperature for normalizing Data deg. F

$$R_o := \frac{od}{2} \qquad R_{id} := \frac{id}{2} \qquad t := R_o - R_{id} \qquad R_m := R_{id} + \frac{t}{2} \qquad Tim_{opr} := Years \cdot 365 \cdot 24$$

$$CF_{inhr} := 1.417 \cdot 10^5 \qquad C_{blk} := \frac{Tim_{opr}}{I_{lim}} \qquad Prnt_{blk} := \left| \frac{I_{lim}}{50} \right| \qquad c_0 := \frac{L}{2} \qquad R_t := \frac{R_m}{t}$$

$$C_{01} := e^{\left[\frac{-Q_g}{1.103 \cdot 10^{-3}} \cdot \left(\frac{1}{T+459.67} - \frac{1}{T_{ref}+459.67}\right)\right] \cdot \alpha_{0c}}$$ Temperature Correction for Coefficient Alpha

$C_0 := C_{01}$ 75 th percentile MRP-55 Revision 1

Stress Input Data

Input all available Nodal stress data in the table below. The column designations are as follows:
Column "0" = Axial distance from minimum to maximum recorded on data sheet (inches)
Column "1" = ID Stress data at each Elevation (ksi)
Cloumn "2" = Quarter Thickness Stress data at each Elevation (ksi)
Cloumn "3" = Mid Thickness Stress data at each Elevation (ksi)
Column "4" = Three quarter Thickness Stress data at each Elevation (ksi)
Column "5" = OD Stress data at each Elevation (ksi)

AllData :=

	0	1	2	3	4	5
0	0	-20.18	-11.45	-5.94	-1.16	3.7
1	1.79	-3.02	-4.38	-5.44	-5.51	-5.34
2	3.23	9.4	12.13	-0.26	-12.62	-20.23
3	4.38	25.65	24.71	14.58	-15.3	-25.69
4	5.3	36.18	33.79	26.29	-5.92	-24.31
5	6.04	38.11	35.03	31.43	21.21	8.83
6	6.63	42.19	38.1	36.25	40.68	36.41
7	6.76	45.07	42.22	42.74	47.55	44.23
8	6.9	44.97	43.61	46.01	49.99	48.8
9	7.03	44.7	44.12	47.02	51.04	54.11

$AXLen := AllData^{\langle 0 \rangle}$ $ID_{All} := AllData^{\langle 1 \rangle}$ $OD_{All} := AllData^{\langle 5 \rangle}$

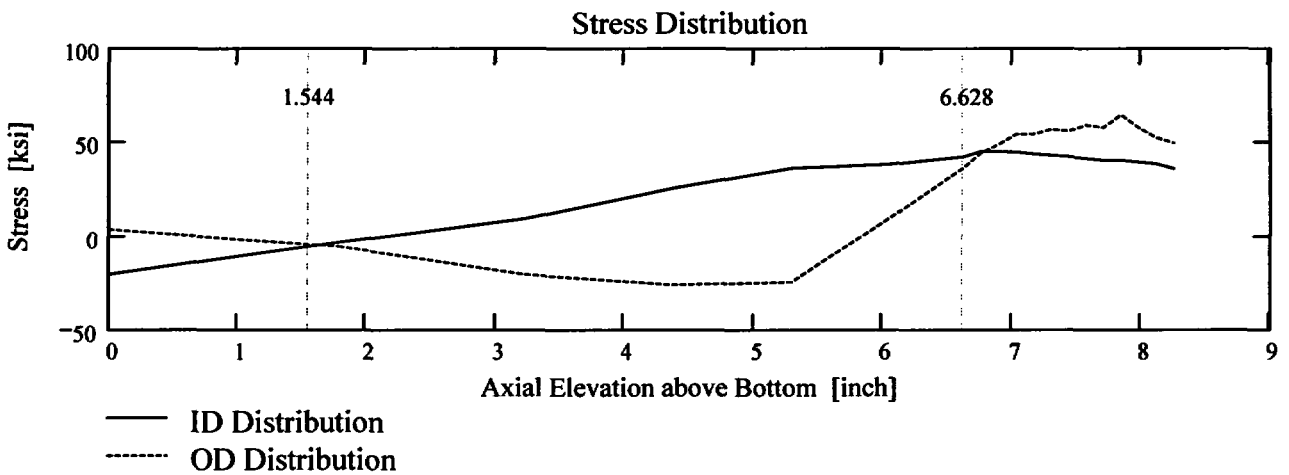

Observing the stress distribution select the region in the table above labeled $Data_{All}$ that represents the region of interest. This needs to be done especially for distributions that have a large compressive stress at the nozzle bottom and high tensile stresses at the J-weld location. Higlight the region in the above table representing the region to be selected (click on the first cell for selection and drag the mouse whilst holding the left mosue button down. Once this is done click the right mouse button and select "Copy Selection"; this will copy the selected area on to the clipboard. Then click on the "Matrix" below (to the right of the dtat statement) to highlight the entire matrix and delete it from the edit menu. When the Mathcad input symbol appears, use the paste function in the tool bar to paste the selection.

$$Data := \begin{pmatrix} 0 & -20.175 & -11.45 & -5.94 & -1.163 & 3.704 \\ 1.792 & -3.024 & -4.378 & -5.443 & -5.511 & -5.341 \\ 3.228 & 9.398 & 12.134 & -0.258 & -12.622 & -20.232 \\ 4.378 & 25.65 & 24.71 & 14.577 & -15.299 & -25.689 \\ 5.299 & 36.179 & 33.787 & 26.287 & -5.925 & -24.306 \\ 6.037 & 38.106 & 35.028 & 31.43 & 21.215 & 8.834 \\ 6.628 & 42.186 & 38.102 & 36.248 & 40.684 & 36.405 \\ 6.764 & 45.067 & 42.217 & 42.736 & 47.553 & 44.235 \\ 6.899 & 44.968 & 43.606 & 46.007 & 49.995 & 48.803 \end{pmatrix}$$

$Axl := Data^{\langle 0 \rangle}$ $MD := Data^{\langle 3 \rangle}$ $ID := Data^{\langle 1 \rangle}$ $TQ := Data^{\langle 4 \rangle}$ $QT := Data^{\langle 2 \rangle}$ $OD := Data^{\langle 5 \rangle}$

$R_{ID} := regress(Axl, ID, 3)$ $R_{QT} := regress(Axl, QT, 3)$

$R_{OD} := regress(Axl, OD, 3)$

$R_{MD} := regress(Axl, MD, 3)$ $R_{TQ} := regress(Axl, TQ, 3)$

$$FL_{Cntr} := \begin{cases} Ref_{Point} - c_0 & \text{if } Val = 1 \\ Ref_{Point} & \text{if } Val = 2 \\ Ref_{Point} + c_0 & \text{otherwise} \end{cases}$$

Flaw center Location above Nozzle Bottom

$$U_{Tip} := FL_{Cntr} + c_0$$

$$Inc_{Strs.avg} := \frac{UL_{Strs.Dist} - U_{Tip}}{20}$$

No User Input is required beyond this Point

Sat Aug 09 10:59:39 AM 2003

$Prop_{Length} = 4.924$

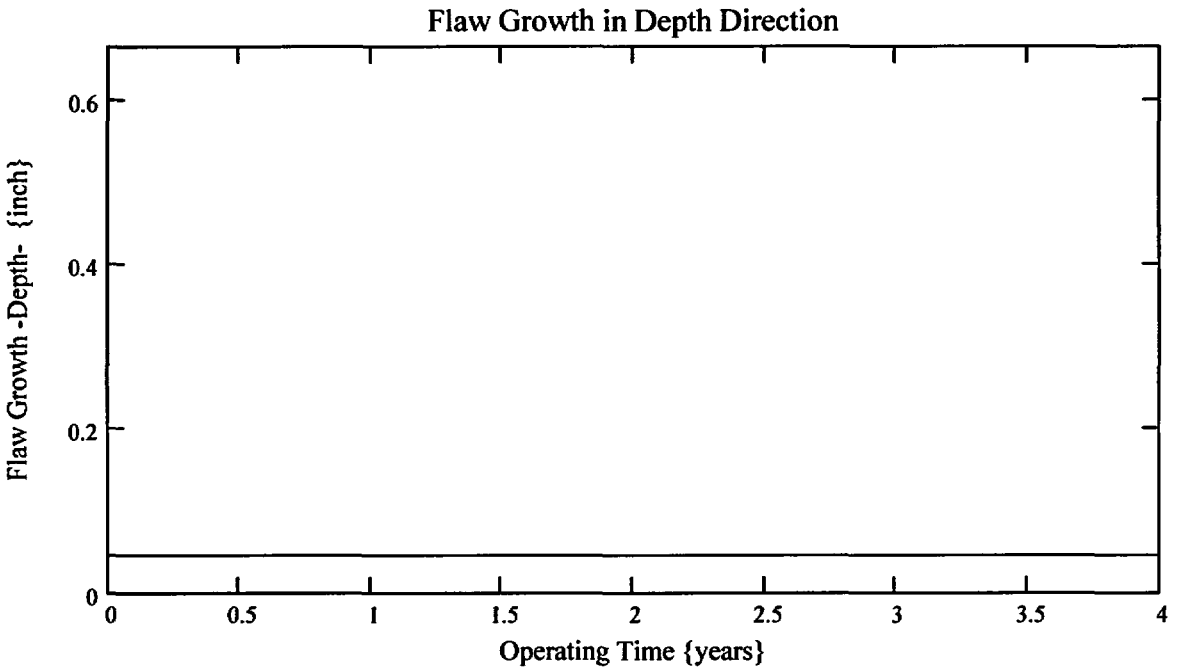

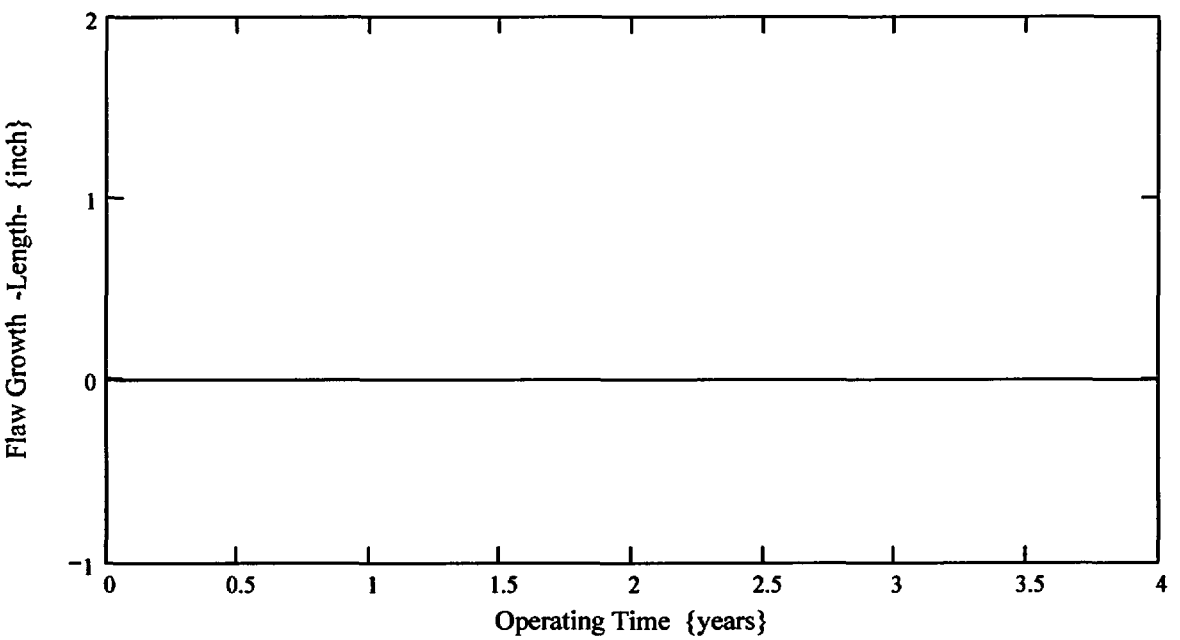

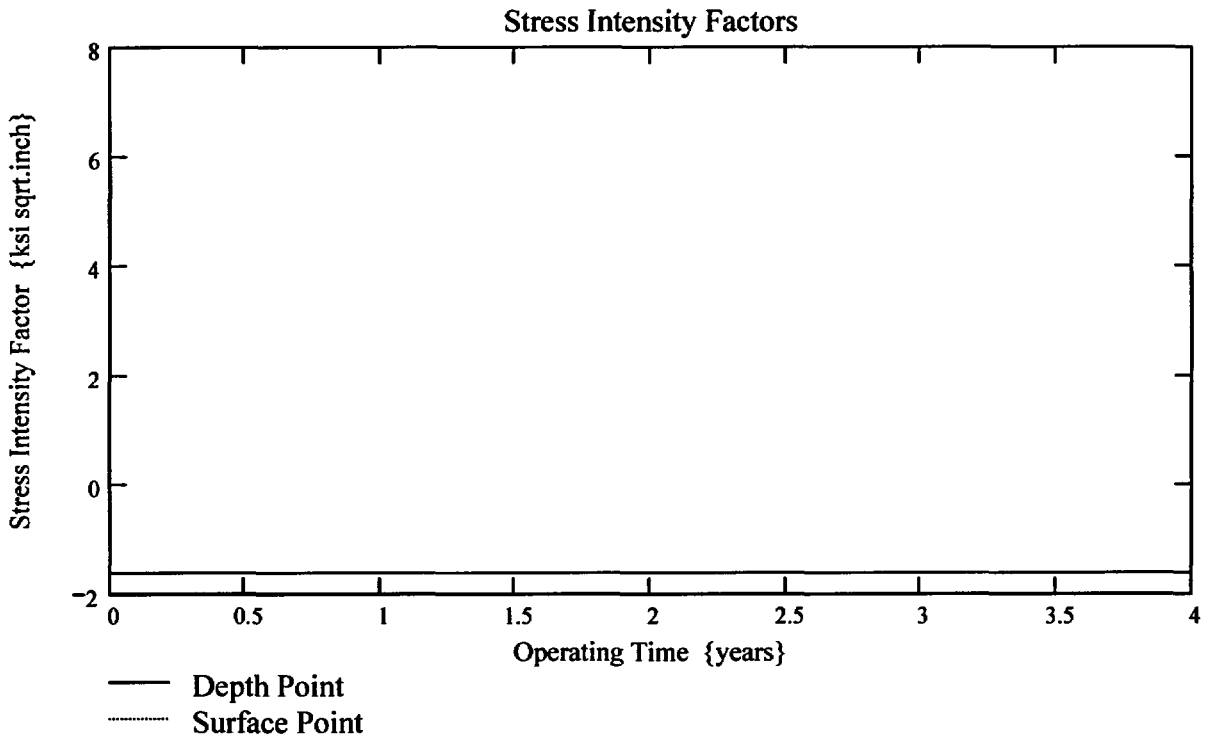
Stress Intensity Factors
Stress Intensity Factor {ksi sqrt.inch}
8
6
4
2
0
−2
0
0.5
1
1.5
2
2.5
3
3.5
4
Operating Time {years}
Depth Point
Surface Point

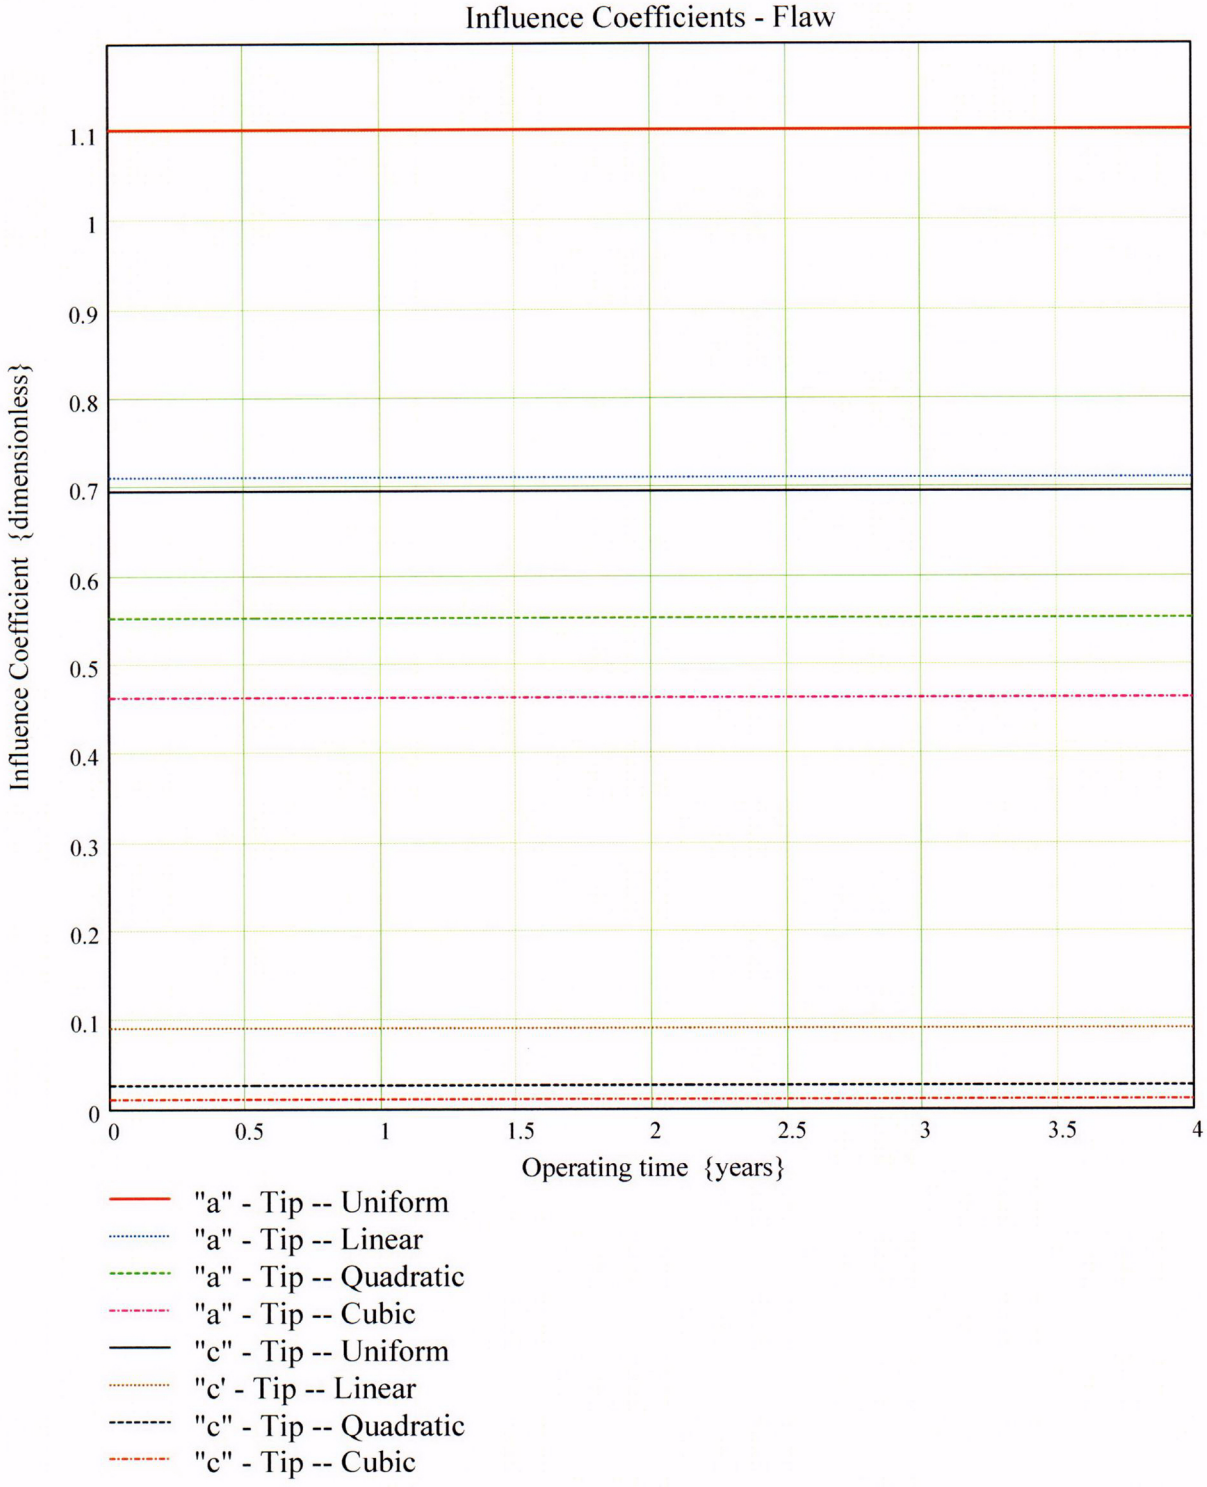
Influence Coefficients - Flaw
Influence Coefficient {dimensionless}
1.1
1
0.9
0.8
0.7
0.6
0.5
0.4
0.3
0.2
0.1
0
0
0.5
1
1.5
2
2.5
3
3.5
4
Operating time {years}
"a" - Tip -- Uniform
"a" - Tip -- Linear
"a" - Tip -- Quadratic
"a" - Tip -- Cubic
"c" - Tip -- Uniform
"c' - Tip -- Linear
"c" - Tip -- Quadratic
"c" - Tip -- Cubic

$CGR_{sambi_{(k,8)}}$ =

1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103
1.103

$CGR_{sambi_{(k,6)}}$ =

-1.99
-1.99
-1.99
-1.99
-1.99
-1.99
-1.99
-1.99
-1.99
-1.99
-1.99
-1.99
-1.99
-1.99
-1.99
-1.99
-1.99

$CGR_{sambi_{(k,5)}}$ =

-1.612
-1.612
-1.612
-1.612
-1.612
-1.612
-1.612
-1.612
-1.612
-1.612
-1.612
-1.612
-1.612
-1.612
-1.612
-1.612
-1.612

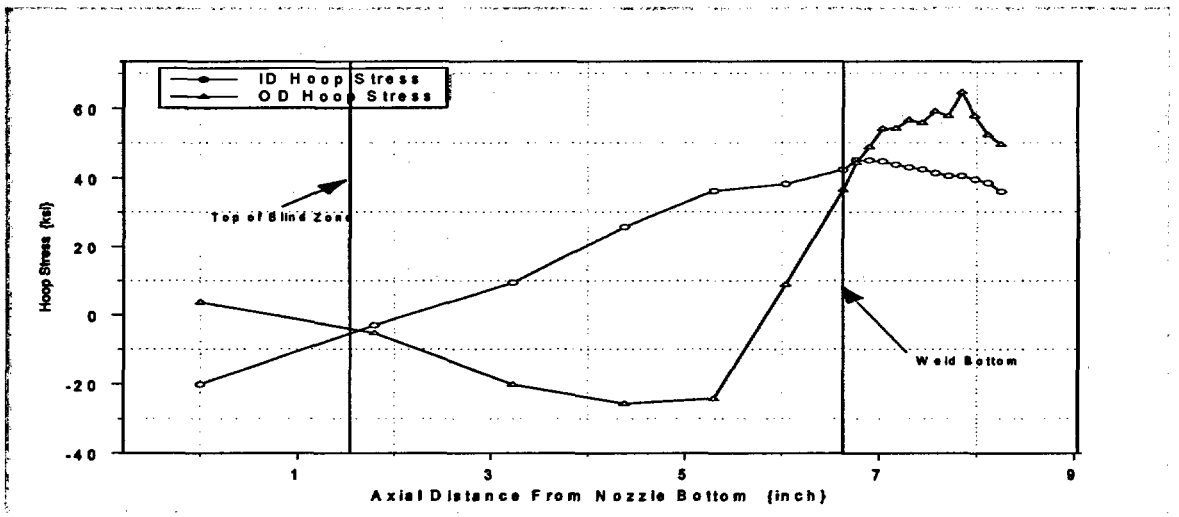
ID Hoop Stress
OD Hoop Stress
Top of Blind Zone
Weld Bottom
Hoop Stress (ksi)
60
40
20
0
-20
-40
1
3
5
7
9
Axial Distance From Nozzle Bottom (inch)

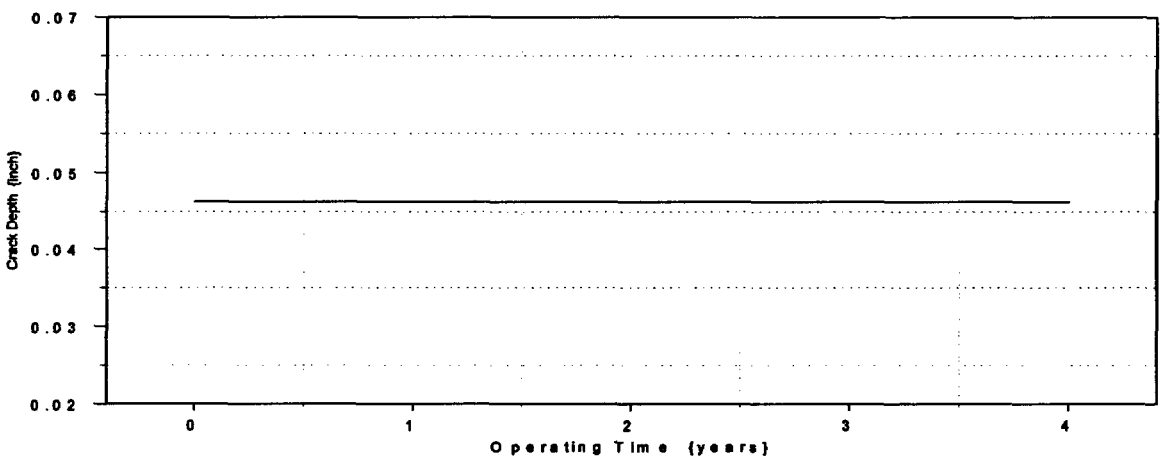
0.07
0.06
0.05
0.04
0.03
0.02
Crack Depth (inch)
0
1
2
3
4
Operating Time (years)

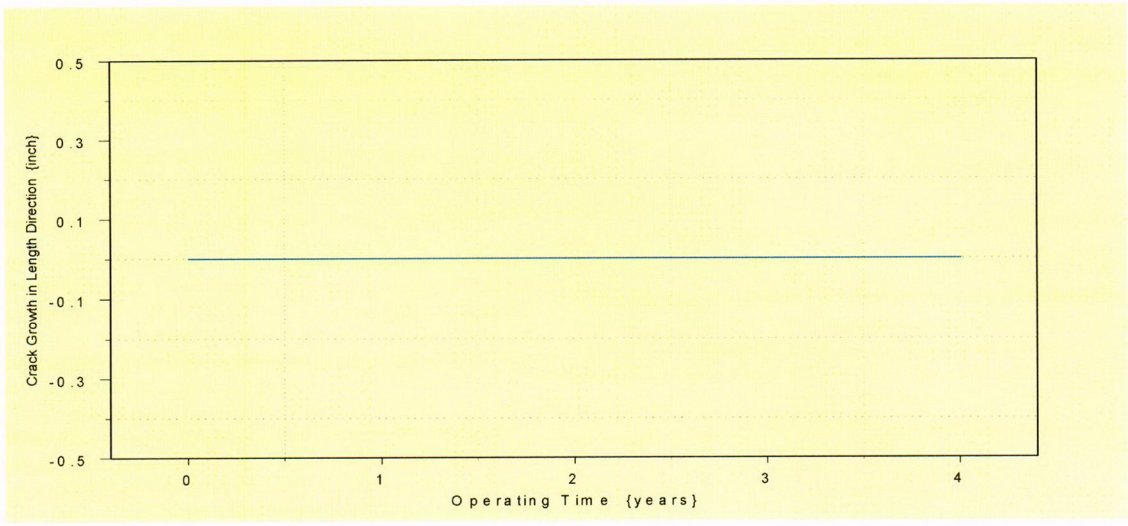
0.5
0.3
0.1
-0.1
-0.3
-0.5
Crack Growth in Length Direction {inch}
0
1
2
3
4
Operating Time {years}

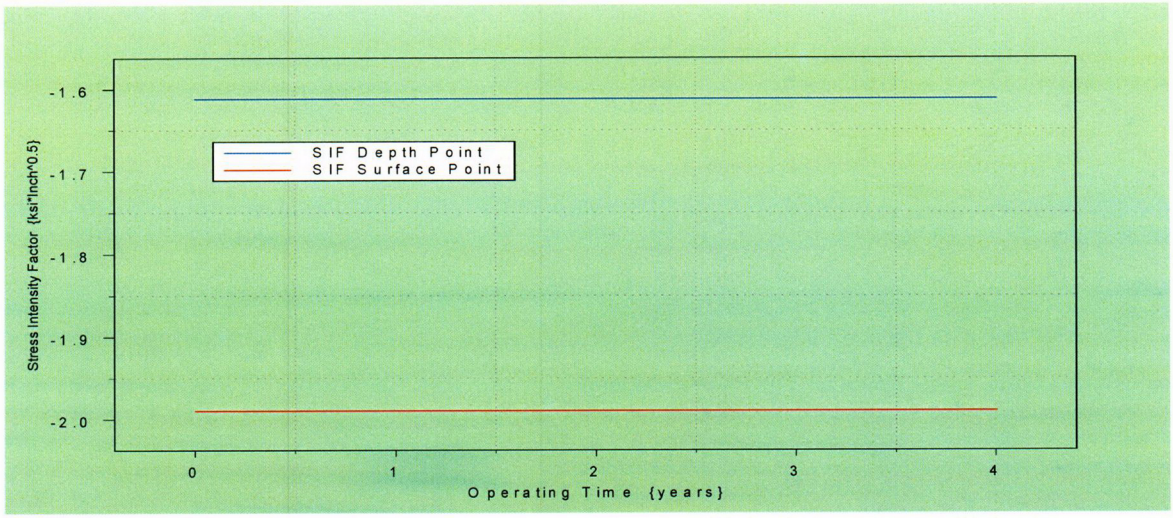
-1.6
-1.7
-1.8
-1.9
-2.0
Stress Intensity Factor {ksi*inch^0.5}
SIF Depth Point
SIF Surface Point
0
1
2
3
4
Operating Time {years}

Primary Water Stress Corrosion Crack Growth Analysis - OD SurfaceFlaw

Developed by Central Engineering Programs, Entergy Operations Inc

Developedby: J. S. Brihmadesam **Verified by: B. C. Gray**

Refrences :

1) "Stress Intensity factors for Part-through Surface cracks"; NASA TM-11707; July 1992.
2) Crack Growth of Alloy 600 Base Metal in PWR Environments; EPRI MRP Report MRP 55 Rev. 1, 2002

Arkansas Nuclear One Unit 2

Component : Reactor Vessel CEDM -"49" Degree Nozzle, Uphill Azimuth, 1.544" above Nozzle Bottom

Calculation Basis: MRP 75 th Percentile and Flaw Face Pressurized

Mean Radius -to- Thickness Ratio:- "R_m/t" -- between 1.0 and 300.0

Note : ***Used the Metric form of the equation from EPRI MRP 55-Rev. 1.***
The correction is applied in the determination of the crack extension to obtain the value in inch/hr .

OD Surface Flaw

The first Required input is a location for a point on the tube elevation to define the point of interest (e.g. The top of the Blind Zone, or bottom of fillet weld etc.). This reference point is necessar to evaluate the stress distribution on the flaw both for the initial flaw and for a growing flaw. This is defined as the reference point. Enter a number (inch) that represnets the reference point elevation measured upward from the nozzle end.

$$Ref_{Point} := 1.544$$

To place the flaw with repsect to the reference point, the flaw tips and center can be located as follows:

1) The Upper "c- tip" located at the reference point (Enter 1)
2) The Center of the flaw at the reference point (Enter 2)
3) The lower "c- tip" located at the reference point (Enter 3).

$$Val := 2$$

Upper Limit to be selected for stress distribution (e.g. Weld bottom). This is the elevation from Nozzle Bottom. Enter this value below

$UL_{Strs.Dist} := 6.628$ Upper Axial Extent for Stress Distribution to be used in the Analysis (Axial distance above nozzle bottom)

Input Data :-

$L := 0.32$ Initial Flaw Length

$a_0 := 0.661 \cdot 0.12$ Initial Flaw Depth

$od := 4.05$ Tube OD

$id := 2.728$ Tube ID

$P_{Int} := 2.235$ Design Operating Pressure (internal)

$Years := 4$ Number of Operating Years

$I_{lim} := 1500$ Iteration limit for Crack Growth loop

$T := 604$ Estimate of Operating Temperature

$\alpha_{0c} := 2.67 \cdot 10^{-12}$ Constant in MRP PWSCC Model for I-600 Wrought @ 617 deg. F

$Q_g := 31.0$ Thermal activation Energy for Crack Growth {MRP)

$T_{ref} := 617$ Reference Temperature for normalizing Data deg. F

$$R_o := \frac{od}{2} \qquad R_{id} := \frac{id}{2} \qquad t := R_o - R_{id} \qquad R_m := R_{id} + \frac{t}{2} \qquad Tim_{opr} := Years \cdot 365 \cdot 24$$

$$CF_{inhr} := 1.417 \cdot 10^5 \qquad C_{blk} := \frac{Tim_{opr}}{I_{lim}} \qquad Prnt_{blk} := \left| \frac{I_{lim}}{50} \right| \qquad c_0 := \frac{L}{2} \qquad R_t := \frac{R_m}{t}$$

$$C_{01} := e^{\left[\frac{-Q_g}{1.103 \cdot 10^{-3}} \cdot \left(\frac{1}{T+459.67} - \frac{1}{T_{ref}+459.67}\right)\right]} \cdot \alpha_{0c}$$ Temperature Correction for Coefficient Alpha

$C_0 := C_{01}$ 75 th percentile MRP-55 Revision 1

Stress Input Data

Input all available Nodal stress data in the table below. The column designations are as follows:
Column "0" = Axial distance from minumum to maximum recorded on data sheet(inches)
Column "1" = ID Stress data at each Elevation (ksi)
Column "2" = Quarter Thickness Stress data at each Elevation (ksi)
Column "3" = Mid Thickness Stress data at each Elevation (ksi)
Column "4" = Three Quarter Thickness Stress data at each Elevation (ksi)
Column "5" = OD Stress data at each Elevation (ksi)

AllData :=

	0	1	2	3	4	5
0	0	-20.18	-11.45	-5.94	-1.16	3.7
1	1.79	-3.02	-4.38	-5.44	-5.51	-5.34
2	3.23	9.4	12.13	-0.26	-12.62	-20.23
3	4.38	25.65	24.71	14.58	-15.3	-25.69
4	5.3	36.18	33.79	26.29	-5.92	-24.31
5	6.04	38.11	35.03	31.43	21.21	8.83
6	6.63	42.19	38.1	36.25	40.68	36.41
7	6.76	45.07	42.22	42.74	47.55	44.23
8	6.9	44.97	43.61	46.01	49.99	48.8
9	7.03	44.7	44.12	47.02	51.04	54.11
10	7.17	43.72	43.97	47.64	50.17	54.17

$AXLen := AllData^{\langle 0 \rangle}$ $ID_{All} := AllData^{\langle 1 \rangle}$ $OD_{All} := AllData^{\langle 5 \rangle}$

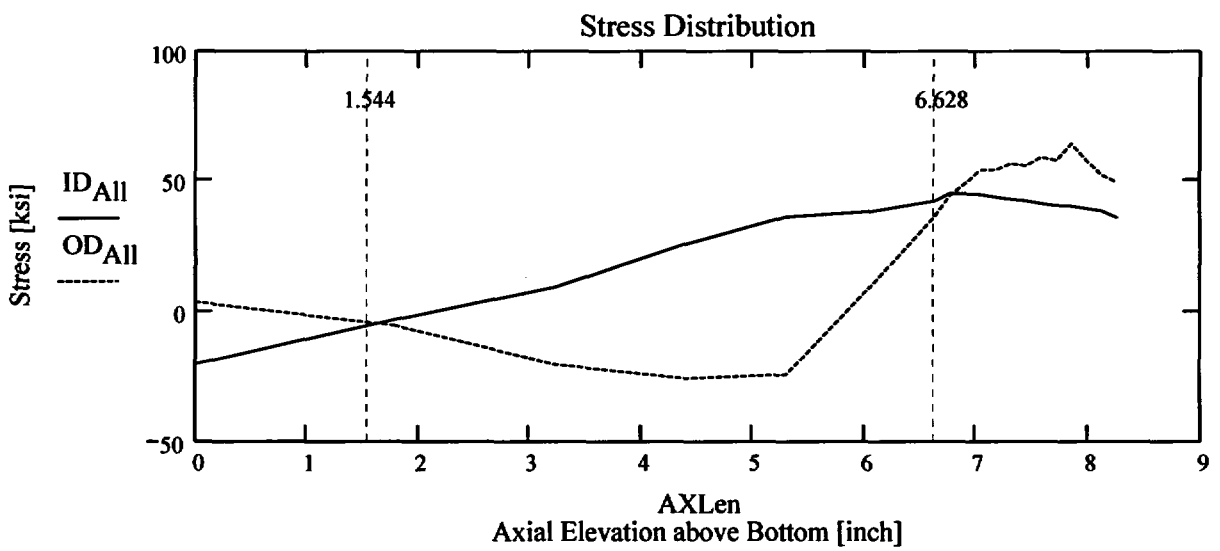

Observing the stress distribution select the region in the table above labeled $Data_{All}$ that represents the region of interest. This needs to be done especially for distributions that have a large compressive stress at the nozzle bottom and high tensile stresses at the J-weld location. Copy the selection in the above table , click on the "Data" statement below and delete it from the edit menu. Type "Data and the Mathcad "equal" sign (Shift-Colon) then insert the same to the right of the Mathcad Equals sign below (paste symbol).

$$Data := \begin{pmatrix} 0 & -20.175 & -11.45 & -5.94 & -1.163 & 3.704 \\ 1.792 & -3.024 & -4.378 & -5.443 & -5.511 & -5.341 \\ 3.228 & 9.398 & 12.134 & -0.258 & -12.622 & -20.232 \\ 4.378 & 25.65 & 24.71 & 14.577 & -15.299 & -25.689 \\ 5.299 & 36.179 & 33.787 & 26.287 & -5.925 & -24.306 \\ 6.037 & 38.106 & 35.028 & 31.43 & 21.215 & 8.834 \\ 6.628 & 42.186 & 38.102 & 36.248 & 40.684 & 36.405 \\ 6.764 & 45.067 & 42.217 & 42.736 & 47.553 & 44.235 \\ 6.899 & 44.968 & 43.606 & 46.007 & 49.995 & 48.803 \\ 7.035 & 44.695 & 44.12 & 47.021 & 51.043 & 54.113 \\ 7.17 & 43.723 & 43.973 & 47.639 & 50.172 & 54.17 \end{pmatrix}$$

$Axl := Data^{\langle 0 \rangle}$ $MD := Data^{\langle 3 \rangle}$ $ID := Data^{\langle 1 \rangle}$ $TQ := Data^{\langle 4 \rangle}$ $QT := Data^{\langle 2 \rangle}$ $OD := Data^{\langle 5 \rangle}$

$R_{ID} := regress(Axl, ID, 3)$ $R_{QT} := regress(Axl, QT, 3)$

$R_{OD} := regress(Axl, OD, 3)$

$R_{MD} := regress(Axl, MD, 3)$ $R_{TQ} := regress(Axl, TQ, 3)$

$$FL_{Cntr} := \begin{cases} Ref_{Point} - c_0 & \text{if } Val = 1 \\ Ref_{Point} & \text{if } Val = 2 \\ Ref_{Point} + c_0 & \text{otherwise} \end{cases}$$

Flaw center Location Location above Nozzle Bottom

$U_{Tip} := FL_{Cntr} + c_0$

$$Inc_{Strs.avg} := \frac{UL_{Strs.Dist} - U_{Tip}}{20}$$

No User Input is required beyond this Point

Sat Aug 09 10:21:18 AM 2003

$Prop_{Length} = 4.924$

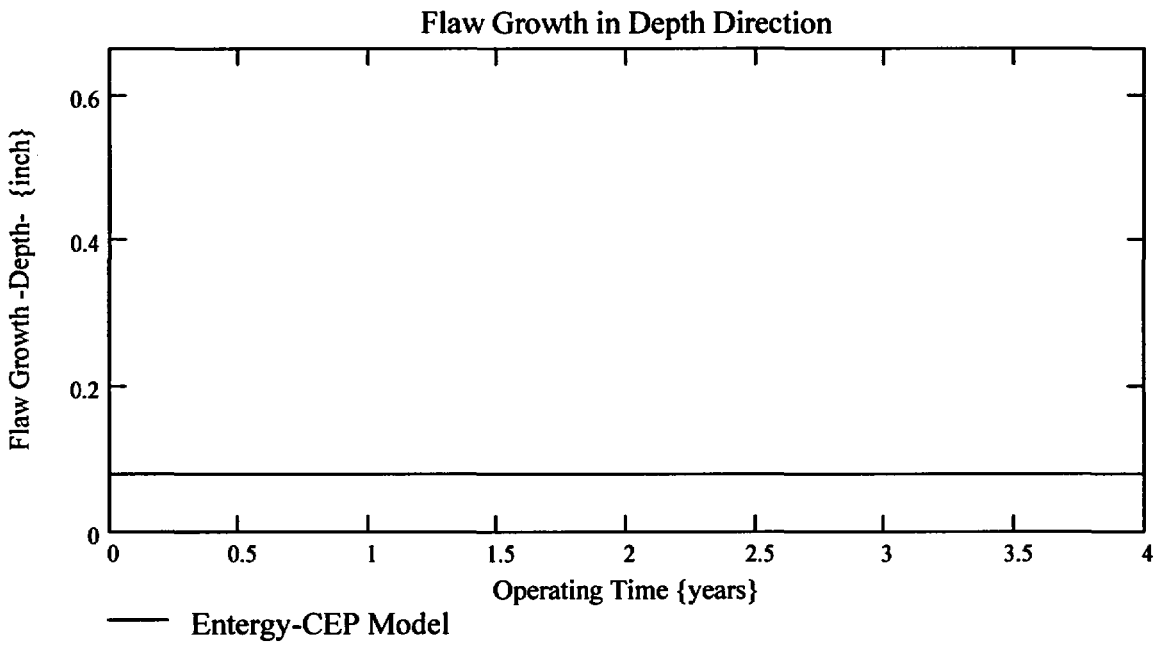

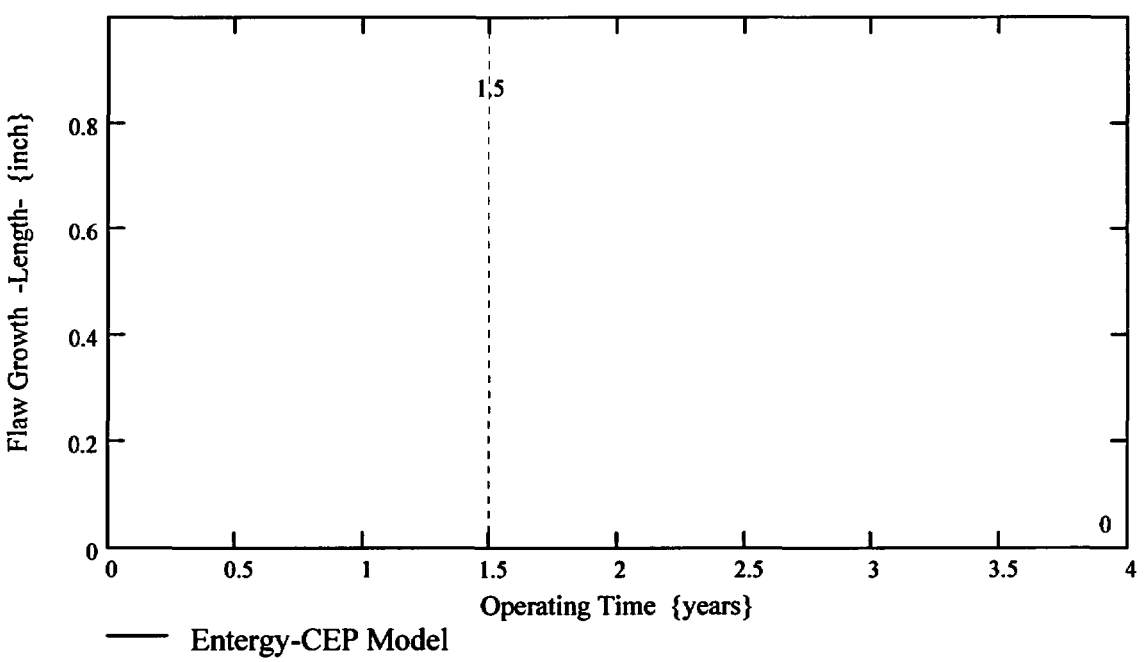

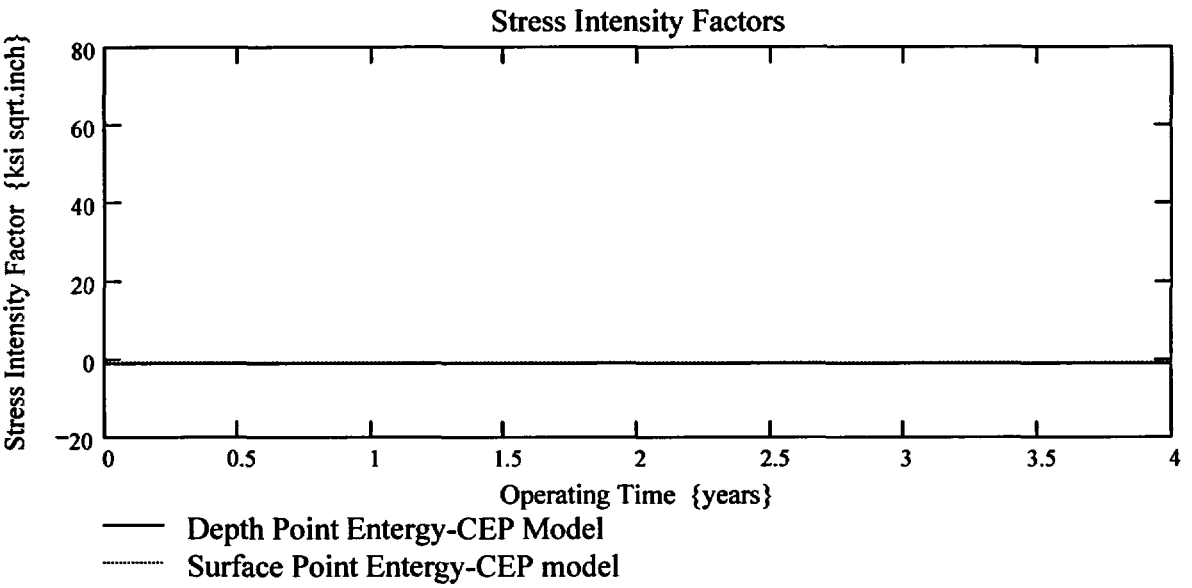
Stress Intensity Factors
Stress Intensity Factor {ksi sqrt.inch}
80
60
40
20
0
-20
0
0.5
1
1.5
2
2.5
3
3.5
4
Operating Time {years}
Depth Point Entergy-CEP Model
Surface Point Entergy-CEP model

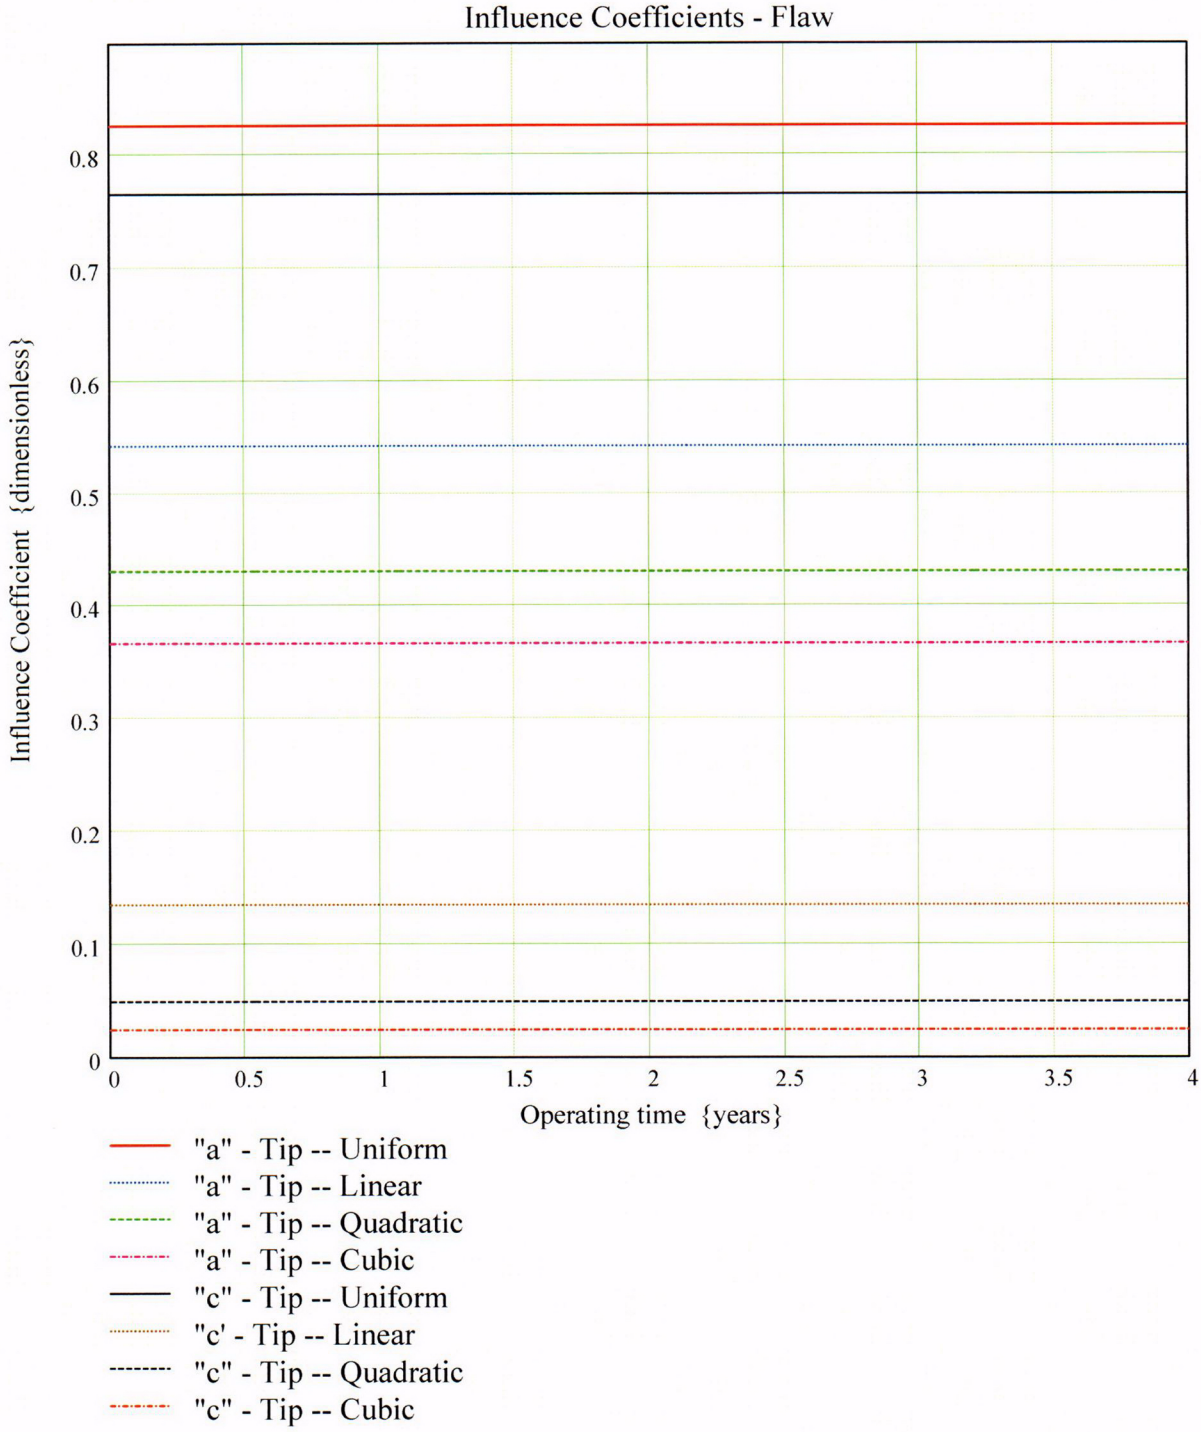
Influence Coefficients - Flaw
Influence Coefficient {dimensionless}
0
0.1
0.2
0.3
0.4
0.5
0.6
0.7
0.8
0
0.5
1
1.5
2
2.5
3
3.5
4
Operating time {years}
"a" - Tip -- Uniform
"a" - Tip -- Linear
"a" - Tip -- Quadratic
"a" - Tip -- Cubic
"c" - Tip -- Uniform
"c' - Tip -- Linear
"c" - Tip -- Quadratic
"c" - Tip -- Cubic

$CGR_{sambi_{(k,8)}}$ =

0.827
0.827
0.827
0.827
0.827
0.827
0.827
0.827
0.827
0.827
0.827
0.827
0.827
0.827
0.827
0.827
0.827

$CGR_{sambi_{(k,6)}}$ =

-0.776
-0.776
-0.776
-0.776
-0.776
-0.776
-0.776
-0.776
-0.776
-0.776
-0.776
-0.776
-0.776
-0.776
-0.776
-0.776
-0.776

$CGR_{sambi_{(k,5)}}$ =

-1.013
-1.013
-1.013
-1.013
-1.013
-1.013
-1.013
-1.013
-1.013
-1.013
-1.013
-1.013
-1.013
-1.013
-1.013
-1.013
-1.013

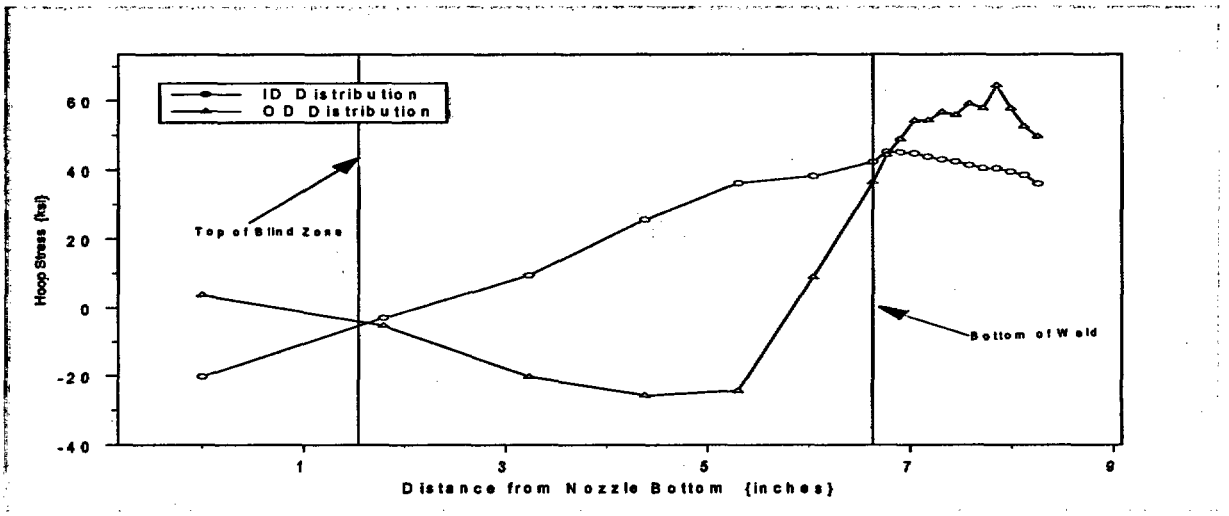

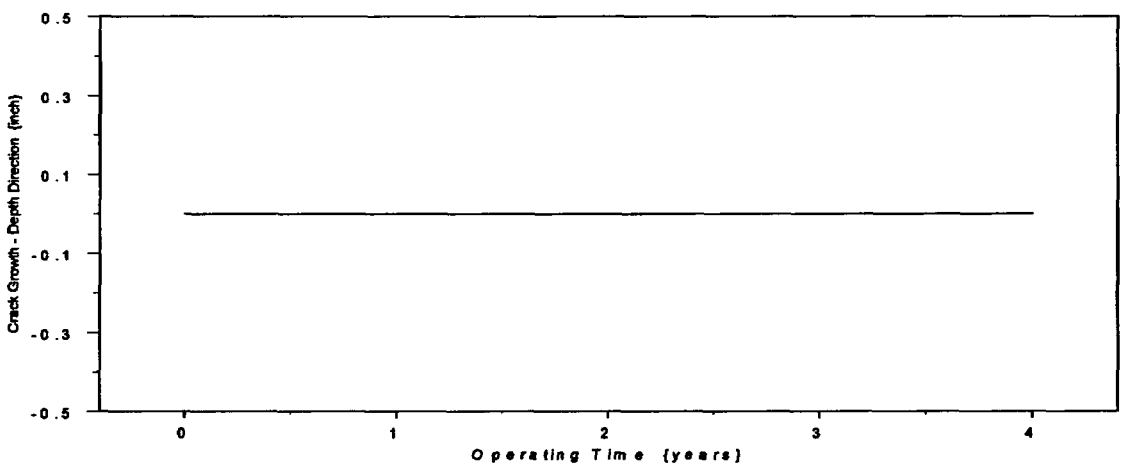

Developed by:
J. S. Brihmadesam

Verified by:
B. C. Gray

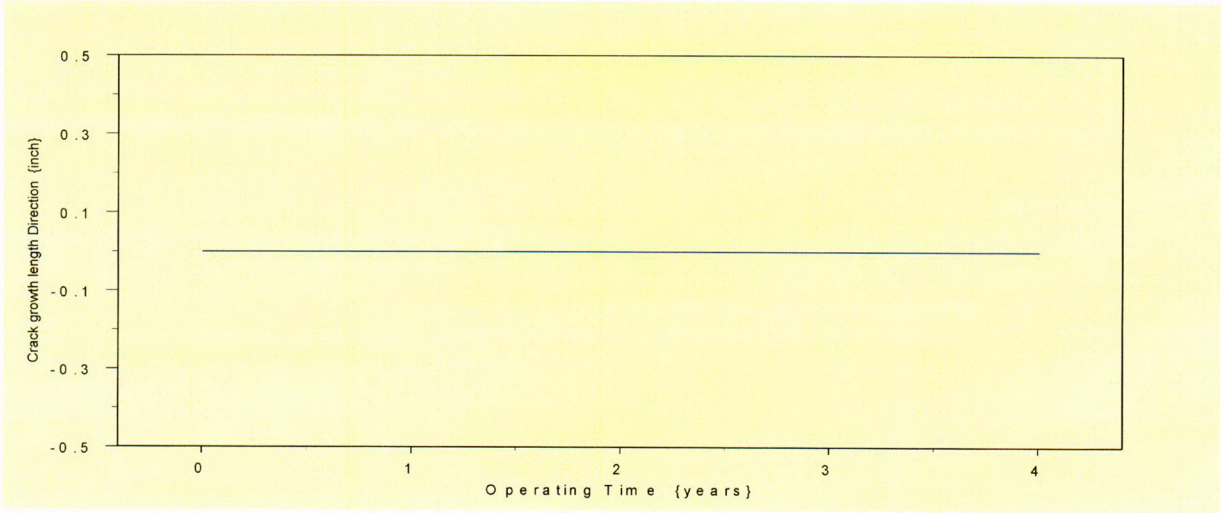
0.5
0.3
0.1
-0.1
-0.3
-0.5
Crack growth length Direction {inch}
0
1
2
3
4
Operating Time {years}

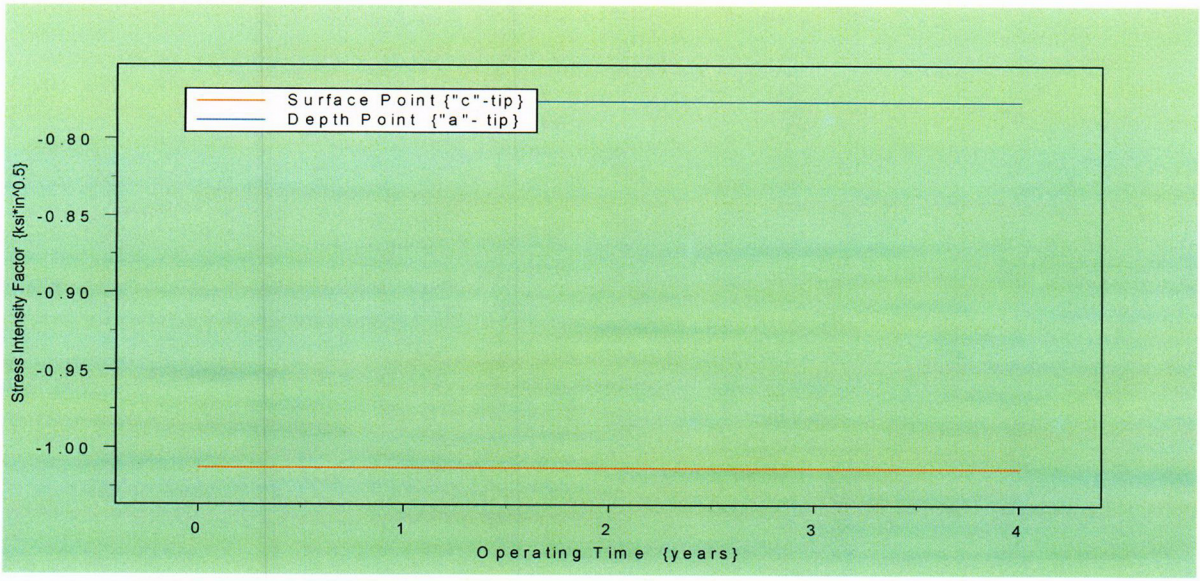
Surface Point {"c"-tip}
Depth Point {"a"- tip}
-0.80
-0.85
-0.90
-0.95
-1.00
Stress Intensity Factor {ksi*in^0.5}
0
1
2
3
4
Operating Time {years}