

**A. Alan Blind**  
Vice President

Consolidated Edison Company of New York, Inc.  
Indian Point Station  
Broadway & Bleakley Avenue  
Buchanan, NY 10511  
Telephone (914) 734-5340  
Fax: (914) 734-5718  
blinda@coned.com

May 3, 2001

Re: Indian Point Unit No. 2  
Docket No. 50-247  
NL-01-056

U.S. Nuclear Regulatory Commission  
Attn: Document Control Desk  
Mail Station O-P1-17  
Washington, DC 20555-0001

Subject: Supplemental Information - 2000 Refueling Outage Inservice  
Inspection (ISI) Program Summary Report – Second Outage, Second  
Period, Third Interval


Reference: 1) Con Edison Letter to NRC dated April 2, 2001

Consolidated Edison Company of New York, Inc. ("Con Edison") submitted via Reference 1, a report summarizing the inservice inspection (ISI) activities conducted during the 2000 refueling outage at Indian Point 2. Information, which was unavailable at the time that the report was required to be submitted relative to Class 1 and 2 code repairs and replacements, was subsequently committed to be provided to the staff. The attachment to this letter provides that information.

No new regulatory commitments are being made by Con Edison in this correspondence.

Should you or your staff have any concerns regarding this matter, please contact Mr. John McCann, Manager, Nuclear Safety & Licensing at 914-734-5074.

Sincerely,



Attachment

A047

C: Mr. Hubert J. Miller  
Regional Administrator-Region I  
U.S. Nuclear Regulatory Commission  
475 Allendale Road  
King of Prussia, PA 19406

Mr. Patrick D. Milano, Senior Project Manager, Section 1  
Project Directorate I  
Division of Licensing Project Management  
U.S. Nuclear Regulatory Commission  
Mail Stop O-8-C2  
Washington, DC 20555

Senior Resident Inspector  
U.S. Nuclear Regulatory Commission  
PO Box 38  
Buchanan, NY 10511

ATTACHMENT TO NL-01-056

Summary of Class 1 and 2 Code Repairs and Replacements  
And  
Form NIS-2

Consolidated Edison Company of New York, Inc.  
Indian Point Unit No. 2  
Docket No. 50-247

**FORM NIS-2 OWNER'S REPORT FOR REPAIRS OR REPLACEMENTS  
AS REQUIRED BY THE PROVISIONS OF THE ASME CODE SECTION XI**

1. Owner: Consolidated Edison of New York, Inc. Date: January 2, 2001  
4 Irving Place, New York NY 10003
2. Plant: Indian Point Station Unit: No. 2  
Broadway and Bleakley Ave.  
Buchanan, NY 10511
3. Work Performed by: Owner Repair Org. PO: None
4. Identification of Systems: AFW, CSS, CVCS, MS, RCS, RHR, SGBD, SIS, SSD,  
WCPS
5. (A) Applicable Construction Codes: As identified in the plant Operating Equipment  
(OE) history  
(B) Applicable Edition of Section XI utilized for repairs or replacements: 1989  
Edition, No Addenda
6. Identification of components repaired or replaced and replacement components:

Name of Component	Manufacturer	Serial No.	National Board No.	Other Ident.	Year Built	Repaired or Replaced	ASME Code Stamp	Construction Code
See item description								

7. Description of work: See "Work Description" on attached Abstract
8. Tests conducted: Hydrostatic ( ) Pneumatic ( ) Nominal Operating (X)\*  
Other ( ) Pressure\_\_\_\_\_ Test Temp.\_\_\_\_\_

\*See NIS-1 Report submitted in Con Edison letter to NRC dated April 2, 2001

9. Remarks: No ASME Section III or Section VIII components were repaired or replaced this outage as identified in this document.

A listing of additional non ASME III or VIII components which are included in the Section XI Code Repair & Replacement Program is contained in the attached NIS-2 abstract.

**FORM NIS-2 OWNER'S REPORT FOR REPAIRS OR REPLACEMENTS  
AS REQUIRED BY THE PROVISIONS OF THE ASME CODE SECTION XI**


**CERTIFICATE OF COMPLIANCE**

We certify that the statements made in this report are correct and these repairs/replacements conform to the rules of the ASME Code, Section XI.

Type code symbol stamp: None

Certificate of Authorization No.: None

Expiration Date: N/A

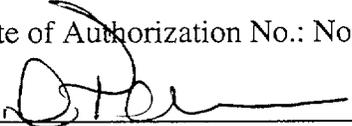Signed  Maintenance Manager  
Owner or Owner's designee, Title

Date 5/2, 2001

**CERTIFICATE OF INSERVICE INSPECTION**

I, the undersigned, holding a valid commission issued by the National Board of Boiler and Pressure Vessel Inspectors and the state or province of NEW YORK and employed by HARTFORD STEAM POWER of HARTFORD, CT have inspected the components described in this Owner's Report during the period 9-25-99 to 1-3-01, and state that to the best of my knowledge and belief, the Owner has performed examinations and taken corrective measures described in this Owner's Report in accordance with the requirements of the ASME Code, Section XI.

By signing this certificate neither the Inspector nor his employer makes any warranty, expressed or implied, concerning the examinations and corrective measures described in this Owner's Report. Furthermore, neither the Inspector nor his employer shall be liable in any manner for any personal injury or property damage or a loss of any kind arising from or connected with this inspection.

  
Inspector's Signature

Commissions NB 10011 I, N. NYS 3084  
National Board, State, Province & Endorsements

Date 5/3, 2001

**NIS-2 (CONT.)**  
**ABSTRACT OF REPAIRS, REPLACEMENT, OR CORRECTIVE**  
**MEASURES REQUIRED FOR CONTINUED SERVICE**

<b>CODE CLASS</b>	<b>R/R PLAN NUMBER</b>	<b>ITEM DESCRIPTION</b>	<b>R/R OR CORRECTIVE MEASURE</b>	<b>CODE CASE N-416-1</b>	<b>WORK DESCRIPTION</b>	<b>DATE COMPLETE</b>
A	NP-00-14025	TE-442B	REPLACEMENT	<input type="checkbox"/>	REPLACED WELDED RTD ON 24 COLD LEG	5/7/00
A	NP-00-14338	4976	REPLACEMENT	<input type="checkbox"/>	REPLACED ALL SYSTEM FLANGES NUTS ON 3" GLOBE VALVE	5/18/00
A	NP-00-15443	SG-22-1	REPLACEMENT	<input type="checkbox"/>	REPLACE SNUBBER W/SPARE	5/12/00
A	NP-00-15444	SG-22-3	REPLACEMENT	<input type="checkbox"/>	REPLACE SNUBBER W/SPARE	5/16/00
A	NP-00-15445	SG-23-3	REPLACEMENT	<input type="checkbox"/>	REPLACE SNUBBER W/SPARE	5/12/00
A	NP-00-17719	897A	REPLACEMENT	<input type="checkbox"/>	REPLACED 3 STUDS AND 3 NUTS FOR THE BODY TO BONNET ON 10" VALVE	11/14/00
A	NP-97-96846	24RCP	REPLACEMENT	<input type="checkbox"/>	REPLACED SUPPORT HANGER	1/8/98
A	NP-99-06664	897D	REPLACEMENT	<input type="checkbox"/>	REPLACED 10" VALVE BONNET AND 16 STUDS	11/12/00
A	NP-99-07420	PCV-466	REPLACEMENT	<input type="checkbox"/>	REPLACED VALVE INLET /OUTLET FASTENERS	5/19/00
A	NP-99-07561	PCV-464	REPLACEMENT	<input type="checkbox"/>	REPLACED VALVE INLET & OUTLET FLANGE FASTENERS	5/19/00
A	NP-99-07585	PCV-468	REPLACEMENT	<input type="checkbox"/>	REPLACED VALVE SYS. FLANGE FASTENERS	6/15/00
A	NP-99-10808	SIH-216	REPLACEMENT	<input type="checkbox"/>	REPLACED FIXED SUPPORT	9/17/99
A	NP-99-11116	897C	REPLACEMENT	<input type="checkbox"/>	REPLACED 2 BODY TO COVER NUTS ON 10" CHECK VALVE	11/14/00

CODE CLASS	R/R PLAN NUMBER	ITEM DESCRIPTION	R/R OR CORRECTIVE MEASURE	CODE CASE N-416-1	WORK DESCRIPTION	DATE COMPLETE
A	NP-99-12116	PWR-147A	REPLACEMENT	<input type="checkbox"/>	REPLACED SNUBBER W/SPARE	4/24/00
A	NP-99-12124	SR-924	REPLACEMENT	<input type="checkbox"/>	REPLACED SNUBBER W/SPARE	4/12/00
B	NP-00-13798	21RP	REPLACEMENT	<input type="checkbox"/>	REPLACED PUMP W/NEW PUMP THIS INCLUDED REPLACEMENT IF WELDED AUXILIARY PIPING	5/16/00
B	NP-00-13799	22RP	REPLACEMENT	<input type="checkbox"/>	REPLACED PUMP W/NEW PUMP THIS INCLUDED REPLACEMENT OF AUXILIARY PIPING (WELDED TO PUMP)	5/16/00
B	NP-00-13953	MP-UU	REPLACEMENT	<input type="checkbox"/>	REPLACED PENETRATION FLANGE FASTENERS	5/21/00
B	NP-00-14247	MS-105-9	REPAIR	<input type="checkbox"/>	REPLACED STEM AND DISC IN 1 1/2" GLOBE VALVE	1/16/00
B	NP-00-14425	MS-106-5	REPLACEMENT	<input type="checkbox"/>	REPLACED 1 1/2" WELDED VALVE	3/24/00
B	NP-00-14426	MS-105-15	REPAIR	<input type="checkbox"/>	REPLACED BONNET ON 1 1/2" VALVE	3/24/00
B	NP-00-14821	MS-91B	REPAIR	<input type="checkbox"/>	REPLACED VALVE STEM & DISC ASSEMBLY	5/12/00
B	NP-00-15258	SR-M5B	REPLACEMENT	<input type="checkbox"/>	REPLACE SNUBBER W/SPARE	5/6/00
B	NP-00-15259	SR-M5A	REPLACEMENT	<input type="checkbox"/>	REPLACED SNUBBER W/SPARE	5/6/00
B	NP-00-15260	SR-M7	REPLACEMENT	<input type="checkbox"/>	REPLACE SNUBBER W/SPARE	5/6/00
B	NP-00-15578	334	REPAIR	<input type="checkbox"/>	REPLACED VALVE BONNET ASSEMBLY & 1 BODY STUD	5/11/00
B	NP-00-15824	FE-5832	REPLACEMENT	<input checked="" type="checkbox"/>	REPLACED FLOW ELEMENT AND INSTRUMENT TUBING WITH 2" STAINLESS STEEL PIPING.	7/27/00

CODE CLASS	R/R PLAN NUMBER	ITEM DESCRIPTION	R/R OR CORRECTIVE MEASURE	CODE CASE N-416-1	WORK DESCRIPTION	DATE COMPLETE
B	NP-00-15825	FE-5833	REPLACEMENT	<input checked="" type="checkbox"/>	REPLACED FLOW ELEMENT AND INSTRUMENT TUBING WITH 2" STAINLESS STEEL PIPING.	7/13/00
B	NP-00-16576	891C	REPAIR	<input type="checkbox"/>	REPLACED STEM, DISC AND SEAT ON 1" CONTROL VALVE	7/12/00
B	NP-00-16618	4005	REPLACEMENT	<input checked="" type="checkbox"/>	WELDED IN NEW VALVE	8/1/00
B	NP-95-80778	226	REPAIR	<input type="checkbox"/>	REPLACED STEM AND DISC IN 3" GLOBE VALVE	5/15/00
B	NP-96-82142	MS-42	REPAIR	<input type="checkbox"/>	REPLACE DISC IN 4" STOP CHECK VALVE	4/20/00
B	NP-96-82852	21RRHX	REPLACEMENT	<input type="checkbox"/>	REPLACED ALL SERVICE WATER AND RHR SIDE STUDS AND NUTS	11/15/00
B	NP-97-89727	MS-108-38	REPAIR	<input type="checkbox"/>	DISASSEMBLED VALVE, CUT VALVE SEAT, REPLACED PLUG, REASSEMBLED VALVE	9/17/97
B	NP-97-90914	4928	REPAIR	<input type="checkbox"/>	REPLACED STEM AND DISC IN A 1" GLOBE VALVE	5/16/00
B	NP-97-91526	1289	REPAIR	<input type="checkbox"/>	REPLACED VALVE BONNET ASSEMBLY	5/7/00
B	NP-97-93271	MS-45B	REPAIR	<input type="checkbox"/>	DISASSEMBLED VALVE, LAPPED DISC AND SEAT AND REASSEMBLED VALVE	8/30/98
B	NP-97-93272	MS-47B	REPAIR	<input type="checkbox"/>	DISASSEMBLED VALVE, CUT, LAPPED NOZZLE AND DISC AND REASSEMBLED VALVE	8/30/98
B	NP-97-93273	MS-45D	REPAIR	<input type="checkbox"/>	DISASSEMBLED VALVE, LAPPED SEAT AND DISC AND REASSEMBLED VALVE	8/30/98
B	NP-97-93274	MS-47D	REPAIR	<input type="checkbox"/>	DISASSEMBLED VALVE, LAPPED NOZZLE AND DISC AND REASSEMBLED VALVE	8/30/98

CODE CLASS	R/R PLAN NUMBER	ITEM DESCRIPTION	R/R OR CORRECTIVE MEASURE	CODE CASE N-416-1	WORK DESCRIPTION	DATE COMPLETE
B	NP-97-93275	MS-45A	REPAIR	<input type="checkbox"/>	DISASSEMBLED VALVE, LAPPED VALVE NOZZLE AND DISC AND REASSEMBLED VALVE	8/30/98
B	NP-97-93276	MS-47A	REPAIR	<input type="checkbox"/>	DISASSEMBLED VALVE, LAPPED NOZZLE AND DISC AND REASSEMBLED VALVE	8/30/98
B	NP-97-93277	MS-46A	REPAIR	<input type="checkbox"/>	DISASSEMBLED VALVE, LAPPED DISC AND SEAT AND REASSEMBLED VALVE	8/30/98
B	NP-97-93278	MS-49C	REPAIR	<input type="checkbox"/>	DISASSEMBLED VALVE, LAPPED NOZZLE AND DISC AND REASSEMBLED VALVE	8/30/98
B	NP-97-93279	MS-47C	REPAIR	<input type="checkbox"/>	DISASSEMBLED VALVE, CUT, LAPPED NOZZLE AND DISC AND REASSEMBLED VALVE	8/30/98
B	NP-97-93280	MS-46C	REPAIR	<input type="checkbox"/>	DISASSEMBLED VALVE, LAPPED SEAT AND DISC AND REASSEMBLED VALVE	8/30/98
B	NP-97-93929	MS-55B	REPLACEMENT	<input type="checkbox"/>	REPLACED VALVE BONNET	1/13/98
B	NP-97-93968	829B	REPLACEMENT	<input type="checkbox"/>	REPLACED VALVE DISC	10/30/97
B	NP-97-94964	MS-108-37	REPAIR	<input type="checkbox"/>	DISASSEMBLED VALVE, CUT AND LAPPED VALVE SEAT, PLUG AND REASSEMBLED VALVE	11/4/97
B	NP-97-95687	MST-2	REPLACEMENT	<input type="checkbox"/>	REPLACED VALVE DISC	2/6/98
B	NP-97-95690	MST-1	REPLACEMENT	<input type="checkbox"/>	REPLACED VALVE DISC	2/6/98
B	NP-97-95914	SR-M53	REPLACEMENT	<input type="checkbox"/>	REPLACED PIPE SNUBBER	12/8/97
B	NP-97-96277	21BAT	REPLACEMENT	<input type="checkbox"/>	REPLACED MANWAY FASTENERS	1/20/98
B	NP-97-96736	22BAT	REPLACEMENT	<input type="checkbox"/>	REPLACED MANWAY FASTENERS	1/27/98
B	NP-97-96875	21SIP	REPAIR	<input type="checkbox"/>	WELDED IN NEW RECIRC LINE ORIFICE	1/31/98

CODE CLASS	R/R PLAN NUMBER	ITEM DESCRIPTION	R/R OR CORRECTIVE MEASURE	CODE CASE N-416-1	WORK DESCRIPTION	DATE COMPLETE
B	NP-98-00464	21CSP	REPLACEMENT	<input type="checkbox"/>	REPLACED 3 DAMAGED PUMP CASING STUDS	4/30/98
B	NP-98-03040	829A	REPAIR	<input type="checkbox"/>	DISASSEMBLED VALVE, CUT & POLISHED SEAT RING, REPLACED PISTON, REASSEMBLED VALVE	8/10/98
B	NP-98-03066	MS-109-6	REPAIR	<input type="checkbox"/>	DISASSEMBLED VALVE, CUT SEAT AND REASSEMBLED VALVE	8/6/98
B	NP-98-03137	237	REPAIR	<input type="checkbox"/>	REPAIRED FAILED WELD THRU PIPING REPLACEMENT	8/17/98
B	NP-98-03196	4004	REPLACEMENT	<input checked="" type="checkbox"/>	CUT OUT AND WELDED IN A VALVE 1 1/2" CHECK VALVE	7/27/00
B	NP-98-03559	745B	REPLACEMENT	<input type="checkbox"/>	REPLACED BOLTS AND NUTS	8/27/98
B	NP-98-03638	MS-45C	REPAIR	<input type="checkbox"/>	REPLACED DISC ON 6"X8" RELIEF VALVE	5/3/00
B	NP-98-03640	MS-45A	REPAIR	<input type="checkbox"/>	REPLACED DISC IN 6"X8" RELIEF VALVE	5/11/00
B	NP-98-03677	4000	REPAIR	<input type="checkbox"/>	DISASSEMBLED VALVE, CUT AND LAPPED SEAT AND REASSEMBLED VALVE	9/1/98
B	NP-98-03680	4001	REPAIR	<input type="checkbox"/>	DISASSEMBLED VALVE, CUT AND LAPPED VALVE SEAT AND REASSEMBLED VALVE	9/1/98
B	NP-98-03686	MST-2	REPAIR	<input type="checkbox"/>	WELD VALVE ON TRAP BODY	6/16/99
B	NP-98-03950	5221	REPLACEMENT	<input type="checkbox"/>	REPLACED VALVE BONNET CHAMBER	11/25/98
B	NP-98-03951	5225	REPLACEMENT	<input type="checkbox"/>	REPLACED VALVE BONNET CHAMBER	11/25/98
B	NP-98-04107	MST-4	REPAIR	<input type="checkbox"/>	REPLACED VALVE INTERNALS	1/19/99

CODE CLASS	R/R PLAN NUMBER	ITEM DESCRIPTION	R/R OR CORRECTIVE MEASURE	CODE CASE N-416-1	WORK DESCRIPTION	DATE COMPLETE
B	NP-98-04685	284	REPLACEMENT	<input type="checkbox"/>	REMOVED AND REPLACED ENTIRE 4" BUTTERFLY VALVE	5/5/00
B	NP-98-04771	PCV-1217A	REPAIR	<input type="checkbox"/>	REPLACED 2" VALVE DISC AND SEAT	5/19/00
B	NP-98-05501	1801C	REPLACEMENT	<input type="checkbox"/>	CUT OUT AND WELDED IN A NEW 1" GLOBE VALVE	4/27/00
B	NP-98-97251	263	REPLACEMENT	<input type="checkbox"/>	REPLACED 2 X 3 RELIEF VALVE	3/27/98
B	NP-98-97618	852B	REPAIR	<input type="checkbox"/>	DISASSEMBLED VALVE, LAPPED VALVE DISC, AND REASSEMBLED VALVE	2/4/98
B	NP-98-97771	21CSP	REPLACEMENT	<input type="checkbox"/>	REMOVED EDUCTOR, REPLACED WITH ORIFICE	2/5/98
B	NP-98-97790	852B	REPAIR	<input type="checkbox"/>	DISASSEMBLED VALVE, LAPPED DISC & SEAT, REASSEMBLED VALVE	2/13/98
B	NP-98-98666	21CSP	REPLACEMENT	<input type="checkbox"/>	MODIFIED PUMP SUPPORT	3/5/98
B	NP-98-98666	21CSP	REPLACEMENT	<input type="checkbox"/>	MODIFIED PUMP SUPPORT	5/20/98
B	NP-98-99304	4054	REPLACEMENT	<input type="checkbox"/>	REPLACED VALVE BONNET	5/8/98
B	NP-98-99495	C-500	REPAIR	<input type="checkbox"/>	MACHINED VALVE SEAT	6/2/98
B	NP-98-99661	4929	REPAIR	<input type="checkbox"/>	MACHINED VALVE SEAT	6/2/98
B	NP-99-06675	892C	REPLACEMENT	<input type="checkbox"/>	REPLACED ALL VALVE SYSTEM FASTENERS ON 1" VALVE	5/16/00
B	NP-99-06823	MS-2C	REPAIR	<input type="checkbox"/>	REPLACED ALL BONNET FASTENERS AND FOUR STUFFING BOX STUDS	5/19/00
B	NP-99-06841	MS-1-23	REPLACEMENT	<input type="checkbox"/>	REPLACED ONE BODY TO BONNET STUD AND NUT ON 28" VALVE	4/28/00

CODE CLASS	R/R PLAN NUMBER	ITEM DESCRIPTION	R/R OR CORRECTIVE MEASURE	CODE CASE N-416-1	WORK DESCRIPTION	DATE COMPLETE
B	NP-99-07501	847	REPLACEMENT	<input type="checkbox"/>	REPLACED BODY TO BONNET NUTS AND STUDS ON 8" VALVE (ALSO POLISHED COVER)	5/6/00
B	NP-99-07536	881	REPAIR	<input type="checkbox"/>	REPLACED DISC ON 12" CHECK VALVE	5/6/00
B	NP-99-07716	BFD-31	REPAIR	<input type="checkbox"/>	REPLACED DISC ON 6" CHECK VALVE	5/17/00
B	NP-99-08940	22CSP	REPLACEMENT	<input type="checkbox"/>	REPLACED PUMP WITH SPARE	3/2/00
B	NP-99-09686	MS-105-18	REPAIR	<input type="checkbox"/>	REPLACED STEM AND DISC ON 1 1/2" GLOBE VALVE	6/29/00
B	NP-99-09996	21BAT	REPLACEMENT	<input type="checkbox"/>	REPLACED MANWAY COVER	2/11/00
B	NP-99-09997	22BAT	REPLACEMENT	<input type="checkbox"/>	REPLACED MANWAY COVER	2/11/00
B	NP-99-10041	MS-374	REPAIR	<input type="checkbox"/>	REPLACED HANGER ROD	8/11/99
B	NP-99-11509	235	REPAIR	<input type="checkbox"/>	REPLACE STEM AND DISC ON 3" GLOBE VALVE	5/7/00
B	NP-99-11875	21BAT	REPLACEMENT	<input type="checkbox"/>	FABRICATED NEW MANWAY COVERS FOR 21 AND 22 BORIC ACID TANKS	11/2/99
B	NP-99-12061	250-SR-1	REPLACEMENT	<input type="checkbox"/>	REPLACED EXISTING SNUBBER W/SPARE	4/13/00
B	NP-99-12063	SR-1025A	REPLACEMENT	<input type="checkbox"/>	REPLACED EXISTING SNUBBER W/SPARE	4/26/00
B	NP-99-12065	SR-1100	REPLACEMENT	<input type="checkbox"/>	REPLACED EXISTING SNUBBER W/SPARE	4/17/00
B	NP-99-12066	SR-763A	REPLACEMENT	<input type="checkbox"/>	REPLACED EXISTING SNUBBER W/SPARE	4/10/00
B	NP-99-12069	SR-1073	REPLACEMENT	<input type="checkbox"/>	REPLACED EXISTING SNUBBER W/SPARE	4/10/00
B	NP-99-12110	SR-753	REPLACEMENT	<input type="checkbox"/>	REPLACED SNUBBER W/SPARE	4/24/00

CODE CLASS	R/R PLAN NUMBER	ITEM DESCRIPTION	R/R OR CORRECTIVE MEASURE	CODE CASE N-416-1	WORK DESCRIPTION	DATE COMPLETE
B	NP-99-12111	SR-755	REPLACEMENT	<input type="checkbox"/>	REPLACED SNUBBER W/SPARE	4/24/00
B	NP-99-12117	BF-5R-9	REPLACEMENT	<input type="checkbox"/>	REPLACED SNUBBER W/NEW SPARE	4/15/00
B	NP-99-12127	SR-50A	REPLACEMENT	<input type="checkbox"/>	REPLACED SNUBBER W/SPARE	4/28/00
B	NP-99-12149	MS-1-24	REPLACEMENT	<input type="checkbox"/>	REPLACED BODY TO COVER STUDS, NUTS AND COVER FOR 28" CHECK VALVE	3/30/00
B	NP-99-12853	MST-5	REPLACEMENT	<input type="checkbox"/>	CUT OUT AND WELDED IN A NEW 1" STEAM TRAP	3/23/00
C	NP-00-17171	CFA	MODIFICATION	<input checked="" type="checkbox"/>	INSTALLED NEW LONG LOOP PIPING AND VALVES	11/28/00
C	NP-97-91277	SWN-77-1	REPLACEMENT	<input checked="" type="checkbox"/>	REPLACED VALVE, FITTINGS AND PIPING	5/2/00
C	NP-98-04660	FCV-405A	REPLACEMENT	<input checked="" type="checkbox"/>	REPLACED VALVE	5/30/00
C	NP-98-04661	FCV-405B	REPLACEMENT	<input checked="" type="checkbox"/>	REPLACED VALVE	5/30/00
C	NP-98-04662	FCV-405C	REPLACEMENT	<input checked="" type="checkbox"/>	REPLACED VALVE	5/30/00
C	NP-98-04663	FCV-405D	REPLACEMENT	<input checked="" type="checkbox"/>	REPLACED VALVE	5/30/00
C	NP-98-04664	FCV-406A	REPLACEMENT	<input checked="" type="checkbox"/>	REPLACED VALVE	5/30/00
C	NP-98-04665	FCV-406B	REPLACEMENT	<input checked="" type="checkbox"/>	REPLACED VALVE	5/17/00
C	NP-98-04666	FCV-406C	REPLACEMENT	<input checked="" type="checkbox"/>	REPLACED VALVE	5/17/00
C	NP-98-04667	FCV-406D	REPLACEMENT	<input checked="" type="checkbox"/>	REPLACED VALVE	5/17/00
C	NP-98-99298	SWA	REPLACEMENT	<input checked="" type="checkbox"/>	REPLACED SECTION OF BENT PIPING ON LINE 499	4/19/00

CODE CLASS	R/R PLAN NUMBER	ITEM DESCRIPTION	R/R OR CORRECTIVE MEASURE	CODE CASE N-416-1	WORK DESCRIPTION	DATE COMPLETE
C	NP-99-06781	21SWPS	REPLACEMENT	<input checked="" type="checkbox"/>	REPLACED DRAIN PLUG WITH NEW PIPE, FLANGE AND VALVE.	8/22/00
C	NP-99-06782	22SWPS	REPLACEMENT	<input checked="" type="checkbox"/>	REPLACED DRAIN PLUG WITH NEW PIPE AND VALVE.	8/8/00
C	NP-99-06783	23SWPS	REPLACEMENT	<input checked="" type="checkbox"/>	REPLACED DRAIN PLUG WITH NEW PIPE AND VALVE.	8/16/00
C	NP-99-06784	24SWPS	REPLACEMENT	<input checked="" type="checkbox"/>	REPLACED DRAIN PLUG WITH NEW PIPE, FLANGE AND VALVE.	8/4/00
C	NP-99-06785	25SWPS	REPLACEMENT	<input checked="" type="checkbox"/>	REPLACED DRAIN PLUG WITH NEW PIPE AND VALVE.	8/1/00
C	NP-99-06786	26SWPS	REPLACEMENT	<input checked="" type="checkbox"/>	REPLACED DRAIN PLUG WITH NEW PIPE AND VALVE.	8/29/00

C: Mr. Hubert J. Miller  
Regional Administrator-Region I  
U.S. Nuclear Regulatory Commission  
475 Allendale Road  
King of Prussia, PA 19406

Mr. Patrick D. Milano, Senior Project Manager, Section 1  
Project Directorate I  
Division of Licensing Project Management  
U.S. Nuclear Regulatory Commission  
Mail Stop O-8-C2  
Washington, DC 20555

Senior Resident Inspector  
U.S. Nuclear Regulatory Commission  
PO Box 38  
Buchanan, NY 10511