

Terry J. Garrett Vice President, Engineering

> March 4, 2009 ET 09-0007

U. S. Nuclear Regulatory Commission ATTN: Document Control Desk Washington, DC 20555

Subject: Docket No. 50-482: License Amendment Request (LAR) for Deviation from Fire Protection Program Requirements

Gentlemen:

Pursuant to 10 CFR 50.90, Wolf Creek Nuclear Operating Corporation (WCNOC) hereby requests an amendment to the Renewed Facility Operating License No. NPF-42 for the Wolf Creek Generating Station (WCGS). This license amendment request is seeking approval by the Commission, pursuant to License Condition 2.C(5), to make changes to the approved fire protection program as described in the Updated Safety Analysis Report (USAR). Specifically, a deviation from certain technical requirements of 10 CFR 50, Appendix R, Section III.G.2, as documented in Appendix 9.5E of the WCGS Updated Safety Analysis Report (USAR), is requested regarding the use of operator manual actions in lieu of meeting circuit separation protection criteria.

Attachment I provides the evaluation and justification for the proposed license amendment. Attachment II provides markups of USAR Appendix 9.5E. USAR Appendix 9.5E provides a design comparison to 10 CFR 50 Appendix R. Attachment III provides a list of regulatory commitments. Enclosure I provides a revision to E-1F9900, "Post-Fire Safe Shutdown Manual Actions," which is identified by interim document number WIP-E-1F9900-004-A-1. WIP-E-1F9900-004-A-1 will be released as a new revision to E-1F9900 based on approval of this license amendment request. E-1F9900 is incorporated by reference in USAR Appendix 9.5B, "Fire Hazards Analysis."

ET 09-0007 Page 2 of 3

It has been determined that this amendment application does not involve a significant hazard consideration as determined per 10 CFR 50.92. The amendment application was reviewed by the WCNOC Plant Safety Review Committee. In accordance with 10 CFR 50.91, a copy of this application is being provided to the designated Kansas State official.

WCNOC requests approval of this proposed amendment by March 1, 2010. Once approved, the amendment will be implemented within 90 days of receipt.

If you have any questions concerning this matter, please contact me at (620) 364-4084, or Mr. Richard D. Flannigan at (620) 364-4117.

Sincerely.

Terry J. Garrett

TJG/rlt

- Attachments: I Evaluation of Proposed Change
 - II Markup of USAR Pages
 - III List of Regulatory Commitments
- Enclosure: I WIP-E-1F9900-004-A-1, "Post-Fire Safe Shutdown Operator Manual Actions"
- cc: E. E. Collins (NRC), w/a, w/e T. A. Conley (KDHE), w/a, w/e V. G. Gaddy (NRC), w/a, w/e B. K. Singal (NRC), w/a, w/e Senior Resident Inspector (NRC), w/a, w/e

STATE OF KANSAS)) SS COUNTY OF COFFEY)

Terry J. Garrett, of lawful age, being first duly sworn upon oath says that he is Vice President Engineering of Wolf Creek Nuclear Operating Corporation; that he has read the foregoing document and knows the contents thereof; that he has executed the same for and on behalf of said Corporation with full power and authority to do so; and that the facts therein stated are true and correct to the best of his knowledge, information and belief.

Bv

Terry //Garrett Vice President Engineering

SUBSCRIBED and sworn to before me this $4\frac{4}{2}$ day of March ,

, 2009.

GAYLE SHEPHEARD Notary Public - State of Kansas My Appt. Expires

Notary Public

4/24/2011 Expiration Date

Attachment I to ET 09-0007 Page 1 of 9

EVALUATION OF PROPOSED CHANGE

Subject: License Amendment Request for Deviation from Fire Protection Program Requirements

÷

- 1. SUMMARY DESCRIPTION
- 2. DETAILED DESCRIPTION
- 3. TECHNICAL EVALUATION
- 4. REGULATORY EVALUATION
 - 4.1 Applicable Regulatory Requirements/Criteria
 - 4.2 Precedent
 - 4.3 Significant Hazards Consideration
 - 4.4 Conclusions
- 5. ENVIRONMENTAL CONSIDERATION
- 6. REFERENCES

1. SUMMARY DESCRIPTION

This evaluation supports a request to amend Renewed Facility Operating License NPF-42 for the Wolf Creek Generating Station (WCGS).

The proposed amendment would revise the Renewed Facility Operating License to deviate from certain WCGS Fire Protection Program requirements. The reason for this amendment is to allow the performance of operator manual actions, in certain cases, to achieve and maintain safe shutdown in the event of a fire outside of the control room in lieu of meeting the circuit separation protection requirements of 10 CFR 50, Appendix R, Section III.G.2 referenced in Appendix 9.5E of the Updated Safety Analysis Report (USAR).

ď,

2. DETAILED DESCRIPTION

The WCGS Fire Protection Program is described in USAR Section 9.5.1 and Appendices 9.5A through 9.5E. Historically, Appendix 9.5B provided the Fire Hazards Analysis. The Fire Hazards Analysis is now located in E-1F9905. Appendix 9.5B of the USAR incorporates by reference the following:

- E-1F9905, Fire Hazards Analysis
- E-1F9900, Post-Fire Safe Shutdown Manual Actions
- E-1F9910, Post-Fire Safe Shutdown Fire Area Analysis
- XX-E-013, Post-Fire Safe Shutdown (PFSSD) Analysis
- M-663-00017A, Fire Protection Evaluations for Unique or Unbounded Fire Barrier Configurations

USAR Appendix 9.5E provides a design comparison to 10 CFR 50 Appendix R and how WCNOC compares with the specific requirements of 10 CFR 50 Appendix R.

During the 2005 NRC Fire Protection Triennial Inspection, WCNOC received a green non-cited violation (NCV) of License Condition 2.C(5), "Fire Protection (Section 9.5.1, SER; Section 9.5.1.8, SSER 5)," for failure to ensure that redundant trains of safe shutdown systems in the same fire area were free of fire damage. The NRC inspection report concluded that a green NCV of License Condition 2.C(5) existed because WCNOC credited the use of operator manual actions to mitigate the effects of fire damage in lieu of providing the physical protection required by 10 CFR Part 50, Appendix R, Section III.G.2.

WCNOC submitted letter WM 06-0013 (Reference 6.1), denying the NCV as a change in the interpretation of WCNOC's licensing basis. The NRC concluded in letter dated July 25, 2006 (Reference 6.2), that the use of operator manual actions is not within the WCGS current fire protection licensing basis. The NRC staff considered the current WCGS fire protection program to provide a reduced level of protection to assure post-fire safe shutdown from that in the fire protection program approved in License Condition 2.C(5)(a) and, therefore, did not meet the criteria of License Condition 2.C(5)(b) for an allowable change not requiring prior NRC approval.

£

The NCV received for this issue during the 2005 NRC Fire Protection Triennial was recategorized to an apparent violation with enforcement discretion. The enforcement discretion identified in the referenced NRC letter was consistent with that published in the March 6, 2006 Federal Register Notice (Reference 6.3) regarding operator manual actions. This Federal Register Notice withdrew the proposed rule from 10 CFR 50 Appendix R to codify the acceptability of operator manual actions in lieu of compliance with the separation requirements of Appendix R Section III.G.2. WCNOC accepted the apparent violation and is complying with the following requirements for maintaining enforcement discretion through March 5, 2009:

- Implement compensatory measures and initiate corrective actions within 6 months of the publication date of the Federal Register Notice (i.e., by September 5, 2006 per Reference 6.2).
- The enforcement discretion will continue provided the appropriate compensatory measures are maintained and the planned corrective actions are completed within 3 years of the publication date of the Federal Register Notice (i.e., March 5, 2009 per Reference 6.2).

In response to the apparent violation, WCNOC developed a plan to address resolution of the operator manual actions issue. The plan contained the following major milestones:

A. Perform a detailed circuit analysis to determine if a credible circuit fault condition is present to warrant the mitigating operator manual action currently credited.

No operator manual actions were eliminated as a result of this additional PFSSD review.

B. Perform a thermal hydraulic analysis to assess plant performance when an operator manual action was credited in response to fire induced spurious equipment operation.

Some operator manual actions were eliminated in cases where the thermal hydraulic analysis demonstrated that the operator manual action was not required to be implemented to achieve and maintain hot standby.

C. Where cost beneficial, implement plant modifications that would meet the requirements of 10 CFR 50 Appendix R, Section III.G.2.

Several plant modifications were implemented to completely eliminate the need for an operator manual action. Modifications included: cable reroute, instrument relocation, creation of a new fire area, and application of raceway fire barrier protection. Additional plant modifications are progressing which address: single spurious equipment operation for Fire Area A-27, multiple spurious equipment operation, elimination of a Control Room action to maintain hot standby, or resolution of an issue identified in the 2008 Triennial Fire Protection Inspection Report (Reference 6.8).

D. For remaining operator manual actions that were cost prohibitive to address by modification or presented a reasonable success probability for acceptance based on available time to implement the operator manual action, a feasibility and reliability analysis, utilizing the guidance in NUREG-1852, "Demonstrating the Feasibility and Reliability of Operator Manual Actions in Response to Fire," (Reference 6.4) was conducted. The information within SECY-08-0093, "Resolution of Issues Related to Fire-Induced Circuit Failures," (Reference 6.5) was utilized as guidance to determine if the identified operator manual action required prior NRC approval in order to credit an operator manual action as a permanent resolution. SECY-08-0093 divides equipment important to safe shutdown into the following two classifications:

- One train of systems necessary to achieve and maintain hot shutdown conditions (identified as "Required for Hot Standby" within the WIP-E-1F9900-004-A-1 analysis). For fire induced spurious operation within this classification, SECY-08-0093 identifies there is no allowance for operator manual action without prior NRC approval.
- Equipment important to safety that could be damaged by a single fire, and the spurious equipment operation could result in either an indirect or direct affect on PFSSD capability. However, the equipment is not credited as an element of the analyzed PFSSD success path. This equipment subset is identified as "Important to Safe Shutdown" within the WIP-E-1F9900-004-A-1 analysis. SECY-08-0093 indicates that prescriptive requirements of 10 CFR 50 Appendix R Sections III.G.1.a and III.G.2 do not apply, and an operator manual action is an acceptable mitigating action for the spurious equipment operation. NRC approval is not required in this case.

As documented in WIP-E-1F9900-004-A-1, the operator manual actions for thirteen fire areas address the maloperation of "Important to Safe Shutdown" equipment, while the operator manual actions for one fire area address the maloperation of "Required for Hot Standby" equipment. However, WCNOC has conservatively decided to request NRC review and approval of all presently identified operator manual actions that are intended to be credited as a permanent resolution in lieu of 10 CFR 50 Appendix R, Section III.G.2 protection. These operator manual actions are evaluated for feasibility and reliability within WIP-E-1F9900-004-A-1. Review and approval is also requested for the interim compensatory measure operator manual actions for Fire Area A-27, which are evaluated for feasibility within WIP-E-1F9900-004-A-1.

WCNOC requests approval pursuant to License Condition 2.C(5) to deviate from the 10 CFR 50 Appendix R comparison response referenced in USAR Appendix 9.5E, to allow the performance of operator manual actions in lieu of meeting separation requirements to protect cables from fire damage that could prevent the operation or cause mal-operation of safe shutdown functions. The operator manual actions provide an acceptable, alternative method of protection to ensure that the unit can be safely shutdown in the event of a fire.

3. TECHNICAL EVALUATION

As discussed in Section 2 above, document E-1F9900, "Post-Fire Safe Shutdown Manual Actions," is incorporated by reference into USAR Section 9.5B. Interim document number WIP-E-1F9900-004-A-1 for the E-1F9900 revision is provided in Enclosure I of this application. Document WIP-E-1F9900-004-A-1 evaluates the feasibility and reliability of operator manual actions that are necessary to ensure the availability of a PFSSD success path to achieve and maintain hot standby conditions, in response to a single fire event outside the control room.

Table 3-1 identifies the proposed feasible and reliable operator manual actions that are requested for approval. Table 3-2 identifies the proposed feasible, operator manual actions that are requested for approval on an interim basis for Fire Area A-27. The interim operator manual actions will be eliminated with the field implementation of Change Package 012418. A compensatory fire watch has been established in Fire Area A-27 to provide additional defense in depth for that area, and will remain in place until Change Package 012418 is field implemented. The interim operator manual actions are included within the WIP-E-1F9900-004-A-1 analysis, as they are manual actions that are within the March 5, 2009 enforcement discretion scope.

OPERATOR MANUAL ACTION	Fire Location (Fire Area)	Room/Fire Area where implemented
Close valve KAV0201 to fail close letdown valves BGLCV0459 and BGLCV0460	A-1, A-11, A-18, C-7, C-12, C-18, C-21, C-24, RB	1322/A-25
Use local controller ABFHC0002 to control/isolate steam release through atmospheric relief valve (ARV) for Steam Generator B	A-16N	1509/A-23
Use local controller ABFHC0003 to control/isolate steam release through atmospheric relief valve (ARV) for Steam Generator C	A-16N	1509/A-23
Isolate air and nitrogen to ARV ABPV0004 to fail the ARV closed	A-16N	1508/A-23
Terminate train B containment spray by opening breaker NB0203	C-22, C-23, C-30, C-33	3302/C-10
Terminate train A containment spray by opening breaker NB0102	C-18, C-21, C-24	3301/C-9

Table 3-1, Permanent Operator Manual Actions

Table 3-2, Interim Operator Manual Actions

OPERATOR MANUAL ACTION	Fire Location (Fire Area)	Room/Fire Area where implemented
Open EGHV0016 and EGHV0054 to support 'B' Train CCW lineup	A-27	1401, 1402/A-16

The proposed feasible and reliable operator manual actions in conjunction with the engineered and administrative defense-in-depth fire protection features provide an acceptable alternative in lieu of fully meeting the 10 CFR 50 Appendix R, Section III.G.2 circuit separation requirements referenced in USAR Appendix 9.5E. Therefore, the proposed change to the Fire Protection Program provides reasonable assurance that the plant can be safely shutdown in the event of a fire in the above fire areas.

The WIP-E-1F9900-004-A-1 analysis provides reasonable assurance that the interim operator manual actions for Fire Area A-27 are feasible. Reliability was not demonstrated by the analysis. Therefore, the operator manual actions are considered interim compensatory measures, coupled with a fire watch, until the operator manual actions are eliminated by the field implementation of Change Package 012418. These compensatory measures provide reasonable assurance that a fire in Fire Area A-27 will not adversely affect the ability to achieve and maintain safe shutdown.

4. **REGULATORY EVALUATION**

٩,

4.1 Applicable Regulatory Requirements/Criteria

10 CFR 50, Section 48, Fire Protection, which states in paragraph (a) that "Each operating nuclear power plant must have a fire protection plan that satisfies Criterion 3 of Appendix A of this part." Paragraph (e) states "Nuclear power plants licensed to operate after January 1, 1979, shall...satisfy Criterion 3 of Appendix A to this part in accordance with the provisions of their licenses."

10 CFR 50, Appendix A, General Design Criterion 3, Fire Protection, requires that structures, systems, and components important to safety shall be designed and located to minimize, consistent with other safety requirements, the probability and effect of fires and explosions.

10 CFR 50, Appendix R, "Fire Protection Program for Nuclear Power Facilities Operating Prior to January 1, 1979", Section III.G.2 requires that cables whose fire damage could prevent the operation or cause mal-operation of safe shutdown functions be physically protected from fire damage by one of three methods. The use of operator manual actions to mitigate the effects of fire damage to these cables is not listed in the regulation as an acceptable method for satisfying this requirement.

Since WCGS was licensed after January 1, 1979, WCNOC is not obligated to meet the requirements of Section III.G.2. However, USAR Appendix 9.5E provides a comparison of the WCGS design to Appendix R. Operator manual actions proposed in this amendment request have not been previously reviewed by the NRC.

NRC Regulatory Issue Summary (RIS) 2006-10 (Reference 6.6) provides the regulatory expectations for 10 CFR 50 Appendix R, Section III.G.2 operator manual actions. This license amendment request is a corrective action option for non-compliances involving operator manual actions.

NUREG-1852, "Demonstrating the Feasibility and Reliability of Operator Manual Actions in Response to Fire," provides the latest published technical guidance to assist in determining that operator manual actions are feasible and can be performed reliably in response to a fire.

'n.

4.2 Precedent

RIS 2006-10, "Regulatory Expectations with Appendix R Paragraph III.G.2 Operator Manual Actions," (Reference 6.6) discusses that operator manual actions in lieu of meeting circuit separation criteria have been previously approved as exemption requests for plants licensed to operate prior to January 1, 1979 (i.e., plants, subjected to the requirements of 10 CFR 50, Appendix R). RIS 2006-10 goes on further to state that plants licensed to operate on or after January 1, 1979 (post 1979 licensees) are not required to meet the requirements of paragraph III.G.2 and use of operator manual actions are approved by a staff decision in an NRC Safety Evaluation Report, either as the result of original licensing or via a license amendment.

Amendment No. 186 to South Texas Project (STP) Unit 1 Facility Operating License No. NPF-76 and Amendment No. 173 to STP Unit 2 Facility Operating License No. NPF-80 approved the use of operator manual actions in lieu of meeting protection requirements of circuit separation. (Reference 6.7)

4.3 <u>Significant Hazards Consideration</u>

WCNOC has evaluated whether or not a significant hazards consideration is involved with the proposed amendment(s) by focusing on the three standards set forth in 10 CFR 50.92, "Issuance of amendment," as discussed below:

1. Does the proposed amendment involve a significant increase in the probability or consequences of an accident previously evaluated?

Response: No.

The design function of structures, systems and components are not impacted by the proposed change. The proposed change involves the performance of operator manual actions to achieve and maintain safe shutdown in the event of a fire outside of the control room and will not initiate an event. The proposed change does not increase the probability of occurrence of a fire or any other accident previously evaluated.

The proposed operator manual actions are feasible and reliable and demonstrate that the plant can be safely shutdown in the event of a fire. No significant consequences result from the performance of the proposed change.

Therefore, the proposed change does not involve a significant increase in the probability or consequences of an accident previously evaluated.

2. Does the proposed amendment create the possibility of a new or different kind of accident from any accident previously evaluated?

Response: No.

The design function of structures, systems and components are not impacted by the proposed change. The proposed change involves the performance of operator manual actions to achieve and maintain safe shutdown in response to a fire outside of the control room. The operator manual actions do not involve new failure mechanisms or malfunctions that can initiate a new accident.

Therefore, the proposed change does not create the possibility of a new or different kind of accident from any accident previously evaluated.

3. Does the proposed amendment involve a significant reduction in a margin of safety?

Response: No.

For the permanent operator manual actions, adequate time is available to perform the proposed operator manual actions to account for uncertainties in estimates of the time available and in estimates of how long it takes to diagnose and execute the actions. The actions have been verified that they can be performed through demonstration and the actions are proceduralized. The proposed actions are feasible and reliable and demonstrate that the plant can be safely shutdown in the event of a fire.

For the interim operator manual actions adequate time is available to feasibly perform the proposed operator manual actions and a compensatory measure fire watch is provided for the affected area as an added defense in depth fire protection measure.

Therefore, the proposed change does not involve a significant reduction in a margin of safety.

Based on the above, WCNOC concludes that the proposed amendment does not involve a significant hazards consideration under the standards set forth in 10 CFR 50.92(c), and, accordingly, a finding of "no significant hazards consideration" is justified.

4.4 <u>Conclusions</u>

In conclusion, based on the considerations discussed above, (1) there is reasonable assurance that the health and safety of the public will not be endangered by operation in the proposed manner, (2) such activities will be conducted in compliance with the Commission's regulations, and (3) the issuance of the amendment will not be inimical to the common defense and security or to the health and safety of the public.

5. ENVIRONMENTAL CONSIDERATION

WCNOC has evaluated the proposed changes and determined that the changes do not involve (i) a significant hazards consideration, (ii) a significant change in the types or a significant increase in the amounts of any effluents that may be released offsite, or (iii) a significant increase in individual or cumulative occupational radiation exposure. Accordingly, the proposed amendment meets the eligibility criterion for categorical exclusion set forth in 10 CFR 51.22(c)(9). Therefore, pursuant to 10 CFR 51.22(b), no environmental impact statement or environmental assessment need be prepared in connection with the proposed amendment.

6. **REFERENCES**

- 6.1 WCNOC letter WM 06-0013, "Wolf Creek Nuclear Operating Corporation's (WCNOC's) Response to Noncited Violation 2005008-03 – NRC Inspection Report 05000482/2005008," April 14, 2006. (ADAMS Accession number ML061100444)
- 6.2 NRC letter EA-06-170, "Wolf Creek Generating Station Revised Violation and Exercise of Enforcement Discretion 05000482/2005008-003 (NRC Inspection Report 05000482/2005008)", July 25, 2006. (ADAMS Accession number ML062070216)
- 6.3 Federal Register Notice (71 FR 11169), "10 CFR Part 50 Fire Protection Program Post-Fire Operator Manual Actions," March 6, 2006.
- 6.4 NUREG-1852, "Demonstrating the Feasibility and Reliability of Operator Manual Actions in Response to Fire," USNRC, October 2007. (ADAMS Accession number ML073020676)
- 6.5 SECY-08-0093, "Resolution of Issues Related to Fire-Induced Circuit Failures," USNRC, June 30, 2008. (ADAMS Accession number ML081370346)
- 6.6 NRC Regulatory Issue Summary 2006-10, "Regulatory Expectations with Appendix R Paragraph III.G.2 Operator Manual Actions," June 30, 2006. (ADAMS Accession number ML061650389)
- 6.7 "South Texas Project, Units 1 and 2 Issuance of Amendments RE: Deviation from Fire Protection Program Requirements (TAC Nos. MD6694 and MD6695)," September 16, 2008. (ADAMS Accession numbers ML082280465 and ML082280472)
- 6.8 "Wolf Creek Generating Station NRC Triennial Fire Protection Inspection Report 05000482/2008010," January 2, 2009. (ADAMS Accession number ML090020490)

Markup of USAR Pages

Attachment II to ET 09-0007 Page 1 of 4

III.

G.

WOLF CREEK

TABLE 9.5E-1 (Sheet 6)

10CFR50 Appendix R

<u>WCGS</u>

batteries are served by a battery charger that can be manually connected to the plant emergency ac power supply.

The ESW pumphouse also complies.

Fire Protection of Safe Shutdown Capability

1. Fire protection features shall be provided for structures, systems, and components important to safe shutdown. These features shall be capable of limiting fire danger so that:

a. One train of systems necessary to achieve and maintain hot shutdown conditions from either the control room or emergency control station(s) is free of fire damage; and

b. Systems necessary to achieve and maintain cold shutdown from either the control room or emergency control station(s) can be repaired within 72 hours.

2. Except as provided for in paragraph G.3 of this section,

USAR Appendix 9.5B provides an area-by-area analysis of the power block that demonstrates that no single fire can prevent safe shutdown.

Redundant trains of systems required to achieve and maintain hot standby are separated by 3-hour rated fire barriers, or the equivalent provided by III.G.2, or else a diverse means of providing the safe shutdown capability exists and is unaffected by the fire.

For redundant trains of systems required to achieve and maintain cold shutdown that could potentially be affected by

E-1F9905, Fire Hazards Analysis, coupled with E-1F9910, Post Fire Safe Shutdown Fire Area Analysis, provide an area-by-area analysis of the powerblock, which demonstrates that no single fire can prevent safe shutdown.

For a fire outside the control room, fire protection features are provided such that post-fire hot standby can be achieved and maintained from the control room, with limited reliance on operator manual actions outside the control room. Predominantly, redundant safe shutdown components are separated by 3-hour fire rated barriers or the equivalent protection identified by III.G.2. In some instances, operator manual actions outside the control room are utilized in lieu of III.G.2 protection. Operator manual actions have been evaluated for feasibility and reliability, considering NUREG-1852 guidance.

Rev. 0

WOLF CREEK

TABLE 9.5E-1 (Sheet 7)

10CFR50 Appendix R

where cables or equipment, including associated nonsafety circuits that could . prevent operation or cause maloperation due to hot shorts, open circuits, or shorts to ground, or redundant trains of systems necessary to achieve and maintain hot shutdown conditions are located within the same fire area outside of primary containment, one of the following means of ensuring that one of the redundant trains is free of fire damage shall be provided:

a. Separation of cables and equipment and associated non-safety circuits of redundant trains by a fire barrier having a 3-hour rating. Structural steel forming a part of or supporting such fire barriers shall be protected to provide fire resistance equivalent to that required of the barrier;

b. Separation of cables and equipment and associated non-safety circuits of redundant trains by a horizontal distance of more than 20 feet with no intervening combustible or WCGS

a single fire, repairs or local operator actions can be performed within 72 hours. As described in Appendix 9.5B E-1F9905 and Section 7.4, hn auxiliary shutdown panel is provided as a dedicated. means of achieving and maintaining hot standby in the event that the main control room is uninhabitable due to a fire. The ESW pumphonse also complies.

CRev. 0

1.

WOLF CREEK

No changes this page. Included for information only.

TABLE 9.5E-1 (Sheet 8)

10CFR50 Appendix R

fire hazards. In addition, fire detectors and an automatic fire suppression system shall be installed in the fire area; or

c. Enclosure of cable and equipment and associated non-safety circuits of one redundant train in a fire barrier having a 1-hour rating. In addition, fire detectors and an automatic fire suppression system shall be installed in the fire area;

Inside noninerted containments one of the fire protection means specified above or one of the following fire protection means shall be provided:

d. Separation of cables and equipment and associated nonsafety circuits of redundant trains by a horizontal distance of more than 20 feet with no intervening combustibles or fire hazards;

e. Installation of fire detectors and an automatic fire suppression system in the fire area; or

f. Separation of cables and equipment and associated nonsafety circuits of redundant trains by a noncombustible radiant energy shield. WCGS

No changes this page. Included for information only.

WOLF CREEK

TABLE 9.5E-1 (Sheet 9)

10CFR50 Appendix R

<u>WCGS</u>

3. Alternative or dedicated shutdown capability and its associated circuits,6 independent of cables, systems or components in the area, room, or zone under consideration, shall be provided:

a. Where the protection of systems whose function is required for hot shutdown does not satisfy the requirement of paragraph G.2 of this section; or

b. Where redundant trains of systems required for hot shutdown located in the same fire area may be subject to damage from fire suppression activities or from the rupture or inadvertent operation of fire suppression systems.

In addition, fire detection and a fixed fire suppression system shall be installed in the area, room, or zone under consideration.

6Alternative shutdown capability is provided by rerouting, relocating or modificating of existing systems; dedicated shutdown capability is provided by installing new structures and systems for the function of postfire shutdown.

LIST OF REGULATORY COMMITMENTS

The following table identifies those actions committed to by WCNOC in this document. Any other statements in this submittal are provided for information purposes and are not considered to be regulatory commitments. Please direct questions regarding these commitments to Mr. Richard Flannigan at (620) 364-4117.

REGULATORY COMMITMENTS

Regulatory commitment	Due
Implement License Amendment	Once approved, the amendment will be implemented within 90 days of receipt.
A compensatory fire watch will be maintained in Fire Area A-27, and will remain in place until Change Package 012418 is field implemented.	Will be maintained until Change Package 012418 is field implemented.

WIP-E-1F9900-004-A-1, "Post-Fire Safe Shutdown Operator Manual Actions"

Page 1 of 117

COVER SHEET

REVISION NOTES: WIP-E-1F9900-004-A-1 is a complete replacement of E-1F9900, Revision 4. The WIP will not be released as a revision to E-1F9900 un approval is received from the NRC. Correspondence ET 09-0007 documents Wolf Creek's license amendment request for the feasibility and reliability analysis provided in WIP-E-1F9900-004-A-1. ELECTRONIC APPROVAL		REVISED	INCOPORATED CHC, DOC.		Change PKG. No. (012954 Rev. 0
REVISION NOTES: WIP-E-1F9900-004-A-1 is a complete replacement of E-1F9900, Revision 4. The WIP will not be released as a revision to E-1F9900 un approval is received from the NRC. Correspondence ET 09-0007 documents Wolf Creek's license amendment request for the feasibility and reliability analysis provided in WIP-E-1F9900-004-A-1. ELECTRONIC APPROVAL	\boxtimes	ISSUED			····	
WIP-E-1F9900-004-A-1 is a complete replacement of E-1F9900, Revision 4. The WIP will not be released as a revision to E-1F9900 uil approval is received from the NRC. Correspondence ET 09-0007 documents Wolf Creek's license amendment request for the feasibility and reliability analysis provided in WIP-E-1F9900-004-A-1. ELECTRONIC NUCLEAR OPERATING CORPORATION	THIS D	WG. SUPERSEDED	BY REV	I. THIS DWG SU	PERSEDES	REV.
Revision 4. The WIP will not be released as a revision to E-1F9900 un approval is received from the NRC. Correspondence ET 09-0007 documents Wolf Creek's license amendment request for the feasibility and reliability analysis provided in WIP-E-1F9900-004-A-1. ELECTRONIC APPROVAL	REVIS	NOTES:				
WELF CREEK NUCLEAR OPERATING CORPORATION ELECTRONIC APPROVAL	Revi appr docu	Revision 4. The WIP will not be released as a revision to E-1F9900 until approval is received from the NRC. Correspondence ET 09-0007 documents Wolf Creek's license amendment request for the feasibility				
Post-Fire Safe Shutdown Operator Manual Actions						
1		Post-Fire Safe Shutdown Operator Manual Actions				
SCALE DRAWING NUMBER REV	P	ost-Fire S	are Shutuow	in operation	, mandar	ACIONS
NONE WIP-E-1F9900-004-A-1 0						



Table of Contents

1.0	Pur	pose	3		
2.0	2.0 Scope 3				
3.0	Bac	kground	4		
4.0	Def	initions	7		
5.0	Met	hodology	12		
6.0	E-1	F9900 Revision Guidance	28		
7.0	Ref	erences	28		
8.0	Fea	sibility and Reliability Review	30		
. 8.1		Fire Area A-1, Auxiliary Building 1974' General Corridor	30		
8.2		Fire Area A-11, Auxiliary Building 2000' Cable Chase	36		
8.3		Fire Area A-16, Auxiliary Building 2026' General Corridor	41		
8.4		Fire Area A-18, Auxiliary Building 2026' North Electrical Penetration Roo	om 48		
8.5		Fire Area C-7, Control Building 1984' Cable Chase	54		
8.6		Fire Area C-12, Control Building 2000' North Cable Chase	60		
8.7		Fire Area C-18, Control Building 2016' Cable Chase	65		
8.8		Fire Area C-21, Control Building 2032' Lower Cable Spreading Room	72		
8.9		Fire Area C-22, Control Building 2073'-6 Upper Cable Spreading Room	79		
8.1	0	Fire Area C-23, Control Building 2032' South Cable Chase	84		
8.1	1	Fire Area C-24, Control Building 2032' North Cable Chase	89		
8.1	2	Fire Area C-30, Control Building 2047'-6	96		
8.1	3	Fire Area C-33, Control Building 2073'-6	101		
8.1	4	Fire Area RB, Reactor Building General Area	106		
8.1	5 I	Fire Area A-27, Auxiliary Building 2026' Rod Drive MG Set Room	113		
Attachmen	t A	Summary of OMAs to Achieve and Maintain Hot Standby	A1		
Attachmen	t B1	Fire Alarm System Response Time	B1-1		
Attachmen	t B2	Sample FDT Data Sheet NUREG-1805 FDT 11. Estimating Smoke Detector Response Time	B2-1		
Attachmen	t C	Photos of Equipment Manipulated for Operator Manual Action	C1		

1.0 Purpose

- 1.1 The purpose of this document is to evaluate the feasibility and reliability of operator manual actions (OMA) that are potentially necessary to ensure the availability of a post-fire safe shutdown (PFSSD) success path to achieve and maintain hot standby conditions, in response to a single fire event outside the Control Room.
 - 1. The OMAs for Fire Area A-27 are evaluated for feasibility only. Refer to Section 2.6 for further discussion.

2.0 Scope

- 2.1 This feasibility and reliability review is applicable to OMAs, as defined in Section 4.11. Attachment A summarizes the OMAs, and the fire areas affected.
- 2.2 Consistent with the scope of NUREG-1852, actions taken within the Control Room that are potentially necessary to mitigate or prevent the undesirable affects of fire induced spurious equipment operation are not addressed within this review for feasibility and reliability. Control Room Actions are identified in E-1F9910, *Post-Fire Safe Shutdown Fire Area Analysis*, and procedural guidance is provided in OFN KC-016, *Fire Response*.
- 2.3 Fire areas that do not require a mitigating action to ensure preservation of a PFSSD success path, are not addressed within this review. Refer to E-1F9910 for the detailed PFSSD analysis for each fire area.
- 2.4 Actions required for transition to cold shutdown are not included. Hot standby is a safe, stable condition for the plant. Consistent with 10 CFR 50 Appendix R, Section III.G.1.b, cold shutdown repairs are required to be completed within 72 hours. However, cold shutdown is not required to be achieved within 72 hours.
- 2.5 Interim compensatory OMAs that are being eliminated as a result of plant modifications are not included within this review. These modifications include the following:
 - Change Package 012368 and 012568 Darmatt fire wrap protection for BGLT0185 and BGLCV0112C. This change will reduce vulnerability within Fire Area A-8 for the VCT outlet valves to spuriously stick open, resulting in the potential for charging pump gas binding. This modification addresses a Required for Safe Shutdown component (charging pump). It is a multiple spurious operation (MSO) from a PFSSD perspective, as both VCT outlet valves stick open and letdown is diverted from the VCT. In addition to an OMA compensatory measure for the identified issue, a fire watch compensatory measure has been established for the affected area.
 - 2. Change Package 012944 Pressurizer PORV Cable Reroute to allow PORV closure from Control Room. This modification is in response to LER 2008-009. The modification addresses an Important to Safe Shutdown element, as the pressurizers PORVs are not required for PFSSD. However, closure of the PORVs is desired to prevent an RCS flow diversion. It is a MSO equipment operation from a PFSSD perspective, as the fire induced maloperation of both the PORV and its associated block valve must occur before the event would require outside Control Room response. In addition

to an OMA compensatory measure for the identified issue, a fire watch compensatory measure has been established for the affected areas.

- 2.6 The interim compensatory measure OMAs for Fire Area A-27 are evaluated for feasibility only. These interim OMAs will be eliminated with the implementation of Change Package 012418. This modification will install fire rated cable for protection of EGHV0016, CCW 'B' Return and EGHV0054 CCW 'B' Supply. The modification addresses a Required for Safe Shutdown element (component cooling water supporting 'B' Train Charging). It is a single spurious equipment operation from a PFSSD perspective as the fire induce failure, will affect CCW cooling to the seal water heat exchanger. The interim OMAs are included within this analysis, as they are manual actions that are within the March 5, 2009 enforcement discretion scope discussed in Section 3.0. In addition to an OMA compensatory measure for the issue, a fire watch compensatory measure has been established for the affected area.
- 2.7 The interim compensatory manual action for protection of reactor coolant pump (RCP) seals is not included within this review as the OMA is being eliminated by a Technical Specification (TS) change. The TS change will allow the seal injection containment isolation valves to be open with power to the motor operated valve removed. This modification addresses an Important to Safe Shutdown element, as the reactor coolant pumps are not required for PFSSD. However, RCP seal cooling is desired to prevent an RCS flow diversion, as a result of RCP seal failure. It is a MSO equipment operation from a PFSSD perspective, as both seal injection and thermal barrier cooling must be lost before the event would require outside Control Room response. In addition to an OMA compensatory measure for the identified issue, a fire watch compensatory measure has been established for the affected areas.

3.0 Background

The Wolf Creek comparison to 10 CFR 50, Appendix R is contained in USAR, Appendix 9.5E. Section III.G of Appendix R requires fire protection of safe shutdown capability to ensure the ability to achieve and maintain safe shutdown following a severe fire. Outside containment, three separation methods are recognized by the NRC to ensure at least one success path is available to achieve and maintain safe shutdown following a fire where redundant components are located in the same fire area. These methods are as follows:

- 1. Separation of cables and equipment and associated non-safety circuits of redundant trains by a fire barrier having a 3-hour fire rating.
- 2. Separation of cables and equipment and associated non-safety circuits of redundant trains by a horizontal distance of more than 20 feet with no intervening combustibles or fire hazards. In addition, fire detectors and an automatic fire suppression system shall be installed in the fire area.
- 3. Enclosure of cables and equipment and associated non-safety circuits of redundant trains in a fire barrier having a 1-hour fire rating. In addition, fire detectors and an automatic fire suppression system shall be installed in the area.

Inside non-inerted containments, the following criteria apply:

- 1. Separation of cables and equipment and associated non-safety circuits of redundant trains by a horizontal distance of more than 20 feet with no intervening combustibles or fire hazards.
- 2. Installation of fire detectors and an automatic fire suppression system.
- 3. Separation of cables and equipment and associated non-safety circuits of redundant trains by a non-combustible radiant energy shield.

The Wolf Creek response to the requirements of Section III.G of Appendix R is as follows:

USAR Appendix 9.5B provides an area-by-area analysis of the power block that demonstrates that no single fire can prevent safe shutdown. Redundant trains of systems required to achieve and maintain hot standby are separated by 3- hour rated fire barriers, or the equivalent provided by III.G.2, or else a diverse means of providing the safe shutdown capability exists and is unaffected by the fire. For redundant trains of systems required to achieve and maintain cold shutdown that could potentially be affected by a single fire, repairs or local operator actions can be performed within 72 hours. As described in Appendix 9.5B and Section 7.4, an auxiliary shutdown panel is provided as a dedicated means of achieving and maintaining hot standby in the event that the main control room is uninhabitable due to a fire. The ESW pumphouse also complies.

Initially, Wolf Creek's position was that the license commitment described in the USAR comparison response to 10 CFR 50 Appendix R, Section III.G allowed the use of "diverse means" to achieve safe shutdown. Diverse means was interpreted by Wolf Creek to mean any reasonable means, in compliance with other license requirements, necessary to ensure the plant can be brought to safe shutdown conditions following a fire. For example, valve or breaker manipulations are considered reasonable since they are performed as part of normal operator duties. Repairs necessary to achieve hot standby conditions were not considered reasonable since they are not allowed by 10 CFR 50 Appendix R.

During the 2005 NRC Fire Protection Triennial Inspection, Wolf Creek received a green non-cited violation (NCV) of License Condition 2.C.(5), "Fire Protection (Section 9.5.1, SER; Section 9.5.1.8, SSER 5)," for failure to ensure that redundant trains of safe shutdown systems in the same fire area were free of fire damage. The NRC inspection report concluded that a green NCV of License Condition 2,C.(5) existed because Wolf Creek credited the use of manual actions to mitigate the effects of fire damage in lieu of providing the physical protection required by 10 CFR Part 50, Appendix R, Section III.G.2.

Wolf Creek denied the NCV, as documented in letter WM 06-0013 (Reference 7.10). The NRC concluded in their response letter (Reference 7.11) to the denial, that the use of operator manual actions in lieu of direct compliance with the separation requirements of 10 CFR 50 Appendix R Section III.G.2 is not within Wolf Creek's current fire protection license basis. The NCV received for this issue during the 2005 NRC Fire Protection Triennial was recategorized to an Apparent Violation with

enforcement discretion. The enforcement discretion identified in the referenced NRC letter was consistent with that published in the March 6, 2006 Federal Register Notice regarding operator manual actions. This Federal Register Notice withdrew the proposed rule from 10 CFR 50 Appendix R to codify the acceptability of operator manual actions in lieu of compliance with the separation requirements of Appendix R Section III.G.2. Wolf Creek accepted the Apparent Violation and is complying with the following requirements in effort to receive enforcement discretion through March 5, 2009:

- Implement compensatory measures and initiate corrective actions within 6 months of the publication date of the Federal Register Notice (i.e., by September 5, 2006).
- The enforcement discretion will continue provided the appropriate compensatory measures are maintained and the planned corrective actions are completed within 3 years of the publication date of the Federal Register Notice (i.e., March 5, 2009).

In response to the Apparent Violation Wolf Creek developed a plan to address resolution of the manual actions issue. The plan contained the following major milestones:

A. Perform a detailed circuit analysis to determine if a credible circuit fault condition is present to warrant the mitigating manual action currently credited.

No operator manual actions were eliminated as a result of this additional PFSSD review.

- B. Perform a thermal hydraulic analysis (WCNOC-CP-002) to assess plant performance when an OMA was credited in response to fire induced spurious equipment operation.
- Some OMAs were eliminated in cases where the thermal hydraulic analysis demonstrated that the OMA was not required to be implemented to achieve and maintain hot standby.
- C. Where cost beneficial, implement plant modifications to comply with 10 CFR 50 Appendix R III.G.2.

Several plant modifications were implemented to either completely eliminate the need for an operator manual action or improve the overall feasibility and reliability of remaining operator manual actions for a specific fire area. Modifications included: cable reroute, instrument relocation, creation of a new fire area, and application of raceway fire barrier protection.

D. For remaining operator manual actions that were cost prohibitive to address by modification or presented a reasonable success probability for acceptance based on available time margin, a feasibility and reliability analysis, considering NUREG-1852 guidance, was conducted. The NUREG-1852 feasibility and reliability analysis is contained within this document. The information within SECY-08-0093 was utilized as guidance to determine if the identified OMA required prior NRC approval in order to credit an OMA as a

permanent resolution. SECY-08-0093 divides equipment important to safe shutdown into the following two classifications:

- One train of systems necessary to achieve and maintain hot shutdown conditions (identified as "Required for Hot Standby" in this analysis). For fire induced spurious operation within this classification, SECY-08-0093 identifies there is no allowance for OMA without prior NRC approval.
- Equipment important to safety that could be damaged by a single fire, and the spurious equipment operation could result in either an indirect or direct affect on PFSSD capability. However, the equipment is not credited as an element of the analyzed PFSSD success path. This equipment subset is identified as "Important to Safe Shutdown" within this analysis. SECY-08-0093 indicates that prescriptive requirements of 10 CFR 50 Appendix R Sections III.G.1.a and III.G.2 do not apply, and an OMA is an acceptable mitigating action for the spurious equipment operation. NRC approval is not required in this case.

4.0 Definitions

- 4.1 <u>Action</u>
 - 4.1.1 An activity, typically observable, and usually involving the manipulation of equipment, that is carried out by an operator(s) to achieve a certain outcome. The required diagnosis of the need to perform the activity, the subsequent decision to perform the activity, obtaining any necessary equipment, procedures, or other aids or devices necessary to perform the activity, traveling to the location to perform the activity, implementing the activity, and checking that the activity has had its desired effect, are all implied and encompassed by the term "action."

4.2 Available Time (or Time Available)

- 4.2.1 The time period from a presentation of a cue for an action to the time of adverse consequences if the action is not taken. This time is based on one of the following:
 - a. Thermal hydraulic analysis, where plant thermal performance is not adversely affected. The thermal hydraulic analysis is documented in WCNOC-CP-002 and SA-08-006. Fire induced spurious equipment actuation requiring OMA implementation are assumed to occur simultaneously at the onset of the event.
 - b. Established Technical Specification or Technical Requirements Manual for allowed equipment outage times.
 - c. Referenced source (calculation, analysis, industry document, etc.).

4.3 <u>Cold Shutdown</u>

4.3.1 Plant Mode 5, which is within the following parameters:

Reactivity Condition (k _{eff})	% Rated Thermal Power (excluding decay heat)	Average Reactor Coolant Temperature (°F)
< 0.99	N/A	<u>≤</u> 200

4.4 <u>Control Room Action</u>

4.4.1 Action within the Control Room to mitigate or prevent the undesirable affects of fire induced spurious equipment operation.

4.5 <u>Diagnosis Time</u>

4.5.1 The time required for operator(s) to examine and evaluate data to determine the need for, and to make the decision to implement, an action.

4.6 Feasible Action

4.6.1 An action that is analyzed and demonstrated as being able to be performed within an available time so as to avoid a defined undesirable outcome. As compared to a reliable action (see definition), an action is considered feasible if it is shown that it is possible to be performed within the available time; but it does not necessarily demonstrate that the action is reliable. For instance, performing an action successfully one time out of three attempts within the available time shows that the action is feasible, but not necessarily reliable.

4.7 <u>Fire Indicated</u>

4.7.1 The point when the fire is detected by either human or automatic detection means. The duration of early fire growth before fire alarm indication is determined based on NUREG-1805 guidance regarding smoke detector response time. Refer to Attachment B1 for further discussion regarding the use of NUREG-1805 Fire Dynamics Tools (FDT).

4.8 <u>Fire Initiation</u>

4.8.1 The point when the fire event commences.

4.9 <u>Hot Standby</u>

4.9.1 Plant Mode 3, which is within the following parameters:

Reactivity Condition	% Rated Thermal	Average Reactor Coolant
(k _{eff})	Power (excluding decay heat)	Temperature (°F)
< 0.99	N/A	<u>></u> 350

The residual heat removal (RHR) system is utilized for decay heat removal at RCS temperatures less than 350°F. RHR is a cold shutdown system.

4.10 Important to Safe Shutdown

4.10.1 Component that could be damaged by a single fire, and the spurious equipment operation could result in either an indirect or direct affect on PFSSD capability. However, the equipment is not credited as an element of the analyzed PFSSD success path. This is "orange box" equipment as, defined in Table 1 of SECY-08-0093.

4.11 Multiple Spurious Operation (MSO)

4.11.1 Condition where more than one fire induced equipment maloperation is required before an undesired event, potentially affecting PFSSD, would occur.

4.12 Operator Manual Action (OMA)

4.12.1 Those actions performed by operators to manipulate components and equipment from outside the main Control Room to achieve and maintain post-fire hot standby, but not including "repairs." Operator manual actions comprise an integrated set of actions needed to help ensure that hot standby can be accomplished, given that a fire has occurred in a particular plant area.

4.13 OMA Implementation Time (or OMA Time)

4.13.1 The time required by the operator(s) to successfully perform the manipulative aspects of an action (i.e., not the diagnosis aspects themselves, but typically as a result of the diagnosis aspects), including obtaining any necessary equipment, procedures, or other aids or devices; traveling to the necessary location; implementing the action; and checking that the action has had its desired effect.

4.14 OMA Uncertainty Time

- 4.14.1 A time duration to account for varying conditions/uncertainties that could adversely affect overall OMA completion time. Examples considered include:
 - Communication and feedback with Control Room
 - Electronically controlled door requiring key access
 - Obtain RCA access
 - Human centered uncertainties such as size, physical strength, and cognitive difference
 - Return trip to Control Room as a result of loss of Gaitronics and Radio communication capability

4.15 <u>Preventive Action</u>

4.15.1 Those actions that, upon entering a fire plan/procedure, the operator(s) takes (without needing further diagnosis) to mitigate the potential effects of possible spurious actuations or other fire-related failures, so as to ensure that hot standby can be achieved and maintained. For these actions, it is generally assumed that once the fire has been detected and located, per procedure, the Control Room crew will direct personnel to execute a number of actions, possibly even without the existence of other damage symptoms, to ensure the availability of equipment to achieve its function during the given fire scenario. In many cases, the only criterion for initiating these actions is the presence of the fire itself. The fire must be confirmed before a preventive action will be taken.

4.16 <u>Reactive Action</u>

4.16.1 Those actions taken during a fire in response to an undesired change in plant condition. In reactive actions, the operator(s) detects the undesired change and, with the support of procedural guidance, diagnoses the correct actions to be taken. Thus, with reactive actions, the plant staff responds to indications of changing equipment conditions caused by the fire, and then takes the steps necessary to ensure that the equipment will function when needed (e.g., manually reopening a spuriously closed valve). The plant staff may not initiate the actions until the procedure indicates that, given the relevant indications, the actions must be performed.

4.17 <u>Reliable Action</u>

4.17.1 A feasible action that is analyzed and demonstrated as being dependably repeatable within an available time, so as to avoid a defined adverse consequence, while considering varying conditions that could affect the available time and/or the time to perform the action. As compared to an action that is only feasible (see definition), an action is considered to be reliable as well if it is shown that it can be dependably and repeatably performed within the available time, by different crews, under somewhat varying conditions that typify uncertainties in the available time and the time to perform the action, with a high success rate.

4.18 <u>Required for Hot Standby</u>

- 4.18.1 Component on the required safe shutdown path for a particular fire area that is designated to perform one or more of the following safe shutdown functions:
 - Reactivity control
 - Pressure control
 - Inventory control
 - Decay heat removal
 - Process monitoring
 - Support systems

This is "green box" equipment as defined in Table 1 of SECY-08-0093.

- 4.19 <u>Single Spurious Equipment Operation</u>
 - 4.19.1 Condition where the fire induced maloperation of a single component potentially affects PFSSD.
- 4.20 <u>Time Margin</u>
 - 4.20.1 The amount of Available Time (see definition) remaining following OMA implementation, factoring in uncertainty.

4.21 <u>Undetected Fire Growth</u>

Time from initial onset of fire before the fire event is detected.

5.0 Methodology

The following methodology was applied for each fire area where fire induced spurious equipment operation could result in the need to perform a mitigating OMA to ensure PFSSD capability. Section 8.0 contains the detailed evaluation for each fire area analyzed, utilizing the format described in Section 5.1

5.1 Fire Area # and Location

The specific fire area and location within the plant is identified. This is the location of the postulated fire.

5.1.1 Fire Area Features

A general description of the fire area, including the active fire protection features provided.

5.1.2 Spurious Equipment Operation requiring Operator Manual Action

A discussion of the equipment that could spuriously operate as a result of the fire is identified. The equipment is classified as either "Required for Hot Standby" or "Important to Safe Shutdown" and a basis is provided for the classification. Additionally, the equipment maloperation is classified as either "Single Spurious Equipment Operation" or "Multiple Spurious Operation" (MSO), and a basis is provided for the classification.

5.1.3 Operator Manual Action Description

The OMA and location of the action is identified. The OMA is identified as either a "Reactive Action" or "Preventive Action" based on when the OMA implementation occurs in relation to event diagnosis.

Some OMAs necessary to achieve and maintain PFSSD affect more than one component in the plant. The following assesses the impact to PFSSD concerning components affected by OMA implementation. The review determined that implementation of the OMAs identified in Attachment A will not result in an adverse consequence to PFSSD capability.

5.1.3.1 Close KAV0201

Closing instrument air valve KAV0201 will fail air to the air operated components within the Reactor Building. This is performed in order to fail letdown isolation valves BGLCV0459 and BGLCV0460. Table 5.1.3.1-1 identifies all other components affected by closing KAV0201. Based on the table, there is not adverse impact of safe shutdown by closing KAV0201.

Component	Description	Consequence Review
BBHV7141	Reactor coolant drain tank (RCDT) heat exchanger to pressurizer relief tank (PRT)	Valve is normally closed and fails closed on loss of air. Neither the RCDT nor the PRT are PFSSD components. The position of this valve has no impact on safe shutdown.
BBHV8026	PRT nitrogen supply	Valve is normally closed and fails closed on loss of air. The PRT is not a PFSSD component. This valve is a containment isolation valve and the safety position of this valve is closed. The position of this valve has no impact on safe shutdown.
BBHV8031	PRT drain to reactor coolant drain tank (RCDT)	Valve is normally closed and fails closed on loss of air. Neither the PRT nor the RCDT are PFSSD components. The position of this valve has no impact on safe shutdown.
BBHV8032	Reactor vessel flange leak off	Valve is normally open and fails open on loss of air. This valve allows any leakage from the reactor vessel flange to pass to the RCDT. Flange leakage is not considered in the PFSSD analysis, as it is mechanical. The position of this valve has no impact on safe shutdown.
BBHV8045	Reactor makeup water to PRT	Valve is normally closed and fails closed on loss of air. This valve assists in maintaining water level in the PRT. The PRT is not a PFSSD component. The position of this valve has no impact on safe shutdown.
BBHV8141A	Reactor coolant pump (RCP) A seal water outlet	These valves are on the individual RCP seal return lines. They are normally open and fail
BBHV8141B	RCP B seal water outlet	open on loss of air. This is the assumed PFSSD position of these valves. A loss of air
BBHV8141C	RCP C seal water outlet	to these valves has no negative impact on PFSSD.
BBHV8141D	RCP D seal water outlet	
BBLCV0178	RCP D standpipe fill	These valves are normally closed and fail
BBLCV0179	RCP C standpipe fill	closed on loss of air. The RCP seal standpipes are not PFSSD components. The
BBLCV0180	RCP B standpipe fill	position of these valves has no impact on safe shutdown.
BBLCV0181	RCP A standpipe fill	- shutdown.
BBPCV0455B	Pressurizer spray valve	Air feeds the controllers for the two pressurizer
BBPCV0455C	Pressurizer spray valve	spray valves and modulates the valves. Based on preoperational testing, loss of air
BBPY0455CA	Pressurizer pressure controller	the controller causes the spray valves to
BBPY0455BA	Pressurizer pressure controller	 close. Based on thermal hydraulic analyses (WCNOC-CP-002), closing the pressurizer spray valves creates a more conservative condition in the primary system.
BGHCV0123	Excess letdown heat exchanger isolation	Valve is normally closed and fails closed on loss of air. This valve is not a PFSSD component, but in the failed position it would assist in isolating the excess letdown. The position of this valve has no impact on safe shutdown.

Table 5.1.3.1-1, OMA Consequence Review for Closing KAV0201

Ē

Component	Description	Consequence Review	
BGHV8143	Excess letdown to RCDT	Valve is a three-way valve and fails open to the seal water heat exchanger on loss of air. This valve is not a PFSSD component and the position of this valve has no impact on safe shutdown.	
BGHV8146	Regenerative heat exchanger to RCS Loop 1 Cold Leg	These valves are the charging injection valves to the Loop 1 and Loop 4 hot legs. They fail to	
BGHV8147	Regenerative heat exchanger to RCS Loop 4 Cold Leg	the open position. For post-fire line-up, charging is isolated using the containment isolation valves BGHV8105 and BGHV8106. The position of these valves has no impact on safe shutdown.	
BGHV8149A	Letdown orifice isolation	These valves are the orifice isolation valves on	
BGHV8149B	Letdown orifice isolation	the letdown lines. They fail closed on loss of air. Letdown is isolated using BGLCV459 and	
BGHV8149C	Letdown orifice isolation	BGLCV460. Closing these valves assists in isolating letdown, but the position of these valves has no impact on safe shutdown.	
BGHV8160	Letdown containment isolation valve	Valve is the inboard containment isolation valve on the letdown line. It fails closed on loss of air. Letdown is isolated using BGLCV459 and BGLCV460. Closing this valve assists in isolating letdown, but the position of this valve has no impact on safe shutdown.	
BGHY8145	Pressurizer spray from regenerative heat exchanger	Valve is normally closed and fails closed on loss of air. It allows charging water to spray in the Pressurizer. Charging is isolated upstream of this valve using BGHV8105 or BGHV8106. The position of this valve has no impact on safe shutdown.	
BGLCV0459	Letdown isolation	These valves are normally open and fail closed on loss of air. The PFSSD position of these two valves is closed. Failing air to the	
BGLCV0460	Letdown isolation	two valves will place them in the PFSSD position.	
EJHCV8890A	RHR A test line to safety injection (SI)	These valves are normally closed and fail closed on loss of air. The RHR system is not	
EJHCV8890B	RHR B test line to safety injection	impacted by the closure of these valves. They are not PFSSD components and their position has no impact on safe shutdown.	
EJHCV8825	RHR test line to safety injection		

.

Component	Description	Consequence Review
EMHV8823	SI / accumulator test line	These valves are normally closed and fail
EMHV8824	SI pump B test line	closed on loss of air. The SI system is not used for PFSSD and it is not impacted by the closure of these valves. They are not PFSSD components and their position has no impact on safe shutdown.
EMHV8843	Boron injection upstream test line	
EMHV8871	Containment isolation test line	
EMHV8881	SI pump A test line	
EMHV8882	Boron injection downstream test line	
EMHV8889A	Hot leg 1 test line	
EMHV8889B	Hot leg 2 test line	
EMHV8889C	Hot leg 3 test line	
EMHV8889D	Hot leg 4 test line	
EPHCV0943	Nitrogen containment isolation	These valves are normally closed and fail
EPHV8875A	Accumulator A nitrogen supply	closed on loss of air. They are associated with the Nitrogen supply to the SI
EPHV8875B	Accumulator B nitrogen supply	accumulators. The SI accumulators are not used for PFSSD. The valves are not PFSSD
EPHV8875C	Accumulator C nitrogen supply	components and their position has no impact
EPHV8875D	Accumulator D nitrogen supply	on safe shutdown.
EPHV8877A	Accumulator A test line	These valves are normally closed and fail
EPHV8877B	Accumulator B test line	closed on loss of air. They are associated with the SI accumulators. The SI
EPHV8877C	Accumulator C test line	accumulators are not used for PFSSD. The valves are not PFSSD components and their
EPHV8877D	Accumulator D test line	position has no impact on safe shutdown.
EPHV8878A	Accumulator A fill line	These valves are normally closed and fail
EPHV8878B	Accumulator B fill line	closed. They are used to maintain water level in the SI accumulators. The SI accumulators
EPHY8878C	Accumulator C fill line	are not used for PFSSD. The valves are not
EPHV8878D	Accumulator D fill line	PFSSD components and their position has no impact on safe shutdown.
EPHV8879A	Accumulator A test line	These valves are normally closed and fail
EPHV8879B	Accumulator B test line	closed on loss of air. They are associated with the SI accumulators. The SI
EPHV8879C	Accumulator C test line	accumulators are not used for PFSSD. The valves are not PFSSD components and their position has no impact on safe shutdown.
EPHV8879D	Accumulator D test line	
EPPV0001	Steam generator nitrogen purge regulator	This is a control valve that fails closed on loss of air. This valve was used to purge the Steam Generators with Nitrogen during plant shutdowns. The PIC for this valve is now valved out of service and a manual valve is used to control the Nitrogen flow. The position of this valve has no impact on safe shutdown.
GTHY0005	Containment purge supply	The dampers are associated with the
GTHY0007	Containment purge supply	containment purge system. The dampers are normally closed and fail closed on loss of air.
GTHY0008	Containment purge exhaust	The position of these dampers has no impact on safe shutdown.
GTHY0011	Mini purge exhaust	

Component	Description	Consequence Review
HBHV7126	RCDT vent	These seven components are associated with
HBHV7127	RCDT outlet	the reactor coolant drain tank. Some of the valves fail open and some fail closed on loss
HBHV7143	RCDT recirculation	of air. Loss of air to the controller causes valve HBLCV1003 to fail closed. However,
HBHV7144	RCDT recirculation	the RCDT and associated valves are not
HBHV7176	RCDT discharge	PFSSD components. The position of these valves has no impact on safe shutdown.
HBLCV1003	RCDT level control	
HBLY1003A	RCDT level controller	
LFLV0097	Containment cooler A drain	These valves are normally closed and fail
LFLV0098	Containment cooler B drain	open on loss of air. The valves allow normal drainage from the containment coolers to drain
LFLV0099	Containment cooler C drain	to the containment normal sumps. They fail open on loss of air to assure that the
LFLV0100	Containment cooler D drain	open of loss of an to assure that the containment coolers will function properly in an accident case. The containment coolers and drain valves are not PFSSD components and the position of these valves has no impa- on safe shutdown.
LFLV0122	Refueling pool standpipe drain to containment sump	Valve is a normally closed and fails closed on loss of air. It is associated with the refueling pool leak detection system. The refueling pool leak detection system is not a PFSSD system. The position of this valve has no impact on safe shutdown.

5.1.3.2 Manipulate Local Controller ABFHC0002

Steam generator atmospheric relief valve (ARV) ABPV0002 can be controlled/isolated by manipulation of ABFHC0002. The local controller is not associated with any other component; so there is no adverse consequence to PFSSD capability.

5.1.3.3 Manipulate Local Controller ABFHC0003

Steam generator ARV ABPV0003 can be controlled/isolated by manipulation of ABFHC0003. The local controller is not associated with any other component; so there is no adverse consequence to PFSSD capability.

5.1.3.4 Isolate ARV ABPV0004

Steam generator ARV ABPV0004 can be isolated by closing air supply valve KAV1429 and nitrogen supply valve KAV1365, and then bleeding air from the regulator. The manipulated equipment is not associated with any other component; so there is no adverse consequence to PFSSD capability.

5.1.3.5 Open Breaker NB00203

Breaker NB00203 is opened to terminate the spurious operation of Train B containment spray. Breaker NB00203 is associated only with containment spray pump B. There are no other components that can be affected by manually opening the breaker. Therefore, there is no adverse consequence to PFSSD capability.

5.1.3.6 Open Breaker NB00102

Breaker NB00102 is opened to terminate the spurious operation of Train A containment spray. Breaker NB00102 is associated only with containment spray pump A. There are no other components that can be affected by manually opening the breaker. Therefore, there is no adverse consequence to PFSSD capability.

5.1.4 <u>Feasibility Analysis of Time Available to Perform Operator Manual Action</u>

1. An event timeline, similar to Figure 5.1.4-1, was developed for each fire area necessitating OMA implementation. The event timeline starts at fire initiation. This is more conservative than NUREG-1852 guidance, which starts the event timeline at fire indicated. The fire induced spurious equipment operation is also postulated to occur at fire initiation. This is conservative, as the cable type utilized (IEEE-383) will not present an immediate failure mode when exposed to fire. Elements of the timeline include:

Fire Initiation – Reference Section 4.8 for definition.

Fire Indicated – Reference Section 4.7 for definition. As discussed in Section 5.1.14, OFN KC-016 *Fire Response*, is entered once the fire condition is confirmed, which is accomplished by one of the following:

- a. Fire reported by personnel.
- b. Fire alarm verified by inspection.
- c. Multiple fire alarms for the same area are received at fire alarm control panel (FACP) KC-008, located in the Control Room.

Diagnosis Time – Reference Section 4.5 for definition. Diagnosis time will start following fire indication.


OMA Implementation Time – Reference Section 4.13 for definition.

OMA Uncertainty Time - Reference Section 4.14 for definition.

Available Time – Reference Section 4.2 for definition.

Time Margin – Reference Section 4.20 for definition.

- 2. The timeline results are reviewed to determine if adequate time is available to ensure feasibility of the OMA. The OMA is considered feasible, from a timing perspective, if the OMA implementation time (excluding the OMA uncertainty time) for at least one demonstration does not exceed the available time for performing the OMA.
- 3. The timeline results are reviewed to determine if adequate time margin is available to ensure reliability of the OMA. The OMA is considered reliable, from a timing perspective, if the OMA time plus the OMA uncertainty time does not exceed the available time for OMA implementation.

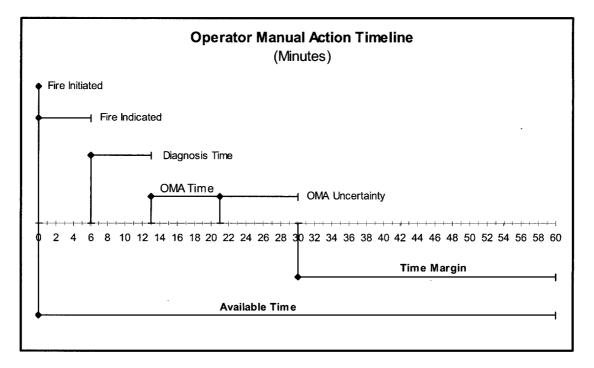



5.1.5 Reliability Analysis of Time Available to Perform Manual Actions

This criterion addresses uncertainties to ensure that the OMA can be dependably and repeatedly performed within the available time. An OMA is considered reliable provided that a Time Margin remains when considering Fire Indicated Time, Diagnosis Time, OMA Implementation Time and OMA Uncertainty Time, within the OMA event timeline. The following uncertainty times were included, as applicable, in effort to address OMA reliability:

- 1. For implementation of each OMA a delay of one (1) minute is included for the OMA action to be understood and repeated back to the Control Room. This delay is invoked in recognition that a limited delay will be present regarding the three-way communication method that will be utilized when the Control Room directs implementation of the OMA. Additional uncertainty time is added for implementation of multiple OMAs.
- 2. A time delay of three (3) minutes is included, where applicable, to account for cumulative delay through electronically controlled doors that could require key access in the event power is lost to the door. This is a reasonable timeframe for the operator to assess that key access is necessary, in order to obtain ingress beyond affected electronically controlled doors.
- 3. A time delay of two (2) minutes is included for obtaining necessary access and dosimetry when entering the radiological controlled area (RCA). This time delay is based on the typical processing time to log into and gain access into the RCA. It is recognized that during an emergency, such as fire response, conventional RCA entry may be waived provided a RDD is obtained. However, for conservatism, a time delay has been included within this analysis, which accounts for conventional RCA entry.
- 4. A time delay of three (3) minutes is included for human centered uncertainties such as size, physical strength, and cognitive difference.

5.1.6 Environmental Factors

The expected environmental conditions for the OMA location and associated egress routes were reviewed for acceptability. Environmental factors considered were radiation, lighting, temperature, humidity, smoke, toxic gas, noise, and halon fire suppression discharge. The following is the smoke propagation impact review for OMAs.

5.1.6.1 Smoke Propagation Review

A single fire originating within a plant fire area will be contained within the fire area of origin until extinguished. This is the case due to the fire rated barrier construction and associated closure assemblies (fire doors, fire dampers, seismic gap seals, and penetration seals) provided for the fire area boundary. All OMAs are performed outside the fire area of origin and the affected fire area does not have to be traversed in order to perform mitigating manual actions. Therefore, fire propagation does not present an impediment to the performance of OMAs. However, smoke migration beyond the fire boundary could potentially occur as a result of the following:

- Smoke migration through HVAC duct work or transfer grille prior to activation of the fusible link operated fire damper within the fire barrier opening created by the ductwork.
- Smoke migration resulting from the momentary opening of a fire door within the boundary of the affected fire area to support fire fighting activities.

Smoke migration via ventilation ductwork or a transfer grille only presents a potential concern during the incipient stage of fire development. Once the 165°F activation temperature of the fusible link is attained, the fire damper will close. This action will substantially reduce ventilation related smoke migration beyond the fire boundary, effectively eliminating it as a smoke propagation concern. For fire dampers within ductwork, initial smoke migration would be limited to that entering ventilation diffusers, with the overall internal duct volume presenting an initial repository for the smoke and hot gases. Transfer grilles are open entirely to the fire environment, which presents a more ready means to spread smoke to an adjacent fire area during incipient stage fire development.

In an effort to limit smoke migration via ventilation systems, AP 10-106, *Fire Preplans*, identifies the HVAC equipment serving each fire area and the respective controls to shutdown each unit. This information provides the necessary guidelines to minimize smoke migration via ventilation equipment during a fire event. Prior to shutdown of the fan, smoke would be drawn into the return ductwork of the respective fan unit. The smoke would then be carried through the ductwork, through the filters and either be exhausted to the outside or recirculated back into the areas served via the supply ductwork. After a period of time, the filters could become clogged, causing the fan unit to shut down due to low air flow or high dP across the filters, at which time smoke migration through the ductwork would be limited to natural buoyancy of the heated smoke and gases.

Regarding smoke migration via a fire damper protected transfer grille, Table 5.1.6.1-1 identifies the fire areas containing a transfer grille that also require a potential OMA within the same building if the subject fire area is involved in a fire event. OMAs occurring outside the building of fire origin are not a concern as no transfer grilles are present between power block buildings. Table 5.1.6.1-1 reveals that no transfer grilles directly communicate with an affected fire area and the location of an OMA. Additionally, the travel path necessary to perform the OMA is not subjected to a transfer grille within the affected fire area boundary. Therefore, initial smoke propagation through transfer grilles prior to fire damper activation, will not impede the performance of OMAs.

Fire Location (Fire Area)	Ventilation Transfer Grille Review	Fire Area Where OMA Implemented	Room Where OMA Implemented	Discussion
A-1	Fire area A-1 contains the following transfer grilles, identified by fire damper and communicating fire area:	A-25	1322	Note 1
	$ \begin{array}{l} {\rm GLD040} \rightarrow {\rm RW-1} \\ {\rm GLD059, \ GLD060, \ GLD061} \rightarrow {\rm A-4} \\ {\rm GLD062, \ GLD063, \ GLD064} \rightarrow {\rm A-2} \\ {\rm GLD167} \rightarrow {\rm A-7} \\ {\rm GLD095} \rightarrow {\rm A-3} \end{array} $			
A-16	Fire area A-16 contains the following transfer grilles, identified by fire damper and communicating fire area:	A-23	1508 1509	Note 1
	$\begin{array}{l} \text{GLD020} \rightarrow \text{A-18} \\ \text{GLD027} \rightarrow \text{A-17} \\ \text{GLD170} \rightarrow \text{A-3} \\ \text{GLD194}, \text{GLD195} \rightarrow \text{A-28} \\ \text{GLD0407} \rightarrow \text{A-26} \\ \text{GLD0411} \rightarrow \text{A-34} \end{array}$			
A-18	Fire area A-18 contains the following transfer grille, identified by fire damper and communicating fire area:	A-25	1322	Note 2
	$GLD020 \rightarrow A-16$			

<u>Notes</u>:

1. Access to room or rooms where manual action is to be performed does not require the operator to traverse through any identified fire areas that communicate via a fusible link, fire damper protected transfer grille.

2. Transfer grill is provided with a volume control damper that closes prior to Halon release in fire area A-18. A fusible link operated fire damper is also provided for the ventilation opening.

The potential to spread smoke and hot gases as a result of fire fighting efforts only presents a concern if egress to the manual action area is potentially impeded or the area where the manual action occurs is directly subjected to smoke migration via the periodic opening of an access doorway for entry into the affected fire area. A review of OMAs require to achieve and maintain hot standby identified two areas where fire-fighting activities could potentially expose the OMA operator to the fire environment as a result of opening an access door to fight the fire. These areas are identified in Table 5.1.6.1-2.

Fire Area A-27 is the MG Set Room on the 2026' Elevation of the Auxiliary Building. This fire area is protected by a total flooding halon system. It is accessible for fire fighting from the south end through door 14031. This door communicates with fire area A-16. As identified in Table 5.1.6.1-2, Fire Area A-16

is the location where OMA action may be required in response to an A-27 fire. The manual action at valves EGHV0016 and EGHV0054 are located more than 40 ft from door 14031. This will be the closest point that the operator will be from door 14031, as access to A-16 is remotely located at either the southeast or northeast ends of the building via enclosed stairwells. The ceiling height within A-16 varies from 19'-10" to 20'-6" with a corresponding fire area size of approximately 7,900 ft². This substantial room volume coupled with the separation distance between the communicating door and valves to be manipulated provides reasonable assurance that the periodic fire fighting entry through door 14031 will not present a smoke migration severity that would impede the performance of the OMAs in A-16.

Fire Area C-30 is a cable chase located on the 2047' elevation of the Control Building. The cable chase has no ventilation openings. However, the access door for the chase opens to the Control Room Cabinet area (south of general Control Room area). The OMA operator could potentially be exposed to the fire fighting efforts for the cable chase, since the initial operator response is to physically report to the Control Room for direction.

Considering the sensitivity of the cable chase location within the Control Room area, the fire brigade will be cautious to limit smoke propagation beyond the C-30 cable chase, and the duration for opening the cable chase door will be limited due to the small footprint (12' x 12') of the chase. Based on this, the OMA operator and overall OMA implementation will not be adversely affected by the fire fighting efforts for Fire Area C-30.

Fire Location (Fire Area)	Fire Area Where OMA Performed	Room OMA Performed
A-27	A-16	1402
C-30	C-27	3601

Table 5.1.6.1-2, Locations where OMA Operator Potentially Subjected to Fire Fighting Efforts

5.1.7 Equipment Functionality and Accessibility

Equipment credited for implementation of OMA was reviewed to ensure it is accessible, available, and not damaged by the affects of the fire.

5.1.8 Available Indications

Availability of relevant diagnostic indications was reviewed to ensure operators would be able to:

- Detect and diagnose fire location.
- Assess the need to perform OMA.
- Direct personnel performing OMA.
- Provide feedback to the operators, if not directly observable, to verify that the OMA has provided the expected result and the manipulated equipment will remain in the desired position.

5.1.9 <u>Communications</u>

Communication equipment was reviewed, to ensure an acceptable communication method is available to the extent it is needed.

The two primary communication systems available for use are the plant public address system (Gaitronics) and the 900 MHz radio system. The following is a review of Gaitronics and radio availability in the event of a fire outside the Control Room.

5.1.9.1 Gaitronics

The main Gaitronics panel (QF076) is located in the Control Room back panel area. The Gaitronics system is powered from two separate and independent 120/208 VAC sources. The normal source is from PN0703 in Fire Area C-16. Cable routing from PN0703 to QF076 is through Fire Areas C-16, C-18, C-24, C-21 and C-27. The emergency source of power is from PN0803 in fire area C-15. Cable routing from PN0803 to QF076 is through fire areas C-15, C-17, C-23, C-30, C-33, C-22 and C-27. Therefore, except for Fire Area C-27, a fire in any area will not affect both sources of 120 VAC power to the Gaitronics system.

The Gaitronics system utilizes 16-conductor cables to distribute 120 VAC power and communication signals to the field devices. A hot short across conductors within this cable could create noise in the system and/or damage multiple components (amplifiers, power supplies, etc), which will prevent operation of the system. Cables associated with the Gaitronics system are run in conduit, which will provide some protection against the effects of a fire. It is reasonable to conclude that a fire will be detected and fire brigade callout will occur prior to the Gaitronics system becoming damaged. After that, Gaitronics functionality may be adversely affected.

5.1.9.2 Radio

The 900 MHz radio system main panel (QF362) is located in the Communication Corridor, elevation 2061-6. Power for panel QF362 is from batteries located adjacent to the Radio Equipment Room in Fire Area CC-1. The batteries are charged from the QA lighting system and have sufficient capacity to operate the radio system during the fire. A fire induced short anywhere along the coaxial communication cable, used for the antenna system, will disable the entire 900 MHz radio system. Table 5.1.9.2-1 identifies the fire areas where the coaxial cable is routed.

Auxiliary Building	Control Building	Other
A-1	C-1	CC-1
A-6	C-2	Reactor Building
A-8	C-3	RW-1
A-16	C-7	Fuel Building
A-18	C-8	
A-27	C-11	
A-33	C-12	
	C-15	
	C-16	
	C-17	
	C-18	
	C-23	·····

Table 5.1.9.2-1, 900 MHz Radio System C	able Routing
---	--------------

The on shift operator responsible for OFN KC-016 OMAs is trained to respond to the Control Room for instruction when a fire brigade callout announcement is made for a fire event. This approach allows the Control Room operators to provide initial face-to-face direction to the operator responsible for implementing OFN KC-016 OMAs. For the majority of the plant OMAs, this is the only communication that will be required to successfully implement the OMAs. A copy of OFN KC-016 will also be available within the Control Room for OMA operator use, this will aid in ensuring that the operator manipulates the proper plant equipment.

The on shift operator responsible for OFN KC-016 OMAs is required to carry a radio on their person in effort to improve communication diversity.

5.1.10 Portable Equipment

The portable equipment needed to successfully implement the OMA was identified and reviewed for availability and dedication to PFSSD, where appropriate.

In addition to the radio discussed above, the on shift operator responsible for OFN KC-016 OMAs is required to carry on their person the following portable equipment:

- Hand tool for cutting wire tab type locking devices on components that potentially would be required to be manipulated.
- Master key to unlock electronic card reader controlled doors, in the event electronic door function is affected by the fire.
- Flashlight to aid access/egress in the event normal lighting is affected by the fire.
- Key for ABFHC0002 and ABFHC0003 enclosure housings.

5.1.11 <u>Personnel Protective Equipment (PPE)</u>

The personnel protective equipment required to support the performance of the OMA is identified and assessed for availability. Hard hat, safety glasses, hearing protection, and gloves are not included in this review since this is the standard PPE complement, imposed by the WCNOC Safety Manual, for entry into industrial portions of the plant.

5.1.12 Procedures and Training

Each OMA was reviewed to ensure it is included within OFN KC-016, *Fire Response*. This procedure contains the actions potentially necessary to ensure availability of a PFSSD success path following a single fire event outside the Control Room. The Operations department owns this procedure. Training for the procedure is on a biennial cycle. The procedure is also exercised during fire brigade drill activities that involve postulated fires affecting PFSSD success path. The procedure identifies the following information, per fire area with a potential OMA, to ensure Control Room personnel are aware of the potential fire impact on safe shutdown.

- Equipment susceptible to fire induced spurious operation that could affect PFSSD success path.
- OMAs that are required to achieve PFSSD hot standby.
- OMA to mitigate spurious equipment operation.
- Available diagnostic instrumentation to aid in determining the need to perform OMA.

5.1.13 Staffing

The manpower requirements for OMA implementation are identified and reviewed against Operations staffing level, taking into account the NUREG-1852 guidance that Control Room or fire brigade personnel should not perform OMAs. This review is performed to ensure that an adequate number of qualified personnel will be available so that hot standby conditions can be achieved and maintained in the event of a fire.

One Operations individual is assigned OFN KC-016 OMA responsibility prior to taking the shift watch. This assignment is documented on the Shift Managers Relief Checklist (APF 21-001-01). This position assignment has no Control Room, Fire Brigade, or Emergency Planning responsibility.

5.1.14 Demonstration

1. As previously identified, OMAs are identified within procedure OFN KC-016. The procedure is entered when a fire outside the Control Room is confirmed, as discussed in Section 5.1.4.

The Control Room Supervisor is responsible for directing OFN KC-016 actions. The procedure is configured such that another Control Room operator will review the applicable procedure attachment for potential OMAs. This approach ensures that Control Room personnel are promptly made aware of potential OMAs, including the instrumentation that can be relied upon to assess the need for performing the OMA. This is a continuous action step within the procedure, which means that the operator is responsible for observing the step for potential response throughout the fire event. Based on procedure structure and observed Control Room operator performance during fire brigade drill activities, it is conservatively concluded that Control Room personnel will consistently diagnose the need to perform a reactive OMA within seven (7) minutes of a confirmed fire alarm condition.

2. The OMA response outside the Control Room was reviewed to determine that it could be successfully performed (to the extent practical) within the time constraints of this analysis. Multiple operations personnel were timed in the simulated performance of the OMA. The starting point for the timing evolution was the Work Control Center (Room 3613), which is adjacent to the Control Room on the 2047' elevation of the Communications Corridor. Where multiple OMAs were involved for a particular fire area, the timing for each OMA was initiated from Room 3613. This approach was utilized in effort to conservatively account for each OMA response originating from the Control Room in the event that radio and Gaitronics communication capability is affected by the fire.

The following timing limitations were applied generically when conducting OMA demonstration timing:

- a. A time delay of two (2) minutes is included where electrical safety personnel protective equipment is required to be donned prior to performing the OMA. This time constraint is consistent with electrical safety dress-out times that have been demonstrated for OFN RP-017.
- b. For fire areas with multiple OMAs where both Gaitronics and radio communication capability could be affected by the fire, a return trip to the Control Room is assumed to be necessary following the implementation of individual OMAs. This action is necessary in order for the operator to receive direction regarding additional required OMA response activities. A five (5) minute duration is applied for return trips to the Control Room from the Auxiliary Building and three (3) minutes for Control and Turbine Building. These times were based on walk down time efforts from the most remote components requiring OMA implementation. A return trip following implementation of the final OMA was not postulated within the OMA timeline as available Control Room indication will reflect OMA implementation.
- 3. Limitations (environmental, personnel protective equipment, tools, etc.) identified as applicable to the performance of the OMA were incorporated, to the extent practical, when conducting the OMA timed demonstration walkdowns.

5.1.15 Defense-In-Depth Analysis

The concept of defense-in-depth, described in 10 CFR 50, Appendix R, is applied to fire protection in areas important to safety, with the following three objectives:

- 1. Prevent fires from starting.
- 2. Detect rapidly, control, and extinguish promptly those fires that do occur; and,
- 3. Provide protection of structures, systems, and components (SSCs) important to safety so that a fire that is not promptly extinguished by fire suppression activities will not prevent safe shutdown of the plant.

These fire protection defense-in-depth objectives are assessed for each fire area where an OMA is credited for PFSSD.

5.1.16 Conclusion

Considering the cumulative results of the OMA review, a conclusion statement is provided regarding the overall feasibility and reliability of the OMA.

6.0 E-1F9900 Revision Guidance

- 6.1 E-1F9900 is part of the Approved Fire Protection Program, as it is incorporated by reference within Updated Safety Analysis Report (USAR). NRC review and approval was obtained for WIP-E-1F9900-004-A-1. Subsequent changes to E-1F9900 require prior NRC approval if any one of the following criteria is met:
 - 6.1.1 A Required for Hot Standby OMA is being added.
 - 6.1.2 The Time Margin for a Required for Hot Standby OMA is reduced by more than 10%.
- 6.2 Important to Safe Shutdown OMA additions or revisions do not require prior NRC approval provided analysis demonstrates that the OMA is feasible and reliable, considering NUREG-1852 guidance.

7.0 References

- 7.1 NRC Generic Letter 86-10, Implementation of Fire Protection Requirements, dated April 24, 1986
- 7.2 10 CFR 50 Appendix R, Fire Protection Program For Nuclear Power Facilities Operating Prior To January 1, 1979
- 7.3 NRC Inspection Manual 0609, Appendix F, Fire Protection Significant Determination Process, dated 02/28/05.
- 7.4 NUREG/CR-6850, Fire PRA Methodology for Nuclear Power Facilities, published 09/2005
- 7.5 NUREG-1805, Fire Dynamics Tools (FDTs) Quantitative Fire Hazard Analysis Methods for the U.S. Nuclear Regulatory Commission Fire Protection Inspection Program, published 12/2004
- 7.6 NUREG-1824, Verification and Validation of Selected Fire Models for Nuclear Power Plant Applications
- 7.7 NUREG-1852, Demonstration of the Feasibility and Reliability of Operator Manual Actions in Response to Fire, Published October 2007
- 7.8 Regulatory Guide 1.189, Fire Protection For Operating Nuclear Power Plants, March 2007
- 7.9 Federal Register Notice / Vol. 71, No. 43 / March 6, 2006, Fire Protection Program— Post-Fire Operator Manual Actions
- 7.10 Wolf Creek Letter WM 06-0013, from Richard Muench, Subject: Response to Noncited Violation 2008-08-03 NRC Inspection Report 2005-08, dated April 14, 2006
- 7.11 NRC Letter EA-06-170 from Dwight Chamberlain, Subject: Wolf Creek Generating Station - Revised Violation and Exercise of Enforcement Discretion 05000482/2005008-003 (NRC Inspection Report 05000482/2005008), dated July 25, 2006 [Wolf Creek Correspondence Number 06-00357]

- 7.12 SECY 08-093, Resolution of Issues Related to Fire-Inducted Circuit Failures, dated June 30, 2008
- 7.13 NRC Letter from Annette L. Vietti-Cook, Secretary to R. W. Borchardt Executive Director for Operations, Staff Requirements – SECY-08-0093 – Resolution Of Issues Related To Fire-Induced Circuit Failures, dated September 3, 2008
- 7.14 NUREG-0881 SER and SSER through Supplement 5
- 7.15 Technical Specifications, Wolf Creek Generating Station, Table 1.1-1 (Modes), Amendment 142
- 7.16 NEI 00-01, Guidance for Post-Fire Safe Shutdown Circuit Analysis, Revision 1
- 7.17 OFN KC-016, Fire Response Revision 21
- 7.18 OFN RP-017, Control Room Evacuation, Revision 29
- 7.19 AP 10-102, Control of Combustible Materials, Revision 13
- 7.20 AP 10-106, Fire Preplans, Revision 7
- 7.21 AP 21-001, Conduct of Operations, Revision 43
- 7.22 STS KJ-001A, Integrated D/G And Safeguards Actuation Test Train A, Revision 36
- 7.23 WCNOC Electrical Safety Manual, Revision 7
- 7.24 Wolf Creek Safety Manual, Revision 11
- 7.25 E-1F9910, Post Fire Safe Shutdown Fire Area Analysis, Revision 5
- 7.26 XX-E-013, Post-Fire Safe Shutdown (PFSSD) Analysis, Revision 1
- 7.27 Equipment Qualification Summary Document (EQSD) Section IV, Revision 0
- 7.28 WCNOC-CP-002, Thermal Hydraulic Analysis for Fires Outside Control Room, Revision 0
- 7.29 SA-08-006, Thermal Hydraulic Analysis [Control Room Fire], Revision 0
- 7.30 AN-96-062, RETRAN Analysis of Plant Shutdown Capability following a Postulated Fire in Fire Area A-18, Revision 0
- 7.31 NUREG/CR-6931, Cable Response to Live Fire (CAROLFIRE) Volume 1: Test Descriptions and Analysis of Circuit Response Data, Published April 2008

8.0 Feasibility and Reliability Review

8.1 Fire Area A-1, Auxiliary Building 1974' General Corridor

8.1.1 <u>Fire Area Features</u>

Fire Area A-1 is the general corridor area on the 1974' elevation of the Auxiliary Building. The fire area is separated from adjacent areas by 3-hour fire rated barriers. Smoke detection is provided in areas where the PFSSD circuits of concern are routed. A preaction sprinkler system is located in areas with high concentration of cable trays.

8.1.2 Spurious Equipment Operation Requiring Operator Manual Action

Cables associated with letdown isolation valves BGLCV0459 and BGLCV0460 may be damaged, preventing these valves from being closed from the Control Room. PFSSD requires one of these valves to be closed to ensure adequate charging flow.

This spurious equipment operation is Important to Safe Shutdown, as letdown is not required for PFSSD. However, letdown isolation is required to prevent RCS flow diversion. This event is a multiple spurious equipment operation from a PFSSD perspective, as the fire-induced maloperation involves two series valves in the chemical and volume control system.

8.1.3 Operator Manual Action Description

Valves BGLCV0459 and BGLCV0460 can be isolated by closing instrument air supply valve KAV0201 located in the South Pipe Penetration Room on the 2000' elevation of the Auxiliary Building (Reference Attachment C, Photo C-1). This removes air to BGLCV0459, BGLCV0460, and all air operated components within the Reactor Building. Historical performance of STS KJ-001A, which isolates instrument air to the Reactor Building, reveals that BGLCV0459 and BGLCV0460 will fail closed within three (3) minutes following isolation of instrument air. This is a Reactive OMA.

8.1.4 <u>Feasibility Analysis of Time Available to Perform Manual Actions</u>

Figure 8.1.4-1 reflects the OMA timeline for closing BGLCV0459 and BGLCV0460. The identified times are based on the following:

Fire Initiated - This is the initiating event, which occurs at time zero.

Fire Indicated – An eight (8) minute detection response time is utilized based on the Attachment B1 application of NUREG-1805 for smoke detector response. Smoke detection is provided in areas where the PFSSD circuits of concern are routed. Therefore, multiple detection alarms would be initiated for a fire event warranting OMA response action.

Diagnosis Time – A seven (7) minute diagnosis time is utilized based on Section 5.1.14.1.

OMA Implementation Time – A twelve (12) minute operator action time is utilized based on the demonstrated OMA walkdown time documented in Section 8.1.14.

OMA Uncertainty Time – A twelve (12) minute OMA uncertainty time is utilized based on Section 8.1.14.

Available Time – Thermal hydraulic analysis WCNOC-CP-002 identifies that when letdown is the only flow diversion event, it can remain open for one hundred eighty (180) minutes without adverse consequence to reactor performance.

Time Margin – The time margin for OMA performance is one hundred forty one (141) minutes.

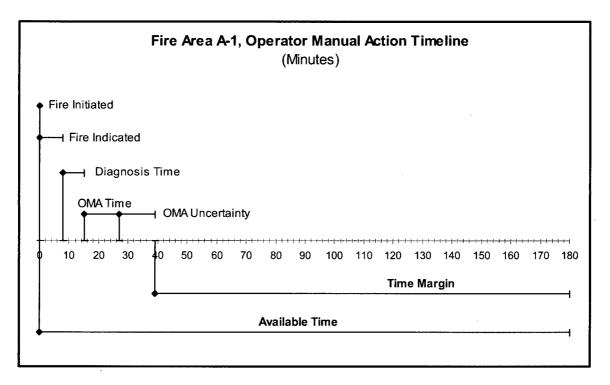


Figure 8.1.4-1, Fire Area A-1 OMA Timeline

8.1.5 <u>Reliability Analysis of Time Available to Perform Manual Actions</u>

As discussed in Section 5.1.5, an OMA is considered reliable provided that a Time Margin remains when applying Fire Indicated Time, Diagnosis Time, OMA Implementation Time, and OMA Uncertainty Time, within the OMA event timeline. The OMA Timeline for Fire Area A-1 reveals that a one hundred forty one (141) minute time margin remains. Application of the uncertainty time provides reasonable assurance that the OMA is dependable, reliable, and can be performed with a high rate of success.

8.1.6 Environmental Factors

Habitable environmental conditions will be present for performance of the OMA. The postulated fire event is within the general corridor area of the Auxiliary Building 1974' elevation. The location of the OMA is within the South Pipe Penetration Room on the 2000' elevation of the Auxiliary Building (Fire Area A-25). Based on fire barrier separation, the fire will be confined to Fire Area A-1. Access to Fire Area A-25 does not require transition through Fire Area A-1. Fire Area A-1 is within the normal travel path for obtaining access to the Auxiliary Building. However, OFN KC-016 identifies that the exit from the Control Room through CAS Room 3609 and into 2047' of the Auxiliary Building may be utilized since normal access could be affected by the fire event. This is an improved travel path versus A-1 access, as fewer stairwell elevations are required to be traversed. The demonstration timing conducted from the Work Controls Center (3613) effectively bounds travel time utilizing the alternative access means. The travel path and location of the equipment requiring manipulation are physically separated from the fire by rated fire barriers. The smoke propagation review documented in Section 5.1.6 determined that the described OMA implementation would not be impeded by smoke migration from the fire event.

Emergency lighting is provided for illumination of potential egress paths and the component requiring OMA manipulation. Normal radiation, temperature, and humidity conditions within the area of concern will not be adversely affected by the fire and subsequent spurious equipment operation.

There are no physical impediments in proximity to the manual action component that would significantly delay or prevent required manipulation. No special equipment, related to environmental condition, is necessary for performance of the OMA.

8.1.7 Equipment Functionality and Accessibility

No equipment support functions are required for successful manual action implementation. The OMA component is physically separated from the fire event by several fire rated barriers. This ensures that the credited equipment is not adversely affected by the fire and its effects.

The operator responsible for OFN KC-016 OMAs carries a master key that can be used to open electronically controlled doors in the event that the fire has negatively affected the normal card key access means. All electronically controlled doors are provided with this secondary access arrangement. This ensures that the postulated fire will not prevent egress through doors provided with electronic access control.

8.1.8 Available Indications

Point addressable smoke detection is provided for the fire area. Upon detector activation, main fire alarm panel KC-008, located in the Control Room, will annunciate a fire alarm condition with a descriptive location of the detector in alarm. This will likely be the first indication of a fire event within the cable chase.

To diagnose a failure of BGLCV0459 and BGLCV0460 to close, valve position indication or appropriate level indication needs to be available. The following instrumentation is unaffected by the fire and is available to assist Control Room diagnosis of BGLCV0459 and BGLCV0460 failure to close:

- Pressurizer level indicators BBLI0459A and BBLI0460A.
- VCT level indicators BGLI0112 and BGLI0185.

8.1.9 <u>Communications</u>

A fire in this area could affect the Gaitronics and 900 MHz radio systems. This OMA does not require constant communication with the Control Room. As previously discussed, the operator assigned OFN KC-016 OMA duty will report to the Control Room for instruction following fire brigade callout. This approach allows the Control Room operators to provide face-to-face direction for the OMA. Once the OMA has been implemented, the operator can physically report back to the Control Room if the Gaitronics or radio system functionality are affected by the fire.

8.1.10 <u>Portable Equipment</u>

KAV0201 is located approximately 10' above the floor. Access to a portable ladder for OMA implementation is available. No other portable equipment or tools, beyond those required to be carried by the designated OMA operator, are necessary to perform the specified OMA. Key access may be necessary for electronic card reader controlled doors if the fire affects electronic door control. As previously identified, the OFN KC-016 OMA designated operator is required to carry master key.

8.1.11 Personnel Protection Equipment

No other personnel protective equipment, beyond that normally necessary for Auxiliary Building access, is required to perform the OMA.

8.1.12 Procedures and Training

The OMA is identified in OFN KC-016. See Section 5.1.12 for further discussion addressing the fire response procedure.

8.1.13 Staffing

The operator assigned OFN KC-016 OMA duty for the shift is responsible for performing the OMA. Only one person is required to perform the OMA.

8.1.14 <u>Demonstrations</u>

The OMA was timed using multiple operators, each starting from the Work Control Center (3613) on the 2047' elevation of the Communications Corridor. The timing effort reflected that the OMA could be consistently performed within nine (9) minutes. This included time to obtain a ladder to reach KAV0201. The three (3) minute delay for BGLCV0459 and BGLCV0460 closure following the isolation of instrument air is also factored into the overall OMA implementation time. This results in a cumulative OMA implementation time of twelve (12) minutes. In addition, the following uncertainty times have been included, resulting in a total uncertainty time of twelve (12) minutes.

- Communication and feedback with Control Room 1 minute
- Electronically controlled door key access 3 minutes
- Obtain RCA access 2 minutes
- Human centered uncertainty 3 minutes
- Delay in obtaining and setting up ladder 3 minutes

8.1.15 Defense-In-Depth

1. Fire Prevention

The objective of fire prevention is not affected by the OMA. The area of the plant where the fire could occur, necessitating OMA implementation, has combustible loading allowances and hot work limitations that are consistent with other plant areas important to safety.

2. Detect, Control, and Extinguish Fires

This objective is not affected by the OMA. Smoke detection is provided for the majority of Fire Area A-1, including the areas where the PFSSD circuits of concern are routed. A preaction sprinkler system is located in areas with high concentration of cable trays. Fire alarm annunciation is provided locally, and within the Control Room. Smoke detection is point addressable, allowing for prompt recognition of fire location. The preaction sprinkler system will aid in controlling the fire event until manual suppression can be applied, as necessary. Fire extinguishers and hose stations are provided in the area for manual fire fighting.

3. Protection of SSCs so that Fires Will Not Prevent Safe Shutdown

Historically, this objective has been deterministically satisfied by conforming to the requirements of 10 CFR 50 Appendix R, Sections III.G.1 or III.G.2. The subject OMA is utilized in lieu of III.G.2 protection to ensure a fire in A-1 does not challenge PFSSD.

8.1.16 <u>Conclusion</u>

The above analysis and time-authenticated demonstrations provide reasonable assurance that the OMA for Fire Area A-1 is dependable, reliable, and can be consistently performed within the required Available Time. A one hundred forty one (141) minute time margin remains, when applying uncertainty elements to ensure OMA reliability. Post-fire safe shutdown capability is maintained with no adverse reactor thermal performance. Therefore, the OMA is considered both feasible and reliable.

8.2 Fire Area A-11, Auxiliary Building 2000' Cable Chase

8.2.1 Fire Area Features

Fire Area A-11 is a single room (1335) cable chase located on the 2000' elevation of the Auxiliary Building within the North Pipe Penetration Room. The chase contains cable and normal room lighting only. It is separated from adjacent areas by 3-hour fire rated barriers. Smoke detection and wet pipe sprinkler protection are provided for the area. No natural or forced ventilation is provided for the fire area. General access to the cable chase is restricted by a normally locked fire door.

8.2.2 Spurious Equipment Operation Requiring Operator Manual Action

Cables associated with letdown isolation valves BGLCV0459 and BGLCV0460 may be damaged, preventing these valves from being closed from the Control Room. PFSSD requires one of these valves to be closed to ensure adequate charging flow.

This spurious equipment operation is Important to Safe Shutdown, as letdown is not required for PFSSD. However, letdown isolation is required to prevent RCS flow diversion. This event is a multiple spurious equipment operation from a PFSSD perspective, as the fire-induced maloperation involves two series valves in the chemical and volume control system.

8.2.3 Operator Manual Action Description

Valves BGLCV0459 and BGLCV0460 can be isolated by closing instrument air supply valve KAV0201 located in the South Pipe Penetration Room on the 2000' elevation of the Auxiliary Building (Reference Attachment C, Photo C-1). This removes air to BGLCV0459, BGLCV0460, and all air operated components within the Reactor Building. Historical performance of STS KJ-001A, which isolates instrument air to the Reactor Building, reveals that BGLCV0459 and BGLCV0460 will fail closed within three (3) minutes following isolation of instrument air. This is a Reactive OMA.

8.2.4 Feasibility Analysis of Time Available to Perform Manual Actions

Figure 8.2.4-1 reflects the OMA timeline for closing BGLCV0459 and BGLCV0460. The identified times are based on the following:

Fire Initiated - This is the initiating event, which occurs at time zero.

Fire Indicated – A six (6) minute detection response time is utilized based on the Attachment B1 application of NUREG-1805 for smoke detector response. However, A-11 contains only one smoke detector within the cable chase. Therefore, physical confirmation of the fire event is necessary. This confirmation is postulated to take up to five (5) minutes following receipt of the initial fire alarm indication in the Control Room. This increases the total fire detected time to eleven (11) minutes.

Diagnosis Time – A seven (7) minute diagnosis time is utilized based on Section 5.1.14.1.

OMA Implementation Time – A twelve (12) minute operator action time is utilized based on the demonstrated OMA walkdown time documented in Section 8.2.14.

OMA Uncertainty Time – A twelve (12) minute OMA uncertainty time is utilized based on Section 8.2.14.

Available Time – Thermal hydraulic analysis WCNOC-CP-002 identifies that when letdown is the only flow diversion event, it can remain open for one hundred eighty (180) minutes without adverse consequence to reactor performance.

Time Margin – The time margin for OMA performance is one hundred thirty eight (138) minutes.

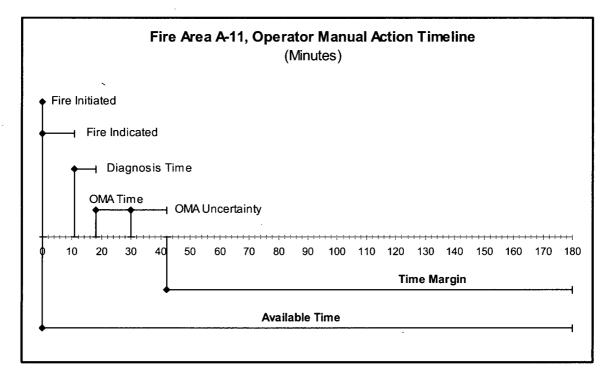


Figure 8.2.4-1, Fire Area A-11 OMA Timeline

8.2.5 Reliability Analysis of Time Available to Perform Manual Actions

As discussed in Section 5.1.5, an OMA is considered reliable provided that a Time Margin remains when applying Fire Indicated Time, Diagnosis Time, OMA Implementation Time, and OMA Uncertainty Time, within the OMA event timeline. The OMA Timeline for Fire Area A-11 reveals that a one hundred thirty eight (138) minute time margin remains. Application of the uncertainty time provides reasonable assurance that the OMA is dependable, reliable, and can be performed with a high rate of success.

8.2.6 Environmental Factors

Habitable environmental conditions will be present for performance of the OMA. The postulated fire event is within Cable Chase 1335 located on the 2000' elevation of the Auxiliary Building, within the North Pipe Penetration Room. The fire will be confined to the Fire Area A-11 Cable Chase of origin, which contains no ventilation openings. The travel path and location of the equipment requiring manipulation are physically separated from the fire by multiple fire rated barriers, ensuring that smoke propagation and fire fighting activities will not present an egress impediment.

Emergency lighting is provided for illumination of potential egress paths and the component requiring OMA manipulation. Normal radiation, temperature, and humidity conditions within the area of concern will not be adversely affected by the fire and subsequent spurious equipment operation.

There are no physical impediments in proximity to the manual action component that would significantly delay or prevent required manipulation. No special equipment, related to environmental condition, is necessary for performance of the OMA.

8.2.7 Equipment Functionality and Accessibility

No equipment support functions are required for successful manual action implementation. The OMA component is physically separated from the fire event by several fire rated barriers. This ensures that the credited equipment is not adversely affected by the fire and its effects.

The operator responsible for OFN KC-016 OMAs carries a master key that can be used to open electronically controlled doors in the event that the fire has negatively affected the normal card key access means. All electronically controlled doors are provided with this secondary access arrangement. This ensures that the postulated fire will not prevent egress through doors provided with electronic access control.

8.2.8 <u>Available Indications</u>

Point addressable smoke detection is provided for Cable Chase 1335. Upon detector activation, main fire alarm panel KC-008, located in the Control Room, will annunciate a fire alarm condition with a descriptive location of the detector in alarm. This will likely be the first indication of a fire event within the cable chase.

To diagnose a failure of BGLCV0459 and BGLCV0460 to close, valve position indication or appropriate level indication needs to be available. The following instrumentation is unaffected by the fire and is available to assist Control Room diagnosis of BGLCV0459 and BGLCV0460 failure to close:

• Pressurizer level indicator BBLI0460A.

VCT level indicators BGLI0112 and BGLI0185.

8.2.9 <u>Communications</u>

A fire in this area could affect the Gaitronics system. The 900 MHz radio communication system is unaffected by the fire. The OMA does not require constant communication with the Control Room. After initially reporting to the Control Room, the operator will receive face-to-face direction regarding OMA implementation. The operator may then use the radio system as necessary, or report directly back to the Control Room for further instruction.

8.2.10 Portable Equipment

KAV0201 is located approximately 10' above the floor. Access to a portable ladder for OMA implementation is available. No other portable equipment or tools, beyond those required to be carried by the designated OMA operator, are necessary to perform the specified OMA. Key access may be necessary for electronic card reader controlled doors if the fire affects electronic door control. As previously identified, the OFN KC-016 OMA designated operator is required to carry a master key.

8.2.11 Personnel Protection Equipment

No other personnel protective equipment, beyond that normally necessary for Auxiliary Building access, is required to perform the OMA.

8.2.12 <u>Procedures and Training</u>

The OMA is identified in OFN KC-016. See Section 5.1.12 for further discussion addressing the fire response procedure.

8.2.13 Staffing

The operator assigned OFN KC-016 OMA duty for the shift is responsible for performing the OMA. Only one person is required to perform the OMA.

8.2.14 Demonstrations

The OMA was timed using multiple operators, each starting from the Work Control Center (3613) on the 2047' elevation of the Communications Corridor. The timing effort reflected that the OMA could be consistently performed within nine (9) minutes. This included time to obtain a ladder to reach KAV0201. The three (3) minute delay for BGLCV0459 and BGLCV0460 closure following the isolation of instrument air is also factored into the overall OMA implementation time. This results in a cumulative OMA implementation time of twelve (12) minutes. In addition, the following uncertainty times have been included, resulting in a total uncertainty time of twelve (12) minutes.

Communication and feedback with Control Room – 1 minute

- Electronically controlled door key access 3 minutes
- Obtain RCA access 2 minutes
- Human centered uncertainty 3 minutes
- Delay in obtaining and setting up ladder 3 minutes

8.2.15 Defense-In-Depth

1. Fire Prevention

The objective of fire prevention is not affected by the OMA. The area of the plant where the fire could occur, necessitating OMA implementation, has combustible loading allowances and hot work limitations that are consistent with other plant areas important to safety. Additionally, the cable chase is normally locked, which prevents general access to the area.

2. Detect, Control, and Extinguish Fires

This objective is not affected by the OMA. Smoke detection and wet pipe sprinkler protection are provided for the area. Fire alarm annunciation is provided locally, and within the Control Room. Smoke detection is point addressable, allowing for prompt recognition of fire location. The sprinkler system will aid in controlling the fire event until manual suppression can be applied, as necessary. Fire extinguishers and hose stations are provided in the general area for manual fire fighting.

3. Protection of SSCs so that Fires Will Not Prevent Safe Shutdown

Historically, this objective has been deterministically satisfied by conforming to the requirements of 10 CFR 50 Appendix R, Sections III.G.1 or III.G.2. The subject OMA is utilized in lieu of III.G.2 protection to ensure a fire in A-11 does not challenge PFSSD.

8.2.16 <u>Conclusion</u>

The above analysis and time-authenticated demonstrations provide reasonable assurance that the OMA for Fire Area A-11 is dependable, reliable, and can be consistently performed within the required Available Time. A one hundred thirty eight (138) minute time margin remains, when applying uncertainty elements to ensure OMA reliability. Post-fire safe shutdown capability is maintained with no adverse reactor thermal performance. Therefore, the OMA is considered both feasible and reliable.

8.3 Fire Area A-16, Auxiliary Building 2026' General Corridor

8.3.1 Fire Area Features

Fire Area A-16 is the general corridor area on the 2026' elevation of the Auxiliary Building. It is effectively separated into two areas (A-16N and A-16S) by a 10 CFR 50 Appendix R, III.G.2.b, 20' combustible control zone. The fire area is separated from adjacent areas by 3-hour fire rated barriers. Smoke detection is provided, and a preaction sprinkler system is located in areas with a high concentration of cable trays.

8.3.2 Spurious Equipment Operation Requiring Operator Manual Action

In A-16N, cables associated with steam generator atmospheric relief valves (ARV) ABPV0002 (steam generator 'B'), ABPV0003 (steam generator 'C'), and ABPV0004 (steam generator 'D') may be damaged, preventing control of theses valves from the Control Room. Additionally, auxiliary feedwater for steam generators 'A' and 'D' could be affected by a fire in this area.

This is an Important to Safe Shutdown spurious equipment operation, as Thermal Hydraulic Analysis WCNOC-CP-002 determined that hot standby conditions could be maintained with no action taken to close three spuriously open ARVs. Additionally, WCNOC-CP-002 determined that, for three spuriously failed closed ARVs, hot standby could be maintained via steam released through the steam generator safety valves. However, use of the safety valves is not the operational preferred method for maintaining post-fire hot standby. Therefore, it was conservatively concluded that a feasibility and reliability analysis would be completed for the A-16 actions addressing fire induced ARV maloperation. This event is a multiple spurious equipment operation from a PFSSD perspective, as the fire induced maloperation involves multiple steam release paths from the main steam system.

8.3.3 Operator Manual Action Description

Steam generator ARV ABPV0002 can be controlled/isolated by manipulation of ABFHC0002. Steam generator ARV ABPV0003 can be controlled/isolated by manipulation of ABFHC0003. These components are located at local control stations in Fire Area A-23 on the 2037'-7" elevation of the Auxiliary Building (Reference Attachment C, Photos C-2 and C-3).

Steam generator ARV ABPV0004 can be isolated by closing air supply valve KAV1429 and nitrogen supply valve KAV1365, and then bleeding air from the regulator. The air and nitrogen supply valves and regulator are also located in Fire Area A-23, on the 2037'-7" elevation of the Auxiliary Building (Reference Attachment C, Photos C-4 through C-6).

Based on thermal hydraulic analysis (Reference 7.28 and 7.30), the operator can close ABPV0004 and either ABPV0002 or ABPV0003 and leave either ABPV0002 or ABPV0003 full open. The operator will report

back to the Control Room for further instructions. The initial OMA response will be a Reactive Action.

8.3.4 Feasibility Analysis of Time Available to Perform Manual Actions

Figure 8.3.4-1 reflects the OMA timeline in response to ARV ABPV0002 ABPV0003, and ABPV0004 maloperation. The identified times are based on the following:

Fire Initiated - This is the initiating event, which occurs at time zero.

Fire Indicated – A four (4) minute detection response time is utilized based on the Attachment B1 application of NUREG-1805 for smoke detector response. Area detection is provided for Fire Area A-16. Therefore, multiple detection alarms would be initiated for a fire event warranting OMA response action.

Diagnosis Time – A seven (7) minute diagnosis time is utilized, based on Section 5.1.14.1.

OMA Implementation Time – A cumulative twenty seven (27) minute operator implementation time for performing the three OMAs is utilized, based on the demonstrated OMA walkdown time documented in Section 8.3.14.

OMA Uncertainty Time – A twenty six (26) minute OMA uncertainty time is utilized based on Section 8.3.14.

Available Time – Thermal hydraulic analysis AN-96-062 identifies that RHR entry conditions can be achieved in 94 hours after reactor trip if a single steam generator ARV is used and; if a second ARV is placed in service in 60 hours, RHR entry conditions can be achieved in 61 hours. Furthermore, if either ARV ABPV0002 or ABPV0003 is left in the full open position with all remaining ARVs closed, cool down can be controlled from the Control Room by adjusting auxiliary feedwater flow to the associated steam generator with an open ARV. This approach is also supported by thermal hydraulic analysis WCNOC-CP-002, which identifies that three ARVs can remain spuriously open or closed for at least 200 minutes without adverse consequence to reactor performance.

Time Margin – The time margin for OMA performance is one hundred thirty six (136) minutes.

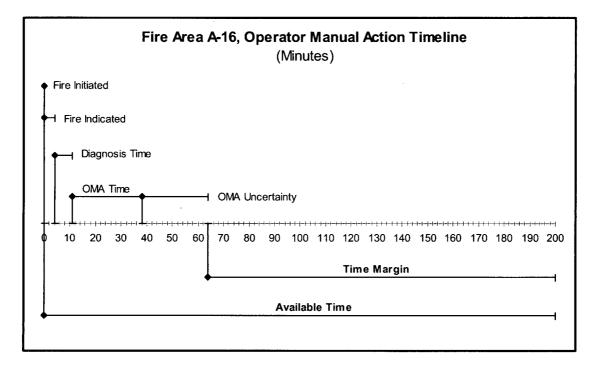


Figure 8.3.4-1, Fire Area A-16 OMA Timeline

8.3.5 Reliability Analysis of Time Available to Perform Manual Actions

As discussed in Section 5.1.5, an OMA is considered reliable provided that a Time Margin remains when applying Fire Indicated Time, Diagnosis Time, OMA Implementation Time, and OMA Uncertainty Time, within the OMA event timeline. The OMA Timeline for Fire Area A-16 reveals that a one hundred thirty six (136) minute time margin remains. Application of the uncertainty time, provides reasonable assurance that the OMAs are dependable, reliable, and can be performed with a high rate of success.

8.3.6 Environmental Factors

Habitable environmental conditions will be present for performance of the OMAs. The postulated fire event is within the general corridor area of the Auxiliary Building 2026' elevation. The location of the OMAs is within the Main Steam Enclosure on the 2037'-7" elevation of the Auxiliary Building (Fire Area A-23). Based on fire barrier separation, the fire will be confined to Fire Area A-16. Access to Fire Area A-23 does not require transition through Fire Area A-16. The travel path and location of the equipment requiring manipulation are physically separated from the fire by rated fire barriers. The smoke propagation review documented in Section 5.1.6 determined that the described OMA implementation would not be impeded by smoke migration from the fire event.

Emergency lighting is provided for illumination of potential egress paths, and the components requiring OMA manipulation. Normal radiation conditions within the areas of concern will not be adversely affected by the fire and subsequent spurious equipment operation.

Temperature and humidity conditions within the Main Steam Enclosure will be elevated in the proximity of a spuriously open ARV. Historically, Operations has successfully isolated an ARV by closing its respective local isolation valve, which requires closer, long-term proximity to the ARV discharge line than the prescribed OMA. This historical success demonstrates that the environment within the Main Steam Enclosure will remain tenable regarding local temperature and humidity exposure during the prescribed OMA implementation. Additionally, the discharge piping in the area where the OMA is performed is insulated, which protects against contact exposure with the hot piping.

There are no physical impediments in proximity to the manual action components that would significantly delay or prevent required manipulation. No special equipment, related to environmental condition, is necessary for performance of the OMAs.

8.3.7 Equipment Functionality and Accessibility

The components requiring manipulation for ARV control/isolation are mechanical. No equipment support functions are required for successful manual action implementation. Each is readily accessible for manipulation. These components are physically separated from the fire event by fire rated barriers. This ensures that the credited equipment is not adversely affected by the fire and its effects.

The operator responsible for OFN KC-016 OMAs carries a master key that can be used to open electronically controlled doors in the event that the fire has negatively affected the normal card key access means. All electronically controlled doors are provided with this secondary access arrangement. This ensures that the postulated fire will not prevent egress through doors provided with electronic access control. Key access is also required for the enclosure housing ARV controllers ABFHC0002 and ABFHC0003. The OFN KC-016 OMA operator also carries this key.

8.3.8 Available Indications

Point addressable smoke detection is provided for Fire Area A-16. Upon detector activation, main fire alarm panel KC-008, located in the Control Room, will annunciate a fire alarm condition with a descriptive location of the detector in alarm. This will likely be the first indication of a fire event within the area.

To diagnose the spurious opening of an ARV, valve position indication or appropriate pressure instrumentation needs to be available. The following instrumentation is unaffected by the fire and is available to assist Control Room diagnosis of spurious opening of an ARV:

- ABPV0002 Steam Generator 'B' pressure indication on ABPI524A
- ABPV0003 Steam Generator 'C' pressure indication on ABPI534A

 ABPV0004 - Steam Generator 'D' pressure indication on ABPI544A

8.3.9 <u>Communications</u>

A fire in this area could affect the Gaitronics and 900 MHz radio systems. As previously discussed, the operator assigned OFN KC-016 OMA duty will report to the Control Room for instruction following fire brigade callout. This approach allows the Control Room operators to provide face-to-face direction for the OMAs. OMA implementation approach provided in OFN KC-016 is based on availability of communication. If the fire affects communication, OFN KC-016 guidance will be followed to close ABPV0002 and open ABPV0003 and then physically report to the Control Room for further direction. The limiting scenario, reflected by the Figure 8.3.4-1 timeline is that the fire affects communication.

8.3.10 Portable Equipment

No portable equipment or tools, beyond those required to be carried by the designated OMA operator, are necessary to perform the specified OMAs. Key access may be necessary for electronic card reader controlled doors if the fire affects electronic door control. Wire cutters will be necessary to remove the lock tabs from the components to be manipulated for ARV ABPV0004 isolation. As previously identified, the OFN KC-016 OMA designated operator is required to carry a master key and wire cutters. Key access is also required for the enclosures housing ARV controllers ABFHC0002 and ABFHC0003. The OFN KC-016 OMA operator also carries this key.

8.3.11 <u>Personnel Protection Equipment</u>

No other personnel protective equipment, beyond that normally necessary for Auxiliary Building access, is required to perform the OMA.

8.3.12 Procedures and Training

The OMAs are identified in OFN KC-016. Procedure direction is based on availability of communications. If communication is not affected by the fire, the direction for the ARVs, with a protected auxiliary feedwater source, is to close ABPV0002 and throttle open ABPV0003 per Control Room direction. If the fire affects communication, the direction is to close ABPV0002, open ABPV0003, and physically report back to the Control Room for further direction. See Section 5.1.12 for further discussion addressing the fire response procedure.

8.3.13 Staffing

The operator assigned OFN KC-016 OMA duty for the shift is responsible for performing the OMAs. Only one person is required to perform the OMAs.

8.3.14 Demonstrations

The OMAs were timed using multiple operators, each starting from the Work Control Center (3613) on the 2047' elevation of the Communications Corridor. Each of the three OMAs were conservatively timed as independently originating from Room 3613 in recognition that radio and Gaitronics communication capability could be affected by the fire. The timing effort reflected that each OMA could be implemented in nine (9) minutes, for a cumulative OMA total of twenty-seven (27) minutes.

Once initial ARV control/isolation is established, PFSSD OMA capability is adequately demonstrated. Operations can continue to transition between the Main Steam Enclosure and the Control Room to affect ARV position change throughout the event course, or steam generator feedwater can be throttled from the Control Room to control decay heat removal. Based on the diversity of available decay heat removal options, timing considerations were that each ARV maloperation would have to be visited once for OMA implementation.

In addition, the following uncertainty times have been included, resulting in a total uncertainty time of twenty-six (26) minutes.

- Communication and feedback with Control Room for OMAs 3 minutes
- Electronically controlled door key access 3 minutes
- Obtain RCA access 2 minutes
- Transition to Control Room from Fire Area A-23 after OMA implementation (three trips at 5 minutes per trip) – 15 minutes
- Human centered uncertainty 3 minutes

8.3.15 <u>Defense-In-Depth</u>

1. Fire Prevention

The objective of fire prevention is not affected by the OMA. The area of the plant where the fire could occur, necessitating OMA implementation, has combustible loading allowances and hot work limitations that are consistent with other plant areas important to safety. A 10 CFR 50 Appendix R, 20' combustible control zone is provided for separation of redundant component cooling water components.

2. Detect, Control, and Extinguish Fires

This objective is not affected by the OMA. Smoke detection is provided for the area. A preaction sprinkler system is located in areas with high concentration of cable trays. Fire alarm annunciation is provided locally, and within the Control Room. Smoke detection is point addressable, allowing for prompt

recognition of fire location. The preaction sprinkler system will aid in controlling the fire event until manual suppression can be applied, as necessary. Fire extinguishers and hose stations are provided in the area for manual fire fighting.

3. Protection of SSCs so that Fires Will Not Prevent Safe Shutdown

Historically, this objective has been deterministically satisfied by conforming to the requirements of 10 CFR 50 Appendix R, Sections III.G.1 or III.G.2. The subject OMAs are utilized in lieu of III.G.2 protection to ensure a fire in A-16 does not challenge PFSSD.

8.3.16 Conclusion

The above analysis and time-authenticated demonstrations provide reasonable assurance that the OMAs for Fire Area A-16 are dependable, reliable, and can be consistently performed within the required Available Time. A one hundred thirty six (136) minute time margin remains, when applying uncertainty elements to ensure OMA reliability. Therefore, the OMAs are considered both feasible and reliable. Considering that WCNOC-CP-002 demonstrates that the maloperation of three ARVs does not require outside Control Room action to achieve and maintain post-fire hot standby, the feasibility and reliability analysis for A-16 provides an added defense in depth approach to ensure post-fire safe shutdown capability is maintained with no adverse reactor thermal performance.

8.4 Fire Area A-18, Auxiliary Building 2026' North Electrical Penetration Room

8.4.1 Fire Area Features

Fire Area A-18 is the North Electrical Penetration Room (1410) on the 2026' elevation of the Auxiliary Building. The fire area is separated from adjacent areas by 3-hour fire rated barriers. Cross-zoned smoke detection is provided, which actuates a total flooding halon system for the room. A wet pipe sprinkler system is provided for the open cable chase in the northwest corner of the room.

8.4.2 Spurious Equipment Operation Requiring Operator Manual Action

Cables associated with letdown isolation valves BGLCV0459 and BGLCV0460 may be damaged, preventing these valves from being closed from the Control Room. PFSSD requires one of these valves to be closed to ensure adequate charging flow.

This spurious equipment operation is Important to Safe Shutdown, as letdown is not required for PFSSD. However, letdown isolation is required to prevent RCS flow diversion. This event is a multiple spurious equipment operation from a PFSSD perspective, as the fire-induced maloperation involves two series valves in the chemical and volume control system.

Atmospheric relief valve (ARV) ABPV0002 could spuriously open as a result of an A-18 fire. Thermal hydraulic analysis WCNOC-CP-002 determined that no operator action is required to achieve and maintain hot standby with a spuriously open ARV. However, the thermal hydraulic analysis determined that a spuriously open ARV concurrent with letdown does affect the available time for isolating letdown.

8.4.3 Operator Manual Action Description

Valves BGLCV0459 and BGLCV0460 can be isolated by closing instrument air supply valve KAV0201 located in the South Pipe Penetration Room on the 2000' elevation of the Auxiliary Building (Reference Attachment C, Photo C-1). This removes air to BGLCV0459, BGLCV0460, and all air operated components within the Reactor Building. Historical performance of STS KJ-001A, which isolates instrument air to the Reactor Building, reveals that BGLCV0459 and BGLCV0460 will fail closed within three (3) minutes following isolation of instrument air. This is a Reactive OMA.

8.4.4 Feasibility Analysis of Time Available to Perform Manual Actions

Figure 8.4.4-1 reflects the OMA timeline for closing BGLCV0459 and BGLCV0460. The identified times are based on the following:

Fire Initiated - This is the initiating event, which occurs at time zero.

Fire Indicated – A four (4) minute detection response time is utilized based on the Attachment B1 application of NUREG-1805 for smoke detector response. Area smoke detection is provided. Therefore, multiple detection alarms would be initiated for a fire event warranting OMA response action.

Diagnosis Time – A seven (7) minute diagnosis time is utilized based on Section 5.1.14.1.

OMA Implementation Time – A twelve (12) minute operator action time is utilized based on the demonstrated OMA walkdown time documented in Section 8.4.14.

OMA Uncertainty Time – A twelve (12) minute OMA uncertainty time is utilized based on Section 8.4.14.

Available Time – Thermal hydraulic analysis WCNOC-CP-002 identifies when letdown is open, concurrent with spuriously open atmospheric relief valve related cooling, letdown can remain open for fifty (50) minutes, without adverse consequence to reactor performance.

Time Margin – The limiting time margin for OMA performance is fifteen (15) minutes.

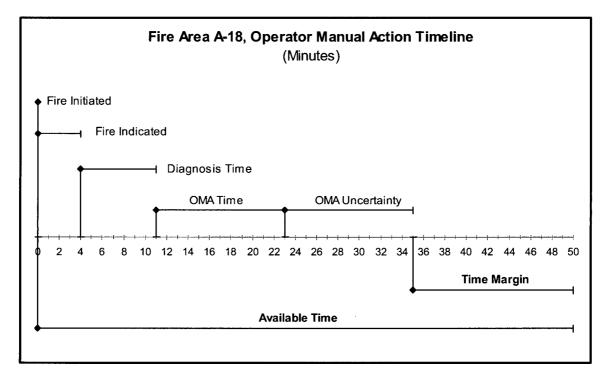


Figure 8.4.4-1, Fire Area A-18 OMA Timeline

8.4.5 Reliability Analysis of Time Available to Perform Manual Actions

As discussed in Section 5.1.5, an OMA is considered reliable provided that a Time Margin remains when applying Fire Indicated Time, Diagnosis Time, OMA Implementation Time, and OMA Uncertainty Time, within the OMA event timeline. The OMA Timeline for Fire Area A-18 reveals that a fifteen (15) minute time margin remains. Application of the uncertainty time provides reasonable assurance that the OMA is dependable, reliable, and can be performed with a high rate of success.

8.4.6 Environmental Factors

Habitable environmental conditions will be present for performance of the OMA. The postulated fire event is within the North Electrical Penetration Room on the 2026' elevation of the Auxiliary Building. The location of the OMA is within the South Pipe Penetration Room on the 2000' elevation of the Auxiliary Building (Fire Area A-25). Based on fire barrier separation, the fire will be confined to Fire Area A-18. Access to Fire Area A-25 does not require transition through Fire Area A-18. The travel path and location of the equipment requiring manipulation are physically separated from the fire by rated fire barriers. The smoke propagation review documented in Section 5.1.6 determined that the described OMA implementation would not be impeded by smoke migration from the fire event.

Emergency lighting is provided for illumination of potential egress paths and the component requiring OMA manipulation. Normal radiation, temperature, and humidity conditions within the area of concern will not be adversely affected by the fire and subsequent spurious equipment operation.

There are no physical impediments in proximity to the manual action component that would significantly delay or prevent required manipulation. No special equipment, related to environmental condition, is necessary for performance of the OMA.

8.4.7 Equipment Functionality and Accessibility

No equipment support functions are required for successful manual action implementation. The OMA component is physically separated from the fire event by several fire rated barriers. This ensures that the credited equipment is not adversely affected by the fire and its effects.

The operator responsible for OFN KC-016 OMAs carries a master key that can be used to open electronically controlled doors in the event that the fire has negatively affected the normal card key access means. All electronically controlled doors are provided with this secondary access arrangement. This ensures that the postulated fire will not prevent egress through doors provided with electronic access control.

8.4.8 Available Indications

Point addressable smoke detection is provided for the North Electrical Penetration Room. Upon detector activation, main fire alarm panel KC-008, located in the Control Room, will annunciate a fire alarm condition with a descriptive location of the detector in alarm. This will likely be the first indication of a fire event within the area.

To diagnose a failure of BGLCV0459 and BGLCV0460 to close, valve position indication or appropriate level indication needs to be available. The following instrumentation is unaffected by the fire and is available to assist Control Room diagnosis of BGLCV0459 and BGLCV0460 failure to close:

- Pressurizer level indicator BBLI0460A.
- VCT level indicators BGLI0185 and BGLI0112.

8.4.9 <u>Communications</u>

A fire in this area could affect the Gaitronics and 900 MHz radio systems. The OMA does not require constant communication with the Control Room. As previously discussed, the operator assigned OFN KC-016 OMA duty will report to the Control Room for instruction following fire brigade callout. This approach allows the Control Room operators to provide face-to-face direction for the OMA. Once the OMA has been implemented, the operator can physically report back to the Control Room if the Gaitronics or radio system functionality are affected by the fire.

8.4.10 Portable Equipment

KAV0201 is located approximately 10' above the floor. Access to a portable ladder for OMA implementation is available. No other portable equipment or tools, beyond those required to be carried by the designated OMA operator, are necessary to perform the specified OMA. Key access may be necessary for electronic card reader controlled doors if the fire affects electronic door control. As previously identified, the OFN KC-016 OMA designated operator is required to carry a master key.

8.4.11 <u>Personnel Protection Equipment</u>

No other personnel protective equipment, beyond that normally necessary for Auxiliary Building access, is required to perform the OMA.

8.4.12 Procedures and Training

The OMA is identified in OFN KC-016. See Section 5.1.12 for further discussion addressing the fire response procedure.

8.4.13 Staffing

The operator assigned OFN KC-016 OMA duty for the shift is responsible for performing the OMA. Only one person is required to perform the OMA.

8.4.14 <u>Demonstrations</u>

The OMA was timed using multiple operators, each starting from the Work Control Center (3613) on the 2047' elevation of the Communications Corridor. The timing effort reflected that the OMA could be consistently performed within nine (9) minutes. This included time to obtain a ladder to reach KAV0201. The three (3) minute delay for BGLCV0459 and BGLCV0460 closure following the isolation of instrument air is also factored into the overall OMA implementation time. This results in a cumulative OMA implementation time of twelve (12) minutes. In addition, the following uncertainty times have been included, resulting in a total uncertainty time of twelve (12) minutes.

- Communication and feedback with Control Room 1 minute
- Electronically controlled door key access 3 minutes
- Obtain RCA access 2 minutes
- Human centered uncertainty 3 minutes
- Delay in obtaining and setting up ladder 3 minutes

8.4.15 Defense-In-Depth

1. Fire Prevention

The objective of fire prevention is not affected by the OMAs. The area of the plant where the fire could occur, necessitating OMA implementation, has combustible loading allowances and hot work limitations that are consistent with other plant areas important to safety.

2. Detect, Control, and Extinguish Fires

This objective is not affected by the OMAs. Smoke detection and a total flooding halon system are provided for the area. Fire alarm annunciation is provided locally, and within the Control Room. Smoke detection is point addressable, allowing for prompt recognition of fire location. The sprinkler protection for the open cable chase and the general area halon protection will aid in controlling the fire event until manual suppression can be applied, as necessary. Fire extinguishers and hose stations are provided adjacent to the area for manual fire fighting.

3. Protection of SSCs so that Fires Will Not Prevent Safe Shutdown

Historically, this objective has been deterministically satisfied by conforming to the requirements of 10 CFR 50 Appendix R, Sections III.G.1 or III.G.2. The subject OMA is utilized in lieu of III.G.2 protection to ensure a fire in A-18 does not challenge PFSSD.

8.4.16 <u>Conclusion</u>

The above analysis and time-authenticated demonstrations provide reasonable assurance that the OMA for Fire Area A-18 is dependable, reliable, and can be consistently performed within the required Available Time. A fifteen (15) minute time margin remains when applying uncertainty elements to ensure OMA reliability. Post-fire safe shutdown capability is maintained with no adverse reactor thermal performance. Therefore, the OMA is considered both feasible and reliable.

8.5 Fire Area C-7, Control Building 1984' Cable Chase

8.5.1 <u>Fire Area Features</u>

Fire Area C-7 is a single room (3230) cable chase located on the 1984' elevation of the Control Building. The chase contains cable and normal room lighting only. It is separated from adjacent areas by 3-hour fire rated barriers. Smoke detection and wet pipe sprinkler protection are provided for the area. No natural or forced ventilation is provided for the fire area. General access to the cable chase is restricted by a normally locked fire door.

8.5.2 Spurious Equipment Operation Requiring Operator Manual Action

Cables associated with letdown isolation valves BGLCV0459 and BGLCV0460 may be damaged, preventing these valves from being closed from the Control Room. PFSSD requires one of these valves to be closed to ensure adequate charging flow.

This spurious equipment operation is Important to Safe Shutdown, as letdown is not required for PFSSD. However, letdown isolation is required to prevent RCS flow diversion. This event is a multiple spurious equipment operation from a PFSSD perspective, as the fire-induced maloperation involves two series valves in the chemical and volume control system.

8.5.3 Operator Manual Action Description

Valves BGLCV0459 and BGLCV0460 can be isolated by closing instrument air supply valve KAV0201 located in the South Pipe Penetration Room on the 2000' elevation of the Auxiliary Building (Reference Attachment C, Photo C-1). This removes air to BGLCV0459, BGLCV0460, and all air operated components within the Reactor Building. Historical performance of STS KJ-001A, which isolates instrument air to the Reactor Building, reveals that BGLCV0459 and BGLCV0460 will fail closed within three (3) minutes following isolation of instrument air. This is a Reactive OMA.

8.5.4 <u>Feasibility Analysis of Time Available to Perform Manual Actions</u>

Figure 8.5.4-1 reflects the OMA timeline for closing BGLCV0459 and BGLCV0460. The identified times are based on the following:

Fire Initiated - This is the initiating event, which occurs at time zero.

Fire Indicated – A one (1) minute detection response time is utilized based on the Attachment B1 application of NUREG-1805 for smoke detector response. However, C-7 contains only one smoke detector within the cable chase. Therefore, physical confirmation of the fire event is necessary. This confirmation is postulated to take up to five (5) minutes following receipt of the initial fire alarm indication in the Control Room. This increases the total fire detected time to six (6) minutes.

Diagnosis Time – A seven (7) minute diagnosis time is utilized based on Section 5.1.14.1.

OMA Implementation Time – A twelve (12) minute operator action time is utilized based on the demonstrated OMA walkdown time documented in Section 8.5.14.

OMA Uncertainty Time – A twelve (12) minute OMA uncertainty time is utilized based on Section 8.5.14.

Available Time – Thermal hydraulic analysis WCNOC-CP-002 identifies that when letdown is the only flow diversion event, it can remain open for one hundred eighty (180) minutes without adverse consequence to reactor performance.

Time Margin – The time margin for OMA performance is one hundred forty three (143) minutes.

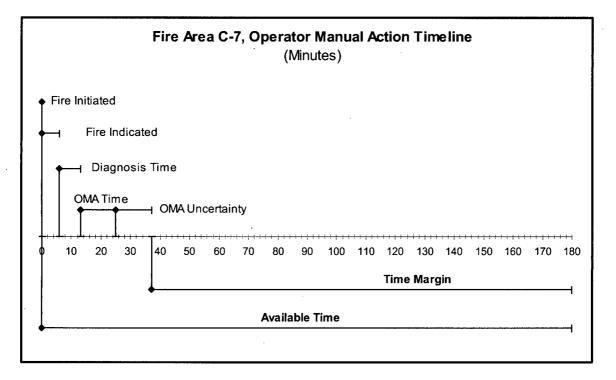


Figure 8.5.4-1, Fire Area C-7 OMA Timeline

8.5.5 Reliability Analysis of Time Available to Perform Manual Actions

As discussed in Section 5.1.5, an OMA is considered reliable provided that a Time Margin remains when applying Fire Indicated Time, Diagnosis Time, OMA Implementation Time, and OMA Uncertainty Time, within the OMA event timeline. The OMA Timeline for Fire Area C-7 reveals that a one hundred forty three (143) minute time margin remains. Application of the uncertainty time provides reasonable assurance that the OMA is dependable, reliable, and can be performed with a high rate of success.

8.5.6 <u>Environmental Factors</u>

Habitable environmental conditions will be present for performance of the OMA. The postulated fire event is within Cable Chase 3230 located on the 1984' elevation of the Control Building. The OMA is in an adjacent structure within the Auxiliary Building. The fire will be confined to the Fire Area C-7 Cable Chase of origin, which contains no ventilation openings. The travel path and location of the equipment requiring manipulation are physically separated from the fire by multiple fire rated barriers, ensuring that smoke propagation and fire fighting activities will not present an egress impediment. The cable chase door for C-7 opens into the normal travel path for obtaining access to the Auxiliary Building. However, OFN KC-016 identifies that the exit from the Control Room through CAS Room 3609 and into 2047' of the Auxiliary Building may be utilized since normal access could be affected by the fire event. This is an improved travel path versus Auxiliary Building access through Fire Area A-1, as fewer stairwell elevations are required to be traversed. The demonstration timing conducted from the Work Controls Center (3613) effectively bounds travel time utilizing the alternative access means.

Emergency lighting is provided for illumination of potential egress paths and the component requiring OMA manipulation. Normal radiation, temperature, and humidity conditions within the area of concern will not be adversely affected by the fire and subsequent spurious equipment operation.

There are no physical impediments in proximity to the manual action component that would significantly delay or prevent required manipulation. No special equipment, related to environmental condition, is necessary for performance of the OMA.

8.5.7 Equipment Functionality and Accessibility

No equipment support functions are required for successful manual action implementation. The OMA component is physically separated from the fire event by several fire rated barriers. This ensures that the credited equipment is not adversely affected by the fire and its effects.

The operator responsible for OFN KC-016 OMAs carries a master key that can be used to open electronically controlled doors in the event that the fire has negatively affected the normal card key access means. All electronically controlled doors are provided with this secondary access arrangement. This ensures that the postulated fire will not prevent egress through doors provided with electronic access control.

8.5.8 Available Indications

Point addressable smoke detection is provided for Cable Chase 3230. Upon detector activation, main fire alarm panel KC-008, located in the Control Room, will annunciate a fire alarm condition with a descriptive location of the detector in alarm. This will likely be the first indication of a fire event within the cable chase.

To diagnose a failure of BGLCV0459 and BGLCV0460 to close, valve position indication or appropriate level indication needs to be available. The following instrumentation is unaffected by the fire and is available to assist Control Room diagnosis of BGLCV0459 and BGLCV0460 failure to close:

- Pressurizer level indicators BBLI0459A and BBLI0460A.
- VCT level indicators BGLI0112 and BGLI0185.

8.5.9 <u>Communications</u>

A fire in this area could affect the Gaitronics and 900 MHz radio systems. This OMA does not require constant communication with the Control Room. As previously discussed, the operator assigned OFN KC-016 OMA duty will report to the Control Room for instruction following fire brigade callout. This approach allows the Control Room operators to provide face-to-face direction for the OMA. Once the OMA has been implemented, the operator can physically report back to the Control Room if the Gaitronics or radio system functionality are affected by the fire.

8.5.10 <u>Portable Equipment</u>

KAV0201 is located approximately 10' above the floor. Access to a portable ladder for OMA implementation is available. No other portable equipment or tools, beyond those required to be carried by the designated OMA operator, are necessary to perform the specified OMA. Key access may be necessary for electronic card reader controlled doors if the fire affects electronic door control. As previously identified, the OFN KC-016 OMA designated operator is required to carry a master key.

8.5.11 Personnel Protection Equipment

No other personnel protective equipment, beyond that normally necessary for Auxiliary Building access, is required to perform the OMA.

8.5.12 <u>Procedures and Training</u>

The OMA is identified in OFN KC-016. See Section 5.1.12 for further discussion addressing the fire response procedure.

8.5.13 Staffing

The operator assigned OFN KC-016 OMA duty for the shift is responsible for performing the OMA. Only one person is required to perform the OMA.

8.5.14 Demonstrations

The OMA was timed using multiple operators, each starting from the Work Control Center (3613) on the 2047' elevation of the Communications Corridor. The timing effort reflected that the OMA could be consistently performed within nine (9) minutes. This included time to obtain a ladder to reach KAV0201. The three (3) minute delay for BGLCV0459 and BGLCV0460 closure following the isolation of instrument air is also factored into the overall OMA implementation time. This results in a cumulative OMA implementation time of twelve (12) minutes. In addition, the following uncertainty times have been included, resulting in a total uncertainty time of twelve (12) minutes.

- Communication and feedback with Control Room 1 minute
- Electronically controlled door key access 3 minutes
- Obtain RCA access 2 minutes
- Human centered uncertainty 3 minutes
- Delay in obtaining and setting up ladder 3 minutes

8.5.15 Defense-In-Depth

1. Fire Prevention

The objective of fire prevention is not affected by the OMA. The area of the plant where the fire could occur, necessitating OMA implementation, has combustible loading allowances and hot work limitations that are consistent with other plant areas important to safety. Additionally, the cable chase is normally locked, which prevents general access to the area.

2. Detect, Control, and Extinguish Fires

This objective is not affected by the OMA. Smoke detection and wet pipe sprinkler protection are provided for the area. Fire alarm annunciation is provided locally, and within the Control Room. Smoke detection is point addressable, allowing for prompt recognition of fire location. The sprinkler system will aid in controlling the fire event until manual suppression can be applied, as necessary. Fire extinguishers and hose stations are provided in the adjacent area for manual fire fighting.

3. Protection of SSCs so that Fires Will Not Prevent Safe Shutdown

Historically, this objective has been deterministically satisfied by conforming to the requirements of 10 CFR 50 Appendix R, Sections III.G.1 or III.G.2. The subject OMA is utilized in lieu of III.G.2 protection to ensure a fire in C-7 does not challenge PFSSD.

8.5.16 Conclusion

The above analysis and time-authenticated demonstrations provide reasonable assurance that the OMA for Fire Area C-7 is dependable, reliable, and can be consistently performed within the required Available Time. A one hundred forty three (143) minute time margin remains, when applying uncertainty elements to ensure OMA reliability. Post-fire safe shutdown capability is maintained with no adverse reactor thermal performance. Therefore, the OMA is considered both feasible and reliable.

8.6 Fire Area C-12, Control Building 2000' North Cable Chase

8.6.1 Fire Area Features

Fire Area C-12 is a single room (3306) cable chase located on the 2000' elevation of the Control Building. The chase contains cable and normal room lighting only. It is separated from adjacent areas by 3-hour fire rated barriers. Smoke detection and wet pipe sprinkler protection are provided for the area. No natural or forced ventilation is provided for the fire area. General access to the cable chase is restricted by a normally locked fire door.

8.6.2 Spurious Equipment Operation Requiring Operator Manual Action

Cables associated with letdown isolation valves BGLCV0459 and BGLCV0460 may be damaged, preventing these valves from being closed from the Control Room. PFSSD requires one of these valves to be closed to ensure adequate charging flow.

This spurious equipment operation is Important to Safe Shutdown, as letdown is not required for PFSSD. However, letdown isolation is required to prevent RCS flow diversion. This event is a multiple spurious equipment operation from a PFSSD perspective, as the fire-induced maloperation involves two series valves in the chemical and volume control system.

8.6.3 Operator Manual Action Description

Valves BGLCV0459 and BGLCV0460 can be isolated by closing instrument air supply valve KAV0201 located in the South Pipe Penetration Room on the 2000' elevation of the Auxiliary Building (Reference Attachment C, Photo C-1). This removes air to BGLCV0459, BGLCV0460, and all air operated components within the Reactor Building. Historical performance of STS KJ-001A, which isolates instrument air to the Reactor Building, reveals that BGLCV0459 and BGLCV0460 will fail closed within three (3) minutes following isolation of instrument air. This is a Reactive OMA.

8.6.4 <u>Feasibility Analysis of Time Available to Perform Manual Actions</u>

Figure 8.6.4-1 reflects the OMA timeline for closing BGLCV0459 and BGLCV0460. The identified times are based on the following:

Fire Initiated - This is the initiating event, which occurs at time zero.

Fire Indicated – A one (1) minute detection response time is utilized based on the Attachment B1 application of NUREG-1805 for smoke detector response. However, C-12 contains only one smoke detector within the cable chase. Therefore, physical confirmation of the fire event is necessary. This confirmation is postulated to take up to five (5) minutes following receipt of the initial fire alarm indication in the Control Room. This increases the total fire detected time to six (6) minutes.

Diagnosis Time – A seven (7) minute diagnosis time is utilized based on Section 5.1.14.1.

OMA Implementation Time – A twelve (12) minute operator action time is utilized based on the demonstrated OMA walkdown time documented in Section 8.6.14.

OMA Uncertainty Time – A twelve (12) minute OMA uncertainty time is utilized based on Section 8.6.14.

Available Time – Thermal hydraulic analysis WCNOC-CP-002 identifies that when letdown is the only flow diversion event, it can remain open for one hundred eighty (180) minutes without adverse consequence to reactor performance.

Time Margin – The time margin for OMA performance is one hundred forty three (143) minutes.

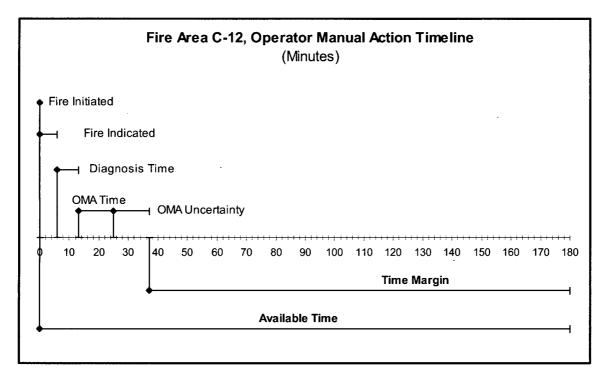


Figure 8.6.4-1, Fire Area C-12 OMA Timeline

8.6.5 Reliability Analysis of Time Available to Perform Manual Actions

As discussed in Section 5.1.5, an OMA is considered reliable provided that a Time Margin remains when applying Fire Indicated Time, Diagnosis Time, OMA Implementation Time, and OMA Uncertainty Time, within the OMA event timeline. The OMA Timeline for Fire Area C-12 reveals that a one hundred forty three (143) minute time margin remains. Application of the uncertainty time provides reasonable assurance that the OMA is dependable, reliable, and can be performed with a high rate of success.

8.6.6 Environmental Factors

Habitable environmental conditions will be present for performance of the OMA. The postulated fire event is within Cable Chase 3306 located on the 2000' elevation of the Control Building. The OMA is in an adjacent structure within the Auxiliary Building. The fire will be confined to the Fire Area C-12 Cable Chase of origin, which contains no ventilation openings. The travel path and location of the equipment requiring manipulation are physically separated from the fire by multiple fire rated barriers, ensuring that smoke propagation and fire fighting activities will not present an egress impediment.

Emergency lighting is provided for illumination of potential egress paths and the component requiring OMA manipulation. Normal radiation, temperature, and humidity conditions within the area of concern will not be adversely affected by the fire and subsequent spurious equipment operation.

There are no physical impediments in proximity to the manual action component that would significantly delay or prevent required manipulation. No special equipment, related to environmental condition, is necessary for performance of the OMA.

8.6.7 Equipment Functionality and Accessibility

No equipment support functions are required for successful manual action implementation. The OMA component is physically separated from the fire event by several fire rated barriers. This ensures that the credited equipment is not adversely affected by the fire and its effects.

The operator responsible for OFN KC-016 OMAs carries a master key that can be used to open electronically controlled doors in the event that the fire has negatively affected the normal card key access means. All electronically controlled doors are provided with this secondary access arrangement. This ensures that the postulated fire will not prevent egress through doors provided with electronic access control.

8.6.8 <u>Available Indications</u>

Point addressable smoke detection is provided for Cable Chase 3306. Upon detector activation, main fire alarm panel KC-008, located in the Control Room, will annunciate a fire alarm condition with a descriptive location of the detector in alarm. This will likely be the first indication of a fire event within the cable chase.

To diagnose a failure of BGLCV0459 and BGLCV0460 to close, valve position indication or appropriate level indication needs to be available. The following instrumentation is unaffected by the fire and is available to assist Control Room diagnosis of BGLCV0459 and BGLCV0460 failure to close:

Pressurizer level indicators BBLI0459A and BBLI0460A.

• VCT level indicators BGLI0112 and BGLI0185.

8.6.9 <u>Communications</u>

A fire in this area could affect the Gaitronics and 900 MHz radio systems. This OMA does not require constant communication with the Control Room. As previously discussed, the operator assigned OFN KC-016 OMA duty will report to the Control Room for instruction following fire brigade callout. This approach allows the Control Room operators to provide face-to-face direction for the OMA. Once the OMA has been implemented, the operator can physically report back to the Control Room if the Gaitronics or radio system functionality are affected by the fire.

8.6.10 Portable Equipment

KAV0201 is located approximately 10' above the floor. Access to a portable ladder for OMA implementation is available. No other portable equipment or tools, beyond those required to be carried by the designated OMA operator, are necessary to perform the specified OMA. Key access may be necessary for electronic card reader controlled doors if the fire affects electronic door control. As previously identified, the OFN KC-016 OMA designated operator is required to carry a master key.

8.6.11 <u>Personnel Protection Equipment</u>

No other personnel protective equipment, beyond that normally necessary for Auxiliary Building access, is required to perform the OMA.

8.6.12 <u>Procedures and Training</u>

The OMA is identified in OFN KC-016. See Section 5.1.12 for further discussion addressing the fire response procedure.

8.6.13 Staffing

The operator assigned OFN KC-016 OMA duty for the shift is responsible for performing the OMA. Only one person is required to perform the OMA.

8.6.14 <u>Demonstrations</u>

The OMA was timed using multiple operators, each starting from the Work Control Center (3613) on the 2047' elevation of the Communications Corridor. The timing effort reflected that the OMA could be consistently performed within nine (9) minutes. This included time to obtain a ladder to reach KAV0201. The three (3) minute delay for BGLCV0459 and BGLCV0460 closure following the isolation of instrument air is also factored into the overall OMA implementation time. This results in a cumulative OMA implementation time of twelve (12) minutes. In addition, the following uncertainty times have been included, resulting in a total uncertainty time of twelve (12) minutes.

-E-11 5500-004-A-1	
	Communication and feedback with Control Room – 1 minute
	 Electronically controlled door key access – 3 minutes
	Obtain RCA access – 2 minutes
	 Human centered uncertainty – 3 minutes
	 Delay in obtaining and setting up ladder – 3 minutes
8.6.15	Defense-In-Depth
	1. Fire Prevention
	The objective of fire prevention is not affected by the OMA. The area of the plant where the fire could occur, necessitating OMA implementation, has combustible loading allowances and hot work limitations that are consistent with other plant areas important to safety. Additionally, the cable chase is normally locked, which prevents general access to the area.
	2. Detect, Control, and Extinguish Fires
	This objective is not affected by the OMA. Smoke detection and wet pipe sprinkler protection are provided for the area. Fire alarm annunciation is provided locally, and within the Control Room. Smoke detection is point addressable, allowing for prompt recognition of fire location. The sprinkler system will aid in controlling the fire event until manual suppression can be applied, as necessary. Fire extinguishers and hose stations are provided in the adjacent area for manual fire fighting.
	3. Protection of SSCs so that Fires Will Not Prevent Safe Shutdown
	Historically, this objective has been deterministically satisfied by conforming to the requirements of 10 CFR 50 Appendix R, Sections III.G.1 or III.G.2. The subject OMA is utilized in lieu of III.G.2 protection to ensure a fire in C-12 does not challenge PFSSD.
8.6.16	Conclusion
	The above analysis and time-authenticated demonstrations provide reasonable assurance that the OMA for Fire Area C-12 is dependable, reliable, and can be consistently performed within the required Available

Time. A one hundred forty three (143) minute time margin remains, when applying uncertainty elements to ensure OMA reliability. Post-fire safe shutdown capability is maintained with no adverse reactor thermal performance. Therefore, the OMA is considered both feasible and

reliable.

8.7 Fire Area C-18, Control Building 2016' Cable Chase

8.7.1 <u>Fire Area Features</u>

Fire Area C-18 is a single room (3419) cable chase located on the 2016' elevation of the Control Building. The chase contains cable and normal room lighting only. It is separated from adjacent areas by 3-hour fire rated barriers. Smoke detection and wet pipe sprinkler protection are provided for the area. No natural or forced ventilation is provided for the fire area. General access to the cable chase is restricted by a normally locked fire door.

8.7.2 Spurious Equipment Operation Requiring Operator Manual Action

Cables associated with letdown isolation valves BGLCV0459 and BGLCV0460 may be damaged, preventing these valves from being closed from the Control Room. PFSSD requires one of these valves to be closed to ensure adequate charging flow.

This spurious equipment operation is Important to Safe Shutdown, as letdown is not required for PFSSD. However, letdown isolation is required to prevent RCS flow diversion. This event is a multiple spurious equipment operation from a PFSSD perspective, as the fire-induced maloperation involves two series valves in the chemical and volume control system.

Atmospheric relief valve (ARV) ABPV0001 could spuriously open as a result of a C-18 fire. Thermal hydraulic analysis WCNOC-CP-002 determined that no operator action is required to achieve and maintain hot standby with a spuriously open ARV. However, the thermal hydraulic analysis determined that a spuriously open ARV concurrent with letdown does affect the available time for isolating letdown.

Containment spray pump PEN01A could spuriously start and discharge valve ENHV0006 could spuriously open due to fire induced cable damage. This would result in containment spray actuation. Containment spray is an Important to Safe Shutdown spurious equipment operation, as the event would divert RWST inventory to the containment sump. This is a multiple spurious operation scenario from a PFSSD perspective, as two fire induced component maloperation events are required before containment spray would be spuriously actuated.

8.7.3 Operator Manual Action Description

Valves BGLCV0459 and BGLCV0460 can be isolated by closing instrument air supply valve KAV0201 located in the South Pipe Penetration Room on the 2000' elevation of the Auxiliary Building (Reference Attachment C, Photo C-1). This removes air to BGLCV0459, BGLCV0460, and all air operated components within the Reactor Building. Historical performance of STS KJ-001A, which isolates instrument air to the Reactor Building, reveals that BGLCV0459 and BGLCV0460 will fail closed within three (3) minutes following isolation of instrument air. This is a Reactive OMA.

Containment spray pump PEN01A can be stopped by opening breaker NB0102. The breaker is located on 4.16 KV bus NB01 within the Control Building 2000' north ESF Switchgear Room (Fire Area C-9). Refer to Attachment C Photo C-7, for a photograph of the respective breaker. This is a Reactive OMA.

8.7.4 Feasibility Analysis of Time Available to Perform Manual Actions

Figure 8.7.4-1 reflects the OMA timeline for closing BGLCV0459 and BGLCV0460 and opening breaker NB0102. The identified times are based on the following:

Fire Initiated - This is the initiating event, which occurs at time zero.

Fire Indicated – A one (1) minute detection response time is utilized based on the Attachment B1 application of NUREG-1805 for smoke detector response. However, C-18 contains only one smoke detector within the cable chase. Therefore, physical confirmation of the fire event is necessary. This confirmation is postulated to take up to five (5) minutes following receipt of the initial fire alarm indication in the Control Room. This increases the total fire detected time to six (6) minutes.

Diagnosis Time – A seven (7) minute diagnosis time is utilized based on Section 5.1.14.1.

OMA Implementation Time – Implementation sequence for the two OMAs will be based on Control Room diagnosis. The conservative approach from a feasibility and reliability timing perspective is to postulate that letdown isolation is addressed second in the sequence of OMA events. This is conservative since letdown has a more restrictive available time for OMA implementation.


A six (6) minute operator action time is utilized for opening NB0102, based on the demonstrated OMA walkdown time documented in Section 8.7.14.

A fifteen (15) minute operator action time is utilized for isolating KAV0201, based on the demonstrated OMA walkdown time documented in Section 8.7.14.

OMA Uncertainty Time – A thirteen (13) minute OMA uncertainty time is utilized based on Section 8.7.14.

Available Time – Thermal hydraulic analysis WCNOC-CP-002 identifies when letdown is open, concurrent with spuriously open atmospheric relief valve related cooling, letdown can remain open for fifty (50) minutes, without adverse consequence to reactor performance.

E-1F9910 identifies that containment spray can operate for sixty (60) minutes before RWST level will be below that required for cold shutdown.

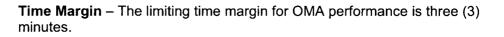

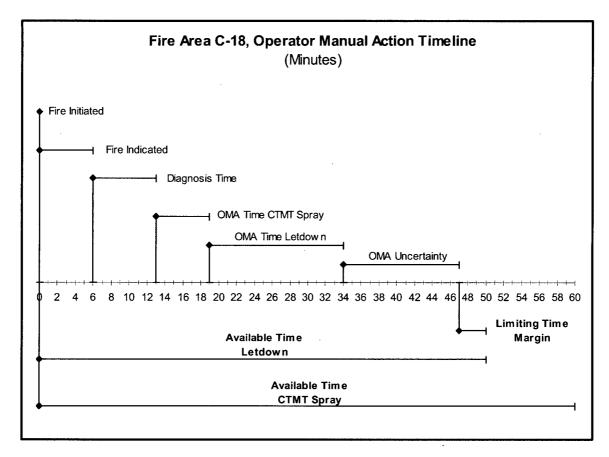


Figure 8.7.4-1, Fire Area C-18 OMA Timeline

8.7.5 Reliability Analysis of Time Available to Perform Manual Actions

As discussed in Section 5.1.5, an OMA is considered reliable provided that a Time Margin remains when applying Fire Indicated Time, Diagnosis Time, OMA Implementation Time, and OMA Uncertainty Time, within the OMA event timeline. The OMA Timeline for Fire Area C-18 reveals that a three (3) minute time margin remains for the most limiting OMA. Application of the uncertainty time provides reasonable assurance that the OMAs are dependable, reliable, and can be performed with a high rate of success.

8.7.6 Environmental Factors

Habitable environmental conditions will be present for performance of the OMAs. The postulated fire event is within Cable Chase 3419 located on the 2016' elevation of the Control Building. The location of the OMA for isolating KAV0201 is in an adjacent structure on the 2000' elevation of the Auxiliary Building, within the south Pipe Penetration Room. The location of the OMA for stopping PEN01A containment spray is located on the

2000' elevation of the Control Building, within the north ESF Switchgear Room.

The fire will be confined to the Fire Area C-18 Cable Chase of origin, which contains no ventilation openings. The travel path and location of the equipment requiring manipulation are physically separated from the fire by multiple fire rated barriers, ensuring that smoke propagation and fire fighting activities will not present an egress impediment.

Emergency lighting is provided for illumination of potential egress paths, the emergency equipment cabinet necessitating access for retrieval of personal protective equipment, and the components requiring OMA manipulation. Normal radiation, temperature, and humidity conditions within the OMA areas will not be adversely affected by the fire and subsequent spurious equipment operation.

There are no physical impediments in proximity to the manual action components that would significantly delay or prevent required manipulation. No special equipment, related to environmental condition, is necessary for performance of the OMAs.

8.7.7 Equipment Functionality and Accessibility

No equipment support functions are required for successful manual action implementation. The OMA components are physically separated from the fire event by several fire rated barriers. This ensures that the credited equipment is not adversely affected by the fire and its effects.

The operator responsible for OFN KC-016 OMAs carries a master key that can be used to open electronically controlled doors in the event that the fire has negatively affected the normal card key access means. All electronically controlled doors are provided with this secondary access arrangement. This ensures that the postulated fire will not prevent egress through doors provided with electronic access control.

8.7.8 Available Indications

Point addressable smoke detection is provided for Cable Chase 3419. Upon detector activation, main fire alarm panel KC-008, located in the Control Room, will annunciate a fire alarm condition with a descriptive location of the detector in alarm. This will likely be the first indication of a fire event within the cable chase.

To diagnose a failure of BGLCV0459 and BGLCV0460 to close, valve position indication or appropriate level indication needs to be available. The following instrumentation is unaffected by the fire and is available to assist Control Room diagnosis of BGLCV0459 and BGLCV0460 failure to close:

- Pressurizer level indicator BBLI0460A.
- VCT level indicator BGLI0185.

To diagnose spurious operation of containment spray, the pump breaker status indication, containment spray flow indication, containment pressure indication, or RWST level indication needs to be available. The following instrumentation is unaffected by the fire and is available to assist Control Room diagnosis of spurious containment spray actuation:

- RWST level indicators BNLI0931 and BNLI933.
- Containment pressure indicators GNPI0934 and GNPI0936.

8.7.9 <u>Communications</u>

A fire in this area could affect the Gaitronics and 900 MHz radio systems. The OMAs do not require constant communication with the Control Room. As previously discussed, the operator assigned OFN KC-016 OMA duty will report to the Control Room for instruction following fire brigade callout. This approach allows the Control Room operators to provide face-to-face direction for the OMA. Once the OMA has been implemented, the operator can physically report back to the Control Room if the Gaitronics or radio system functionality are affected by the fire.

8.7.10 <u>Portable Equipment</u>

KAV0201 is located approximately 10' above the floor. Access to a portable ladder for OMA implementation is available. No other portable equipment or tools, beyond those required to be carried by the designated OMA operator, are necessary to perform the specified OMA. Key access may be necessary for electronic card reader controlled doors if the fire affects electronic door control. As previously identified, the OFN KC-016 OMA designated operator is required to carry a master key.

8.7.11 <u>Personnel Protection Equipment</u>

Opening of breaker NB0102 requires donning of electrical safety gear to protect against potential arc flash. This PPE is located within Fire Area C-10, which is adjacent to the room where the OMA is performed.

No other personnel protective equipment, beyond that normally necessary for Auxiliary or Control Building access, is required to perform the OMAs.

8.7.12 Procedures and Training

The OMAs are identified in OFN KC-016. See Section 5.1.12 for further discussion addressing the fire response procedure.

8.7.13 Staffing

The operator assigned OFN KC-016 OMA duty for the shift is responsible for performing the OMAs. Only one person is required to perform the OMAs.

8.7.14 Demonstrations

The OMAs were timed using multiple operators, each starting from the Work Control Center (3613) on the 2047' elevation of the Communications Corridor.

The timing effort reflected that the OMA for opening NB0102 could be implemented in six (6) minutes. This included time for donning electrical safety PPE.

The timing effort reflected that the OMA for isolating KAV0201 could be consistently performed within nine (9) minutes. This included time to obtain a ladder to reach KAV0201. The three (3) minute delay for BGLCV0459 and BGLCV0460 closure following the isolation of instrument air is also factored into the overall OMA implementation time. Additionally, three (3) minutes is included in the OMA time for the operator to return to the Control Room after opening breaker NB0102. This results in a cumulative OMA implementation time of fifteen (15) minutes for KAV0201.

In addition, the following uncertainty times have been included, resulting in a total uncertainty time of thirteen (13) minutes.

- Communication and feedback with Control Room 2 minutes
- Electronically controlled door key access 3 minutes
- Obtain RCA access 2 minutes
- Human centered uncertainty 3 minutes
- Delay in obtaining and setting up ladder 3 minutes

8.7.15 Defense-In-Depth

1. Fire Prevention

The objective of fire prevention is not affected by the OMAs. The area of the plant where the fire could occur, necessitating OMA implementation, has combustible loading allowances and hot work limitations that are consistent with other plant areas important to safety. Additionally, the cable chase is normally locked, which prevents general access to the area.

2. Detect, Control, and Extinguish Fires

This objective is not affected by the OMAs. Smoke detection and wet pipe sprinkler protection are provided for the area. Fire alarm annunciation is provided locally, and within the Control Room. Smoke detection is point addressable, allowing for prompt recognition of fire location. The sprinkler system will aid in controlling the fire event until manual suppression can be applied, as necessary. Fire extinguishers and hose stations are provided in the general area for manual fire fighting.

3. Protection of SSCs so that Fires Will Not Prevent Safe Shutdown

Historically, this objective has been deterministically satisfied by conforming to the requirements of 10 CFR 50 Appendix R, Sections III.G.1 or III.G.2. The subject OMAs are utilized in lieu of III.G.2 protection to ensure a fire in C-18 does not challenge PFSSD.

8.7.16 Conclusion

The above analysis and time-authenticated demonstrations provide reasonable assurance that the OMAs for Fire Area C-18 are dependable, reliable, and can be consistently performed within the required Available Time. A three (3) minute time margin remains for the most limiting OMA, when applying uncertainty elements to ensure OMA reliability. Post-fire safe shutdown capability is maintained with no adverse reactor thermal performance or unacceptable loss of RWST inventory. Therefore, the OMAs are considered both feasible and reliable.

8.8 Fire Area C-21, Control Building 2032' Lower Cable Spreading Room

8.8.1 <u>Fire Area Features</u>

Fire Area C-21 is the Lower Cable Spreading Room (3501) on the 2032' elevation of the Control Building. The Room contains predominantly cable. It is separated from adjacent areas by 3-hour fire rated barriers. Smoke detection and a preaction sprinkler system are provided for the area.

8.8.2 Spurious Equipment Operation Requiring Operator Manual Action

Cables associated with letdown isolation valves BGLCV0459 and BGLCV0460 may be damaged, preventing these valves from being closed from the Control Room. PFSSD requires one of these valves to be closed to ensure adequate charging flow.

This spurious equipment operation is Important to Safe Shutdown, as letdown is not required for PFSSD. However, letdown isolation is required to prevent RCS flow diversion. This event is a multiple spurious equipment operation from a PFSSD perspective, as the fire-induced maloperation involves two series valves in the chemical and volume control system.

Atmospheric relief valve (ARV) ABPV0001 and ABPV0003 could spuriously open as a result of a C-21 fire. Thermal hydraulic analysis WCNOC-CP-002 determined that no operator action is required to achieve and maintain hot standby with two spuriously open ARVs. However, the thermal hydraulic analysis determined that spuriously open ARVs concurrent with letdown does affect the available time for isolating letdown.

Containment spray pump PEN01A could spuriously start and discharge valve ENHV0006 could spuriously open due to fire induced cable damage. This would result in containment spray actuation. Containment spray is an Important to Safe Shutdown spurious equipment operation, as the event would divert RWST inventory to the containment sump. This is a multiple spurious operation scenario from a PFSSD perspective, as two fire induced component maloperation events are required before containment spray would be spuriously actuated.

8.8.3 Operator Manual Action Description

Valves BGLCV0459 and BGLCV0460 can be isolated by closing instrument air supply valve KAV0201 located in the South Pipe Penetration Room on the 2000' elevation of the Auxiliary Building (Reference Attachment C, Photo C-1). This removes air to BGLCV0459, BGLCV0460, and all air operated components within the Reactor Building. Historical performance of STS KJ-001A, which isolates instrument air to the Reactor Building, reveals that BGLCV0459 and BGLCV0460 will fail closed within three (3) minutes following isolation of instrument air. This is a Reactive OMA.

Containment spray pump PEN01A can be stopped by opening breaker NB0102. The breaker is located on 4.16 KV bus NB01 within the Control Building 2000' north ESF Switchgear Room (Fire Area C-9). Refer to Attachment C, Photo C-7, for a photograph of the respective breaker. This is a Reactive OMA.

8.8.4 <u>Feasibility Analysis of Time Available to Perform Manual Actions</u>

Figure 8.8.4-1 reflects the OMA timeline for closing BGLCV0459 and BGLCV0460 and opening breaker NB0102. The identified times are based on the following:

Fire Initiated - This is the initiating event, which occurs at time zero.

Fire Indicated – A one (1) minute detection response time is utilized based on the Attachment B1 application of NUREG-1805 for smoke detector response. Total area detection is provided for Fire Area C-21. Therefore, multiple detection alarms would be initiated for a fire event warranting OMA response action.

Diagnosis Time – A seven (7) minute diagnosis time is utilized based on Section 5.1.14.1.

OMA Implementation Time – Implementation sequence for the two OMAs will be based on Control Room diagnosis. The conservative approach from a feasibility and reliability timing perspective is to postulate that letdown isolation is addressed second in the sequence of OMA events. This is conservative since letdown has a more restrictive available time for OMA implementation.

A six (6) minute operator action time is utilized for opening NB0102, based on the demonstrated OMA walkdown time documented in Section 8.8.14.

A fifteen (15) minute operator action time is utilized for isolating KAV0201, based on the demonstrated OMA walkdown time documented in Section 8.8.14.

OMA Uncertainty Time – A thirteen (13) minute OMA uncertainty time is utilized based on Section 8.8.14.

Available Time – Thermal hydraulic analysis WCNOC-CP-002 identifies when letdown is open, concurrent with spuriously open atmospheric relief valve related cooling, letdown can remain open for fifty (50) minutes, without adverse consequence to reactor performance.

E-1F9910 identifies that containment spray can operate for sixty (60) minutes before RWST level will be below that required for cold shutdown.

Time Margin – The limiting time margin for OMA performance is eight (8) minutes.

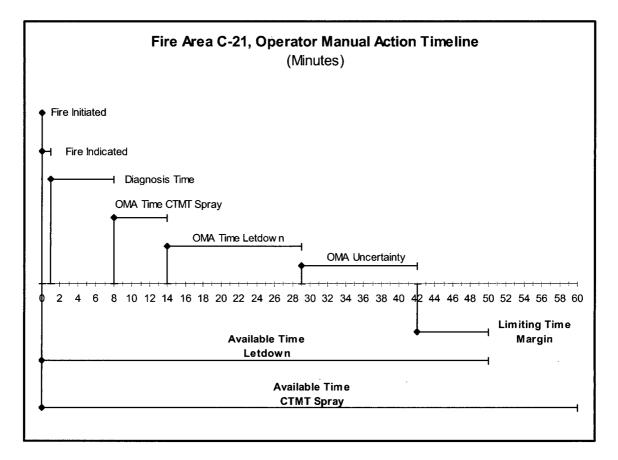


Figure 8.8.4-1, Fire Area C-21 OMA Timeline

8.8.5 Reliability Analysis of Time Available to Perform Manual Actions

As discussed in Section 5.1.5, an OMA is considered reliable provided that a Time Margin remains when applying Fire Indicated Time, Diagnosis Time, OMA Implementation Time, and OMA Uncertainty Time, within the OMA event timeline. The OMA Timeline for Fire Area C-21 reveals that an eight (8) minute time margin remains for the most limiting OMA. Application of the uncertainty time provides reasonable assurance that the OMAs are dependable, reliable, and can be performed with a high rate of success.

8.8.6 Environmental Factors

Habitable environmental conditions will be present for performance of the OMAs. The postulated fire event is within Lower Cable Spreading Room on the 2032' elevation of the Control Building. The location of the OMA for isolating KAV0201 is in an adjacent structure on the 2000' elevation of the Auxiliary Building, within the south Pipe Penetration Room. The location of the OMA for stopping PEN01A containment spray is located on the 2000' elevation of the Control Building, within the north ESF Switchgear Room.

Based on fire barrier separation, the fire will be confined to Fire Area C-21. The travel path and location of the equipment requiring

manipulation are physically separated from the fire by rated fire barriers. The smoke propagation review documented in Section 5.1.6 determined that the described OMA implementation would not be impeded by smoke migration from the fire event.

Emergency lighting is provided for illumination of potential egress paths, the emergency equipment cabinet necessitating access for retrieval of personal protective equipment, and the components requiring OMA manipulation. Normal radiation, temperature, and humidity conditions within the OMA areas will not be adversely affected by the fire and subsequent spurious equipment operation.

There are no physical impediments in proximity to the manual action components that would significantly delay or prevent required manipulation. No special equipment, related to environmental condition, is necessary for performance of the OMAs.

8.8.7 Equipment Functionality and Accessibility

No equipment support functions are required for successful manual action implementation. The OMA components are physically separated from the fire event by several fire rated barriers. This ensures that the credited equipment is not adversely affected by the fire and its effects.

The operator responsible for OFN KC-016 OMAs carries a master key that can be used to open electronically controlled doors in the event that the fire has negatively affected the normal card key access means. All electronically controlled doors are provided with this secondary access arrangement. This ensures that the postulated fire will not prevent egress through doors provided with electronic access control.

8.8.8 Available Indications

Point addressable smoke detection is provided for the Lower Cable Spreading Room. Upon detector activation, main fire alarm panel KC-008, located in the Control Room, will annunciate a fire alarm condition with a descriptive location of the detector in alarm. This will likely be the first indication of a fire event within the area.

To diagnose a failure of BGLCV0459 and BGLCV0460 to close, valve position indication or appropriate level indication needs to be available. The following instrumentation is unaffected by the fire and is available to assist Control Room diagnosis of BGLCV0459 and BGLCV0460 failure to close:

- Pressurizer level indicator BBLI0460A.
- VCT level indicator BGLI0185.

To diagnose spurious operation of containment spray, the pump breaker status indication, containment spray flow indication, containment pressure indication, or RWST level indication needs to be available. The following

instrumentation is unaffected by the fire and is available to assist Control Room diagnosis of spurious containment spray actuation:

- RWST level indicators BNLI0931 and BNLI933.
- Containment pressure indicators GNPI0934 and GNPI0936.

8.8.9 <u>Communications</u>

A fire in this area could affect the Gaitronics system. The 900 MHz radio communication system is unaffected by the fire. The OMAs do not require constant communication with the Control Room. After initially reporting to the Control Room, the operator will receive face-to-face direction regarding OMA implementation. The operator may then use the radio system as necessary, or report directly back to the Control Room for further instruction.

8.8.10 Portable Equipment

KAV0201 is located approximately 10' above the floor. Access to a portable ladder for OMA implementation is available. No other portable equipment or tools, beyond those required to be carried by the designated OMA operator, are necessary to perform the specified OMA. Key access may be necessary for electronic card reader controlled doors if the fire affects electronic door control. As previously identified, the OFN KC-016 OMA designated operator is required to carry a master key.

8.8.11 <u>Personnel Protection Equipment</u>

Opening of breaker NB0102 requires donning of electrical safety gear to protect against potential arc flash. This PPE is located within Fire Area C-10, which is adjacent to the room where the OMA is performed.

No other personnel protective equipment, beyond that normally necessary for Auxiliary or Control Building access, is required to perform the OMAs.

8.8.12 Procedures and Training

The OMAs are identified in OFN KC-016. See Section 5.1.12 for further discussion addressing the fire response procedure.

8.8.13 <u>Staffing</u>

The operator assigned OFN KC-016 OMA duty for the shift is responsible for performing the OMAs. Only one person is required to perform the OMAs.

8.8.14 <u>Demonstrations</u>

The OMAs were timed using multiple operators, each starting from the Work Control Center (3613) on the 2047' elevation of the Communications Corridor.

The timing effort reflected that the OMA for isolating KAV0201 could be consistently performed within nine (9) minutes. This included time to obtain a ladder to reach KAV0201. The three (3) minute delay for BGLCV0459 and BGLCV0460 closure following the isolation of instrument air is also factored into the overall OMA implementation time. Additionally, three (3) minutes is included in the OMA time for the operator to return to the Control Room after opening breaker NB0102 This is conservative, as radio communication will be available. The resulting cumulative OMA implementation time for KAV0201 is fifteen (15) minutes.

The timing effort reflected that the OMA for opening NB0102 could be implemented in six (6) minutes. This included time for donning electrical safety PPE.

In addition, the following uncertainty times have been included, resulting in a total uncertainty time of thirteen (13) minutes.

- Communication and feedback with Control Room 2 minutes
- Electronically controlled door key access 3 minutes
- Obtain RCA access 2 minutes
- Human centered uncertainty 3 minutes
- Delay in obtaining and setting up ladder 3 minutes

8.8.15 Defense-In-Depth

1. Fire Prevention

The objective of fire prevention is not affected by the OMAs. The area of the plant where the fire could occur, necessitating OMA implementation, has combustible loading allowances and hot work limitations that are consistent with other plant areas important to safety.

2. Detect, Control, and Extinguish Fires

This objective is not affected by the OMA. Smoke detection and preaction sprinkler protection are provided for the area. Fire alarm annunciation is provided locally, and within the Control Room. Smoke detection is point addressable, allowing for prompt recognition of fire location. The sprinkler system will aid in controlling the fire event until manual suppression can be applied, if necessary. Fire extinguishers and hose stations are provided in the area for manual fire fighting.

3. Protection of SSCs so that Fires Will Not Prevent Safe Shutdown

Historically, this objective has been deterministically satisfied by conforming to the requirements of 10 CFR 50 Appendix R, Sections III.G.1 or III.G.2. The subject OMAs are utilized in lieu of III.G.2 protection to ensure a fire in C-21 does not challenge PFSSD.

8.8.16 <u>Conclusion</u>

The above analysis and time-authenticated demonstrations provide reasonable assurance that the OMAs for Fire Area C-21 are dependable, reliable, and can be consistently performed within the required Available Time. An eight (8) minute time margin remains for the most limiting OMA, when applying uncertainty elements to ensure OMA reliability. Post-fire safe shutdown capability is maintained with no adverse reactor thermal performance or unacceptable loss of RWST inventory. Therefore, the OMAs are considered both feasible and reliable.

8.9 Fire Area C-22, Control Building 2073'-6 Upper Cable Spreading Room

8.9.1 <u>Fire Area Features</u>

Fire Area C-22 is the Upper Cable Spreading Room (3801) on the 2073'-6" elevation of the Control Building. The Room contains predominantly cable. It is separated from adjacent areas by 3-hour fire rated barriers. Smoke detection and a preaction sprinkler system are provided for the area.

8.9.2 Spurious Equipment Operation Requiring Operator Manual Action

Containment spray pump PEN01B could spuriously start and discharge valve ENHV0012 could spuriously open due to fire induced cable damage. This would result in containment spray actuation. Containment spray is an Important to Safe Shutdown spurious equipment operation, as the event would divert RWST inventory to the containment sump. This is a MSO scenario from a PFSSD perspective, as two fire induced component maloperation events are required before containment spray would be spuriously actuated.

8.9.3 Operator Manual Action Description

Containment spray pump PEN01B can be stopped by opening breaker NB0203. The breaker is located on 4.16 KV bus NB02 within the Control Building 2000' south ESF Switchgear Room (Fire Area C-10). Refer to Attachment C, Photo C-8, for photograph of the respective breaker. This is a Reactive OMA.

8.9.4 <u>Feasibility Analysis of Time Available to Perform Manual Actions</u>

Figure 8.9.4-1 reflects the OMA timeline in response to spurious containment spray actuation. The identified times are based on the following:

Fire Initiated - This is the initiating event, which occurs at time zero.

Fire Indicated – A one (1) minute detection response time is utilized based on the Attachment B1 application of NUREG-1805 for smoke detector response. Total area detection is provided for Fire Area C-22. Therefore, multiple detection alarms would be initiated for a fire event warranting OMA response action.

Diagnosis Time – A seven (7) minute diagnosis time is utilized based on Section 5.1.14.1.

OMA Implementation Time – A six (6) minute operator implementation time is utilized based on the demonstrated OMA walkdown time documented in Section 8.9.14.

OMA Uncertainty Time – A seven (7) minute OMA uncertainty time is utilized based on Section 8.9.14.

Available Time – E-1F9910 identifies that containment spray can operate for sixty (60) minutes before RWST level will be below that required for cold shutdown.

Time Margin – The time margin for OMA performance is thirty nine (39) minutes.

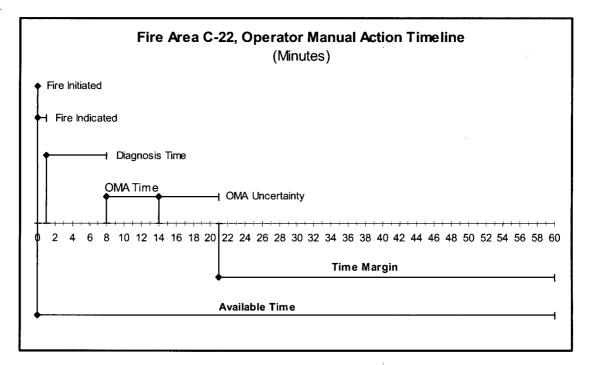


Figure 8.9.4-1, Fire Area C-22 OMA Timeline

8.9.5 Reliability Analysis of Time Available to Perform Manual Actions

As discussed in Section 5.1.5, an OMA is considered reliable provided that a Time Margin remains when applying Fire Indicated Time, Diagnosis Time, OMA Implementation Time, and OMA Uncertainty Time, within the OMA event timeline. The OMA Timeline for Fire Area C-22 reveals that a thirty nine (39) minute time margin remains. Application of the uncertainty time provides reasonable assurance that the OMA is dependable, reliable, and can be performed with a high rate of success.

8.9.6 Environmental Factors

Habitable environmental conditions will be present for performance of the OMA. The postulated fire event is within Upper Cable Spreading Room on the 2073'-6" elevation of the Control Building. The location of the OMA for stopping PEN01B containment spray is located on the 2000' elevation of the Control Building within the south ESF Switchgear Room.

The fire will be confined to Fire Area C-22 Upper Cable Spreading Room. The travel path and location of the equipment requiring manipulation are

physically separated from the fire by multiple fire rated barriers. The smoke propagation review documented in Section 5.1.6 determined that the described OMA implementation would not be impeded by smoke migration from the fire event.

Emergency lighting is provided for illumination of potential egress paths, the component requiring OMA manipulation, and emergency equipment cabinet necessitating access for retrieval of personal protective equipment. Normal radiation, temperature, and humidity conditions will not be adversely affected by the fire and subsequent spurious equipment operation.

There are no physical impediments in proximity to the manual action component that would significantly delay or prevent required manipulation. No special equipment, related to environmental condition, is necessary for performance of the OMA.

8.9.7 Equipment Functionality and Accessibility

No equipment support functions are required for successful manual action implementation. The component requiring manipulation is an electrical breaker. The breaker is readily accessible for manipulation. It is physically separated from the fire event by several fire rated barriers. This ensures that the credited equipment is not adversely affected by the fire and its effects.

The operator responsible for OFN KC-016 OMAs carries a master key that can be used to open electronically controlled doors in the event that the fire has negatively affected the normal card key access means. All electronically controlled doors are provided with this secondary access arrangement. This ensures that the postulated fire will not prevent egress through doors provided with electronic access control.

8.9.8 Available Indications

Point addressable smoke detection is provided for C-22. Upon detector activation, main fire alarm panel KC-008, located in the Control Room, will annunciate a fire alarm condition with a descriptive location of the detector in alarm. This will likely be the first indication of a fire event within the area.

To diagnose spurious operation of containment spray, the pump breaker status indication, containment spray flow indication, containment pressure indication, or RWST level indication needs to be available. The following instrumentation is unaffected by the fire and is available to assist Control Room diagnosis of spurious containment spray actuation:

- RWST level indicators BNLI0930 and BNLI0932.
- Containment pressure indicators GNPI0935 and GNPI0937.

8.9.9 <u>Communications</u>

A fire in this area could affect the Gaitronics system. The 900 MHz radio communication system is unaffected by the fire. The OMA does not require constant communication with the Control Room. After initially reporting to the Control Room, the operator will receive face-to-face direction regarding OMA implementation. The operator may then use the radio system as necessary, or report directly back to the Control Room for further instruction.

8.9.10 <u>Portable Equipment</u>

No portable equipment or tools, beyond those required to be carried by the designated OMA operator, are necessary to perform the specified OMA. Key access may be necessary for electronic card reader controlled doors if the fire affects electronic door control. As previously identified, the OFN KC-016 OMA designated operator is required to carry a master key.

8.9.11 Personnel Protection Equipment

Opening of breaker NB0203 requires donning of electrical safety gear to protect against potential arc flash. This PPE is located within Fire Area C-10, where the OMA is performed.

No other personnel protective equipment, beyond that normally necessary for Control Building access, is required to perform the OMA.

8.9.12 <u>Procedures and Training</u>

The OMA is identified in OFN KC-016. See Section 5.1.12 for further discussion addressing the fire response procedure.

8.9.13 Staffing

The operator assigned OFN KC-016 OMA duty for the shift is responsible for performing the OMA. Only one person is required to perform the OMA.

8.9.14 <u>Demonstrations</u>

The OMA was timed using multiple operators, each starting from the Work Control Center (3613) on the 2047' elevation of the Communications Corridor. The timing effort reflected that the OMA could be consistently performed within six (6) minutes. This included time to don electrical safety PPE. In addition, the following uncertainty times have been included, resulting in a total uncertainty time of seven (7) minutes.

- Communication and feedback with Control Room 1 minute
- Electronically controlled door key access 3 minutes

- Human centered uncertainty 3 minutes
- 8.9.15 Defense-In-Depth
 - 1. Fire Prevention

The objective of fire prevention is not affected by the OMA. The area of the plant where the fire could occur, necessitating OMA implementation, has combustible loading allowances and hot work limitations that are consistent with other plant areas important to safety.

2. Detect, Control, and Extinguish Fires

This objective is not affected by the OMA. Smoke detection and preaction sprinkler protection are provided for the area. Fire alarm annunciation is provided locally, and within the Control Room. Smoke detection is point addressable, allowing for prompt recognition of fire location. The sprinkler system will aid in controlling the fire event until manual suppression can be applied, if necessary. Fire extinguishers and hose stations are provided in the area for manual fire fighting.

3. Protection of SSCs so that Fires Will Not Prevent Safe Shutdown

Historically, this objective has been deterministically satisfied by conforming to the requirements of 10 CFR 50 Appendix R, Sections III.G.1 or III.G.2. The subject OMA is utilized in lieu of III.G.2 protection to ensure a fire in C-22 does not challenge PFSSD.

8.9.16 <u>Conclusion</u>

The above analysis and time-authenticated demonstrations provide reasonable assurance that the OMA for Fire Area C-22 is dependable, reliable, and can be consistently performed within the required Available Time. A thirty nine (39) minute time margin remains, when applying uncertainty elements to ensure OMA reliability. Post-fire safe shutdown capability is maintained with no unacceptable loss of RWST inventory. Therefore, the OMA is considered both feasible and reliable.

8.10 Fire Area C-23, Control Building 2032' South Cable Chase

8.10.1 Fire Area Features

Fire Area C-23 is a single room (3505) cable chase located on the 2032' elevation of the Control Building. The chase contains cable and normal room lighting only. It is separated from adjacent areas by 3-hour fire rated barriers. Smoke detection and wet pipe sprinkler protection are provided for the area. No natural or forced ventilation is provided for the fire area. General access to the cable chase is restricted by a normally locked fire door.

8.10.2 Spurious Equipment Operation Requiring Operator Manual Action

Containment spray pump PEN01B could spuriously start and discharge valve ENHV0012 could spuriously open due to fire induced cable damage. This would result in containment spray actuation. Containment spray is an Important to Safe Shutdown spurious equipment operation, as the event would divert RWST inventory to the containment sump. This is a multiple spurious operation scenario from a PFSSD perspective, as two fire induced component maloperation events are required before containment spray would be spuriously actuated.

8.10.3 Operator Manual Action Description

Containment spray pump PEN01B can be stopped by opening breaker NB0203. The breaker is located on 4.16 KV bus NB02 within the Control Building 2000' south ESF Switchgear Room (Fire Area C-10). Refer to Attachment C, Photo C-8, for photograph of the respective breaker. This is a Reactive OMA.

8.10.4 <u>Feasibility Analysis of Time Available to Perform Manual Actions</u>

Figure 8:10.4-1 reflects the OMA timeline in response to spurious containment spray actuation. The identified times are based on the following:

Fire Initiated - This is the initiating event, which occurs at time zero.

Fire Indicated – A one (1) minute detection response time is utilized based on the Attachment B1 application of NUREG-1805 for smoke detector response. However, C-23 contains only one smoke detector within the cable chase. Therefore, physical confirmation of the fire event is necessary. This confirmation is postulated to take up to five (5) minutes following receipt of the initial fire alarm indication in the Control Room. This increases the total fire detected time to six (6) minutes.

Diagnosis Time – A seven (7) minute diagnosis time is utilized based on Section 5.1.14.1.

OMA Implementation Time – A six (6) minute operator implementation time is utilized based on the demonstrated OMA walkdown time documented in Section 8.10.14.

OMA Uncertainty Time – A seven (7) minute OMA uncertainty time is utilized based on Section 8.10.14.

Available Time – E-1F9910 identifies that containment spray can operate for sixty (60) minutes before RWST level will be below that required for cold shutdown.

Time Margin – The time margin for OMA performance is thirty four (34) minutes.

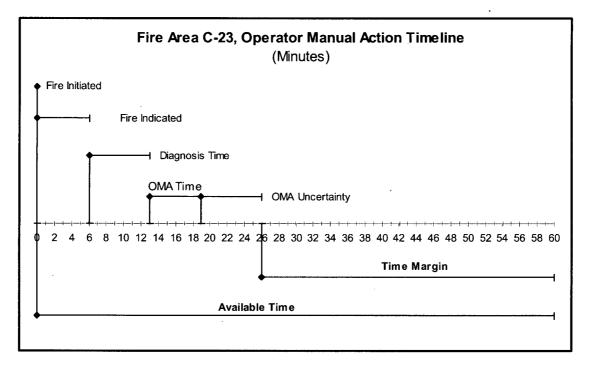


Figure 8.10.4-1, Fire Area C-23 OMA Timeline

8.10.5 Reliability Analysis of Time Available to Perform Manual Actions

As discussed in Section 5.1.5, an OMA is considered reliable provided that a Time Margin remains when applying Fire Indicated Time, Diagnosis Time, OMA Implementation Time, and OMA Uncertainty Time, within the OMA event timeline. The OMA Timeline for Fire Area C-23 reveals that a thirty four (34) minute time margin remains. Application of the uncertainty time provides reasonable assurance that the OMA is dependable, reliable, and can be performed with a high rate of success.

8.10.6 Environmental Factors

Habitable environmental conditions will be present for performance of the OMA. The postulated fire event is within Cable Chase 3505 located on the 2032' elevation of the Control Building. The location of the OMA for

stopping PEN01B containment spray is located on the 2000' elevation of the Control Building within the south ESF Switchgear Room.

The fire will be confined to the Fire Area C-23 Cable Chase of origin, which contains no ventilation openings. The travel path and location of the equipment requiring manipulation are physically separated from the fire by multiple fire rated barriers, ensuring that smoke propagation and fire fighting activities will not present an egress impediment.

Emergency lighting is provided for illumination of potential egress paths, the component requiring OMA manipulation, and the emergency equipment cabinet necessitating access for retrieval of personal protective equipment. Normal radiation, temperature, and humidity conditions will not be adversely affected by the fire and subsequent spurious equipment operation.

There are no physical impediments in proximity to the manual action component that would significantly delay or prevent required manipulation. No special equipment, related to environmental condition, is necessary for performance of the OMA.

8.10.7 Equipment Functionality and Accessibility

No equipment support functions are required for successful manual action implementation. The component requiring manipulation is an electrical breaker. The breaker is readily accessible for manipulation. It is physically separated from the fire event by several fire rated barriers. This ensures that the credited equipment is not adversely affected by the fire and its effects.

The operator responsible for OFN KC-016 OMAs carries a master key that can be used to open electronically controlled doors in the event that the fire has negatively affected the normal card key access means. All electronically controlled doors are provided with this secondary access arrangement. This ensures that the postulated fire will not prevent egress through doors provided with electronic access control.

8.10.8 Available Indications

Point addressable smoke detection is provided for Cable Chase 3505. Upon detector activation, main fire alarm panel KC-008, located in the Control Room, will annunciate a fire alarm condition with a descriptive location of the detector in alarm. This will likely be the first indication of a fire event within the cable chase.

To diagnose spurious operation of containment spray, the pump breaker status indication, containment spray flow indication, containment pressure indication, or RWST level indication needs to be available. The following instrumentation is unaffected by the fire and is available to assist Control Room diagnosis of spurious containment spray actuation:

• RWST level indicators BNLI0930 and BNLI0932.

• Containment pressure indicators GNPI0935 and GNPI0937.

8.10.9 <u>Communications</u>

A fire in this area could affect the Gaitronics and 900 MHz radio systems. The OMA does not require constant communication with the Control Room. As previously discussed, the operator assigned OFN KC-016 OMA duty will report to the Control Room for instruction following fire brigade callout. This approach allows the Control Room operators to provide face-to-face direction for the OMA. Once the OMA has been implemented, the operator can physically report back to the Control Room for further direction, if the Gaitronics or radio system functionality is affected by the fire.

8.10.10 Portable Equipment

No portable equipment or tools, beyond those required to be carried by the designated OMA operator, are necessary to perform the specified OMA. Key access may be necessary for electronic card reader controlled doors if the fire affects electronic door control. As previously identified, the OFN KC-016 OMA designated operator is required to carry a master key.

8.10.11 Personnel Protection Equipment

Opening of breaker NB0203 requires donning of electrical safety gear to protect against potential arc flash. This PPE is located within Fire Area C-10, where the OMA is performed.

No other personnel protective equipment, beyond that normally necessary for Auxiliary or Control Building access, is required to perform the OMA.

8.10.12 Procedures and Training

The OMA is identified in OFN KC-016. See Section 5.1.12 for further discussion addressing the fire response procedure.

8.10.13 Staffing

The operator assigned OFN KC-016 OMA duty for the shift is responsible for performing the OMA. Only one person is required to perform the OMA.

8.10.14 Demonstrations

The OMA was timed using multiple operators, each starting from the Work Control Center (3613) on the 2047' elevation of the Communications Corridor. The timing effort reflected that the OMA could be consistently performed within six (6) minutes. This included time to don electrical safety PPE. In addition, the following uncertainty times

have been included, resulting in a total uncertainty time of seven (7) minutes.

- Communication and feedback with Control Room 1 minute
- Electronically controlled door key access 3 minutes
- Human centered uncertainty 3 minutes

8.10.15 Defense-In-Depth

1. Fire Prevention

The objective of fire prevention is not affected by the OMA. The area of the plant where the fire could occur, necessitating OMA implementation, has combustible loading allowances and hot work limitations that are consistent with other plant areas important to safety. Additionally, the cable chase is normally locked, which prevents general access to the area.

2. Detect, Control, and Extinguish Fires

This objective is not affected by the OMA. Smoke detection and wet pipe sprinkler protection are provided for the area. Fire alarm annunciation is provided locally, and within the Control Room. Smoke detection is point addressable, allowing for prompt recognition of fire location. The sprinkler system will aid in controlling the fire event until manual suppression can be applied, as necessary. Fire extinguishers and hose stations are provided in the adjacent area for manual fire fighting.

3. Protection of SSCs so that Fires Will Not Prevent Safe Shutdown

Historically, this objective has been deterministically satisfied by conforming to the requirements of 10 CFR 50 Appendix R, Sections III.G.1 or III.G.2. The subject OMA is utilized in lieu of III.G.2 protection to ensure a fire in C-23 does not challenge PFSSD.

8.10.16 <u>Conclusion</u>

The above analysis and time-authenticated demonstrations provide reasonable assurance that the OMA for Fire Area C-23 is dependable, reliable, and can be consistently performed within the required Available Time. A thirty four (34) minute time margin remains, when applying uncertainty elements to ensure OMA reliability. Post-fire safe shutdown capability is maintained with no unacceptable loss of RWST inventory. Therefore, the OMA is considered both feasible and reliable.

8.11 Fire Area C-24, Control Building 2032' North Cable Chase

8.11.1 Fire Area Features

Fire Area C-24 is a single room (3504) cable chase located on the 2032' elevation of the Control Building. The chase contains cable and normal room lighting only. It is separated from adjacent areas by 3-hour fire rated barriers. Smoke detection and wet pipe sprinkler protection are provided for the area. No natural or forced ventilation is provided for the fire area. General access to the cable chase is restricted by a normally locked fire door.

8.11.2 Spurious Equipment Operation Requiring Operator Manual Action

Cables associated with letdown isolation valves BGLCV0459 and BGLCV0460 may be damaged, preventing these valves from being closed from the Control Room. PFSSD requires one of these valves to be closed to ensure adequate charging flow.

This spurious equipment operation is Important to Safe Shutdown, as letdown is not required for PFSSD. However, letdown isolation is required to prevent RCS flow diversion. This event is a multiple spurious equipment operation from a PFSSD perspective, as the fire-induced maloperation involves two series valves in the chemical and volume control system.

Atmospheric relief valve (ARV) ABPV0001 could spuriously open as a result of a C-24 fire. Thermal hydraulic analysis WCNOC-CP-002 determined that no operator action is required to achieve and maintain hot standby with a spuriously open ARV. However, the thermal hydraulic analysis determined that a spuriously open ARV concurrent with letdown does affect the available time for isolating letdown.

Containment spray pump PEN01A could spuriously start and discharge valve ENHV0006 could spuriously open due to fire induced cable damage. This would result in containment spray actuation. Containment spray is an Important to Safe Shutdown spurious equipment operation, as the event would divert RWST inventory to the containment sump. This is a multiple spurious operation scenario from a PFSSD perspective, as two fire induced component maloperation events are required before containment spray would be spuriously actuated.

8.11.3 Operator Manual Action Description

Valves BGLCV0459 and BGLCV0460 can be isolated by closing instrument air supply valve KAV0201 located in the South Pipe Penetration Room on the 2000' elevation of the Auxiliary Building (Reference Attachment C, Photo C-1). This removes air to BGLCV0459, BGLCV0460, and all air operated components within the Reactor Building. Historical performance of STS KJ-001A, which isolates instrument air to the Reactor Building, reveals that BGLCV0459 and

BGLCV0460 will fail closed within three (3) minutes following isolation of instrument air. This is a Reactive OMA.

Containment spray pump PEN01A can be stopped by opening breaker NB0102. The breaker is located on 4.16 KV bus NB01 within the Control Building 2000' north ESF Switchgear Room (Fire Area C-9). Refer to Attachment C, Photo C-7, for a photograph of the respective breaker. This is a Reactive OMA.

8.11.4 Feasibility Analysis of Time Available to Perform Manual Actions

Figure 8.11.4-1 reflects the OMA timeline for closing BGLCV0459 and BGLCV0460 and opening breaker NB0102. The identified times are based on the following:

Fire Initiated - This is the initiating event, which occurs at time zero.

Fire Indicated – A one (1) minute detection response time is utilized based on the Attachment B1 application of NUREG-1805 for smoke detector response. However, C-24 contains only one smoke detector within the cable chase. Therefore, physical confirmation of the fire event is necessary. This confirmation is postulated to take up to five (5) minutes following receipt of the initial fire alarm indication in the Control Room. This increases the total fire detected time to six (6) minutes.

Diagnosis Time – A seven (7) minute diagnosis time is utilized based on Section 5.1.14.1.

OMA Implementation Time – Implementation sequence for the two OMAs will be based on Control Room diagnosis. The conservative approach from a feasibility and reliability timing perspective is to postulate that letdown isolation is addressed second in the sequence of OMA events. This is conservative since letdown has a more restrictive available time for OMA implementation.


A six (6) minute operator action time is utilized for opening NB0102, based on the demonstrated OMA walkdown time documented in Section 8.11.14.

A fifteen (15) minute operator action time is utilized for isolating KAV0201, based on the demonstrated OMA walkdown time documented in Section 8.11.14.

OMA Uncertainty Time – A thirteen (13) minute OMA uncertainty time is utilized based on Section 8.11.14.

Available Time – Thermal hydraulic analysis WCNOC-CP-002 identifies when letdown is open, concurrent with spuriously open atmospheric relief valve related cooling, letdown can remain open for fifty (50) minutes, without adverse consequence to reactor performance.

E-1F9910 identifies that containment spray can operate for sixty (60) minutes before RWST level will be below that required for cold shutdown.

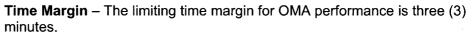

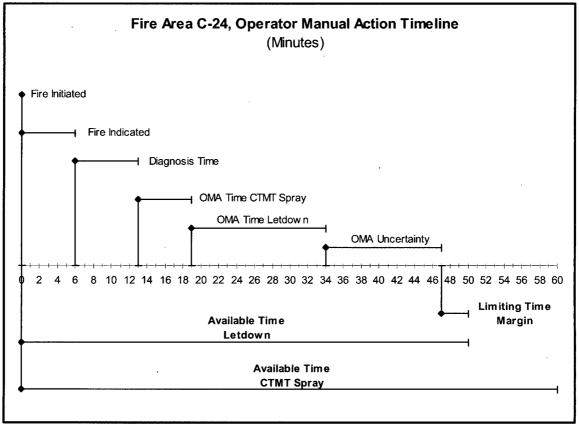


Figure 8.11.4-1, Fire Area C-24 OMA Timeline

8.11.5 Reliability Analysis of Time Available to Perform Manual Actions

As discussed in Section 5.1.5, an OMA is considered reliable provided that a Time Margin remains when applying Fire Indicated Time, Diagnosis Time, OMA Implementation Time, and OMA Uncertainty Time, within the OMA event timeline. The OMA Timeline for Fire Area C-24 reveals that a three (3) minute time margin remains for the most limiting OMA. Application of the uncertainty time provides reasonable assurance that the OMAs are dependable, reliable, and can be performed with a high rate of success.

8.11.6 Environmental Factors

Habitable environmental conditions will be present for performance of the OMAs. The postulated fire event is within Cable Chase 3504 located on the 2032' elevation of the Control Building. The location of the OMA for isolating KAV0201 is in an adjacent structure on the 2000' elevation of the Auxiliary Building, within the south Pipe Penetration Room. The location of the OMA for stopping PEN01A containment spray is located on the 2000' elevation of the Control Building, within the north ESF Switchgear Room.

The fire will be confined to the Fire Area C-24 Cable Chase of origin, which contains no ventilation openings. The travel path and location of the equipment requiring manipulation are physically separated from the fire by multiple fire rated barriers, ensuring that smoke propagation and fire fighting activities will not present an egress impediment.

Emergency lighting is provided for illumination of potential egress paths, the emergency equipment cabinet necessitating access for retrieval of personal protective equipment, and the components requiring OMA manipulation. Normal radiation, temperature, and humidity conditions within the OMA areas will not be adversely affected by the fire and subsequent spurious equipment operation.

There are no physical impediments in proximity to the manual action components that would significantly delay or prevent required manipulation. No special equipment, related to environmental condition, is necessary for performance of the OMAs.

8.11.7 Equipment Functionality and Accessibility

No equipment support functions are required for successful manual action implementation. The OMA components are physically separated from the fire event by several fire rated barriers. This ensures that the credited equipment is not adversely affected by the fire and its effects.

The operator responsible for OFN KC-016 OMAs carries a master key that can be used to open electronically controlled doors in the event that the fire has negatively affected the normal card key access means. All electronically controlled doors are provided with this secondary access arrangement. This ensures that the postulated fire will not prevent egress through doors provided with electronic access control.

8.11.8 <u>Available Indications</u>

Point addressable smoke detection is provided for Cable Chase 3504. Upon detector activation, main fire alarm panel KC-008, located in the Control Room, will annunciate a fire alarm condition with a descriptive location of the detector in alarm. This will likely be the first indication of a fire event within the cable chase.

To diagnose a failure of BGLCV0459 and BGLCV0460 to close, valve position indication or appropriate level indication needs to be available. The following instrumentation is unaffected by the fire and is available to assist Control Room diagnosis of BGLCV0459 and BGLCV0460 failure to close:

- Pressurizer level indicator BBLI0460A
- VCT level indicator BGLI0185.

To diagnose spurious operation of containment spray, the pump breaker status indication, containment spray flow indication, containment pressure

indication, or RWST level indication needs to be available. The following instrumentation is unaffected by the fire and is available to assist Control Room diagnosis of spurious containment spray actuation:

- RWST level indicators BNLI0931 and BNLI933.
- Containment pressure indicators GNPI0934 and GNPI0936.

8.11.9 Communications

A fire in this area could affect the Gaitronics system. The 900 MHz radio communication system is unaffected by the fire. The OMAs do not require constant communication with the Control Room. After initially reporting to the Control Room, the operator will receive face-to-face direction regarding OMA implementation. The operator may then use the radio system as necessary, or report directly back to the Control Room for further instruction.

8.11.10 Portable Equipment

KAV0201 is located approximately 10' above the floor. Access to a portable ladder for OMA implementation is available. No other portable equipment or tools, beyond those required to be carried by the designated OMA operator, are necessary to perform the specified OMA. Key access may be necessary for electronic card reader controlled doors if the fire affects electronic door control. As previously identified, the OFN KC-016 OMA designated operator is required to carry a master key.

8.11.11 Personnel Protection Equipment

Opening of breaker NB0102 requires donning of electrical safety gear to protect against potential arc flash. This PPE is located within Fire Area C-10, which is adjacent to the room where the OMA is performed.

No other personnel protective equipment, beyond that normally necessary for Auxiliary or Control Building access, is required to perform the OMAs.

8.11.12 Procedures and Training

The OMAs are identified in OFN KC-016. See Section 5.1.12 for further discussion addressing the fire response procedure.

8.11.13 Staffing

The operator assigned OFN KC-016 OMA duty for the shift is responsible for performing the OMAs. Only one person is required to perform the OMAs.

8.11.14 Demonstrations

The OMAs were timed using multiple operators, each starting from the Work Control Center (3613) on the 2047' elevation of the Communications Corridor.

The timing effort reflected that the OMA for opening NB0102 could be implemented in six (6) minutes. This included time for donning electrical safety PPE.

The timing effort reflected that the OMA for isolating KAV0201 could be consistently performed within nine (9) minutes. This included time to obtain a ladder to reach KAV0201. The three (3) minute delay for BGLCV0459 and BGLCV0460 closure following the isolation of instrument air is also factored into the overall OMA implementation time. Additionally, three (3) minutes is included in the OMA time for the operator to return to the Control Room after opening breaker NB0102. This is conservative, as radio communication will be available. The resulting cumulative OMA implementation time for KAV0201 is fifteen (15) minutes.

In addition, the following uncertainty times have been included, resulting in a total uncertainty time of thirteen (13) minutes.

- Communication and feedback with Control Room 2 minutes
- Electronically controlled door key access 3 minutes
- Obtain RCA access 2 minutes
- Human centered uncertainty 3 minutes
- Delay in obtaining and setting up ladder 3 minutes

8.11.15 Defense-In-Depth

1. Fire Prevention

The objective of fire prevention is not affected by the OMAs. The area of the plant where the fire could occur, necessitating OMA implementation, has combustible loading allowances and hot work limitations that are consistent with other plant areas important to safety. Additionally, the cable chase is normally locked, which prevents general access to the area.

2. Detect, Control, and Extinguish Fires

This objective is not affected by the OMAs. Smoke detection and wet pipe sprinkler protection are provided for the area. Fire alarm annunciation is provided locally, and within the Control Room. Smoke detection is point addressable, allowing for prompt recognition of fire location. The sprinkler system will aid in controlling the fire event until manual suppression can be applied,

as necessary. Fire extinguishers and hose stations are provided in the adjacent area for manual fire fighting.

3. Protection of SSCs so that Fires Will Not Prevent Safe Shutdown

Historically, this objective has been deterministically satisfied by conforming to the requirements of 10 CFR 50 Appendix R, Sections III.G.1 or III.G.2. The subject OMAs are utilized in lieu of III.G.2 protection to ensure a fire in C-24 does not challenge PFSSD.

8.11.16 <u>Conclusion</u>

The above analysis and time-authenticated demonstrations provide reasonable assurance that the OMA for Fire Area C-24 is dependable, reliable, and can be consistently performed within the required Available Time. A three (3) minute time margin remains for the most limiting OMA, when applying uncertainty elements to ensure OMA reliability. Post-fire safe shutdown capability is maintained with no adverse reactor thermal performance or unacceptable loss of RWST inventory. Therefore, the OMAs are considered both feasible and reliable.

8.12 Fire Area C-30, Control Building 2047'-6" Cable Chase

8.12.1 Fire Area Features

Fire Area C-30 is a single room (3617) cable chase located on the 2047'-6" elevation of the Control Building. The chase contains cable and normal room lighting only. It is separated from adjacent areas by 3-hour fire rated barriers. Smoke detection and wet pipe sprinkler protection are provided for the area. No natural or forced ventilation is provided for the fire area. General access to the cable chase is restricted by a normally locked fire door.

8.12.2 Spurious Equipment Operation Requiring Operator Manual Action

Containment spray pump PEN01B could spuriously start and discharge valve ENHV0012 could spuriously open due to fire induced cable damage. This would result in containment spray actuation. Containment spray is an Important to Safe Shutdown spurious equipment operation, as the event would divert RWST inventory to the containment sump. This is a multiple spurious operation scenario from a PFSSD perspective, as two fire induced component maloperation events are required before containment spray would be spuriously actuated.

8.12.3 Operator Manual Action Description

Containment spray pump PEN01B can be stopped by opening breaker NB0203. The breaker is located on 4.16 KV bus NB02 within the Control Building 2000' south ESF Switchgear Room (Fire Area C-10). Refer to Attachment C, Photo C-8, for photograph of the respective breaker. This is a Reactive OMA.

8.12.4 Feasibility Analysis of Time Available to Perform Manual Actions

Figure 8.12.4-1 reflects the OMA timeline in response to spurious containment spray actuation. The identified times are based on the following:

Fire Initiated - This is the initiating event, which occurs at time zero.

Fire Indicated – A nine (9) minute detection response time is utilized based on the Attachment B1 application of NUREG-1805 for smoke detector response. However, C-30 contains only one smoke detector within the cable chase. Therefore, physical confirmation of the fire event is necessary. This confirmation is postulated to take up to five (5) minutes following receipt of the initial fire alarm indication in the Control Room. This increases the total fire detected time to fourteen (14) minutes.

Diagnosis Time – A seven (7) minute diagnosis time is utilized based on Section 5.1.14.1.

OMA Implementation Time – A six (6) minute operator implementation time is utilized based on the demonstrated OMA walkdown time documented in Section 8.12.14.

OMA Uncertainty Time – A seven (7) minute OMA uncertainty time is utilized based on Section 8.12.14.

Available Time – E-1F9910 identifies that containment spray can operate for sixty (60) minutes before RWST level will be below that required for cold shutdown.

Time Margin – The time margin for OMA performance is twenty six (26) minutes.

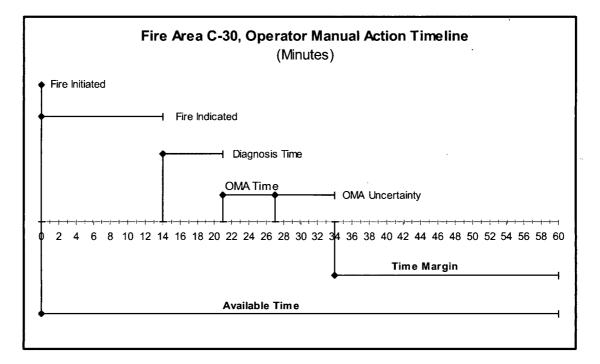


Figure 8.12.4-1, Fire Area C-30 OMA Timeline

8.12.5 Reliability Analysis of Time Available to Perform Manual Actions

As discussed in Section 5.1.5, an OMA is considered reliable provided that a Time Margin remains when applying Fire Indicated Time, Diagnosis Time, OMA Implementation Time, and OMA Uncertainty Time, within the OMA event timeline. The OMA Timeline for Fire Area C-30 reveals that a twenty six (26) minute time margin remains. Application of the uncertainty time provides reasonable assurance that the OMA is dependable, reliable, and can be performed with a high rate of success.

8.12.6 Environmental Factors

Habitable environmental conditions will be present for performance of the OMA. The postulated fire event is within Cable Chase 3617 located on the 2047' elevation of the Control Building. The location of the OMA for

stopping PEN01B containment spray is located on the 2000' elevation of the Control Building within the south ESF Switchgear Room.

The fire will be confined to the Fire Area C-30 Cable Chase of origin, which contains no ventilation openings. The travel path and location of the equipment requiring manipulation are physically separated from the fire by multiple fire rated barriers. The access door for the cable chase opens to the back of the Control Room in the equipment cabinet area. The OMA operator will be present in the Control Room in order to receive OMA implementation direction. Manual fire fighting efforts, if necessary, will require periodic opening of the cable chase door. However, the smoke propagation review documented in Section 5.1.6 determined that OMA implementation would not be impeded by smoke migration from the fire event.

Emergency lighting is provided for illumination of potential egress paths, the component requiring OMA manipulation, and emergency equipment cabinet necessitating access for retrieval of personal protective equipment. Normal radiation, temperature, and humidity conditions will not be adversely affected by the fire and subsequent spurious equipment operation.

There are no physical impediments in proximity to the manual action component that would significantly delay or prevent required manipulation. No special equipment, related to environmental condition, is necessary for performance of the OMA.

8.12.7 Equipment Functionality and Accessibility

No equipment support functions are required for successful manual action implementation. The component requiring manipulation is an electrical breaker. The breaker is readily accessible for manipulation. It is physically separated from the fire event by several fire rated barriers. This ensures that the credited equipment is not adversely affected by the fire and its effects.

The operator responsible for OFN KC-016 OMAs carries a master key that can be used to open electronically controlled doors in the event that the fire has negatively affected the normal card key access means. All electronically controlled doors are provided with this secondary access arrangement. This ensures that the postulated fire will not prevent egress through doors provided with electronic access control.

8.12.8 Available Indications

Point addressable smoke detection is provided for Cable Chase 3617. Upon detector activation, main fire alarm panel KC-008, located in the Control Room, will annunciate a fire alarm condition with a descriptive location of the detector in alarm. This will likely be the first indication of a fire event within the cable chase.

To diagnose spurious operation of containment spray, the pump breaker status indication, containment spray flow indication, containment pressure

indication, or RWST level indication needs to be available. The following instrumentation is unaffected by the fire and is available to assist Control Room diagnosis of spurious containment spray actuation:

- RWST level indicators BNLI0930 and BNLI0932.
- Containment pressure indicators GNPI0935 and GNPI0937.

8.12.9 <u>Communications</u>

A fire in this area could affect the Gaitronics system. The 900 MHz radio communication system is unaffected by the fire. The OMA does not require constant communication with the Control Room. After initially reporting to the Control Room, the operator will receive face-to-face direction regarding OMA implementation. The operator may then use the radio system as necessary, or report directly back to the Control Room for further instruction.

8.12.10 Portable Equipment

No portable equipment or tools, beyond those required to be carried by the designated OMA operator, are necessary to perform the specified OMA. Key access may be necessary for electronic card reader controlled doors if the fire affects electronic door control. As previously identified, the OFN KC-016 OMA designated operator is required to carry a master key and wire cutters.

8.12.11 <u>Personnel Protection Equipment</u>

Opening of breaker NB0203 requires donning of electrical safety gear to protect against potential arc flash. This PPE is located within Fire Area C-10, where the OMA is performed.

No other personnel protective equipment, beyond that normally necessary for Control Building access, is required to perform the OMAs.

8.12.12 Procedures and Training

The OMA is identified in OFN KC-016. See Section 5.1.12 for further discussion addressing the fire response procedure.

8.12.13 Staffing

The operator assigned OFN KC-016 OMA duty for the shift is responsible for performing the OMA. Only one person is required to perform the OMA.

8.12.14 Demonstrations

The OMA was timed using multiple operators, each starting from the Work Control Center (3613) on the 2047' elevation of the Communications Corridor. The timing effort reflected that the OMA could be consistently performed within six (6) minutes. This included time to don electrical safety PPE. In addition, the following uncertainty times have been included, resulting in a total uncertainty time of seven (7) minutes.

- Communication and feedback with Control Room 1 minute
- Electronically controlled door key access 3 minutes
- Human centered uncertainty 3 minutes

8.12.15 Defense-In-Depth

1. Fire Prevention

The objective of fire prevention is not affected by the OMA. The area of the plant where the fire could occur, necessitating OMA implementation, has combustible loading allowances and hot work limitations that are consistent with other plant areas important to safety. Additionally, the cable chase is normally locked, which prevents general access to the area.

2. Detect, Control, and Extinguish Fires

This objective is not affected by the OMA. Smoke detection and wet pipe sprinkler protection are provided for the area. Fire alarm annunciation is provided locally, and within the Control Room. Smoke detection is point addressable, allowing for prompt recognition of fire location. The sprinkler system will aid in controlling the fire event until manual suppression can be applied, as necessary. Fire extinguishers and hose stations are provided in the adjacent area for manual fire fighting.

3. Protection of SSCs so that Fires Will Not Prevent Safe Shutdown

Historically, this objective has been deterministically satisfied by conforming to the requirements of 10 CFR 50 Appendix R, Sections III.G.1 or III.G.2. The subject OMA is utilized in lieu of III.G.2 protection to ensure a fire in C-30 does not challenge PFSSD.

8.12.16 Conclusion

The above analysis and time-authenticated demonstrations provide reasonable assurance that the OMAs for Fire Area C-30 are dependable, reliable, and can be consistently performed within the required Available Time. A twenty six (26) minute time margin remains, when applying uncertainty elements to ensure OMA reliability. Post-fire safe shutdown capability is maintained with no unacceptable loss of RWST inventory. Therefore, the OMA is considered both feasible and reliable.

8.13 Fire Area C-33, Control Building 2073'-6" South Cable Chase

8.13.1 Fire Area Features

Fire Area C-33 is a single room (3804) cable chase located on the 2073'-6" elevation of the Control Building. The chase contains cable and normal room lighting only. It is separated from adjacent areas by 3-hour fire rated barriers. Smoke detection and wet pipe sprinkler protection are provided for the area. No natural or forced ventilation is provided for the fire area. General access to the cable chase is restricted by a normally locked fire door.

8.13.2 Spurious Equipment Operation Requiring Operator Manual Action

Containment spray pump PEN01B could spuriously start and discharge valve ENHV0012 could spuriously open due to fire induced cable damage. This would result in containment spray actuation. Containment spray is an Important to Safe Shutdown spurious equipment operation, as the event would divert RWST inventory to the containment sump. This is a multiple spurious operation scenario from a PFSSD perspective, as two fire induced component maloperation events are required before containment spray would be spuriously actuated.

8.13.3 Operator Manual Action Description

Containment spray pump PEN01B can be stopped by opening breaker NB0203. The breaker is located on 4.16 KV bus NB02 within the Control Building 2000' south ESF Switchgear Room (Fire Area C-10). Refer to Attachment C, Photo C-8, for photograph of the respective breaker. This is a Reactive OMA.

8.13.4 <u>Feasibility Analysis of Time Available to Perform Manual Actions</u>

Figure 8.13.4-1 reflects the OMA timeline in response to spurious containment spray actuation. The identified times are based on the following:

Fire Initiated - This is the initiating event, which occurs at time zero.

Fire Indicated – A one (1) minute detection response time is utilized based on the Attachment B1 application of NUREG-1805 for smoke detector response. However, C-33 contains only one smoke detector within the cable chase. Therefore, physical confirmation of the fire event is necessary. This confirmation is postulated to take up to five (5) minutes following receipt of the initial fire alarm indication in the Control Room. This increases the total fire detected time to six (6) minutes.

Diagnosis Time – A seven (7) minute diagnosis time is utilized based on Section 5.1.14.1.

OMA Implementation Time – A six (6) minute operator implementation time is utilized based on the demonstrated OMA walkdown time documented in Section 8.13.14.

OMA Uncertainty Time – A seven (7) minute OMA uncertainty time is utilized based on Section 8.13.14.

Available Time – E-1F9910 identifies that containment spray can operate for sixty (60) minutes before RWST level will be below that required for cold shutdown.

Time Margin – The time margin for OMA performance is thirty four (34) minutes.

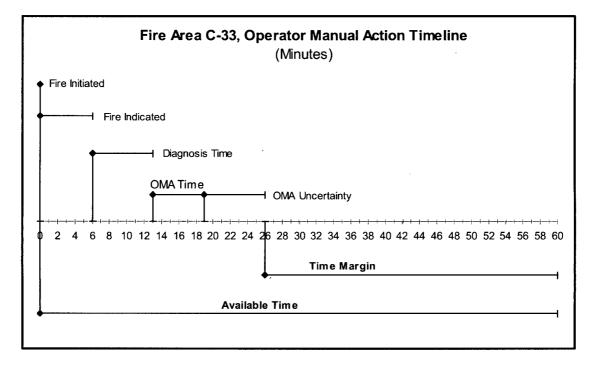


Figure 8.13.4-1, Fire Area C-33 OMA Timeline

8.13.5 Reliability Analysis of Time Available to Perform Manual Actions

As discussed in Section 5.1.5, an OMA is considered reliable provided that a Time Margin remains when applying Fire Indicated Time, Diagnosis Time, OMA Implementation Time, and OMA Uncertainty Time, within the OMA event timeline. The OMA Timeline for Fire Area C-33 reveals that a thirty four (34) minute time margin remains. Application of the uncertainty time provides reasonable assurance that the OMA is dependable, reliable, and can be performed with a high rate of success.

8.13.6 Environmental Factors

Habitable environmental conditions will be present for performance of the OMA. The postulated fire event is within Cable Chase 3804 located on the 2073'-6" elevation of the Control Building. The location of the OMA for stopping PEN01B containment spray is on the 2000' elevation of the Control Building within the south ESF Switchgear Room.

The fire will be confined to the Fire Area C-33 Cable Chase of origin, which contains no ventilation openings. The travel path and location of the equipment requiring manipulation are physically separated from the fire by multiple fire rated barriers, ensuring that smoke propagation and fire fighting activities will not present an egress impediment.

Emergency lighting is provided for illumination of potential egress paths, the component requiring OMA manipulation, and the emergency equipment cabinet necessitating access for retrieval of personal protective equipment. Normal radiation, temperature, and humidity conditions will not be adversely affected by the fire and subsequent spurious equipment operation.

There are no physical impediments in proximity to the manual action component that would significantly delay or prevent required manipulation. No special equipment, related to environmental condition, is necessary for performance of the OMA.

8.13.7 Equipment Functionality and Accessibility

No equipment support functions are required for successful manual action implementation. The component requiring manipulation is an electrical breaker. The breaker is readily accessible for manipulation. It is physically separated from the fire event by several fire rated barriers. This ensures that the credited equipment is not adversely affected by the fire and its effects.

The operator responsible for OFN KC-016 OMAs carries a master key that can be used to open electronically controlled doors in the event that the fire has negatively affected the normal card key access means. All electronically controlled doors are provided with this secondary access arrangement. This ensures that the postulated fire will not prevent egress through doors provided with electronic access control.

8.13.8 Available Indications

Point addressable smoke detection is provided for Cable Chase 3804. Upon detector activation, main fire alarm panel KC-008, located in the Control Room, will annunciate a fire alarm condition with a descriptive location of the detector in alarm. This will likely be the first indication of a fire event within the cable chase.

To diagnose spurious operation of containment spray, the pump breaker status indication, containment spray flow indication, containment pressure

indication, or RWST level indication needs to be available. The following instrumentation is unaffected by the fire and is available to assist Control Room diagnosis of spurious containment spray actuation:

- RWST level indicators BNLI0930 and BNLI0932.
- Containment pressure indicators GNPI0935 and GNPI0937.

8.13.9 Communications

A fire in this area could affect the Gaitronics system. The 900 MHz radio communication system is unaffected by the fire. The OMA does not require constant communication with the Control Room. After initially reporting to the Control Room, the operator will receive face-to-face direction regarding OMA implementation. The operator may then use the radio system as necessary, or report directly back to the Control Room for further instruction.

8.13.10 Portable Equipment

No portable equipment or tools, beyond those required to be carried by the designated OMA operator, are necessary to perform the specified OMA. Key access may be necessary for electronic card reader controlled doors if the fire affects electronic door control. As previously identified, the OFN KC-016 OMA designated operator is required to carry a master key and wire cutters.

8.13.11 <u>Personnel Protection Equipment</u>

Opening of breaker NB0203 requires donning of electrical safety gear to protect against potential arc flash. This PPE is located within Fire Area C-10, where the OMA is performed.

No other personnel protective equipment, beyond that normally necessary for Control Building access, is required to perform the OMAs.

8.13.12 Procedures and Training

The OMA is identified in OFN KC-016. See Section 5.1.12 for further discussion addressing the fire response procedure.

8.13.13 Staffing

The operator assigned OFN KC-016 OMA duty for the shift is responsible for performing the OMA. Only one person is required to perform the OMA.

8.13.14 <u>Demonstrations</u>

The OMA was timed using multiple operators, each starting from the Work Control Center (3613) on the 2047' elevation of the Communications Corridor. The timing effort reflected that the OMA could be consistently performed within six (6) minutes. This included time to don electrical safety PPE. In addition, the following uncertainty times have been included, resulting in a total uncertainty time of seven (7) minutes.

- Communication and feedback with Control Room 1 minute
- Electronically controlled door key access 3 minutes
- Human centered uncertainty 3 minutes

8.13.15 Defense-In-Depth

1. Fire Prevention

The objective of fire prevention is not affected by the OMA. The area of the plant where the fire could occur, necessitating OMA implementation, has combustible loading allowances and hot work limitations that are consistent with other plant areas important to safety. Additionally, the cable chase is normally locked, which prevents general access to the area.

2. Detect, Control, and Extinguish Fires

This objective is not affected by the OMA. Smoke detection and wet pipe sprinkler protection are provided for the area. Fire alarm annunciation is provided locally, and within the Control Room. Smoke detection is point addressable, allowing for prompt recognition of fire location. The sprinkler system will aid in controlling the fire event until manual suppression can be applied, as necessary. Fire extinguishers and hose stations are provided in the adjacent area for manual fire fighting.

3. Protection of SSCs so that Fires Will Not Prevent Safe Shutdown

Historically, this objective has been deterministically satisfied by conforming to the requirements of 10 CFR 50 Appendix R, Sections III.G.1 or III.G.2. The subject OMA is utilized in lieu of III.G.2 protection to ensure a fire in C-33 does not challenge PFSSD.

8.13.16 Conclusion

The above analysis and time-authenticated demonstrations provide reasonable assurance that the OMA for Fire Area C-33 is dependable, reliable, and can be consistently performed within the required Available Time. A thirty four (34) minute time margin remains, when applying uncertainty elements to ensure OMA reliability. Post-fire safe shutdown capability is maintained with no unacceptable loss of RWST inventory. Therefore, the OMA is considered both feasible and reliable.

8.14 Fire Area RB, Reactor Building General Area

8.14.1 Fire Area Features

Fire Area RB is all elevations of the Reactor Building. The 4-foot-thick Reactor Building walls serve as the fire barrier separation from adjacent Buildings. There are no fire rated barriers walls or floors internal to the Reactor Building, though substantial barrier and spatial separation are provided within the building. Linear heat detection is installed above each reactor coolant pump and in areas where cable trays are concentrated. Duct smoke detection is provided for each containment cooler. A fixed, manually charged, closed head sprinkler system is provided for the north and south cable penetration areas on the 2026' elevation.

8.14.2 Spurious Equipment Operation Requiring Operator Manual Action

Cables associated with letdown isolation valves BGLCV0459 and BGLCV0460 may be damaged, preventing these valves from being closed from the Control Room. PFSSD requires one of these valves to be closed to ensure adequate charging flow.

This spurious equipment operation is Important to Safe Shutdown, as letdown is not required for PFSSD. However, letdown isolation is required to prevent RCS flow diversion. This event is a multiple spurious equipment operation from a PFSSD perspective, as the fire-induced maloperation involves two series valves in the chemical and volume control system.

Cables associated with excess letdown isolation valves BGHV8153A and BGHV8154A may be damaged, preventing these valves from being closed from the Control Room. Thermal hydraulic analysis WCNOC-CP-002 reveals that these valves may remain open, with no adverse impact to PFSSD, provided letdown is isolated within one hundred twenty (120) minutes.

8.14.3 Operator Manual Action Description

Valves BGLCV0459 and BGLCV0460 can be isolated by closing instrument air supply valve KAV0201 located in the South Pipe Penetration Room on the 2000' elevation of the Auxiliary Building (Reference Attachment, C Photo C-1). This removes air to BGLCV0459, BGLCV0460, and all air operated components within the Reactor Building. Historical performance of STS KJ-001A, which isolates instrument air to the Reactor Building, reveals that BGLCV0459 and BGLCV0460 will fail closed within three (3) minutes following isolation of instrument air. This is a Reactive OMA.

8.14.4 <u>Feasibility Analysis of Time Available to Perform Manual Actions</u>

Figure 8.14.4-1 reflects the OMA timeline for closing BGLCV0459 and BGLCV0460. The identified times are based on the following:

Fire Initiated - This is the initiating event, which occurs at time zero.

Fire Indicated – Total coverage fire alarm detection is not provided for the Reactor Building. The majority of the detection provided responds to thermal change due to fire and not the smoke products of combustion (duct smoke detection is provided for the containment coolers). Thermal detection typically responds to a fire event slower than smoke detection. Additionally, the Reactor Building is not normally occupied and is not as readily accessible as the Control or Auxiliary Buildings. Therefore, the time for Reactor Building fire indication is postulated to be up to sixty (60) minutes. This is a conservatively reasonable time as a fire that adversely affects all letdown/excess letdown isolation valves would be of significant severity that fire detection would occur within sixty (60) minutes.

Diagnosis Time – A seven (7) minute diagnosis time is utilized based on Section 5.1.14.1.

OMA Implementation Time – A twelve (12) minute operator action time is utilized based on the demonstrated OMA walkdown time documented in Section 8.14.14.

OMA Uncertainty Time – A twelve (12) minute OMA uncertainty time is utilized based on Section 8.14.14.

Available Time – Thermal hydraulic analysis WCNOC-CP-002 identifies that when both letdown and excess letdown flow diversion events are active concurrently, excess letdown may remain open provided letdown is isolated in one hundred and twenty (120) minutes. Implementation within the Available Time ensures there will be no adverse consequence to reactor performance.

Due to substantial spatial separation between cables and the valves of concern, it is unlikely that a fire event would involve the maloperation of all isolation valves associated with letdown and excess letdown. However, from an OMA timeline perspective, it is conservatively assumed that all excess letdown and letdown isolation valves are simultaneously affected by the same fire, since the literal separation of requirements of 10 CFR 50 Appendix R Section III.G.2 are not fully satisfied.

Time Margin – The time margin for OMA performance is twenty nine (29) minutes.

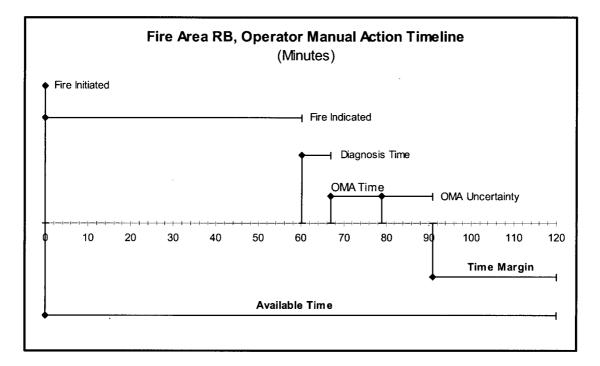


Figure 8.14.4-1, Fire Area RB OMA Timeline

8.14.5 <u>Reliability Analysis of Time Available to Perform Manual Actions</u>

As discussed in Section 5.1.5, an OMA is considered reliable provided that a Time Margin remains when applying Fire Indicated Time, Diagnosis Time, OMA Implementation Time, and OMA Uncertainty Time, within the OMA event timeline. The OMA Timeline for Fire Area RB reveals that a twenty nine (29) minute time margin remains. Application of the uncertainty time provides reasonable assurance that the OMA is dependable, reliable, and can be performed with a high rate of success.

8.14.6 Environmental Factors

Habitable environmental conditions will be present for performance of the OMA. The postulated fire event is within Reactor Building. The location of the OMA is within the South Pipe Penetration Room on the 2000' elevation of the Auxiliary Building (Fire Area A-25). Based on fire barrier separation, the fire will be confined to Fire Area RB. Access to Fire Area A-25 does not require transition through Fire Area RB. The travel path and location of the equipment requiring manipulation are physically separated from the fire by rated fire barriers. The smoke propagation review documented in Section 5.1.6 determined that the described OMA implementation would not be impeded by smoke migration from the fire event.

Emergency lighting is provided for illumination of potential egress paths and the component requiring OMA manipulation. Normal radiation, temperature, and humidity conditions within the area of concern will not be adversely affected by the fire and subsequent spurious equipment operation. There are no physical impediments in proximity to the manual action component that would significantly delay or prevent required manipulation. No special equipment, related to environmental condition, is necessary for performance of the OMA.

8.14.7 Equipment Functionality and Accessibility

No equipment support functions are required for successful manual action implementation. The OMA component is physically separated from the fire event by a the Reactor Building external wall. This ensures that the credited equipment is not adversely affected by the fire and its effects.

The operator responsible for OFN KC-016 OMAs carries a master key that can be used to open electronically controlled doors in the event that the fire has negatively affected the normal card key access means. All electronically controlled doors are provided with this secondary access arrangement. This ensures that the postulated fire will not prevent egress through doors provided with electronic access control.

8.14.8 Available Indications

Point addressable duct smoke detection is provided for the containment coolers. Linear detection is provided for the reactor coolant pumps and areas with cable tray concentration. Upon detector activation, main fire alarm panel KC-008, located in the Control Room, will annunciate a fire alarm condition with a descriptive location of the alarm. This will likely be the first indication of a fire event within area.

To diagnose a failure of BGLCV0459 and BGLCV0460 to close, valve position indication or appropriate level indication needs to be available. The following instrumentation is unaffected by the fire and is available to assist Control Room diagnosis of BGLCV0459 and BGLCV0460 failure to close:

- Pressurizer level indicator BBLI0460A.
- VCT level indicators BGLI0112 and BGLI0185.

To diagnose a failure of the excess letdown valves, valve position indication of appropriate level indication needs to be available. The valve position indication cables are located in the same area of the Reactor Building as the valves, so position indication cannot be relied on. The excess letdown valves discharge to the Pressurizer Relief Tank (PRT) inside the Reactor Building. Since the PRT is also inside Reactor Building, its level indication could also be affected by the same fire. Therefore, there is no direct reliable indication of the failure for excess letdown to isolated. However, based on a thermal hydraulic analysis WCNOC-CP-002, a charging pump will adequately compensate for the loss of inventory from the one inch excess letdown line, which flows approximately 50 gpm at full reactor pressure. Pressurizer level indicator BBLI0460A will be available and both of the VCT level indicators, BGLI0112 and BGLI0185, will be available. However, as previously

identified, no action is required for excess letdown isolation to maintain hot standby, provided letdown is isolated in one hundred twenty (120) minutes.

8.14.9 <u>Communications</u>

A fire in this area could affect the Gaitronics and 900 MHz radio systems. This OMA does not require constant communication with the Control Room. As previously discussed, the operator assigned OFN KC-016 OMA duty will report to the Control Room for instruction following fire brigade callout. This approach allows the Control Room operators to provide face-to-face direction for the OMA. Once the OMA has been implemented, the operator can physically report back to the Control Room if the Gaitronics or radio system functionality are affected by the fire.

8.14.10 Portable Equipment

KAV0201 is located approximately 10' above the floor. Access to a portable ladder for OMA implementation is available. No other portable equipment or tools, beyond those required to be carried by the designated OMA operator, are necessary to perform the specified OMA. Key access may be necessary for electronic card reader controlled doors if the fire affects electronic door control. As previously identified, the OFN KC-016 OMA designated operator is required to carry a master key.

8.14.11 Personnel Protection Equipment

No other personnel protective equipment, beyond that normally necessary for Auxiliary Building access, is required to perform the OMA.

8.14.12 Procedures and Training

The OMA is identified in OFN KC-016. See Section 5.1.12 for further discussion addressing the fire response procedure.

8.14.13 Staffing

The operator assigned OFN KC-016 OMA duty for the shift is responsible for performing the OMA. Only one person is required to perform the OMA.

8.14.14 <u>Demonstrations</u>

The OMA was timed using multiple operators, each starting from the Work Control Center (3613) on the 2047' elevation of the Communications Corridor. The timing effort reflected that the OMA could be consistently performed within nine (9) minutes. This included time to obtain a ladder to reach KAV0201. The three (3) minute delay for BGLCV0459 and BGLCV0460 closure following the isolation of instrument air is also factored into the overall OMA implementation time. This results in a cumulative OMA implementation time of twelve (12)

minutes. In addition, the following uncertainty times have been included, resulting in a total uncertainty time of twelve (12) minutes.

- Communication and feedback with Control Room 1 minute
- Electronically controlled door key access 3 minutes
- Obtain RCA access 2 minutes
- Human centered uncertainty 3 minutes
- Delay in obtaining and setting up ladder 3 minutes

8.14.15 Defense-In-Depth

1. Fire Prevention

The objective of fire prevention is not affected by the OMA. The area of the plant where the fire could occur, necessitating OMA implementation, has combustible loading allowances and hot work limitations that are consistent with other plant areas important to safety. Additionally, the area is not normally occupied, which limits the potential for the introduction of transient fire hazards.

2. Detect, Control, and Extinguish Fires

Considering the conservative OMA timeline application for fire indication, this objective is not affected by the OMA. Linear heat detection is installed above each reactor coolant pump and in areas where cable trays are concentrated. Duct smoke detection is provided for each containment cooler. Fire alarm annunciation is provided locally, and within the Control Room. Alarms are zoned, allowing for prompt recognition of fire location.

A system is provided to collect and contain lubricating oil for each reactor coolant pump (RCP). The RCP oil spillage protection and control system consists of a package of splash guards, catch basins, and enclosure assemblies as attachments to the RCP motors at strategic locations to preclude the possibility of oil making contact with hot components and pipe.

All fire water system piping within the Reactor Building is maintained dry by two normally closed isolation valves located in series on the same supply line. These valves are located in the south Pipe Penetration Room on the 2026' elevation of the Auxiliary Building. A fixed, manually charged, closed head sprinkler system is provided for the north and south cable penetration areas on the 2026' elevation. The preaction sprinkler system, will aid in controlling the fire event within the cable penetration areas. Fire extinguishers and hose stations are also provided within the Reactor Building for manual fire fighting.

3. Protection of SSCs so that Fires Will Not Prevent Safe Shutdown

Historically, this objective has been deterministically satisfied by conforming to the requirements of 10 CFR 50 Appendix R, Sections III.G.1 or III.G.2. The subject OMA is utilized in lieu of III.G.2 protection to ensure a fire in RB does not challenge PFSSD.

8.14.16 <u>Conclusion</u>

The above analysis and time-authenticated demonstrations provide reasonable assurance that the OMA for Fire Area RB is dependable, reliable, and can be consistently performed within the required Available Time. A twenty nine (29) minute time margin remains, when applying uncertainty elements to ensure OMA reliability. Post-fire safe shutdown capability is maintained with no adverse reactor thermal performance. Therefore, the OMA is considered both feasible and reliable.

8.15 Fire Area A-27, Auxiliary Building 2026' Rod Drive MG Set Room

8.15.1 <u>Fire Area Features</u>

Fire Area A-27 is the Rod Drive MG Set Room (1403) on the 2026' elevation of the Auxiliary Building. The fire area is separated from adjacent areas by 3-hour fire rated barriers. Cross-zoned smoke detection is provided, which actuates a total flooding halon system for the room.

8.15.2 Spurious Equipment Operation Requiring Operator Manual Action

Cables associated with component cooling water (CCW) isolation valves EGHV0016 andEGHV0054 may be damaged, preventing the valves from being opened from the Control Room. The fire induced failure mode for EGHV0016 and EGHV0054 is the as is position. These valves are normally closed when 'A' CCW is operating. 'B' CCW is credited for an A-27 fire, as 'A' train CCW operability can be affected by the postulated fire. Swap over from 'A' to 'B' CCW would require opening of EGHV0016 and EGHV0054, which could be failed in the closed position as a result of fire induced circuit interaction. No OMA is required if 'B' train CCW is operating prior to the fire event, as EGHV0016 and EGHV0054 will be open to support charging pump operability, and the valves will not maloperate to the closed position as a result of the fire.

8.15.3 Operator Manual Action Description

Motor operated valve EGHV0016 is located on the 2026' elevation of the Auxiliary Building in the general corridor (1402) area of Fire Area A-16. (Reference Attachment C, Photo C-9). The valve can be manipulated locally by declutching the motor and manually opening the valve.

Motor operated valve EGHV0054 is located on the 2026' elevation of the Auxiliary Building in the 'B' CCW (1401) area of Fire Area A-16. (Reference Attachment C, Photo C-10). The valve can be manipulated locally by declutching the motor and manually opening the valve.

Local opening of EGHV0016 and EGHV0054 is a Reactive OMA.

8.15.4 Feasibility Analysis of Time Available to Perform Manual Actions

Figure 8.15.4-1 reflects the OMA timeline for opening EGHV0016 and EGHV0054. The identified times are based on the following:

Fire Initiated - This is the initiating event, which occurs at time zero.

Fire Indicated – A four (4) minute detection response time is utilized based on the Attachment B1 application of NUREG-1805 for smoke detector response. Total area detection is provided for Fire Area A-27. Therefore, multiple detection alarms would be initiated for a fire event warranting OMA response action.

Diagnosis Time – A seven (7) minute diagnosis time is utilized based on Section 5.1.14.1.

OMA Implementation Time – A cumulative twelve (12) minute operator action time is utilized based on the demonstrated OMA walkdown time documented in Section 8.15.14.

OMA Uncertainty Time – A nine (9) minute OMA uncertainty time is utilized based on Section 8.15.14.

Available Time – Thermal hydraulic analysis SA-08-006 and E-1F9910 identify that charging, and thus CCW, must be established within twenty eight (28) minutes.

Time Margin – The time margin, without considering OMA uncertainty, is five (5) minutes. This demonstrates that the OMAs are feasible. The time margin for OMA performance, considering OMA uncertainty is, negative four (4) minutes.

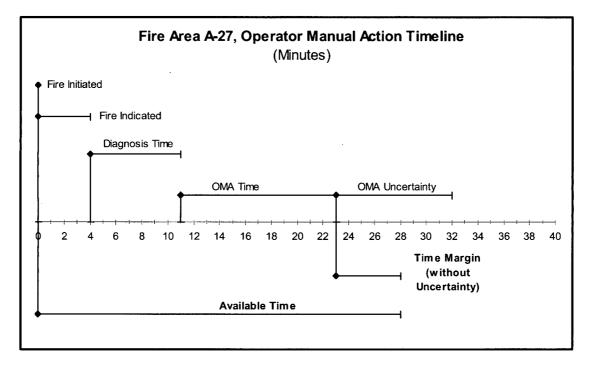


Figure 8.15.4-1, Fire Area A-27 OMA Timeline

8.15.5 Reliability Analysis of Time Available to Perform Manual Actions

As discussed in Section 5.1.5, an OMA is considered reliable provided that a Time Margin remains when applying Fire Indicated Time, Diagnosis Time, OMA Implementation Time, and OMA Uncertainty Time. The Figure 8.15.4-1 OMA timeline does not support a conclusion that the OMAs are reliable. However, the feasible OMAs coupled with a fire watch, are acceptable interim compensatory measures until the OMAs are eliminated by the field implementation of change package 012418.

8.15.6 Environmental Factors

Habitable environmental conditions will be present for performance of the OMAs. The postulated fire event is within the Rod Drive MG Set Room on the 2026' elevation of the Auxiliary Building (Fire Area A-27). Based on fire barrier separation, the fire will be confined to Fire Area A-27. Access to Fire Area A-16 does not require transition through Fire Area A-27. The travel path and location of the equipment requiring manipulation are physically separated from the fire by a rated fire barrier. Fire fighting access to A-27 could be from door 14031 within A-16. However, the smoke propagation review documented in Section 5.1.6 determined that the OMA implementation would not be impeded by smoke migration from the fire event.

Emergency lighting is provided for illumination of potential egress paths and the components requiring OMA manipulation. Normal radiation, temperature, and humidity conditions within the area of concern will not be adversely affected by the fire and subsequent spurious equipment operation.

There are no physical impediments in proximity to the manual action components that would significantly delay or prevent required manipulation. No special equipment, related to environmental condition, is necessary for performance of the OMA.

8.15.7 Equipment Functionality and Accessibility

No equipment support functions are required for successful manual action implementation. The OMA components are physically separated from the fire event by a fire rated barrier. This ensures that the credited equipment is not adversely affected by the fire and its effects.

The operator responsible for OFN KC-016 OMAs carries a master key that can be used to open electronically controlled doors in the event that the fire has negatively affected the normal card key access means. All electronically controlled doors are provided with this secondary access arrangement. This ensures that the postulated fire will not prevent egress through doors provided with electronic access control.

8.15.8 Available Indications

Point addressable smoke detection is provided for the fire area. Upon detector activation, main fire alarm panel KC-008, located in the Control Room, will annunciate a fire alarm condition with a descriptive location of the detector in alarm. This will likely be the first indication of a fire event within the area.

To diagnose a failure of 'A' Train CCW, necessitating the need to swap to 'B' CCW, pump breaker position indication or CCW flow indication needs to be available. The following instrumentation is unaffected by the fire and is available to assist the Control Room in diagnosing the need to locally open EGHV0016 and EGHV0054 to lineup 'B' CCW:

- "A" CCW Pump breaker position from hand indicating switch EGHIS0021.
- "C" CCW Pump breaker position from hand indicating switch EGHIS0023.
- CCW flow to service loop EGFI0055A.

8.15.9 <u>Communications</u>

A fire in this area could affect the Gaitronics and 900 MHz radio systems. The OMAs does not require constant communication with the Control Room. As previously discussed, the operator assigned OFN KC-016 OMA duty will report to the Control Room for instruction following fire brigade callout. This approach allows the Control Room Operators to provide face-to-face direction for the OMA. Once the OMAs have been implemented, the operator can physically report back to the Control Room if the fire affects the Gaitronics or radio system functionality. Communication with the Control Room of OMA implementation is not required due to CCW service loop flow indication being available.

8.15.10 Portable Equipment

No portable equipment or tools, beyond those required to be carried by the designated OMA operator, are necessary to perform the specified OMAs. Key access may be necessary for electronic card reader controlled doors if the fire affects electronic door control. As previously identified, the OFN KC-016 OMA designated operator is required to carry a master key.

8.15.11 Personnel Protection Equipment

No other personnel protective equipment, beyond that normally necessary for Auxiliary Building access, is required to perform the OMAs.

8.15.12 Procedures and Training

The OMAs are identified in OFN KC-016. See Section 5.1.12 for further discussion addressing the fire response procedure.

8.15.13 Staffing

The Operator assigned OFN KC-016 OMA duty for the shift is responsible for performing the OMAs. Only one person is required to perform the OMAs.

8.15.14 <u>Demonstrations</u>

The OMAs were timed using multiple operators, each starting from the Work Control Center (3613) on the 2047' elevation of the Communications Corridor. The timing effort reflected that the OMAs

could be consistently, sequentially performed within twelve (12) minutes. In addition, the following uncertainty times have been included, resulting in a total uncertainty time of nine (9) minutes.

- Communication and feedback with Control Room 1 minute
- Electronically controlled door key access 3 minutes
- Obtain RCA access 2 minutes
- Human centered uncertainty 3 minutes

8.15.15 Defense-In – Depth

1. Fire Prevention

The object of fire prevention is not affected by the OMA. The area of the plant where the fire could occur, necessitating OMA implementation, has combustible loading allowances and hot work limitations that are consistent with other plant areas important to safety.

2. Detection Control and Extinguish Fires

Smoke detection and a total flooding halon system are provided for the area. Fire alarm annunciation is provided locally, and within the Control Room. Smoke detection is point addressable, allowing for prompt recognition of fire location. The halon protection will aid in controlling the fire event until manual suppression can be applied, as necessary. Fire extinguishers and a hose station are provided within the area for manual fire fighting.

3. Protection of systems structures and components (SSC) so that fires will not prevent safe shutdown.

Historically, this objective has been deterministically satisfied by conforming to the requirements of 10 CFR 50 Appendix R, Sections III.G.1 or III.G.2. The subject OMAs, coupled with a fire watch are utilized in lieu of passive fire barrier protection to ensure a fire in A-27 does not challenge PFSSD.

8.15.16 Conclusion

The above analysis and time-authenticated demonstrations provide reasonable assurance that the OMA for Fire Area A-27 is feasible. Reliability was not demonstrated by the analysis. Therefore, the OMAs are considered interim compensatory measures, coupled with a fire watch, until the OMAs are eliminated by the field implementation of change package 012418. These compensatory measures provide reasonable assurance that a fire in Fire Area A-27 will not adversely affect the ability to achieve and maintain safe shutdown.

Page A-1 of A-2

Attachment A

to

WIP-E-1F9900-004-A-1

Summary of OMAs to Achieve and Maintain Hot Standby

Operator Manual Action	Room / Fire Area Where OMA Implemented	A-1	A-11	A-16N	A-18	A-27	C-7	C-12	C-18	C-21	C-22	C-23	C-24	C-30	C-33	RB
Close valve KAV0201 to fail close letdown valves BGLCV0459 and BGLCV0460.	1322 / A-25	х	x		x		x	x	x	x			x			x
Use local controller ABFHC0002 to control/isolate steam release through ARV for Steam Generator B	1509 / A-23			x												
Use local controller ABFHC0003 to control/isolate steam release through ARV for Steam Generator C	1509 / A-23			x												
Isolate air and nitrogen to atmospheric relive valve ABPV0004 to fail the ARV closed	1508 / A-23			x												
Terminate Train B containment spray by opening breaker NB0203.	3302 / C-10										x	x		х	x	
Terminate Train A containment spray by opening breaker NB0102.	3301 / C-9								x	x			x			
Open EGHV0016 and EGHV0054 to support 'B' Train CCW lineup	1401, 1402 / A-16					×										

Summary of OMAs to Achieve and Maintain Hot Standby

Page B1-1 of B1-3

Attachment B1

to

WIP-E-1F9900-004-A-1

Fire Alarm System Response Time

NUREG-1805, Fire Dynamics Tools (FDT) was utilized to determine smoke detector response time in areas where fire induced spurious equipment actuation results in the potential need for mitigating action to preserve the analyzed PFSSD success path. The results of the fire modeling effort are applied to the OMA timeline analysis for the respective fire area. The FDT utilized in the fire modeling approach was developed, prepared, and validated by the Nuclear Regulatory Commission (NRC) to provide a consistent, simplified fire modeling approach.

NUREG-1805 FDT "11. Estimating Smoke Detector Response Time" (Version 1805.0), was utilized to determine smoke detector response time (where applicable) when applying a simple fire heat release rate from Appendix F of NRC Inspection Manual 0609 (Table 2.3.1). An example of the FDT is provided in Attachment B2.

Input information necessary for the FDT is as follows:

- Fire Heat Release Rate (kW) a 70 kW fire was postulated, as it represents lowest kW output fire from generic fire bin types identified in Appendix F Table 2.3.1 of NRC Inspection Manual 0609. A lower intensity fire produces a slower detector response time, which is conservative for application to the OMA timeline. The use of 70 kW as a conservative heat release rate is further substantiated by the intermediate-scale cable burn tests documented in NUREG/CR-6931, where a 200 + kW fire was utilized to assess cable performance when subjected to fire exposure.
- Radial Distance to the Detector (ft) The radial distance to the detector was
 postulated to be 15' (half the detector listed spacing) or room radial distance,
 if the room footprint is less than 15' x 15'.
- Height of Ceiling above Top of Fuel (ft) Distance from ceiling to floor was utilized.
- Ambient air temperature (°F) The lowest normal temperature identified in EQSD-IV Table 1, was utilized. A lower ambient temperature results in a slower detection response time, which is conservative for application to the OMA timeline.

The input data and resulting detector activation time are summarized in Table B1-1. The detector activation time identified in the table is the longest detector activation time calculated from the three methods (Alpert, Mowrer, and Milke) rounded up to the next whole minute.

	NUREG-1805	Detector			
Fire Area	Heat Release Rate (kW)	Radial Distance to Detector (ft)	Ceiling height (ft)	Ambient Temperature (°F)	Activation time (minutes)
A-1	70	15	25	60	8
A-11	70	6	23.33	60	6
A-16N	70	15	20.5	60	4
A-18	70	15	20.5	60 ²	4
A-27	70	15	20.5	60 ³	4
C-7	70	2.917	15.17	60 ·	1
C-12	70	6	15.17	60 ¹	1
C-18	70	6	15.33	60	1
C-21	70	15	14.83	60 ¹	1
C-22	70	15	12	60 ¹	1
C-23	70	6	14.83	60 ¹	1
C-24	70	6	14.83	60 ¹	1
C-30	70	6	25.33	60 ¹	9
C-33	70	6	12	60 ¹	1

Table B1-1, Detector Response Time

Notes :

- Control Building cable chase temperatures are not identified in EQSD-IV Table 1. The low temperature (60°F) for the cable spreading rooms was utilized.
- 2. Auxiliary Building cable chase temperatures are not identified in EQSD-IV Table 1. The low temperature (60°F) for the electrical penetration rooms was utilized.
- 3. The MG Set Room, 1403, is not identified in EQSD-IV Table 1. The low temperature (60°F) for the 2026' corridor rooms, 1402 and 1408, was utilized. GLTIC0185 for SGL20 is set for 65°F per WCRE-01, TPSD.

Page B2-1 of B2-4

Attachment B2

to

WIP-E-1F9900-004-A-1

Sample FDT Data Sheet NUREG-1805 FDT "11. Estimating Smoke Detector Response Time"

chment B E-1F9900	2		erator Manual Actior			Page B2-2 o	r B2-4
	R 11. EST		SMOKE DETECTOR RESP	ONSE TIME	STATES O	GULAZ	
The following c	alculations esti		stector response time. THE YELLOW INPUT PARAMETER BO)	(ES.	- E Do	A CO	
parameters. Th	nis spreadshee	t is protected a	by the spreadsheet and based on values s ind secure to avoid errors due to a wrong e efore an analysis is made.	pecified in the input intry in a cell(s).	s	MM	-
INPUT PA		9. AM 45.	nore an analysis is made.		*INN ****	* NOS	6.8 101
			e (Q) (Steady State)		75.00 kw		ec
	Radial Distanc		tor (r) **never more than 0.707 or $1/2\sqrt{2}$ or	f the listed spacing**	10.00 ft 13.00 ft	3.05 m 3.96 m	
	Activation Ten	nperature of the	e Smoke Detector (T _{activation}) ïme Index (RTI)		86.00 °F 5.00 (m-	30.00 °C	
		emperature (Ta)			77.00 F	25.00 °C	
		at Release Rat			0.70	298.00 K	
	a straightfact the balance of the balance of		pl) (Experimentally Determined) nt (C _{ci}) (Experimentally Determined)		0.67		
	Temperature F	Rise of Gases L	Under the Ceiling (ΔT _c)		18.00 °F	10 °C	
	for Smoke Det I/H =	tector to Activa 0.77					
ESTIMATIN	G SMOKE	ETECTOR	RESPONSE TIME		Calculate		-
METHOD O	F ALPERT						
þ			Handbook, 19 th Edibon, 2003, Page 3-140. - T _a)/(T _{jet} - T _{activation}))				1
		issume smoke	detector is a low RTI device with a fixed a ector activation time (sec)	ctivation temperature			
		RTI = detector	r response time index (m-sec) ^{1/2}				
			et velocity (m/sec) et temperature (°C)				
		and the second se	air temperature (°C)				
			livation temperature of detector (°C)				
	Ceiling Jet T $T_{jet} - T_a = 16.9$	emperature C (Q _o) ^{2/3} /H ^{5/3}	alculation	for r/H ≤ 0.18			
	T _{jet} - T _a = 5.38 Where		et temperature (°C)	for r/H > 0.18			
			air temperature (°C)				
			ve portion of the heat release rate (kW) ceiling above top of fuel (m)				
			nce from the plume centerline to the deter	ctor (m)			7
	Convective H $Q_c = \chi_c Q$	leat Release F	Rate Calculation				
	Where		l ∕e portion of the heat release rate (kW)				
			ise rate of the fire (kW) e heat release rate fraction				
	Q _o =	52.5	kW				
	Radial Distan r/H =		Height Ratio Calculation r/H > 0.15				
	>0.15			23.88			
				23.00			
	$T_{jet} - T_a =$ $T_{jet} - T_a =$	5.38 ((Qc/r)*2/ 9.06	P ²				
	T _{jet} =	34.06	(°C)				
		elocity Calcul	ation	for r/H ≤ 0.15			
	u _{jet} = 0.96 (Q/ u _{jet} = (0.195 Q	^{1/3} H ^{1/2})/r ^{5/6}		for r/H > 0.15			
	Where		et velocity (m/sec) use rate of the fire (kW)				
		H = height of a	ceiling above top of fuel (m) ince from the plume centerline to the deter	ctor (m)			
			Height Ratio Calculation	× 7			-
	r/H =		r/H > 0.15	<u> </u>			
	>0.15	0.65	<0.15	2.56			
	u _{jet} =	(0.195 Q^1/3 H					
		0.647	m/sec				4
			Time Calculation				
	Lactivation = [R1]	/(VUiet)) (In (1:	- Ta)/(Tjet - Tactivation))			······································	

Page B2-3 of B2-4

HOD OF	MOWRER	2	Provide the second s			1			
R	teterences: Moi	wer, F., "Lag Tin	es Associated With Fire Detection and S	uppression," Fire Technology, August	1990, p. 244.		1		
tz	$activation = t_{pl} +$	+ t _{oj}							
٧	Where	t _{activation} = det	ector activation time (sec)						
		t _{pl} = transport	lag time of plume (sec)						
		t _{ei} = transport	lag time of ceiling jet (sec)						
Т	Fransport La	g Time of Plu	me Calculation						
tp	$_{pl} = C_{pl} (H)^{4/3} /$	(Q) ^{1/3}				 			
٧	∿here	t _{pl} = transport	lag time of plume (sec)	n					
		C _{pl} = plume la	ag time constant						
		H = height of	ceiling above top of fuel (m)						
		Q = heat relea	ase rate of the fire (kVV)						
t _p	pl =	1.00	sec						
T	Fransport La	g Time of Cei	sport lag time of ceiling jet (sec)						
	المرتبي ووريا المستان	L		activation time (sec) Image: sec) Image: sec) ne of ceiling jet (sec) Image: sec) Image: sec) ne of plume (sec) Image: sec) Image: sec) r constant Image: sec) Image: sec) above top of fuel (m) Image: sec) Image: sec) et Calculation Image: sec) Image: sec) ne of ceiling jet (sec) Image: sec) Image: sec) image: sec) Image: sec) Image: se					
	$c_{oj} = (r)^{11/6} / (C_{cj})$					 -			
V	Where	and the second s							
		C _{oj} = ceiling j	et lag time constant			 			
				ne detector (m)					
		H = height of	ceiling above top of fuel (m)			 			
to	_{cj} =	0.77	sec				-		
s	Smoke Detec	tor Response	Time Calculation			 			
	activation = t_{pl} +		T				1		
t,	activation =	1.76	sec	Answer			1	-	

Post-Fire Safe Shutdown Operator Manual Actions Attachment B2 -1 V

Page B2-4 of B2-4

VI	P-	E-'	1F	99	90	0-0	04	-A

OF MILKE						1
		anagement for Covered Maila and Atria," Fire Technology, August 1990, p. 223. nagement Systems in Mail, Atria, and Large Areas," 2000 Edition, Section A.3.4.				
NFPA 928, "G	iulde for Smoke Ma	nagement systems in Mell, Atrie, and Large Areas, 2000 Laibon, Section A.S.4.				
tactivation = X	H4/3/Q1/3					
Where		tector activation time (sec)			1997 - 1997 - 1997 - 1997 - 1997 - 1997 - 1997 - 1997 - 1997 - 1997 - 1997 - 1997 - 1997 - 1997 - 1997 - 1997 -	1 22
	$X = 4.6 \ 10^{-4} \ Y$	² + 2.7 10 ⁻¹⁵ Y ⁸				
		ceiling above top of fuel (ft)				
	G - neat relea	ase rate from steady fire (Btu/sec)	handa (1997)		en distante di stat. I	
Where	$Y = \Delta T_{c} H^{5/3} /$	(Q ^{2/3}				
	$\Delta T_{c} = temper$	ature rise of gases under the ceiling for smoke detector to activate (°F)	Server results for all the second results and			
Defense and						
		detector response time, stratification effects can be calculated. ection A.3.4 provides following correlation to estimate smoke		-maril		
	on in a comparti					L
- 74.0	Qe ^{2/5} / ΔT _{1->e} 3/5					-
Where		aximum ceiling clearance to which a plume can rise (ft)				<u> </u>
vvnere		ve portion of the heat release rate (Btu/sec)		£.,.;,,;;;;;		+
-		ence in temperature due to fire between the fuel location and ceiling level (°F)			******	
				arana da		
the second s	Heat Release	Rate Calculation				-
$Q_{c} = Q \chi_{c}$		La strategica de la seconda de la second				
Where		ve portion of the heat release rate (Btu/sec)				ļ
		ase rate of the fire (Btu/sec) /e heat releas rate fraction	<u>Allenses and and and a second s</u>	-12411		
Q _c =	49.76	Btu/sec				
				ii mi		-
		e Due to Fire Between the Fuel Location and Ceiling Level				
and the design of the second se	10 Q ₆ ^{2/3} / H ^{5/3}					ļ
Where		ence in temperature due to fire between the fuel location and ceiling level (°F)				
	transfer to the state of the st	ve portion of the heat release rate (Btu/sec) sight above the fire source (ft)				
$\Delta T_{t \to c} =$	244.70					
↔ (1-3¢	241.10					
	atification Effect	ts				
) _o ^{2/5} / ∆T _{1.>o} ^{3/5}					
H _{max} =	13.03					
		bint of smoke rise is estimated to be 13.03 ft e expected to reach the ceiling mounted smoke detector				
inus, the s		e expected to reach the ceiling mounted smoke detector				
$Y = \Delta T_c H^{5/6}$	³ / Q ^{2/3}					
Y =	75.39					
Y - 1 C 10:4	Y ² + 2.7 10 ⁻¹⁵ Y ⁶					
X = 4.6 10 X =	2.62					1
Smoke Det	ector Response	Time Calculation				
t _{activation} = X						ļ
factivation =	19.30	sec				ļ
+						
						li uni L'uni
fResult	1					1
Calculation		Smoke Detector Response Time (sec)				1
METHOD O	F ALPERT F MOWRER	4.99				-
METHOD O		19.30				t
						Į
NOTE			No. of Concession, Name			ļ
		ased on principles developed in the NFPA Fire Protection Handbook 19 th Edition, ire Technology, 1990, and NFPA 92B, "Guide for Smoke Management Systems i			illing of the second	-
meene, merne		If Pechnology, 1990, and NPPA 928, Guide for Smoke Management Systems i D Edition, Section A.3.4. Calculations are based on certain assumptions and	111113115			
Atria, and La		e results of such calculations may or may not have reasonable predictive capabili	ties			in.
have inheren	it limitations. Th	s resolts of oden editerations may of may not have reasonable predictive editable				£ :
have inheren for a given s	ituationsand, and	should only be interpreted by an informed user.				1
have inheren for a given s Although ea	ituationsand, and ch calculation in	i should only be interpreted by an informed user. The spreadsheet has been verified with the results of hand calculation, se of the accuracy of these calculations.	-			
have inheren for a given s Although ea there is no a Any questio	ituationsand, and ch calculation in absolute guarante ns, comments, c	I should only be interpreted by an informed user. the spreadsheet has been verified with the results of hand calculation, so of the accuracy of these calculations concerns, and suggestions, or to report an error(s) in the spreadsheet,				
have inheren for a given s Although ea there is no a Any questio	ituationsand, and ch calculation in absolute guarante ns, comments, c	I should only be interpreted by an informed user. the spreadsheet has been verified with the results of hand calculation, se of the accuracy of these calculations. concerns, and suggestions, or to report an error(s) in the spreadsheet, barr one or mys3@barc or				
have inheren for a given s Although ea there is no a Any questio	ituationsand, and ch calculation in absolute guarante ns, comments, c	I should only be interpreted by an informed user. the spreadsheet has been verified with the results of hand calculation, se of the accuracy of these calculations. concerns, and suggestions, or to report an error(s) in the spreadsheet, barr one or mys3@barc or				
have inheren for a given s Although ea there is no a Any questio	ituationsand, and ch calculation in absolute guarante ns, comments, c	I should only be interpreted by an informed user. the spreadsheet has been verified with the results of hand calculation, se of the accuracy of these calculations. concerns, and suggestions, or to report an error(s) in the spreadsheet, barr one or mys3@barc or				
have inheren for a given s Although ea there is no a Any questio	ituationsand, and ch calculation in absolute guarante ns, comments, c	I should only be interpreted by an informed user. the spreadsheet has been verified with the results of hand calculation, se of the accuracy of these calculations. concerns, and suggestions, or to report an error(s) in the spreadsheet, barr one or mys3@barc or				
have inheren for a given s Although ea there is no a Any questio	ituationsand, and ch calculation in absolute guarante ns, comments, c	I should only be interpreted by an informed user. the spreadsheet has been verified with the results of hand calculation, se of the accuracy of these calculations. concerns, and suggestions, or to report an error(s) in the spreadsheet, barr one or mys3@barc or				
have inheren for a given s Although ea there is no a Any questio	ituationsand, and ch calculation in absolute guarante ns, comments, c	I should only be interpreted by an informed user. the spreadsheet has been verified with the results of hand calculation, se of the accuracy of these calculations. concerns, and suggestions, or to report an error(s) in the spreadsheet, barr one or mys3@barc or				
have inheren for a given s Although ea there is no a Any questio	ituationsand, and ch calculation in absolute guarante ns, comments, c	I should only be interpreted by an informed user. the spreadsheet has been verified with the results of hand calculation, se of the accuracy of these calculations. concerns, and suggestions, or to report an error(s) in the spreadsheet, barr one or mys3@barc or				
have inheren for a given s Although ea there is no a Any questio	ituationsand, and ch calculation in absolute guarante ns, comments, c	I should only be interpreted by an informed user. the spreadsheet has been verified with the results of hand calculation, se of the accuracy of these calculations. concerns, and suggestions, or to report an error(s) in the spreadsheet, barr one or mys3@barc or				
have inheren for a given s Although ea there is no a Any questio	ituationsand, and ch calculation in absolute guarante ns, comments, c	I should only be interpreted by an informed user. the spreadsheet has been verified with the results of hand calculation, se of the accuracy of these calculations. concerns, and suggestions, or to report an error(s) in the spreadsheet, barr one or mys3@barc or				
have inheren for a given s Although ea there is no a Any questio	ituationsand, and ch calculation in absolute guarante ns, comments, c	I should only be interpreted by an informed user. the spreadsheet has been verified with the results of hand calculation, so of the accuracy of these calculations concerns, and suggestions, or to report an error(s) in the spreadsheet,				

Page C-1 of C-3

Attachment C

to

WIP-E-1F9900-004-A-1

Photos of Equipment Manipulated for Operator Manual Action

Page C-2 of C-3

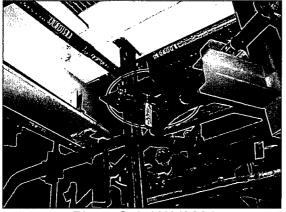


Photo C-1, KAV0201

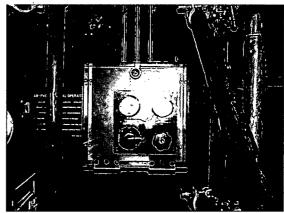


Photo C-2, ABFHC0002

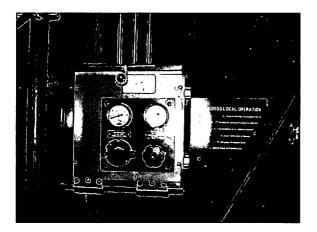


Photo C-3, ABFHC0003

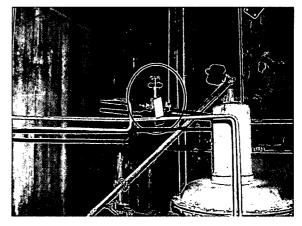


Photo C-4, KAV1429

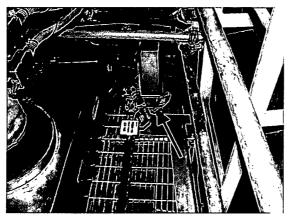


Photo C-5, KAV1365

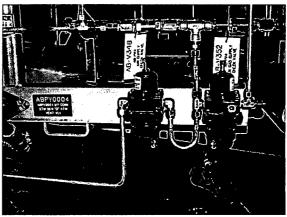


Photo C-6, ABPV0004 Regulators

Page C-3 of C-3

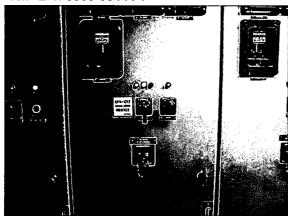


Photo C-7, NB0102

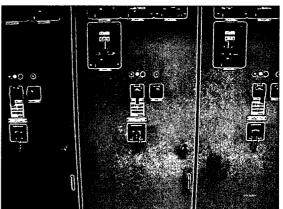


Photo C-8, NB0203

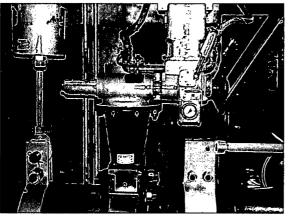


Photo C-9, EGHV0016

Ł

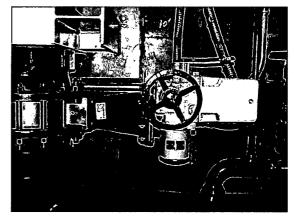


Photo C-10, EGHV0054