A.1.1.A Conduct of Operations ADMIN G2.1.40 - RO & SRO

A.1.1.A				
TITLE: Verification of Initial Conditions Prior to Core Alterations.				
PROGRAM APPLICABLE: SOT SOCT OLT _X LOCT				
ACCEPTABLE EVALUATION METHOD: <u>X</u> PERFORM <u>SIMULATE</u> DISCUSS				
EVALUATION LOCATION: SIMULATOR CONTROL ROOM X CLASSROOM				
PROJECTED TIME: <u>30 MIN</u> SIMULATOR IC NUMBER: <u>N/A</u>				
ALTERNATE PATH TIME CRITICAL PRA				

JPM DIRECTIONS:

- 1. This task is to be administered in a group, classroom setting with access to a variety of procedures (UOPs, STPs, SOPs, et al) available via the Exam Reference disk.
- 2. This task is designed to be performed with evaluation of pictures of the equipment from which operational information will be evaluated.
- 3. Due to the utilization of pictures, upon request, the status of the lights and switches may be clarified (See standards for the applicable light/switch).
- 4. Upon completion of elements 1-10, all candidates will be evaluated at the RO level.
- 5. FOR SRO candidates ONLY: after evaluation of elements 1-10, they will be provided a second Cue sheet (handout #2) and returned to the classroom to evaluate TS.

TASK STANDARD: Required for successful completion of this JPM:

- **<u>NOTE</u>**: Incorrect assessment of any step within the appendix, or entry into any non-applicable LCO would constitute a critical task failure.
 - Assess all steps of UOP-4.1, Appendix 6, Verification of Initial Conditions Prior to Core Alterations and identify all, if any, core alt. initial conditions listed in UOP-4.1, Appendix 6 which are not satisfied.
 - (For SRO ONLY): Based on the conditions identified list all TS CONDITIONS, REQUIRED ACTIONS and COMPLETION TIMES for LCOs not met, if any.

Examinee:				
Overall JPM Performance:	Satisfactory		Unsatisfactory	
Evaluator Comments (attach a	dditional sheets i	f necessary)		

EXAMINER: _____

Developer	H. Fitzwater	2/09/10
NRC Approval		SEE NUREG 1021 FORM ES-301-3

CONDITIONS

When I tell you to begin, you are to perform or evaluate all steps FNP-1-UOP-4.1, Appendix 6, Verification of Initial Conditions Prior to Core Alterations. The conditions under which this task is to be performed are:

- a. Core Offload was suspended 18 hours ago.
- b. RCS temp is 100°F.
- c. Time to boil is >2 hours.
- d. A Fuel shuffle in the Spent Fuel Pool is ongoing.
- e. Communications between the MCR and a System Operator acting as the Cavity Watch have been verified available 10 minutes ago.
- f. RCS boron concentration is 2450 ppm following an over boration performed last shift.
- g. Rx Makeup water is being used to dilute the Reactor Cavity by chemistry's request.
- h. FNP-1-STP-18.4, Containment Midloop and/or Refueling Integrity Verification and Containment Closure, was completed yesterday at 1400.
- i. CTMT Main Purge system is in operation.
- j. The equipment hatch and all containment air locks are currently closed.
- k. The Ctmt Evacuation alarm is sounding inside Containment.
- 1. The Audio Count Rate Channel is NOT producing any audible noises.
- m. Applicable equipment will be assessed using the provided photographs.
- n. You have been directed to perform or evaluate all steps of FNP-1-UOP-4.1, Appendix 6.
- o. Identify all initial conditions for core alterations listed in UOP-4.1, Appendix 6, which are not satisfied, if any.

INITIATING CUE: "You may begin."

EVALUATION CHECKLIST

ELEMENTS:	STANDARDS:	RESULTS: (CIRCLE)
START TIME		
1. (STEP 2.1 & 2.2) Checks correct version and conducted on appropriate unit.	1) Determines step 2.1 & 2.2 has been completed. Utilizes WebTop and verifies unit from initial conditions	S / U
 (STEP 3.1) Communications between MCR and the Reactor Cavity verified within one hour. 	2) Determines step 3.1 has been completed. Utilizes initial conditions to verify task complete.	S / U
NOTE: • Elements 3 through 5, 7 and 8 are performed	by use of pictures. The pictures are s	ufficient to

NOTE: • Elements 3 through 5, 7 and 8 are performed by use of pictures. The pictures are sufficient to demonstrate light status and switch position, however **IF** light status or position is questioned, then the cues may be provided (see the standards column for the applicable light or switch).

A.1.1.A

EVALUATION CHECKLIST

ELEMENTS:

- 3. (STEP 3.2.1) Verify N-31, Source Range NI, detector operable.
- (reference SOP-39.0 section 4.1)
- a. Check N-31 Instrument power on AND control power on lights illuminated.
- b. Check switches aligned:
 - i. Level Trip
 - ii.Operation Selector iii.High Flux at shutdown
- c. Perform a channel check per STP-1.0 (SR 3.9.2.1).
- * 4. (STEP 3.2.2)Verify N-32, Source Range NI, detector operable.
 - (reference SOP-39.0 section 4.1)
 - a. Check N-32 Instrument power on AND control power on lights illuminated.
 - b. Check switches aligned:
 i. Level Trip
 ii.Operation Selector
 iii.High Flux at shutdown
 - c. Performs a channel check per STP-1.0 (SR 3.9.2.1).

STANDARDS:

RESULTS: (CIRCLE)

- 3) Determines step 3.2.1 has been S / U satisfied; Utilizes picture of N-31 and determines that the instrument is operable.
 - a. lights are illuminated
 - b. Switches are in position:
 - i. Normal
 - ii. Normal
 - iii. Normal
 - c. Acceptable per STP-1.0 allowances
- 4) Determines step 3.2.2 can not S / U
 be satisfied; Utilizes picture of N-32 and determines that the instrument is NOT operable.
 - a. Lights are checked
 - Instrument power light is <u>NOT</u> illuminated.
 - Control power is illuminated.
 - b. Switches are determined;
 - i. Normal
 - ii. Normal
 - iii. Normal
 - c. <u>NOT</u> Acceptable per STP-1.0 allowances.

EVALUATION CHECKLIST

ELEMENTS:

- (STEP 3.2.3) Verify N-48, Gamma-metrics Source Range NI, detector operable.
 (reference SOP-39.0 section 4.3)
 - a. Checks N-48 in service.
 - b. Performs a channel check per STP-1.0 (SR 3.9.2.1).
- 6. (STEP 3.3) Reactor Coolant system 2000 ppm.

STANDARDS:

RESULTS: (CIRCLE)

- 5) Determines step 3.2.3 has been S / U satisfied. (May identify that the Refueling Coordinator must first be consulted.)
 - a. Aligned and in service as indicated by picture and bulleted items listed on picture.
 - b. Acceptable per STP-1.0 Table 1 allowances.
- 6) Determines step 3.3 has been S / U satisfied; Utilizes initial conditions to verify boron concentration.

NOTE: Element 7 would require either R-5 being in service **OR** required action being taken. The candidate might question whether or not surveys are being performed. Additionally, due to rules of usage may stop the task and attempt to notify the SS.

IF required CUE: "The SS acknowledges the issue you have identified and directs you to continue. No compensatory actions have yet been completed."

* 7. (STEP 3.4.1) Verifies R-5 operable/operating.

(Reference: SOP-45.0 section 4.1.3; TRM 13.3.4)

- a. Verify Operation Selector switch position.
- b. Verify Range Selector switch position.
- c. Verify Drawer indication lights:
 - i. Power
 - ii. Channel Test light
 - iii. High Alarm
 - iv. Low Alarm

- 7) Identifies R-5 is <u>NOT</u> S / U operable/operating; Determines step 3.4.1 has <u>NOT</u> been satisfied. (May annotate failure or need to initiate survey).
 - a. <u>Level Cal.</u>
 - b. WIDE
 - c. Lights are:
 - i. ON
 - ii. ON
 - iii. OFF
 - iv. OFF

A.1.1.A

EVALUATION CHECKLIST

ELEMENTS:

8. (STEP 3.4.2 through 3.4.4) Verifies R-24AorB, R-25AorB, and R-35AorB operable using SOP-45.0 section 4.1.5.

(uses pictures of LOCAL radiation monitor indications to determine the following conditions)

- a. Verify local switch for vacuum pump.
- b. Verify LOCAL switch position.

(uses pictures of radiation monitor drawers to determine the following conditions)

- c. Verify MCR switch:
 - i. Operation selector
 - ii. Pump Power
 - iii. Pump Start
- d. Verify MCR lights:
 - i. Power light
 - ii. Pump ON light
 - iii. Flow fault light
 - iv. Alert light
 - v. High light
 - vi. Fail/Reset light
- vii. Power on light

STANDARDS:

RESULTS: (CIRCLE)

8) Identifies radiation monitors are S / U operable; Initials step 3.4.2 through 3.4.4.

The following indications are for all steps 3.4.2 through 3.4.4:

- a. AUTO
- b. ON (and Fans are running)
- c. MCR switches are:
 - i. Oper
 - ii. ON
 - iii. Start/Neutral
- d. MCR lights are:
 - i. ON
 - ii. ON
 - iii. OFF
 - iv. OFF
 - v. OFF
 - vi. ON
 - vii. ON
- 9. (STEP 3.5 through 3.6) Evaluates Refueling 9 integrity has been verified within 100 hrs, and that step 3.6 is not applicable.
- 9) Utilizes initial conditions and S / U evaluates that step 3.5 is satisfied and 3.6 in N/A.

NOTE: REVIEW of completed Appendix 6 to evaluate the above elements.

CUE: Identify all, if any, initial conditions listed in UOP-4.1, Appendix 6 which are not satisfied.

* 10. Reports/annotates that step 3.2.2 and 3.4.1 are not completed or satisfied and that core Alts initial conditions are not satisfied. 10) Identifies N32 inoperable, R- S / U
5 inoperable and that Core alterations should not be permitted since the initial conditions have not been satisfied.

A.1.1.A

EVALUATION CHECKLIST		DECHITS.
ELEMENTS:	STANDARDS:	RESULTS: (CIRCLE)
RO ONLY: Terminate when elements 1-10 of the t	task have been completed.	
 SRO ONLY Cue: PROVIDE Handout #2, read an Based on the conditions you identified perform the fo 1) List all TS CONDITIONS, REQUIRED ACT any. 	llowing:	
 * 11. Evaluates TS 3.9.2 Condition C: Inoperable Audio Counts. 	 Identifies the need to IMMEDIATELY verify un- borated water sources are isolated. 	S / U
* 12. Evaluates TRM 13.3.4 condition B.	12) Identifies the need to IMMEDIATELY notify HP to perform a survey of the SFP area within 24 hours.	S / U
13. Evaluates TS 3.9.2 Condition A: One source range neutron flux monitor inoperable.	13) Identifies an ADMIN LCO for Condition A for N32 inoperable	S / U

SRO ONLY: Terminate when elements 1-13 of the task are complete.

____ STOP TIME

<u>CRITICAL ELEMENTS</u>: Critical Elements are denoted with an asterisk (*) before the element number.

GENERAL REFERENCES:

1. UOP-4.1, VER 52 2. KA: # G2.1.40 2.8 3.9

G2.1.36	3.0	4.1	
G2.1.32	3.8	4.0	

GENERAL TOOLS AND EQUIPMENT:

- 1. References to be accessed via classroom computer (using exam ID logon) and Exam Reference disk/files only.
- 2. Provide UOP-4.1, Appendix 6
- 3. Pen/pencil
- 4. Pictures of the following components: (11 pages total)
 - a. R-24A Local indications
 - b. R-24B Local indications
 - c. R-25A Local indications
 - d. R-25B Local indications
 - e. R-35A Local indications
 - f. R-35B Local indications

- g. R24A & R25A MCR indications
- h. R-24B & R25B MCR indications
- i. R-35A & R35B MCR indications
- j. N31drawer indications
- k. N32 drawer indications
- 1. N31, N32 & N48 Board indications
- m. Audio Count Rate Channel Drawer

Critical ELEMENT justification:

<u>STEP</u>

Evaluation

- NOTE: The listed sub-steps to each element (a.b.c...) describe the anticipated actions taken by the candidate. Completion of all sub steps is **not required** to make the determination of operability of the components, nor is it intended that these actions be observed. These sub-steps are provided for the examiner as an evaluation tool.
 - 1. NOT critical—this step is for satisfying site procedural protocol and expectations.
 - 2. NOT critical— this step is for satisfying site level expectations or requirements.
 - 3. NOT critical—Although Task objective-component is operable.
 - 4. **Critical Element** Task objective-evaluate operability of required equipment.
 - 5. NOT critical—Although Task objective-component is operable.
 - 6. NOT critical this step does not require any evaluation from the candidate.
 - 7. **Critical Element** Task objective-evaluate operability of required equipment.
 - 8. NOT critical—Although Task objective-components are operable.
 - 9. **Critical Element**—FINAL Task objective-identifies that initial conditions are not satisfied for Core Alts.
- 10. NOT critical— this step does not require any evaluation from the candidate.
- SRO Critical Element—IDENTIFIES and IMPLEMENTS the Actions for License requirement.
- 11.
- SRO Critical Element—IDENTIFIES and IMPLEMENTS the Actions for License requirement.
- 12.
- SRO NOT critical—Administrative LCO is for tracking purposes only.
- 13.

COMMENTS:

References expected to be utilized:

STP-1.0, section 5.22, Table 1 of Appendix 1 and Appendix 3, Ver. 98.0; channel check information M-50 Master list of Surveillance Tests, Ver. 25.0; determine channel check procedure SOP-39.0, Nuclear Instrumentation System, Ver. 9.0; evaluate switch alignment/operability SOP-45.0, Radiation Monitoring System, Ver. 36.0; evaluate switch alignment/operability TRM 13.3.4 Ver 8.0, and Basis Ver 3.0.
TS 3.9.2 and Basis, Amendment 146 (U-1), Amendment 137 (U-2) UOP-4.1, CONTROLLING PROCEDURE FOR REFUELING, Ver. 52.0

TO DISCUSS with the examiner:

Due to procedure rules of usage, a candidate may stop performing the steps upon encountering the first malfunction; therefore the candidate may not have evaluated all components/steps expected.

Possible options:

• Brief all students verbally prior to providing the task or provide the following as part of the initial conditions:

For the purposes of this task, complete the Appendix in its entirety. Any actions, permissions or notifications required by any identified discrepancies, or procedure step, will be conducted upon completion of all other steps of the Appendix. Annotate any condition identified or the action, the permission, or the notification required for discussion upon completion of the appendix for any, if any, step that can not be completed.

- Facilitate with Cues at the evaluation phase to resolve the expected actions while monitoring the completion of the remaining elements.
- Facilitate with Cues at the evaluation phase then return the candidate to complete the remaining elements.

Consider element #13 relative to the criteria of NON-applicable LCO application resulting in Critical Element Failure. This element is listed based on the probability that this LCO would be entered if immediate evaluation of Gamma-Metrics capability to adequately monitor the core (possible that the fuel movement that existed prior to current condition uncoupled the core with the instruments); A Mandatory application of TS 3.9.2 Condition A may be implemented, due to decision to conservatively declare inoperable until the Refueling Coordinator is consulted.

• Gamma metrics must be evaluated as coupled by Refueling Coordinator.

CONDITIONS

Based on the conditions you identified evaluate TS and TRM requirements and perform the following:

a. List all TS and TRM CONDITIONS, REQUIRED ACTIONS and COMPLETION TIMES for LCOs not met, if any.

CONDITIONS

When I tell you to begin, you are to perform or evaluate all steps FNP-1-UOP-4.1, Appendix 6, Verification of Initial Conditions Prior to Core Alterations. The conditions under which this task is to be performed are:

- a. Core Offload was suspended 18 hours ago.
- b. RCS temp is 100°F.
- c. Time to boil is >2 hours.
- d. A Fuel shuffle in the Spent Fuel Pool is ongoing.
- e. Communications between the MCR and a System Operator acting as the Cavity Watch have been verified available 10 minutes ago.
- f. RCS boron concentration is 2450 ppm following an over boration performed last shift.
- g. Rx Makeup water is being used to dilute the Reactor Cavity by chemistry's request.
- h. FNP-1-STP-18.4, Containment Midloop and/or Refueling Integrity Verification and Containment Closure, was completed yesterday at 1400.
- i. CTMT Main Purge system is in operation.
- j. The equipment hatch and all containment air locks are currently closed.
- k. The Ctmt Evacuation alarm is sounding inside Containment.
- 1. The Audio Count Rate Channel is NOT producing any audible noises.
- m. Applicable equipment will be assessed using the provided photographs.
- n. You have been directed to perform or evaluate all steps of FNP-1-UOP-4.1, Appendix 6.
- o. Identify all initial conditions for core alterations listed in UOP-4.1, Appendix 6, which are not satisfied, if any.

UNIT 1 FNP-1-UOP-4.1

APPENDIX 6

VERIFICATION OF INITIAL CONDITIONS PRIOR TO CORE ALTERATIONS

Performed by: _	Date	
-		

Reviewed by: _____ Date _____

This appendix consists of 2 pages



APPENDIX 6

VERIFICATION OF INITIAL CONDITIONS PRIOR TO CORE ALTERATIONS

1.0 <u>Purpose</u>:

Provide separate guidance for specific initial conditions which will be needed to be verified more than once due to core alterations occurring at various time during an outage period.

2.0 <u>Initial Conditions</u>:

2.1 The version of this appendix is the current version. (OR 1-98-498)

2.2 This appendix is correct for the unit for which the task applies. (OR 1-98-498)

3.0 <u>Instructions</u>:

NOTE:	This appendix should be completed each time core alterations are commenced, including suspensions of core alterations exceeding 12 hours.
3.1	The direct communications system between the control room and the reactor cavity is verified available for use within one hour prior to core alterations.
CAUTIO	N: The Gamma-Metrics source range channel may only be used as a back-up to N-31 or N-32 during certain core configurations. The Refueling Coordinator should be consulted if N-31 or N-32 becomes inoperable when the core is not fully loaded.
3.2	Verify at least two of the required source range neutron flux monitors are operable with continuous visual indication in the Control Room and a channel check performed within 12 hours prior to any core alterations. Trip functions and associated TSLBs are not required for Mode 6 or core alterations.
3.2.1	Source Range Nuclear Instrument, Channel N-31
	3.2.2 Source Range Nuclear Instrument, Channel N-32
	3.2.3 Gamma-Metrics Neutron Flux Monitor, Channel N-48

12/09/09 14:42:20


UNIT 1

- 3.3 The reactor coolant system boron concentration is ≥ 2000 ppm.
 - 3.4 The following radiation monitors are in operation per FNP-1-SOP-45.0, RADIATION MONITORING SYSTEM, or required action is being taken per Tech. Specs 3.3.6, 3.3.7, and 3.3.8, and TR 13.3.4.
 - 3.4.1 R-5 Spent fuel storage or portable monitoring instrumentation used to monitor SFP area at least once per 24 hours (for fuel movement in SFP).
 - 3.4.2. R-25A or B Spent fuel storage Gaseous (for fuel movement in SFP).
 - 3.4.3 R-24A or B Containment purge system with main or mini purge in operation.
 - 3.4.4 R-35A or B Control Room HVAC
- 3.5Refueling integrity has been verified per FNP-1-STP-18.4, CONTAINMENT/MIDLOOP AND/OR REFUELING INTEGRITY VERIFICATION AND
CONTAINMENT CLOSURE within 100 hours prior to the start of core
alterations.
 - 3.6 <u>IF</u> the containment equipment hatch, personnel air lock, or auxiliary air lock is open during core alterations and/or during movement of irradiated fuel assemblies within containment, <u>THEN</u> ensure the following items are complete (TS 3.9.3):


MM


- 3.6.1 A designated, trained Maintenance Closure Response Team (MCRT) is available to shut the containment equipment hatch, a door in the personnel air lock, and a door in the auxiliary air lock within two hours after notification and direction from the control room.
- 3.6.2 For the equipment hatch, the surveillance is current for SR 3.9.3.3, i.e., FNP-0-STP-610.0 has been completed by Maintenance within the last seven days


NUCLEAR INSTRUMENTATION PROTECTION CHANNEL I

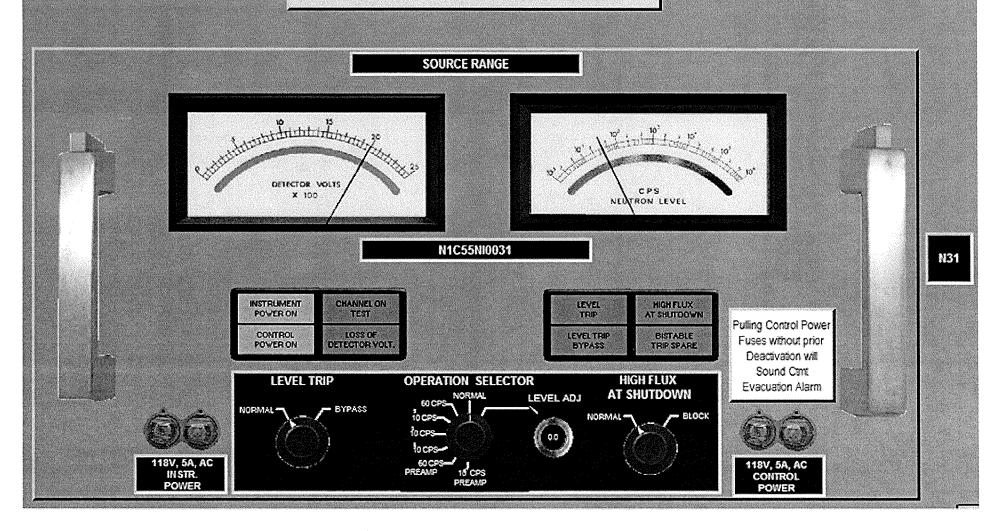



NUCLEAR INSTRUMENTATION PROTECTION CHANNEL II

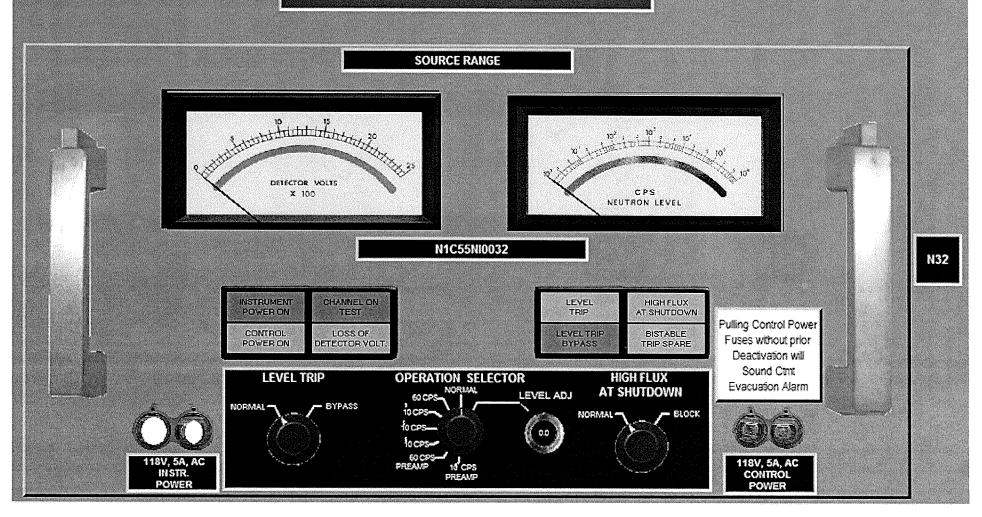


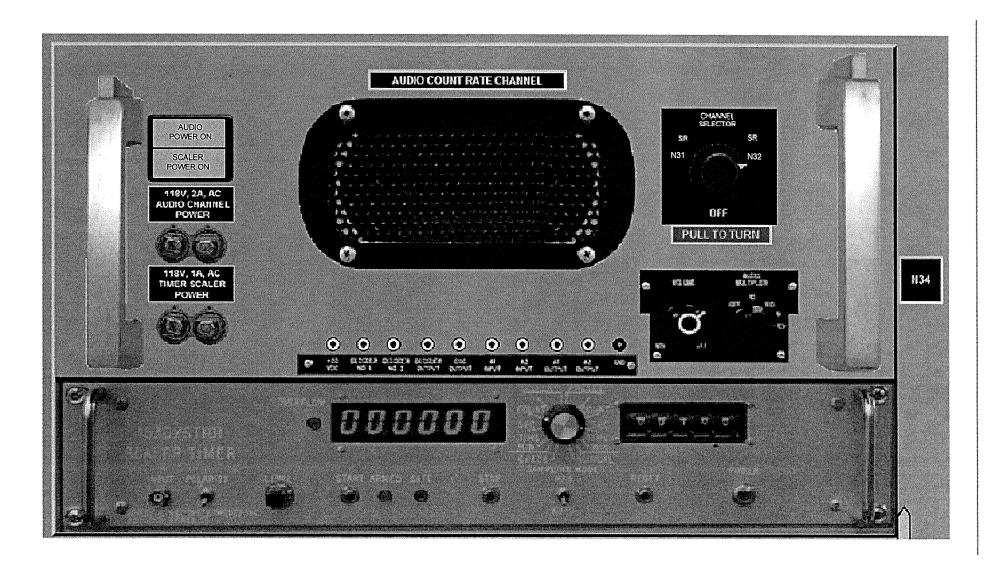


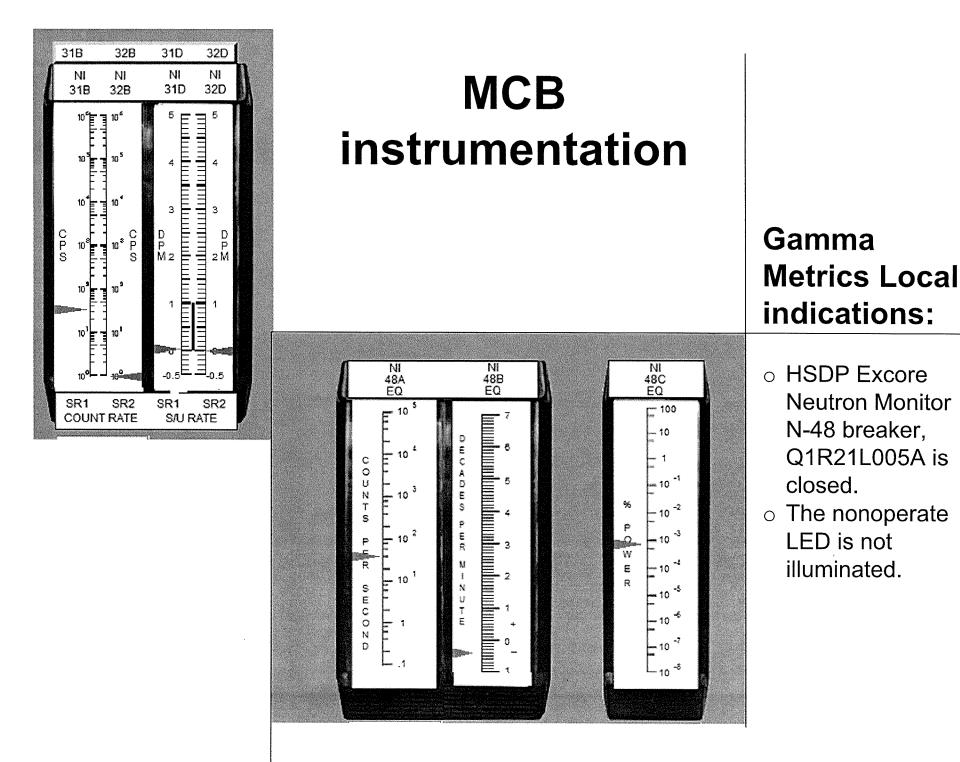


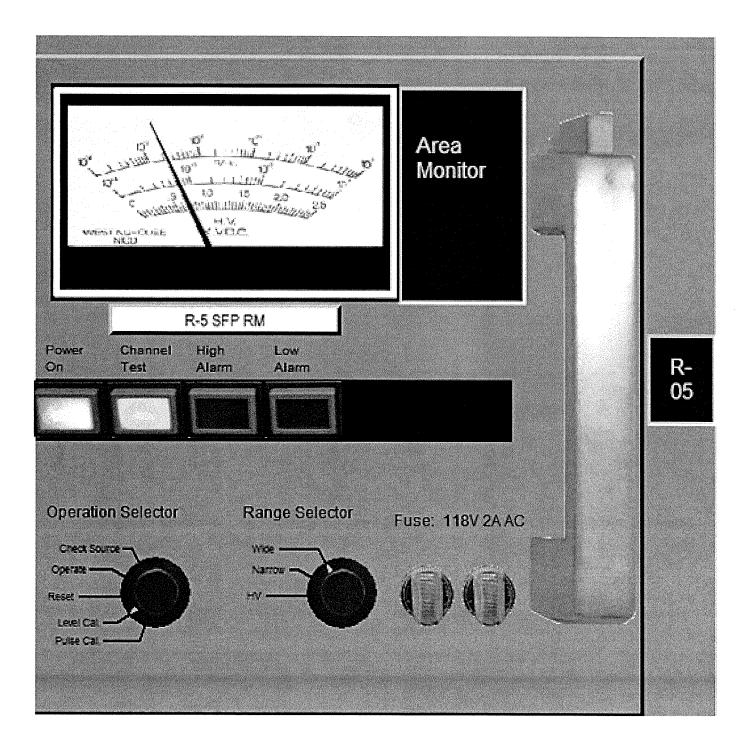


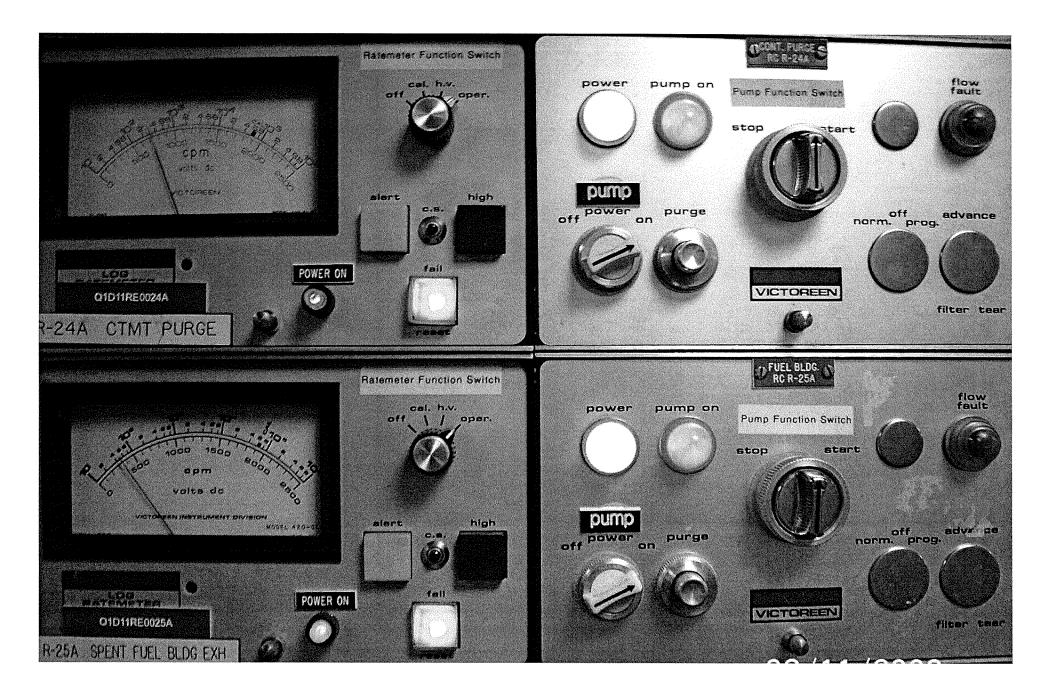

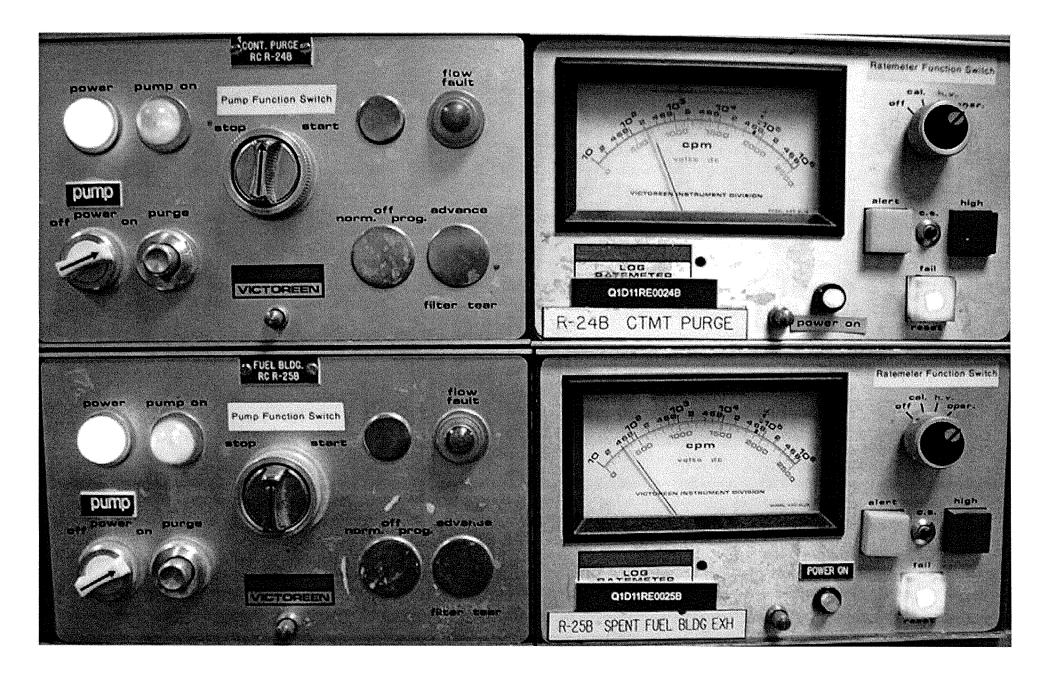

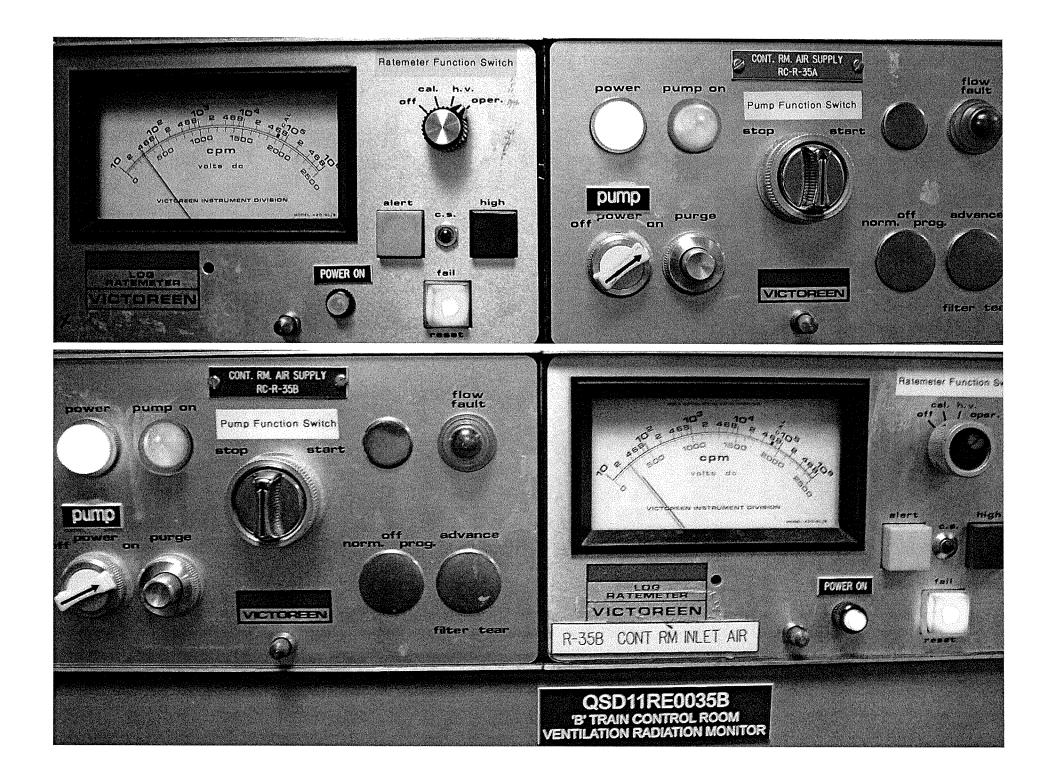


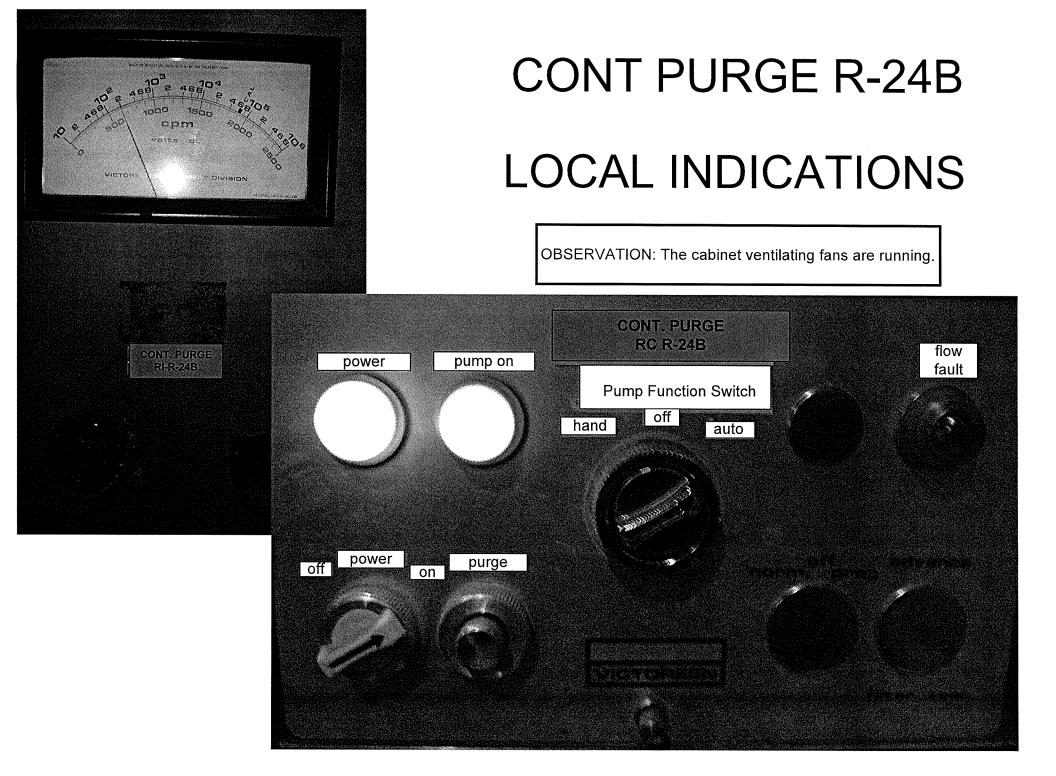


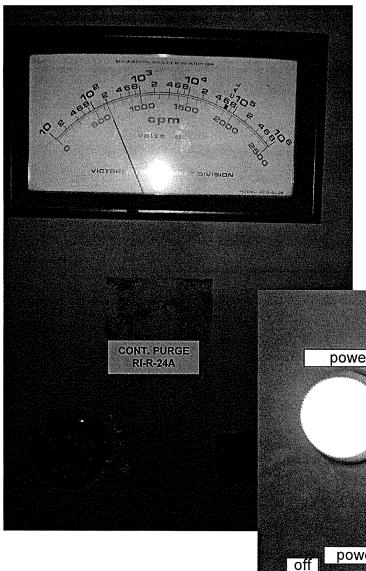



CONT PURGE R-24A LOCAL INDICATIONS


OBSERVATION: The cabinet ventilating fans are running.

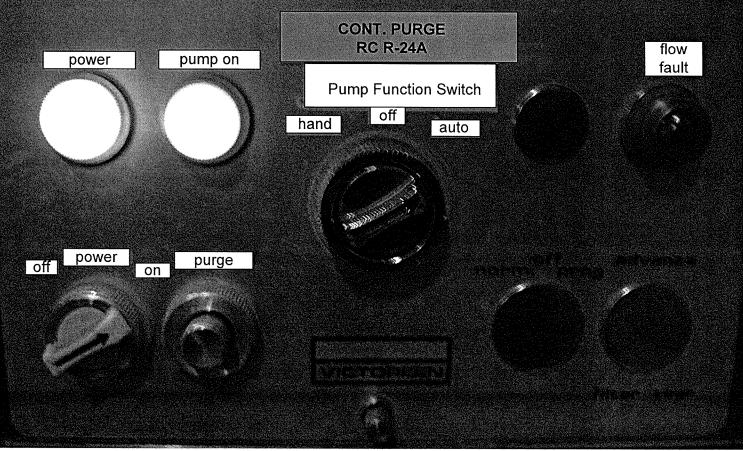

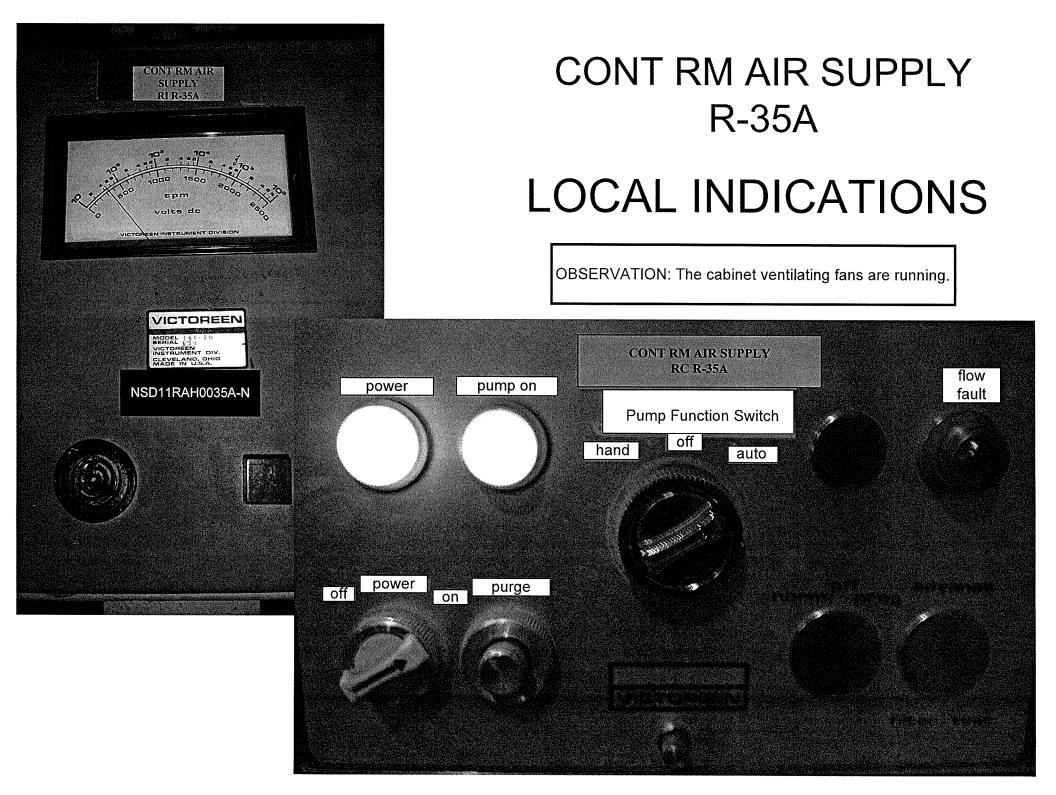

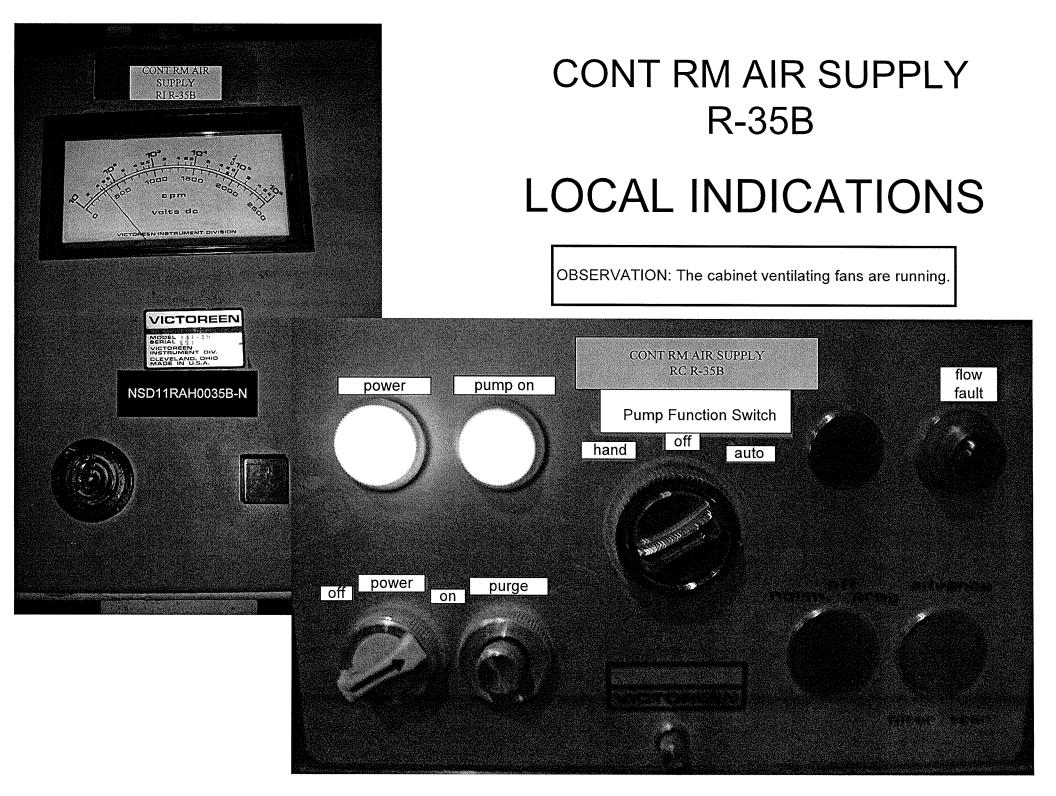

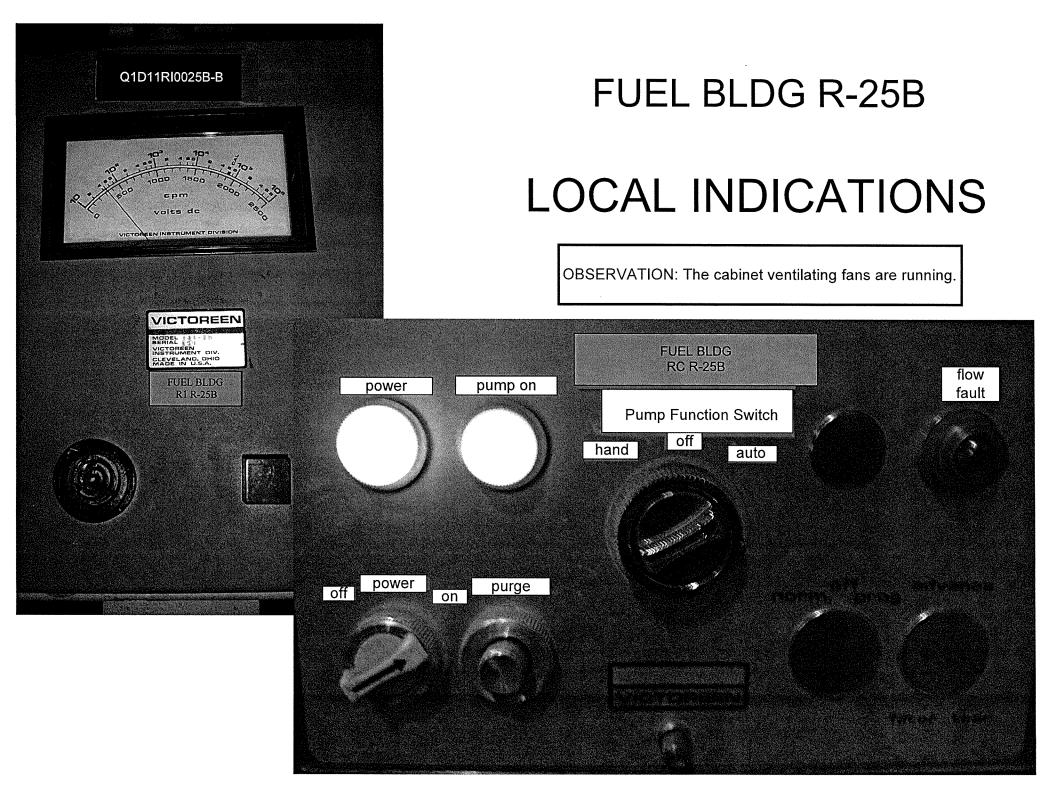

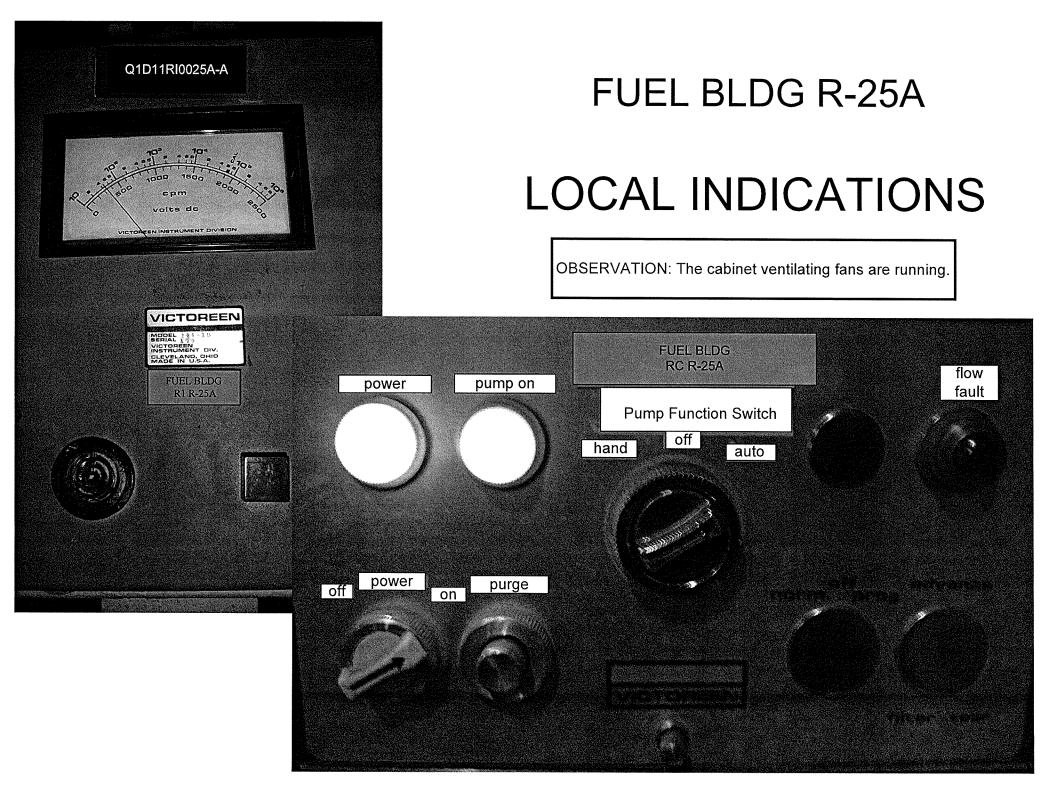

A.1.2.S Conduct of Operations ADMIN G2.1.25 - SRO

A1.2.S				
TITLE: Conduct A Shutdown Safety Assessment and Determine Time to Saturation.				
PROGRAM APPLICABLE: SOT SOCT OLT _X LOCT				
ACCEPTABLE EVALUATION METHOD: X PERFORM SIMULATE DISCUSS				
EVALUATION LOCATION: SIMULATOR CONTROL ROOMX_ CLASSROOM				
PROJECTED TIME: <u>20 MIN</u> SIMULATOR IC NUMBER: <u>N/A</u>				
ALTERNATE PATH TIME CRITICAL PRA				

JPM DIRECTIONS:

- 1. Initiation of task may be in group setting; evaluation performed individually upon completion of the task by reviewing the completed form.
- 2. Provide the examinee with the required materials to perform this JPM.
- 3. The actions of step 4.2 of the Appendix have been completed and information may be provided to examinee, if requested.

TASK STANDARD: Required for successful completion of this JPM:

- Correctly Assess Time to Saturation using TABLE A of UOP-4.0.
- Complete the Core Cooling section of a Shutdown Safety Assessment using Fig 1A of UOP-4.0.

Examinee:				
Overall JPM Performance:	Satisfactory		Unsatisfactory	
Evaluator Comments (attach a	dditional sheets i	f necessary)		

EXAMINER: _____

Developer	H. Fitzwater	10/26/09
NRC Approval		SEE NUREG 1021 FORM ES-301-3

A.1.2.S

RESULTS.

CONDITIONS

When I tell you to begin, you are to determine the time to saturation and prepare the CORE COOLING SECTION ONLY of a shutdown safety assessment on Unit 1 per FNP-0-UOP-4.0, Appendix 1, step 4.3 and step 4.4. The conditions under which this task is to be performed are:

- a. Unit 1 is in a Refueling Outage, and has been shutdown for 120 hours.
- b. 1A SG wide range level is 74%; 1B SG wide range level is 75%; 1C SG wide range level is 10%.
- c. RCS temperature is 117°F.
- d. The SS has not permitted interpolation between data points.
- e. The RCS is at mid-loop with a FULL core.
- f. Both trains of RHR are in operation in the cooldown mode.
- g. Mid-loop integrity per STP-18.4 has been verified current.
- h. The IPC is not available.
- i. Another operator is evaluating the other SHUTDOWN SAFETY FUNCTION/CRITERIAS.
- j. You are directed to determine the time to saturation and prepare the CORE COOLING SECTION ONLY of a shutdown safety assessment on Unit 1 per FNP-0-UOP-4.0, Appendix 1, step 4.3 and step 4.4.

INITIATING CUE: "You may begin."

EVALUATION CHECKLIST

		REDUCTIO.
ELEMENTS:	STANDARDS:	(CIRCLE)

START TIME

NOTE: Since task may be performed as a group classroom task, elements 1 through 8 may be evaluated by reviewing the completed paperwork.

* 1. PER STEP 4.3, determine and document at bottom of Figure 1A:

Time to saturation <u>IF</u> core cooling were lost: (a) hours (b) minutes

- Select Table using given data
- Select applicable page of table.
- Select column for given RCS level
- Select row for time after Shutdown
- Identify time
- Identify units for time

- 1) Written in bottom line of S / UFigure 1A: (a). <u>0.0</u> hours. (b). <u>9.2</u> minutes.
- Table A (Full Core)
- Select page 2 of 3 (120°F)
- Select column 2: (MIDLOOP)
- Select row 6 (120 hours)
- Identify 9.2
- Identify "min" from column header

NOTE: For Element numbers 2 through 7, the "LINE" number correlates to the Core Cooling Shutdown Safety Function Evaluation, Figure 1A of Appendix 1 of FNP-0-UOP-4.0. Elements 2 through 8 are per step 4.4 of the appendix.

EVALUATION CHECKLIST

	ELEMENTS:	STANDARDS:	RESULTS: (CIRCLE)	
۴ 2.	 LINE 1: ≥ 2 SGs Avail with loops filled (Ref. step 2.7) evaluate SG availability: SG tubes filled and vented; considered filled and vented if RCS has remained ≥100 psig since last fill and vent. 	 2) Zero (0) written on the line for item 1. o Midloop ≠ filled and vented and < 100 psig 	S / U	
3.	LINE 2 :Cavity level \geq 152' 9"	3) Zero (0) written on the line for item 2.	S / U	
4.	LINE 3 :RHR subsystems Available (0,1, or 2)	4) Two (2) written on the line for item 3.	S / U	
5.	LINE 4 :RCS level \geq 126' 6"	5) Zero (0) written on the line for item 4.	S / U	
6.	LINE 5 :Time to saturation >30 minutes OR RCS press >325 psig with at least one RCP available for operation and at least one SG available	6) Zero (0) written on the line for item 5.	S / U	
7.	Core Cooling Subtotal	7) Two (2) written on line for Core Cooling Subtotal.	S / U	

IF no condition circled for element 8 THEN provide the following CUE: "What condition is Core Cooling in?"

* 8.	Evaluates Core Cooling condition	 8) Circle around ORANGE condition for the Core Cooling Function OR., if cued per NOTE State the condition is 	S / U
		ORANGE	

Terminate when all elements of the task have been completed.

____ STOP TIME

<u>CRITICAL ELEMENTS</u>: Critical Elements are denoted with an asterisk (*) before the element number.

GENERAL REFERENCES:

1. FNP-0-UOP-4.0, V	VER 36.0		
2. KA: G2.1.25	RO 3.9	SRO	4.2

GENERAL TOOLS AND EQUIPMENT:

- 1. References to be accessed via classroom computer (using exam ID logon) and Exam Reference disk/files only.
- 2. Provide copy of FNP-0-UOP-4.0 Table A, Table B, Appendix 1
- 3. Pen/Pencil
- 4. Calculator (optional-not required to complete this task)

Critical ELEMENT justification:

STEP

Evaluation

- 1. Critical this is first of the two major objectives of the task. Utilization of the plant parameters and selection of the appropriate table are required to properly assess Shutdown Core Cooling function.
- $\frac{2}{2}$ Critical Each line item is critical to evaluate proper assessment of each parameter.
- 3. The aggregate effect of errors made within each line *could* result in obtaining the
- correct end point; therefore each sub-step must be evaluated to ensure examinee is
- 6. correctly assessing the parameters.
- 7. This is **NOT** a critical element since documentation of this summation is not procedurally driven nor will failure to complete this element necessarily impact the outcome.
- 8. Critical This is the final objective of the task; proper assessment of this function is required to identify the need of mitigating actions necessary to ensure the health and safety of the public is not jeopardized.

COMMENTS:

References expected to be utilized:

1. FNP-0-UOP-4.0, ver 36.0

	and the second s				
IN KEY					
Header information is not required for this Task; but if requested use cu	irrent date a	ind time.			
Unit: Prepared By: Name Date: Date Time: H	HMM App	p-1, Fig 2 I	Evaluated 🗆]	
SHUTDOWN SAFETY FUNCTION/ CRITERIA			CONDITIC		
(No/False=0, Yes/True=1, Use number within range when required)			(Circle Condit Condition		
REACTIVITY		Subtotal	RED	AOP 41	
 No Core Alterations in Progress Number of Boration Flow Paths (0, 1, 2) (Ref step 2.13) RCS Boron: CSD/Refueling Concentration Source Range Instrumentation Available Reactivity Subtotal 		0-1 2 3-4 5 (GREEN i	ORANGE YELLOW GREEN f Defueled)	41 41 41	
CORE COOLING		Subtotal	Condition	AOP	
 ≥ 2 SGs Avail with loops filled (Ref step 2.7) Cavity level ≥ 152'9" RHR Subsystems Available (0, 1 or 2) RCS level ≥ 126' 6" Time to saturation > 30 minutes <u>OR</u> RCS press > 325 psig with at least one RCP available for operation and at least one SG available Core Cooling Subtotal 	0 0 2 0 0 0	0-1 2-3 4 ≥5 (GREEN i	RED ORANGE YELLOW GREEN f Defueled)	42 42 Min requi "CIRCLE" condition	" the
		Cultural	Condition	- "ORANG	E"
POWER AVAILABILITY 1. 1 "A" Train DG Available 2. 1 "B" Train DG Available 3. F 4160 V BUS normal (Aligned to A SUT) 4. G 4160 V BUS normal (Aligned to B SUT)		Subtotal 0-2 3 4-5 6	RED ORANGE YELLOW GREEN	including subtotal c is not req	or the AOP
 5. 2 Feeds available to the HV Switchyard (0, 1 or 2) Power Availability Subtotal 					
CONTAINMENT		Subtotal	Condition	AOP	
 Refueling Integrity Set CTMT Closure Set No Core Alterations in Progress (2 pts) Equipment Hatch & Air Locks Closed or Capable of Being Closed on Short Notice 		0-1 2-4 5-6 7	RED ORANGE YELLOW GREEN f Defueled)	44 44 44	
5. RCS level $\ge 126' 6'' (3 \text{ pts})$		Chastin	r Bondonou)		
Containment Subtotal					
INVENTORY		Subtotal	Condition	AOP	_
 Refueling Cavity ≥ 23 Feet (142'1") Above Fuel LHSI Pump/Flowpath Available HHSI Pump/Flowpath Available RCS is Intact below the Reactor Vessel Flange Inventory Subtotal 		0 1 2 3-4 (GREEN i	RED ORANGE YELLOW GREEN f Defueled)	45 45 45	
RCS INTEGRITY		Subtotal	Condition	AOP	
 All S/G Manways or Nozzle Dams Installed RCS is Intact below the Reactor Vessel Flange Pressurizer level < 100% RCS Integrity Subtotal 		0-1 2 3 (GREEN i	ORANGE YELLOW GREEN f Defueled)	46 46	
SPENT FUEL COOLING		Subtotal	Condition	AOP	
 SFP level ≥ 23 feet (151'6") above fuel (4 pts) A Trn SFP Cooling available B Trn SFP Cooling available ≥ 2 SFP Makeup Sources (RWST, DW, RMW to Blender, Boric Acid to Blender, RHT to transfer canal with weir gate removed) 		0-4 5 6 7	RED ORANGE YELLOW GREEN	47 47 47	
SFP Subtotal	0	<u> </u>	0.2	~~~	10000
Time to saturation IF core cooling were lost:	U	hours	<u>9.2</u> minut	es	

CONDITIONS

When I tell you to begin, you are to determine the time to saturation and prepare the CORE COOLING SECTION ONLY of a shutdown safety assessment on Unit 1 per FNP-0-UOP-4.0, Appendix 1, step 4.3 and step 4.4. The conditions under which this task is to be performed are:

- a. Unit 1 is in a Refueling Outage, and has been shutdown for 120 hours.
- b. 1A SG wide range level is 74%; 1B SG wide range level is 75%; 1C SG wide range level is 10%.
- c. RCS temperature is 117°F.
- d. The SS has not permitted interpolation between data points.
- e. The RCS is at mid-loop with a FULL core.
- f. Both trains of RHR are in operation in the cooldown mode.
- g. Mid-loop integrity per STP-18.4 has been verified current.
- h. The IPC is not available.
- i. Another operator is evaluating the other SHUTDOWN SAFETY FUNCTION/CRITERIAS.
- j. You are directed to determine the time to saturation and prepare the CORE COOLING SECTION ONLY of a shutdown safety assessment on Unit 1 per FNP-0-UOP-4.0, Appendix 1, step 4.3 and step 4.4.

IARI

TABLE A

Power-Uprated Unit

Time To Saturation: Full Core

Assumed Initial Temperature = 100° F

Time After Shutdown	Time To Saturation at Midloop	Time To Saturation 3 ft Below Flange	Time To Saturation Full Reactor Cavity	Time To Saturation RCS Full
(hours)	(min)	(min)	(hours)	(hours)
40	7.7	10.5	5.6	1.3
60	8.7	11.9	6.3	1.4
80	9.5	13.0	6.9	1.6
100	10.4	14.2	7.5	1.7
120	11.3	15.4	8.2	1.9
140	11.9	16.3	8.6	2.0
160	12.7	17.4	9.2	2.1
180	13.3	18.2	9.6	2.2
200	13.9	19.0	10.1	2.3
336	17.1	23.4	12.4	2.9
504	20.8	28.5	15.1	3.5

VOLUME REFERENCE TABLE

Midloop Volume (ft3):	945		
Volume: 3 ft Below Flange (ft3)	348	Total =	1293
Volume: Full Reactor Cavity (ft3)	39750	Total =	41043
Volume: RCS Full (including Pzr) (ft3)	9591		



TABLE A

Power-Uprated Unit

Time To Saturation: Full Core

Assumed Initial Temperature = 120°F

Time After	Time To Saturation	Time To Saturation	Time To Saturation	Time To Saturation RCS
Shutdown	at Midloop	3 ft Below Flange	Full Reactor Cavity	Full
(hours)	(min)	(min)	(hours)	(hours)
(nourb)				(
40	6.3	8.6	4.5	1.1
60	7.1	9.8	5.2	1.2
80	7.8	10.6	5.6	1.3
100	8.5	11.7	6.2	1.4
120	9.2	12.6	6.7	1.6
140	9.8	13.4	7.1	1.7
160	10.4	14.2	7.5	1.8
180	10.9	14.9	7.9	1.8
200	11.4	15.6	8.2	1.9
336	14.0	19.1	10.1	2.4
504	17.0	23.3	12.3	2.9

VOLUME REFERENCE TABLE

Midloop Volume (ft3):	945		
Volume: 3 ft Below Flange (ft3)	348	Total =	1293
Volume: Full Reactor Cavity (ft3)	39750	Total =	41043
Volume: Full RCS (including Pzr) (ft3)	9591		



TABLE A

Power-Uprated Unit

Time To Saturation: Full Core

Assumed Initial Temperature = 140°F

Time After Shutdown (hours)	Time To Saturation at Midloop (min)	Time To Saturation 3 ft Below Flange (min)	Time To Saturation Full Reactor Cavity (hours)	Time To Saturation RCS Full (hours)
40	4.9	6.7	3.5	0.8
60	5.6	7.6	4.0	0.9
80	6.1	8.3	4.4	1.0
100	6.6	9.1	4.8	1.1
120	7.2	9.8	5.2	1.2
140	7.6	10.4	5.5	1.3
160	8.1	11.1	5.9	1.4
180	8.5	11.6	6.1	1.4
200	8.9	12.1	6.4	1.5
336	10.9	14.9	7.9	1.8
504	13.3	18.2	9.6	2.2

VOLUME REFERENCE TABLE

Midloop Volume (ft3):	945		.
Volume: 3 ft Below Flange (ft3)	348	Total =	1293
Volume: Full Reactor Cavity (ft3)	39750	Total =	41043
Volume: Full RCS (including Pzr) (ft3)	9591		

-lari \leq |

TABLE B

Power-Uprated Unit

Time To Saturation: One-Third New Fuel

Assumed Initial Temperature = 100°F

Time After Shutdown (hours)	Time To Saturation at Midloop (min)	Time To Saturation 3 ft Below Flange (min)	Time To Saturation Full Reactor Cavity (hours)	Time To Saturation RCS Full (hours)
100	15.6	21.4	11.3	2.6
200	20.9	28.5	15.1	3.5
300	24.7	33.7	17.8	4.2
400	27.5	37.6	19.9	4.7
500	31.1	42.5	22.5	5.3
600	34.5	47.3	25.0	5.8
700	37.2	51.0	27.0	6.3
800	40.4	55.3	29.2	6.8

VOLUME REFERENCE TABLE

Midloop Volume (ft3):	945		
Volume: 3 ft Below Flange (ft3)	348	Total =	1293
Volume: Full Reactor Cavity (ft3)	39750	Total =	41043
Volume: Full RCS (including Pzr) (ft3)	9591		

.

SHAREL

TABLE B

Power-Uprated Unit

Time To Saturation: One-Third New Fuel

Assumed Initial Temperature = 120°F

Time After Shutdown (hours)	Time To Saturation at Midloop (min)	Time To Saturation 3 ft Below Flange (min)	Time To Saturation Full Reactor Cavity (hours)	Time To Saturation RCS Full (hours)
100	12.8	17.5	9.2	2.2
200	17.1	23.4	12.4	2.9
300	20.2	27.6	14.6	3.4
400	22.5	30.8	16.3	3.8
500	25.4	34.8	18.4	4.3
600	28.3	38.7	20.5	4.8
700	30.5	41.7	22.1	5.2
800	33.0	45.2	23.9	5.6

VOLUME REFERENCE TABLE

Midloop Volume (ft3):	945		
Volume: 3 ft Below Flange (ft3)	348	Total =	1293
Volume: Full Reactor Cavity (ft3)	39750	Total =	41043
Volume: Full RCS (including Pzr) (ft3)	9591		

TARE \mathbb{C}

TABLE B

Power-Uprated Unit

Time To Saturation: One-Third New Fuel

Assumed Initial Temperature = 140°F

Time After Shutdown (hours)	Time To Saturation at Midloop (min)	Time To Saturation 3 ft Below Flange (min)	Time To Saturation Full Reactor Cavity (hours)	Time To Saturation RCS Full (hours)
100	10.0	13.6	7.2	1.7
200	13.3	18.2	9.6	2.2
300	15.7	21.5	11.4	2.7
400	17.5	24.0	12.7	3.0
500	19.8	27.1	14.3	3.3
600	22.0	30.1	15.9	3.7
700	23.7	32.5	17.2	4.0
800	25.7	35.2	18.6	4.3

VOLUME REFERENCE TABLE

Midloop Volume (ft3):	945		
Volume: 3 ft Below Flange (ft3)	348	Total =	1293
Volume: Full Reactor Cavity (ft3)	39750	Total =	41043
Volume: Full RCS (including Pzr) (ft3)	9591		

.

FNP-0-UOP-4.0 APPENDIX 1

FARLEY NUCLEAR PLANT SHARED UNIT OPERATING PROCEDURE UOP-4.0 APPENDIX 1

1.0 <u>Purpose</u>

The purpose of the Shutdown Safety Assessment is to provide a means for evaluating the safety condition of the plant when in Modes 4, 5, 6 or de-fueled and to provide appropriate contingency actions. (CR 2004102447)

2.0 <u>Definitions</u>

- 2.1 Green Condition The plant is fully capable of performing the associated safety function.
- 2.2 Yellow Condition The plant's ability to perform the associated safety function is reduced but is at an acceptable level.
- 2.3 Orange Condition The plant's ability to perform the associated safety function has been severely reduced and steps should be taken to minimize the amount of time in this condition.
- 2.4 Red Condition The plant's ability to perform the associated safety function is in jeopardy and steps must be taken immediately to correct the cause of the condition.
- 2.5 Source Range Instrumentation Available The audible count rate and at least one indication of source range counts (preferably NR-45) are available to indicate a dilution of the RCS.
- 2.6 RCS Intact Below the Vessel Flange No opening exist which would result in spillage if the RCS level was raised to the vessel flange.
- 2.7 One or More SGs Available A S/G is available to remove heat if the tubes are filled and vented, the wide range level is \geq 75%, a steam flow path to the atmosphere can be made available with minor valve manipulations and a means of adding water to the S/G via the auxiliary feed water system exists. The S/G tubes are considered filled and vented if the RCS has been maintained greater than or equal to 100 psig since the last RCS fill and vent.
- 2.8 RHR Subsystems Available The RHR system is capable of removing heat from the RCS.

- 2.9 One D/G Available The selected D/G is capable of being started (either manually or automatically) and supplying 4160 V power to its respective bus.
- 2.10 Equipment Hatch & Airlocks Capable of Being Closed on Short Notice The equipment hatch meets this definition when the MCRT is established. The personnel and aux airlocks meet this definition when a routine check of the hoses and cables going through the airlocks reveals that at least one door in each airlock can be closed in less than the current time to boil. (AI 2008207932)
- 2.11 HHSI Pump / Flow Path Available A charging pump is capable of injecting water into the RCS from the RWST which contains > 50,000 gallons of water. Only minor valve manipulations are required.
- 2.12 LHSI Pump / Flow Path Available A RHR pump is capable of injecting water into the RCS from the RWST which contains > 50,000 gallons of water. Only minor valve manipulations are required.
- 2.13 Based on the unit outage, boration flow paths via charging pumps and ECCS injection lines are determined using the guidance of Table 4 of FNP-1-STP-2.1 <u>OR FNP-2-STP-2.1</u>, BORON INJECTION FLOW PATH VERIFICATION AND BORIC ACID TRANSFER PUMP OPERABILITY TEST, MODES 5 & 6 <u>AND</u> by a current FNP-1-STP-3.2 <u>OR FNP-2-STP-3.2</u>, BORATED WATER SOURCE OPERABILITY TEST MODE 5, 6.

Additionally, Normal charging can be considered an available boration flow path under the following conditions:

- 2.13.1 Q1E21MOV8107 and Q1E21MOV8108 are open, <u>OR</u> Q2E21MOV8107 and Q2E21MOV8108 are open.
- 2.13.2 With one of the following charging pump requirements met.
 - 1A or 2A Charging Pump available
 - 1B Charging Pump Available with Q1E21MOV8132A and B open, <u>OR</u> 2B Charging Pump Available with Q2E21MOV8132A and B open
 - 1C Charging pump available with Q1E21MOV8132A and B open, <u>OR</u> 2C Charging pump available with Q2E21MOV8132A and B open

3.0 <u>Precautions and Limitations</u>

- 3.1 The Shift Supervisor will evaluate the affect of removing shutdown safety equipment from service. If proposed changes to the schedule appear to reflect a reduction in the key safety functions, refer the proposed changes to the Outage Manager for assessment per FNP-0-AP-94, OUTAGE NUCLEAR SAFETY, prior to implementing the changes.
- 3.2 The appropriate AOP-40 series procedure will be implemented upon unexpected entry into or discovery of the existence of a Red, Orange or Yellow condition.
- 3.3 Intentional entry into a red condition must be approved by the Plant Manager and documented per FNP-0-AP-94, OUTAGE NUCLEAR SAFETY. FNP's current position is that the plant will not be intentionally placed in this condition. Review FNP's commitment to NUMARC 91-06.
- 3.4 Intentional entry into an orange condition must be approved by the Outage Manager or his designee prior to entry into that condition and documented per FNP-0-AP-94.
- 3.5 Intentional entry into a yellow condition must be approved by the Shift Manager or Operations Superintendent prior to entry into that condition.
- 3.6 Notify the Outage Manager immediately if a red condition or an unexpected orange condition exists.

4.0 <u>Instructions</u>

NOTE: • The Shutdown Safety Assessment form may be a two-side copy.

- The Shift Supervisor will ensure that the appropriate Shutdown Safety Assessment Form is completed at about 0200 and 1400 when in Mode 4, Mode 5, Mode 6 or defueled. (CR 2004102447)
- 4.1 Obtain a copy of the appropriate Shutdown Safety Assessment form. For modes 5, 6, and defueled use Figure 1A and for mode 4 use Figure 1B.
- 4.2 Fill in the header information on the form.
 - Unit
 - Prepared By
 - Date
 - Time

FNP-0-UOP-4.0 APPENDIX 1

- 4.3 IF in mode 5 or 6, THEN determine the time to saturation for existing plant conditions using the IPC (preferred) or FNP-0-UOP-4.0 Table A or B. Enter time on Figure 1A of Appendix 1.
- 4.4 Evaluate the criteria listed below each Shutdown Safety Function as follows.

NOTE: Refer to Definitions to assist in the evaluation as appropriate.

- 4.4.1 <u>IF</u> the reactor is defueled, <u>THEN</u> N/A the blanks for all Safety Functions except power availability and spent fuel cooling.
- 4.4.2 <u>IF</u> the criteria is met, <u>THEN</u> place a 1 in its blank or use the number/range of numbers listed in ().
- 4.4.3 <u>IF</u> the criteria is <u>NOT</u> met, <u>THEN</u> place a 0 in its blank.
- 4.4.4 For each individual Safety Function add up the numbers in the blanks and circle the condition corresponding to the subtotal.
- 4.5 <u>IF</u> an unexpected Red, Orange or Yellow condition is determined to exist, <u>THEN</u> implement the appropriate AOP-40 series procedure referenced on the Shutdown Safety Assessment form.
- 4.6 <u>IF</u> a yellow or orange condition exists that result in a single train available, <u>THEN</u> place a caution sign concerning equipment required for a safe shutdown condition at the applicable locations per the following:
 - 4.6.1 Use Figure 2 to determine posting requirements.
 - 4.6.2 Check the box on Figure 1A or 1B to indicate the review of the Figure 2 posting requirements {AI 2001203573}.
- 4.7 If a red, orange, or yellow condition currently exists for any Safety Function due to an intentional entry, verify
 - 4.7.1 Appropriate approval per FNP-0-AP-94 has been obtained, and
 - 4.7.2 Contingency Actions per Table 1 have been performed for the affected Shutdown Safety Functions.

- 4.8 Evaluate the activities planned for the next 12 hours to determine if the plant may potentially enter a red, orange, or yellow condition.
 - 4.8.1 <u>IF</u> intentional entry into a red condition is expected <u>THEN</u> entry must be approved by the Nuclear Plant General Manager and documented per FNP-0-AP-94, OUTAGE NUCLEAR SAFETY. FNP's current position is that the plant will not be intentionally placed in this condition. Review FNP's commitment to NUMARC 91-06.
 - 4.8.2 IF intentional entry into an orange condition is expected <u>THEN</u>
 - A. Entry must be approved by the Outage Manager or his designee prior to entry into that condition and documented per FNP-0-AP-94.
 - B. Perform the Contingency Actions in Table 2 for the affected Shutdown Safety Function(s).
 - 4.8.3 IF intentional entry into a yellow condition is expected THEN
 - A. Entry must be approved by the Shift Manager or Operations Superintendent prior to entry into that condition and documented per FNP-0-AP-94.
 - B. Perform the Contingency Actions in Table 2 for the affected Shutdown Safety Function(s).
- 4.9 Post the Shutdown Safety Assessment at the following locations.
 - Control Room
 - Entrance to the PAP
 - Entrance to the SAP (only required if SAP opened for protected area access)
 - Outage Control Center

5.0 <u>References</u>

- 4.1 NUMARC 91-06, Guidelines For Industry Actions To Assess Shutdown Management.
- 4.2 10CFR50.65 (a)(4)
- 4.3 NUMARC 93-01, Section 11, Assessment of Risk Resulting from Performance of Maintenance Activities, February 2, 2000.
- 4.4 FNP-0-AP-94, OUTAGE NUCLEAR SAFETY.



FNP-0-UOP-4.0 **APPENDIX 1**

Figure 1A

SHUTDOWN SAFETY ASSESSMENT (Modes 5, 6 and Defueled)

Unit:____ Prepared By:_____ Date:_____ Time:_____ App-1, Fig 2 Evaluated \Box

	SHUTDOWN SAFETY FUNCTION/ CRITERIA		,	CONDITIC	Ň
(No	D/False=0, Yes/True=1, Use number within range when required)		(Circle Condit	tion)
	REACTIVITY		Subtotal	Condition	AOP
1. 2. 3. 4.	No Core Alterations in Progress Number of Boration Flow Paths (0, 1, 2) (Ref step 2.13) RCS Boron: CSD/Refueling Concentration Source Range Instrumentation Available Reactivity Subtotal		0-1 2 3-4 5 (GREEN i	RED ORANGE YELLOW GREEN f Defueled)	41 41 41
	CORE COOLING		Subtotal	Condition	AOP
1. 2. 3. 4. 5.	$\geq 2 \text{ SGs Avail with loops filled (Ref step 2.7)}$ Cavity level ≥ 152 '9" RHR Subsystems Available (0, 1 or 2) RCS level $\geq 126'$ 6" Time to saturation > 30 minutes <u>OR</u> RCS press > 325 psig with at least one RCP available for operation and at least one SG available Core Cooling Subtotal		0-1 2-3 4 ≥5 (GREEN i:	RED ORANGE YELLOW GREEN f Defueled)	42 42 42
	POWER AVAILABILITY		Subtotal	Condition	AOP
1. 2. 3. 4. 5.	 1 "A" Train DG Available 1 "B" Train DG Available F 4160 V BUS normal (Aligned to A SUT) G 4160 V BUS normal (Aligned to B SUT) 2 Feeds available to the HV Switchyard (0, 1 or 2) Power Availability Subtotal 		0-2 3 4-5 6	RED ORANGE YELLOW GREEN	43 43 43
	CONTAINMENT		Subtotal	Condition	AOP
1. 2. 3. 4. 5.	Refueling Integrity Set CTMT Closure Set No Core Alterations in Progress (2 pts) Equipment Hatch & Air Locks Closed or Capable of Being Closed on Short Notice RCS level ≥ 126' 6" (3 pts)		0-1 2-4 5-6 7 (GREEN if	RED ORANGE YELLOW GREEN f Defueled)	44 44 44
2.	Containment Subtotal				
	INVENTORY		Subtotal	Condition	AOP
1. 2. 3. 4.	Refueling Cavity ≥ 23 Feet (142'1") Above Fuel LHSI Pump/Flowpath Available HHSI Pump/Flowpath Available RCS is Intact below the Reactor Vessel Flange Inventory Subtotal		0 1 2 3-4 (GREEN if	RED ORANGE YELLOW GREEN Defueled)	45 45 45
	RCS INTEGRITY	<u></u>	Subtotal	Condition	AOP
1. 2. 3.	All S/G Manways or Nozzle Dams Installed RCS is Intact below the Reactor Vessel Flange Pressurizer level < 100% RCS Integrity Subtotal		0-1 2 3 (GREEN if	ORANGE YELLOW GREEN Defueled)	46 46
	SPENT FUEL COOLING		Subtotal	Condition	AOP
1. 2. 3. 4.	SFP level ≥ 23 feet (151'6") above fuel (4 pts) A Trn SFP Cooling available B Trn SFP Cooling available ≥ 2 SFP Makeup Sources (RWST, DW, RMW to Blender, Boric Acid to Blender, RHT to transfer canal with weir gate removed) SFP Subtotal		0-4 5 6 7	RED ORANGE YELLOW GREEN	47 47 47
Tim	ne to saturation IF core cooling were lost:		hours	minute	es

SHAREI

FNP-0-UOP-4.0 APPENDIX 1

FIGURE 1B

SHUTDOWN SAFETY ASSESSMENT (Mode 4)

Ur	nit: Prepared By: Date:_	Tin	ne:	App-1, Fig	g 2 Evaluated	
	SHUTDOWN SAFETY FUNCTION/ CRI o/False=0, Yes/True=1, Use number within range		red)	(CONDITIO	
	REACTIVITY	e mien requi		Subtotal	Condition	AOP
				<u> </u>		
1.	No positive reactivity changes in Progress	12)		0-1	RED ORANGE	41 41
2.	Number of Boration Flow Paths (0, 1, 2) (Ref step 2. RCS Boron: CSD boron concentration	.15)		2 3-4	YELLOW	41
4.	Number of Source Range Instrumentation Available			5	GREEN	71
1	Reactivity Subtotal				Grassit	
	CORE COOLING			Subtotal	Condition	AOP
1.	2 SGs Available (2 pts if \geq 2 S/G's Available (Ref st	tep 2.7)		0-1	RED	42
2.	RHR Subsystems Available (0, 1 or 2)	1 ,		2-3	ORANGE	42
3.	PRZ level within normal operating band			4	YELLOW	42
4.	RCS Subcooling Margin > 16° F			≥5	GREEN	
	Core Cooling Subtotal					
	POWER AVAILABILITY			Subtotal	Condition	AOP
1.	1 "A" Train DG Available			0-2	RED	43
2.	1 "B" Train DG Available			3	ORANGE	43
3.	F 4160 V BUS normal (Aligned to A SUT)			4-5	YELLOW	43
4.	G 4160 V BUS normal (Aligned to B SUT)			6	GREEN	
5.	2 Feeds available to the HV Switchyard (0, 1 or 2)					
	Power Availability Subtotal					
	CONTAINMENT			Subtotal	Condition	AOP
1.	CTMT Integrity meets tech spec requirements			0-1	RED	44
2.	RCS borated to cold shutdown boron concentration	(2 pts)	<u> </u>	2-4	ORANGE	44
3.	CTMT Cooling tech spec are met (3 pts)			5-6	YELLOW	44
<u> </u>	Containment Subtotal		Total Construction of the	6	GREEN	
	INVENTORY			Subtotal	Condition	AOP
1.	PRZ level within normal operating band			0	RED	45
2.	LHSI Pump/Flowpath Available			1	ORANGE	45
3.	HHSI Pump/Flowpath Available			2	YELLOW	45
4.	Normal make-up capability available Inventory Subtotal			3-4	GREEN	
				Subtotal	Condition	
	RCS INTEGRITY LTOP TECH SPEC MET			Subtotal	Condition	AOP
1. 2.	RCS/PRZ cooldown rate < tech spec allowable			0-1	ORANGE	46 46
2.	Pressurizer operable per tech specs			23	YELLOW GREEN	46
5.	RCS Integrity Subtotal			3	OKEEN	
 	SPENT FUEL COOLING			Subtotal	Condition	
				0-4	RED	47
1. 2.	SFP level \geq 23 feet (151'6") above fuel (4 pts) A Trn SFP Cooling			5	ORANGE	47 47
2. 3.	B Trn SFP Cooling			6	YELLOW	47
3. 4	\geq 2 SFP Makeup Sources (RWST, DW, RMW to Ble	ender Borio		7	GREEN	.,
∥ '	Acid to Blender, RHT to transfer canal with weir ga					
	_	·,				
	SFP Subtotal					

Figure 2

Yellow/Orange Condition Signs Required for Single Train Availability

- 1. <u>IF</u> required by step 4.6, <u>THEN</u> place caution signs at applicable location specified in Table 2 for Unit 1 or Table 3 for Unit 2.
- 2. Signs should be worded similar to the following:

TRAIN OUTAGE
NO WORK IS TO BE DONE ON THE TRAIN
CALLEXT.

- 3. Complete Table 2 or 3 to document the review of posting requirements.
 - 3.1 Mark as N/A any components which are not required to be posted for the given yellow or orange condition.
 - 3.2 Post signs at the applicable locations and initial the appropriate block of Table 2 or 3.
 - 3.3 When the yellow/orange condition no longer exists, ensure the signs have been removed and initial the appropriate block of Table 2 or 3.

TABLE 1 Contingency Actions Required for Voluntary Entry to a Shutdown Safety Assessment **Orange** or **Yellow** condition.

Reactivity Orange Condition Contingency Actions for Entry

1. Voluntary entry into a Reactivity **Orange** condition is not anticipated.

Reactivity Yellow Condition Contingency Actions for Entry

1. Verify Technical Specification and Technical Requirements Manual requirements are met and will continue to be met for boron concentration, boration flow path, and source range instrumentation.

TABLE 1

Contingency Actions Required for Voluntary Entry to a Shutdown Safety Assessment Orange or Yellow condition.

Core Cooling Orange Condition Contingency Actions for Entry

NOTE: Voluntary entry into a core cooling Orange condition is not normally foreseen for evolutions other than Mid Loop Operations or other reduced inventory evolutions (e.g. drain down for reactor vessel head lift). Under certain plant conditions with time to saturation ≤ 30 min., an orange condition may be encountered.

- 1. <u>IF</u> Orange condition entry is being made as part of Mid Loop Operations, <u>THEN</u> ensure the requirements of FNP-1-UOP-4.3 <u>OR</u> FNP-2-UOP-4.3, MID LOOP OPERATIONS, have been met, including the Mid-Loop Compensatory measures in Appendix 3 of FNP-1-UOP-4.1 <u>OR</u> FNP-2-UOP-4.1, CONTROLLING PROCEDURE FOR REFUELING.
- <u>IF</u> orange condition entry is due to certain plant conditions, with time to saturation
 ≤ 30 minutes, <u>THEN</u> ensure the contingency actions specified in the memo for
 compensatory measures for RCS level at the reactor vessel flange as required by
 Appendix 3 of FNP-1-UOP-4.1 <u>OR</u> FNP-2-UOP-4.1, CONTROLLING PROCEDURE
 FOR REFUELING, have been met. These same contingency actions are applicable for
 non-refueling outages when RCS level is at the reactor vessel flange in these conditions.

Core Cooling Yellow Condition Contingency Actions for Entry

1. Ensure both trains of RHR are operable if in Mode 6 prior to lowering refueling cavity level to < 23 feet (142'1") above the fuel.

 ΔR

FNP-0-UOP-4.0 APPENDIX 1

TABLE 1

Contingency Actions Required for Voluntary Entry to a Shutdown Safety Assessment Orange or Yellow condition.

Power Availability Orange Condition Contingency Actions For Entry

- 1. Verify RCS level \geq 126' 6" prior to voluntary **Orange** condition entry.
- 2. Refer to Technical Specification 3.8.2.
- 3. Based on the unit outage, as a minimum, ensure the Unit 1 or Unit 2 F <u>OR</u> G 4160V Bus is maintained with:
 - An offsite power feed through its associated startup transformer.
 - Its associated DG(s) operable
 - An operable charging pump in the boration flow path
 - An operable BATP if a BATP is required as part of the boration flow path
 - An operable RWST TO CHG PUMP SUCT MOV if the RWST is part of the boration flow path
 - An operable RHR, CCW, and SW Pump
- 4. <u>IF</u> the head is on the reactor vessel, <u>THEN</u> at least one PRZR PORV is operable with backup nitrogen available for use in feed and spill cooling in the event that RHR is lost. Notify the Shift Manager, Alabama Control Center (ACC), or outside SO as appropriate to ensure that no work is in progress that could adversely affect the operable train of AC power and to ensure that no such work is started while this **Orange** condition exists.
- 5. Ensure that no work is in progress in the low voltage switchyard that could adversely affect the operable train of AC power.
- 6. Notify EM supervisory personnel of AC power conditions and requirements and direct their personnel (including appropriate Williams and EFS personnel) be briefed on these conditions and requirements.
- 7. Install Caution Tags or place barricades as appropriate to identify components such as ESF bus feeder breaker, DGs, DG output breakers and bus tie breakers, and startup transformer associated with the ESF bus to be maintained operable.

TABLE 1

Contingency Actions Required for Voluntary Entry to a Shutdown Safety Assessment Orange or Yellow condition.

Power Availability Yellow Condition Contingency Actions For Entry

- 1. Verify RCS level \geq 126' 6" prior to voluntary **Yellow** condition entry.
- 2. Refer to Technical Specification 3.8.2.
- 3. Based on the unit outage, as a minimum, ensure the Unit 1 or Unit 2 F <u>OR</u> G 4160V Bus is maintained with:
 - An offsite power feed through its associated startup transformer.
 - Its associated DG(s) operable
 - An operable charging pump in the boration flow path
 - An operable BATP if a BATP is required as part of the boration flow path
 - An operable RWST TO CHG PUMP SUCT MOV if the RWST is part of the boration flow path
 - An operable RHR, CCW, and SW Pump
- 4. <u>IF</u> the head is on the reactor vessel, <u>THEN</u> at least one PRZR PORV is operable with backup nitrogen available for use in feed and spill cooling in the event that RHR is lost.
- 5. Ensure that no work is in progress in the low voltage switchyard that could adversely affect the operable train of AC power.
- 6. Notify EM supervisory personnel of AC power conditions and requirements and direct their personnel (including appropriate Williams and EFS personnel) be briefed on these conditions and requirements.

 $|\Delta ||$

FNP-0-UOP-4.0 APPENDIX 1

TABLE 1 Contingency Actions Required for Voluntary Entry to a Shutdown Safety Assessment **Orange** or **Yellow** condition.

Containment Orange Condition Contingency Actions For Entry

- 1. Verify no core alterations in progress or planned.
- 2. <u>IF</u> **Orange** condition entry is being made as part of Mid Loop Operations, <u>THEN</u> base on the unit outage ensure the requirements of FNP-1-UOP-4.3 <u>OR</u> FNP-2-UOP-4.3, MID LOOP OPERATIONS, have been met.

Containment Yellow Condition Contingency Actions For Entry

1. Not applicable.

TABLE 1 Contingency Actions Required for Voluntary Entry to a Shutdown Safety Assessment **Orange** or **Yellow** condition.

Inventory Orange Condition Contingency Actions For Entry

1. Voluntary entry into an Inventory **Orange** condition is not anticipated.

Inventory Yellow Condition Contingency Actions For Entry

- 1. Ensure both trains of RHR are operable before reducing refueling cavity level to < 23 feet above fuel.
- 2. <u>IF entry is due to Mid Loop Operations, THEN</u> based on the unit outage, ensure the requirements of FNP-1-UOP-4.3 <u>OR</u> FNP-2-UOP-4.3, have been met.
- 3. Refer to applicable Technical Specifications before removing RHR or HHSI systems from service.

TABLE 1 Contingency Actions Required for Voluntary Entry to a Shutdown Safety Assessment **Orange** or **Yellow** condition.

RCS Integrity Orange Condition Contingency Actions For Entry

- 1. <u>IF</u> entry is due to Mid Loop Operations, <u>THEN</u> based on the unit outage ensure the requirements of FNP-1-UOP-4.3 <u>OR</u> FNP-2-UOP-4.3, MID LOOP OPERATIONS, have been met.
- 2. <u>WHEN</u> SG cold leg manways are to be opened OR cold leg nozzle dams are to be removed, <u>THEN</u> verify that at least one hot leg manway, diaphragm, and nozzle dam has been previously removed.

RCS Integrity Yellow Condition Contingency Actions For Entry

- 1. <u>IF</u> entry is due to Mid Loop Operations, <u>THEN</u> based on the unit outage ensure the requirements of FNP-1-UOP-4.3 <u>OR</u> FNP-2-UOP-4.3, MID LOOP OPERATIONS, have been met.
- 2. <u>WHEN</u> SG cold leg manways are to be opened <u>OR</u> cold leg nozzle dams are to be removed, <u>THEN</u> verify that at least one hot leg manway, diaphragm, and nozzle dam has been previously removed.

 ΔR

TABLE 1

Contingency Actions Required for Voluntary Entry to a Shutdown Safety Assessment Orange or Yellow condition.

Spent Fuel Cooling Orange Condition Contingency Actions for Entry

1. Voluntary entry into an **Orange** condition is not anticipated.

Spent Fuel Cooling Yellow Condition Contingency Actions for Entry

- 1. Verify that at least one train of SFP cooling and at least one makeup source are maintained operable.
- 2. Ensure that operating train SFP HX outlet temperature is being monitored every four hours on Rad Side SO logs.

SHAR

TABLE 2

Protected Train Postings Unit 1

Components	Sign Posted Initials	Sign Removed Initials
Charging Pump 1A (B,C)		
RHR Pump 1A (B)		
CCW Pump 1A (B,C)		
BATP 1A (B)		
Diesel Generator 1-2A (1C, 2C, 1B, 2B)		
SFP Cooling 1A TRN (B TRN)		
4160 V Buses F and K (Buses G and L)		
Aux Bldg DC Swgr, A TRN (B TRN)		
Aux Bldg Battery, A TRN (B TRN)		
SW Pumps 1A (B, C, D, E)		
SW Valve Boxes		
Start Up Transformers 1A, or 1B		
Other		

SHARI

FNP-0-UOP-4.0 APPENDIX 1

TABLE 3

Protected Train Postings Unit 2

Components	Sign Posted Initials	Sign Removed Initials
Charging Pump 2 (B,C)		
RHR Pump 2 (B)		
CCW Pump 2 (B,C)		
BATP 2 (B)		
Diesel Generator 1-2A (1C, 2C, or 2B)		
SFP Cooling A TRN (B TRN)		
4160 V Buses F and K (Buses G and L)		
Aux Bldg DC Swgr, A TRN (B TRN)		
Aux Bldg Battery, A TRN (B TRN)		
SW Pumps 2A (B, C, D, E)		
SW Valve Boxes		
Start Up Transformers 2A or 2B		*
Other		

A.2.1.A Equipment Control ADMIN -001A4.11- RO & SRO

A.2.1.A					
TITLE: Perform A Shutdown Margin Calculation in modes 1 & 2.					
PROGRAM APPLICABLE: SOT SOCT OLTX LOCT					
ACCEPTABLE EVALUATION METHOD: <u>X</u> PERFORM <u>SIMULATE</u> DISCUSS					
EVALUATION LOCATION: SIMULATOR CONTROL ROOM CLASSROOM					
PROJECTED TIME: <u>30 MIN</u> SIMULATOR IC NUMBER: <u>N/A</u>					
ALTERNATE PATH TIME CRITICAL PRA					

JPM DIRECTIONS:

- 1. Initiation of task may be in group setting; evaluation performed individually upon completion of the task by reviewing the completed form.
- 2. Provide the examinee with the required materials to perform this JPM.

TASK STANDARD:

- Perform a Shutdown Margin calculation while in Mode 1, using STP-29.5 accurately to within the acceptable ranges identified within each critical element's standard.
- Identify the need to emergency borate.

Examinee:				
Overall JPM Performance:	Satisfactory		Unsatisfactory	
Evaluator Comments (attach a	dditional sheets if	f necessary)		

EXAMINER: _____

Developer	H. Fitzwater	10/28/09
NRC Approval	SEE	NUREG 1021 FORM ES-301-3

FNP HLT-33 ADMIN

A.2.1.A

CONDITIONS

When I tell you to begin, you are to **Determine the excess Shutdown Margin using STP-29.5**, SHUTDOWN MARGIN CALCULATION IN MODES 1 AND 2 (TAVG \geq 547°F), for Unit 1. The conditions under which this task is to be performed are:

- a. Unit 1 is stable at 90% with the ramp on hold
- b. Bank D indicates 192 by Group Demand.
- c. Seven of the Bank D rods (H2, B8, H14, F6, F10, K10, K6) are at 192 steps by DRPI.
- d. Rod P8, in the D bank, has been determined to be stuck.
- e. Rod P8 is at 162 steps by DRPI.
- f. All other rods are at 229 steps.
- g. Core burnup is 9,800 MWD/MTU burnup.
- h. FNP-1-STP-29.5, SHUTDOWN MARGIN CALCULATION IN MODES 1 AND 2 (TAVG ≥ 547°F), initial conditions are satisfied.
- i. The Shift Supervisor has directed you to complete FNP-1-STP-29.5 starting at step 5.1 and identify whether or not emergency boration is required.

INITIATING CUE: "You may begin."

EVALUATION CHECKLIST

		RESULTS:
ELEMENTS:	STANDARDS:	(CIRCLE)

____ START TIME

NOTE: Elements 1 through 13 are evaluated by comparing the completed Calculation page to the values and ranges of each element. The acceptable responses are **ALSO** listed on the calculation KEY.

- 1. Step A.1: Document Core Burnup1) Value entered: 9,800 MWDS / U
- 2. Step A.2: Document Power Level
- 2) Value entered: 90 % entered S / U

		ELEMENTS:	STANDARDS:	RESULTS: (CIRCLE)
3.	Step A.3: below RII	Determine penalty steps for Banks	3) Value entered: ZERO (0) (RNG: NONE)	S / U
	a)	Using COLR figure 1 determines RIL for 90% power level.	 (a). Determines RIL from COLR CB D/ RIL = 167 (165-170) from COLR. CBC / RIL = FULL OUT (or 229). 	
	b)	Gathers data from Conditions page	 (b). Documents given Demand positions CB D/ Demand 192. All others: Full out (or 	
	c)	Determines penalty steps per bank.	 c) All outers: Full out (of 229) (c). Calculates difference All values: 0 (RNG: NONE) 	
* 4.	for RODS	Determine number of penalty steps below RIL Determines stuck rod in CBD, Determines CBD RIL.	 4) Value entered: 5 (RNG: 3-8) (a). Determines RIL from COLR 	S / U
	b)	Documents given Data for rod P-8	 P8 → CB D/ RIL = 167 (Range: 165-170) from COLR. (b). Documents given data i. Rod # → P8 @ 162 	
	c)	Calculates difference	(c). Calculates difference (RIL – DRPI) = 5 (RNG: 3-8)	
* 5.	control and using given a)	Determine Rod Worth for all d shutdown bands at Zero steps a power and burnup: Uses Curve 77 pg 1 for 90% power and 10000MWD	5) Value entered: 6268 pcm. (range: NONE)	S / U
6.	Step B.2: 0	Calculate penalty value of rod banks	6) Value entered of 0 (zero) pcm	S / U
* 7.	Step B.3: C rods	Calculate penalty value of individual	7) Value entered of 50 pcm (range: 30-80)	S / U

FNP HLT-33 ADMIN EVALUATION CHECKLIST

A.2.1.A

EVALUATIO	N CHECKLIST		DEGLU TO.
	ELEMENTS:	STANDARDS:	RESULTS: (CIRCLE)
* 8. Step B.4.a worth	; Determine most reactive Rod	 8) Value entered of 1406 pcm (range: NONE) (a). From Curve 77 pg 2 for ≤ 10000MWD. 	S / U
-	; Calculate rod worth of ippable rod	9) Value entered of 3515 (RNG: 3515- 3516)	S / U
		 (a). # of stuck: 1 rod (b). B.4.a: 1406. (+1 / -0) value for various rounding technique effects) 	
* 10. Step B.5; (Calculate penalized rod worth	10) Value entered of: (-) 2432.7	S / U
		<u>NOTE</u> : NEG (-) SIGN IS IMPORTANT FOR THIS CALCULATION/Evaluation	
		(RNG: (-)2403 to (-) 2451)	
		 Transpose data from other steps: (a). B.1: 6268 (b). B.2: 0 (c). B.3: 50 (d). B.4.b 3515. Calculate using equation. 	
* 11. Step B.6; I conditions	Determine power defect for given	 11) Value entered of: 1634 pcm (RNG: NONE) (a). From Curve 78 for ≤ 10000MWD. 	S / U

ELEMENTS:	STANDARDS:	RESULTS: (CIRCLE)
* 12. Step B.8; Calculate available Shutdown Reactivity	 12) Value entered of: (-) 748.7 (RNG: -718 to -767) 	S / U
	<u>NOTE</u> : NEG (-) SIGN IS IMPORTANT FOR THIS CALCULATION/Evaluation	
	 (a). Transpose data: i. B.5: (-) 2432.7 ii. B.6: 1634 iii. Calculate 	
* 13. Step B.9; Calculate Excess Shutdown Margin	13) Value entered of:(+) 1021.3(RNG: 1003 to 1051)	S / U
	<u>NOTE</u> : POS (+) SIGN IS IMPORTANT FOR THIS CALCULATION/Evaluation	
	(a). Transpose data:i. B.8: (-) 748.7ii. Calculate	
NOTE: Element 15 is not required to be completed but i group/classroom setting.	is likely to be completed/initialed if in	nitiated as a
* 14. Step B.10: Identifies Need to Emergency Borate	14) Notifies Shift Supervisor of need to Emergency Borate.	S / U
15. completes task:a) Signs and dates Calculation Sheet	15) Completes sign off.(a). Signs and dates form	S / U

- b) Initials step 5.1
- c) Asks for verification of calculation
- (b). Initials step 5.1 of procedure.

TERMINATE After calculation of Excess Shutdown Margin AND element 14 completed.

_____ STOP TIME

<u>CRITICAL ELEMENTS</u>: Critical Elements are denoted with an asterisk (*) before the element number.

GENERAL REFERENCES:

 1. FNP-1-STP-29.5, VER 4.0

 2. KA: 001A4.11
 RO 3.5
 SRO 4.1

GENERAL TOOLS AND EQUIPMENT:

- 1. FNP-1-STP-29.5, ver 4.0
- 2. PCB-VOL1-CRV77, Cycle 23 rev 8
- 3. PCB-VOL1-CRV78, Cycle 23 rev 8
- 4. Unit 1, COLR for FNP Unit1 Cycle 23, Rev 0 Figure 1.
- 5. Pen/Pencil
- 6. calculator


Critical ELEMENT justification:

STEP

Evaluation

- 4-13 CRITICAL Calculation completion; each step is critical in accurately determining available SDM and Excess SDM.
 - 14 CRITICAL Task Objective; Identification that Acceptance Criteria NOT met and Emergency boration IS required to ensure corrective action is initiated and compliance with T.S. is restored.


COMMENTS:

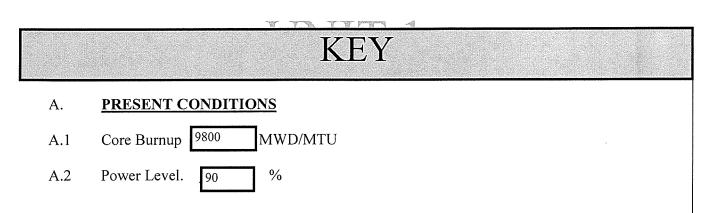

- A.3 Determine number of penalty steps for ROD BANKS below RIL. (Use COLR or convert the RIL computer reading from % to steps)
 - A.3.a Record data in table

ROD BANKS	BANK RIL HEIGHT	BANK DEMAND	STEF RIL	PS B	ELOW
CBA	FULL OUT	Full Out (229)		0	
CBB	FULLOUT	Full Out (229)		0	
CBC	Full Out(229)	Full Out (229)		0	
CBD	167 (166-170)	192		0	
SDA	FULL OUT	Full Out (229)		0	
SDB	FULL OUT	Full Out (229)		0	

TOTAL STEPS BELOW RIL



RANGE for CBD RIL:
LO: Readability of COLR RIL curve may allow allow as low as 165 steps;
although this is < than the curve limit of 166.9, if calculated. The assumptions
within the curve development provides for this readability error.
HI: conservatism allowed by P&L 4.1 may be instituted and a value of up to

170 steps may be selected since the specific value between the Y-axis increments may not be calculated.

KEY

A.4

B.3

5

Determine number of penalty steps for RODS below RIL which were not counted in A.3 (Rods below RIL on DRPI when the BANK demand is above RIL) (Use COLR or convert the RIL computer reading from % to steps)

A.4.a Record data in table

ROD NUMBER	RIL POSITION	DRPI POSITION	DIFFERENCE
P8	167 (+3,-2)	162	5 (3-8)

TOTAL STEPS BELOW RIL

5 (RANGE 3-8)

Β. SHUTDOWN MARGIN

NOTE: Write the values from Curves 77 & 78 directly into the surveillance test. The correct sign convention has been entered in the STP.

B.1 Rod worth for all control and shutdown banks at zero steps at

Present Burnup (A.1) and Power Level (A.2).


()	6268	pcm
	Curve 77	Page 1)

pcm

B.2 Penalty value of rod banks below insertion limit:

$$\frac{6}{4.3.a}$$
 steps × 75 pcm/step =

Penalty value of individual rods below RIL which were not counted in A.3 (Rods below RIL on DRPI when the BANK demand is above RIL) 50 cm (RANGE 3-8) $ps \times 10 pcm/step =$ (RNG 30-80) (A.4.a)

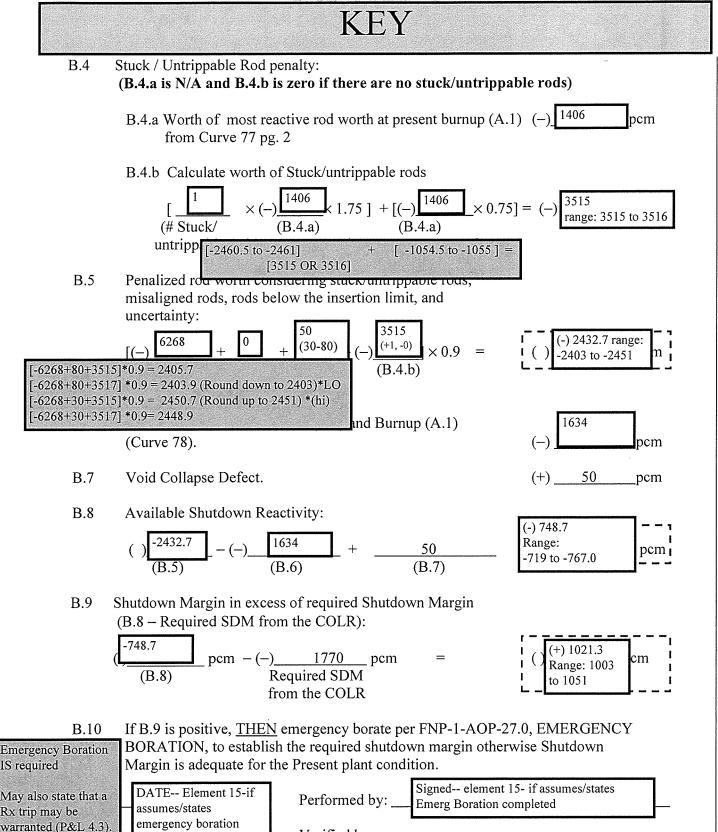


Verified by: _

completed

Westinghouse Proprietary Class 2

PCB-1-VOL1-CRV77





APPROVED: <u>Vandur & For Bryan Grener</u> 4-15 ENGINEERING SUPPORT MANAGER DATE

ARI-1 Rod Worth (pcm) for Shutdown Margin Calculations

		-								
				Pow	ver Level	(%)				
0	10	20	30	40	50	60	70	80	90	100
4587	4710	4831	5071	5311	5483	5655	5792	5927	6162	6397
4667	4801	4935	5180	5425	5594	5762	5905	6048	6285	6523
4717	4867	5017	5267	5517	5680	5844	5995	6145	6384	6623
4755	4909	5063	5320	5578	5740	5902	6052	6201	6442	6683
4818	4975	5131	5396	5660	5814	5969	6113	6257	6483	6708
4767	4920	5072	5346	5619	5778	5938	6073	6208	6439	6670
4717	4865	5013	5296	5579	5743	5906	6033	6159	6395	6631
4689	4827	4965	5254	5542	5714	5885	6001	6118	6355	6593
4660	4788	4916	5211	5506	5685	5864	5 Elen	nent #6	6316	6555
4646	4765	4884	5182	5480	5669	5857	5	Financial Distance Mercel Mercel Mercel	6292	6531
4632	4742	4852	5154	5455	5652	5850	5939	6028	6268	6507
4622	4725	4828	5129	5431	5641	5850	5933	6016	6253	6490
4612	4707	4803	5105	5408	5629	5850	5927	6004	6239	6473
4617	4706	4795	5096	5398	5631	5865	5937	6010	6242	6475
4621	4704	4787	5087	5387	5633	5879	5947	6015	6245	6476
4631	4709	4787	5086	5385	5642	5900	5964	6028	6256	6485
4641	4714	4787	5085	5382	5652	5921	5981	6041	6267	6493
4662	4731	4800	5096	5391	5669	5947	6004	6062	6286	6510
4682	4748	4813	5107	5400	5687	5973	6028	6083	6304	6526
4709	4771	4833	5125	5418	5710	6002	6056	6109	6328	6547
4735	4794	4852	5144	5435	5734	6032	6083	6135	6351	6568
4760	4818	4876	5165	5454	5759	6063	6112	6161	6377	6592
	4587 4667 4717 4755 4818 4767 4717 4689 4660 4632 4622 4612 4617 4631 4641 4662 4631 4642 4631 4643 4709 4735	4587 4710 4667 4801 4717 4867 4755 4909 4818 4975 4767 4920 4717 4865 4689 4827 4660 4788 4646 4765 4622 4725 4612 4707 4617 4706 4631 4709 4641 4714 4662 4731 4682 4748 4709 4771	4587 4710 4831 4667 4801 4935 4717 4867 5017 4755 4909 5063 4818 4975 5131 4767 4920 5072 4717 4865 5013 4689 4827 4965 4660 4788 4916 4646 4765 4884 4632 4742 4852 4622 4725 4828 4612 4707 4803 4617 4706 4795 4621 4704 4787 4631 4709 4787 4662 4731 4800 4682 4748 4813 4709 4771 4833 4709 4771 4833 4735 4794 4852	4587 4710 4831 5071 4667 4801 4935 5180 4717 4867 5017 5267 4755 4909 5063 5320 4818 4975 5131 5396 4767 4920 5072 5346 4717 4865 5013 5296 4689 4827 4965 5254 4660 4788 4916 5211 4660 4788 4916 5211 4646 4765 4884 5182 4632 4742 4852 5154 4622 4725 4828 5129 4612 4707 4803 5105 4617 4706 4795 5086 4621 4704 4787 5087 4661 4714 4787 5085 4662 4731 4800 5096 4662 4731 4800 5096	$\begin{array}{c c c c c c c c c c c c c c c c c c c $	$\begin{array}{ c c c c c c c c c c c c c c c c c c c$	0 10 4831 5071 5311 5483 5655 4587 4710 4831 5071 5311 5483 5655 4667 4801 4935 5180 5425 5594 5762 4717 4867 5017 5267 5517 5680 5844 4755 4909 5063 5320 5578 5740 5902 4818 4975 5131 5396 5660 5814 5969 4767 4920 5072 5346 5619 5778 5938 4717 4865 5013 5296 5579 5743 5906 4689 4827 4965 5254 5542 5714 5885 4660 4788 4916 5211 5506 5685 5864 4646 4765 4884 5182 5480 5669 5857 4632 4742 4852 5154 5455 5652	0 10 20 30 40 50 60 70 4587 4710 4831 5071 5311 5483 5655 5792 4667 4801 4935 5180 5425 5594 5762 5905 4717 4867 5017 5267 5517 5680 5844 5995 4755 4909 5063 5320 5578 5740 5902 6052 4818 4975 5131 5396 5660 5814 5969 6113 4767 4920 5072 5346 5619 5778 5938 6073 4717 4865 5013 5296 5579 5743 5906 6033 4689 4827 4965 5254 5542 5714 5885 6001 4660 4788 4916 5211 5506 5685 5864 5 4632 4742 4852 5154 5455<	$\begin{array}{ c c c c c c c c c c c c c c c c c c c$	$\begin{array}{ c c c c c c c c c c c c c c c c c c c$


Notes:

1. Rod worth data assumes the starting point is rods at the Rod Insertion Limit. If a bank is below the RIL, reduce the table value by 75 pcm for each step below the RIL.

- 2. The rod worth data represents negative reactivity. However, STP-29.1, STP-29.2 and STP-29.5 have been written to handle the correct sign convention when the above data is entered as a positive number. Enter the above numbers directly into the STP.
- 3. ARI-1 is defined as All Rods In -- less the most reactive rod. The SDM calculation requires that one rod be assumed stuck. Therefore, use the data directly from the table above when there are not any known stuck rods.

PCB-1-VOL1-CRV77

UNIT 1 CYCLE 23 CURVE 77 Control Rod Worth for SDM Calculations

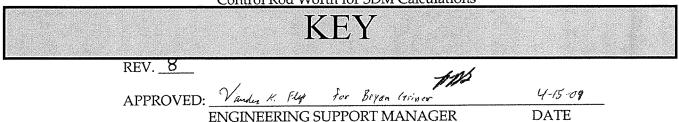

Worth of Most Reactive Rod (pcm) for Shutdown Margin Calculations

	-	-
	Burnup Range	Power Level
	(MWD/MTU)	0% to 100%
	≤ 150	658
	> 150 ≤ 1000	676
	> 1000 \leq 2000	732
	> 2000 ≤ 3000	781
	> 3000 ≤ 4000	889
	> 4000 ≤ 5000	1024
	> 5000 ≤ 6000	1160
	> 6000 ≤ 7000	1232
	> 7000 ≤ 8000	1304
element #9	> 8000 ≤ 9000	1355
	> 9000 ≤10000	1406
lan and a second	>10000 ≤11000	1450
	>11000 ≤12000	1494
	>12000 ≤13000	1528
	>13000 ≤14000	1561
	>14000 ≤15000	1592
	>15000 ≤16000	1623
	>16000 ≤17000	1653
	>17000 ≤18000	1684
	>18000 ≤19000	1713
	>19000 ≤20000	1741
	>20000 ≤20885	1767


Notes:

- 1. Rod worth data assumes the starting point is rods at the Rod Insertion Limit.
- 2. The rod worth data represents negative reactivity. However, STP-29.1, STP-29.2 and STP-29.5 have been written to handle the correct sign convention when the above data is entered as a positive number. Enter the above numbers directly into the STP.
- 3. ARI-1 is defined as All Rods In -- less the most reactive rod.
- 4. For multiple stuck rods, the ARI-1 value on Page 1 of this curve should be reduced by the following calculation: [KUR x WSR x 1.75] + [WSR x 0.75]

where KUR = Number of known untrippable rods (does not include rod assumed stuck in ARI-1 table) and WSR = Worst stuck rod (i.e. most reactive rod)

Westinghouse Proprietary Class 2

PCB-1-VOL1-CRV78



For

APPROVED: Vande ed fily

Bryon Grener Fills ENGINEERING SUPPORT MANAGER

415-09 DATE

	Power Level (%)										
0	10	20	30	40	50	60	70	80	90	100	
0	361	537	717	898	958	1019	1119	1219		1432	
0	351	522	701	879	943	1006	1106	1206	1307	1409	
0	330	495	667	839	903	967	1068	1169	1265	1361	
0	317	476	647	818	879	941	1041	1142	1237	1332	
0	326	489	664	839	901	964	1062	1161	1261	1360	
0	344	514	697	879	942	1004	1103	1202	1306	1410	
0	362	539	729	919	982	1045	1144	1242	1351	1459	
0	388	576	774	972	1037	1103	1202	1301	1416	1531	
0	414	613	818	1024	1092	1160	1260	1360	1481	1603	
0	440	651	863	1074	1147	1220	1 Element #12		1558	1684	
0	466	690	907	1124	1202	1280	1391	1503	1634	1765	
0	492	728	950	1173	1258	1344	1461	1579	1717	1854	
0	518	766	994	1222	1315	1408	1531	1655	1800	1944	
0	543	804	1035	1267	1369	1471	1603	1734	1884	2034	
0	567	841	1077	1313	1424	1535	1674	1813	1968	2123	
0	589	875	1115	1356	1477	1597	1744	1890	2054	2217	
0	611	908	1153	1399	1529	1660	1813	1967	2139	2310	
0	633	940	1189	1438	1578	1718	1882	2046	2223	2400	
0	654	971	1225	1478	1627	1777	1951	2125	2307	2489	
0	673	1001	1259	1516	1677	1837	2020	2203	2392	2582	
0	692	1031	1293	1554	1726	1897	2089	2280	2477	2674	
0	709	1057	1323	1590	1771	1953	2152	2351	2554	2757	
	0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0	0 361 0 351 0 351 0 351 0 351 0 351 0 351 0 351 0 317 0 326 0 344 0 362 0 344 0 362 0 344 0 362 0 344 0 440 0 440 0 446 0 466 0 492 0 518 0 567 0 589 0 611 0 633 0 654 0 673 0 692	0 361 537 0 351 522 0 330 495 0 317 476 0 317 476 0 326 489 0 344 514 0 362 539 0 348 576 0 414 613 0 440 651 0 440 651 0 440 651 0 466 690 0 518 766 0 543 804 0 567 841 0 589 875 0 611 908 0 633 940 0 653 971 0 673 1001 0 692 1031	0 361 537 717 0 351 522 701 0 330 495 667 0 317 476 647 0 326 489 664 0 344 514 697 0 362 539 729 0 362 539 729 0 362 539 729 0 388 576 774 0 414 613 818 0 440 651 863 0 466 690 907 0 492 728 950 0 518 766 994 0 543 804 1035 0 567 841 1077 0 589 875 1115 0 611 908 1153 0 654 971 1225 <t< td=""><td>0$361$$537$$717$$898$0$351$$522$$701$$879$0$330$$495$$667$$839$0$317$$476$$647$$818$0$326$$489$$664$$839$0$344$$514$$697$$879$0$362$$539$$729$$919$0$362$$539$$729$$919$0$362$$539$$729$$919$0$388$$576$$774$$972$0$414$$613$$818$$1024$0$440$$651$$863$$1074$0$466$$690$$907$$1124$0$492$$728$$950$$1173$0$518$$766$$994$$1222$0$543$$804$$1035$$1267$0$567$$841$$1077$$1313$0$589$$875$$1115$$1356$0$611$$908$$1153$$1399$0$633$$940$$1189$$1438$0$654$$971$$1225$$1478$0$673$$1001$$1259$$1516$0$692$$1031$$1293$$1554$</td><td>0 361 537 717 898 958 0 351 522 701 879 943 0 330 495 667 839 903 0 317 476 647 818 879 0 326 489 664 839 901 0 344 514 697 879 942 0 362 539 729 919 982 0 362 539 729 919 982 0 388 576 774 972 1037 0 414 613 818 1024 1092 0 440 651 863 1074 1147 0 466 690 907 1124 1202 0 492 728 950 1173 1258 0 518 766 994 1222 1315 0</td><td>0$10$$10$$10$$10$$10$0$361$$537$$717$$898$$958$$1019$0$351$$522$$701$$879$$943$$1006$0$330$$495$$667$$839$$903$$967$0$317$$476$$647$$818$$879$$941$0$326$$489$$664$$839$$901$$964$0$344$$514$$697$$879$$942$$1004$0$362$$539$$729$$919$$982$$1045$0$388$$576$$774$$972$$1037$$1103$0$414$$613$$818$$1024$$1092$$1160$0$440$$651$$863$$1074$$1147$$1220$0$466$$690$$907$$1124$$1202$$1280$0$492$$728$$950$$1173$$1258$$1344$0$518$$766$$994$$1222$$1315$$1408$0$543$$804$$1035$$1267$$1369$$1471$0$567$$841$$1077$$1313$$1424$$1535$0$589$$875$$1115$$1356$$1477$$1597$0$611$$908$$1153$$1399$$1529$$1660$0$633$$940$$1189$$1438$$1578$$1718$0$654$$971$$1225$<td>0 361 537 717 898 958 1019 1119 0 351 522 701 879 943 1006 1106 0 330 495 667 839 903 967 1068 0 317 476 647 818 879 941 1041 0 326 489 664 839 901 964 1062 0 344 514 697 879 942 1004 1103 0 362 539 729 919 982 1045 1144 0 388 576 774 972 1037 1103 1202 0 414 613 818 1024 1092 1160 1260 0 466 690 907 1124 1202 1280 1391 0 492 728 950 1173 1258 1344 146</td><td>0$361$$537$$717$$898$$958$$1019$$1119$$1219$$0$$351$$522$$701$$879$$943$$1006$$1106$$1206$$0$$330$$495$$667$$839$$903$$967$$1068$$1169$$0$$317$$476$$647$$818$$879$$941$$1041$$1142$$0$$326$$489$$664$$839$$901$$964$$1062$$1161$$0$$344$$514$$697$$879$$942$$1004$$1103$$1202$$0$$362$$539$$729$$919$$982$$1045$$1144$$1242$$0$$388$$576$$774$$972$$1037$$1103$$1202$$1301$$0$$414$$613$$818$$1024$$1092$$1160$$1260$$1360$$0$$440$$651$$863$$1074$$1147$$1220$$1$$Element #12$$0$$466$$690$$907$$1124$$1202$$1280$$1391$$1503$$0$$492$$728$$950$$1173$$1258$$1344$$1461$$1579$$0$$567$$841$$1077$$1313$$1424$$1535$$1674$$1813$$0$$567$$841$$1077$$1313$$1424$$1535$$1674$$1813$$0$$589$$875$$1115$$1356$$1477$$1597$$1744$</td></td></t<> <td>0 361 537 717 898 958 1019 1119 1219 1326 0 351 522 701 879 943 1006 1106 1206 1307 0 330 495 667 839 903 967 1068 1169 1265 0 317 476 647 818 879 941 1041 1142 1237 0 326 489 664 839 901 964 1062 1161 1261 0 344 514 697 879 942 1004 1103 1202 1306 0 362 539 729 919 982 1045 1144 1242 1351 0 388 576 774 972 1037 1103 1202 1301 1416 0 414 613 818 1024 1092 1160 1260 1360</td>	0 361 537 717 898 0 351 522 701 879 0 330 495 667 839 0 317 476 647 818 0 326 489 664 839 0 344 514 697 879 0 362 539 729 919 0 362 539 729 919 0 362 539 729 919 0 388 576 774 972 0 414 613 818 1024 0 440 651 863 1074 0 466 690 907 1124 0 492 728 950 1173 0 518 766 994 1222 0 543 804 1035 1267 0 567 841 1077 1313 0 589 875 1115 1356 0 611 908 1153 1399 0 633 940 1189 1438 0 654 971 1225 1478 0 673 1001 1259 1516 0 692 1031 1293 1554	0 361 537 717 898 958 0 351 522 701 879 943 0 330 495 667 839 903 0 317 476 647 818 879 0 326 489 664 839 901 0 344 514 697 879 942 0 362 539 729 919 982 0 362 539 729 919 982 0 388 576 774 972 1037 0 414 613 818 1024 1092 0 440 651 863 1074 1147 0 466 690 907 1124 1202 0 492 728 950 1173 1258 0 518 766 994 1222 1315 0	0 10 10 10 10 10 0 361 537 717 898 958 1019 0 351 522 701 879 943 1006 0 330 495 667 839 903 967 0 317 476 647 818 879 941 0 326 489 664 839 901 964 0 344 514 697 879 942 1004 0 362 539 729 919 982 1045 0 388 576 774 972 1037 1103 0 414 613 818 1024 1092 1160 0 440 651 863 1074 1147 1220 0 466 690 907 1124 1202 1280 0 492 728 950 1173 1258 1344 0 518 766 994 1222 1315 1408 0 543 804 1035 1267 1369 1471 0 567 841 1077 1313 1424 1535 0 589 875 1115 1356 1477 1597 0 611 908 1153 1399 1529 1660 0 633 940 1189 1438 1578 1718 0 654 971 1225 <td>0 361 537 717 898 958 1019 1119 0 351 522 701 879 943 1006 1106 0 330 495 667 839 903 967 1068 0 317 476 647 818 879 941 1041 0 326 489 664 839 901 964 1062 0 344 514 697 879 942 1004 1103 0 362 539 729 919 982 1045 1144 0 388 576 774 972 1037 1103 1202 0 414 613 818 1024 1092 1160 1260 0 466 690 907 1124 1202 1280 1391 0 492 728 950 1173 1258 1344 146</td> <td>0$361$$537$$717$$898$$958$$1019$$1119$$1219$$0$$351$$522$$701$$879$$943$$1006$$1106$$1206$$0$$330$$495$$667$$839$$903$$967$$1068$$1169$$0$$317$$476$$647$$818$$879$$941$$1041$$1142$$0$$326$$489$$664$$839$$901$$964$$1062$$1161$$0$$344$$514$$697$$879$$942$$1004$$1103$$1202$$0$$362$$539$$729$$919$$982$$1045$$1144$$1242$$0$$388$$576$$774$$972$$1037$$1103$$1202$$1301$$0$$414$$613$$818$$1024$$1092$$1160$$1260$$1360$$0$$440$$651$$863$$1074$$1147$$1220$$1$$Element #12$$0$$466$$690$$907$$1124$$1202$$1280$$1391$$1503$$0$$492$$728$$950$$1173$$1258$$1344$$1461$$1579$$0$$567$$841$$1077$$1313$$1424$$1535$$1674$$1813$$0$$567$$841$$1077$$1313$$1424$$1535$$1674$$1813$$0$$589$$875$$1115$$1356$$1477$$1597$$1744$</td>	0 361 537 717 898 958 1019 1119 0 351 522 701 879 943 1006 1106 0 330 495 667 839 903 967 1068 0 317 476 647 818 879 941 1041 0 326 489 664 839 901 964 1062 0 344 514 697 879 942 1004 1103 0 362 539 729 919 982 1045 1144 0 388 576 774 972 1037 1103 1202 0 414 613 818 1024 1092 1160 1260 0 466 690 907 1124 1202 1280 1391 0 492 728 950 1173 1258 1344 146	0 361 537 717 898 958 1019 1119 1219 0 351 522 701 879 943 1006 1106 1206 0 330 495 667 839 903 967 1068 1169 0 317 476 647 818 879 941 1041 1142 0 326 489 664 839 901 964 1062 1161 0 344 514 697 879 942 1004 1103 1202 0 362 539 729 919 982 1045 1144 1242 0 388 576 774 972 1037 1103 1202 1301 0 414 613 818 1024 1092 1160 1260 1360 0 440 651 863 1074 1147 1220 1 $Element #12$ 0 466 690 907 1124 1202 1280 1391 1503 0 492 728 950 1173 1258 1344 1461 1579 0 567 841 1077 1313 1424 1535 1674 1813 0 567 841 1077 1313 1424 1535 1674 1813 0 589 875 1115 1356 1477 1597 1744	0 361 537 717 898 958 1019 1119 1219 1326 0 351 522 701 879 943 1006 1106 1206 1307 0 330 495 667 839 903 967 1068 1169 1265 0 317 476 647 818 879 941 1041 1142 1237 0 326 489 664 839 901 964 1062 1161 1261 0 344 514 697 879 942 1004 1103 1202 1306 0 362 539 729 919 982 1045 1144 1242 1351 0 388 576 774 972 1037 1103 1202 1301 1416 0 414 613 818 1024 1092 1160 1260 1360	

Notes:

STP-29.1, STP-29.2 and STP-29.5 have been written to handle the correct sign convention when the above data is 1. entered as a positive number. Enter the above numbers directly into the STP.

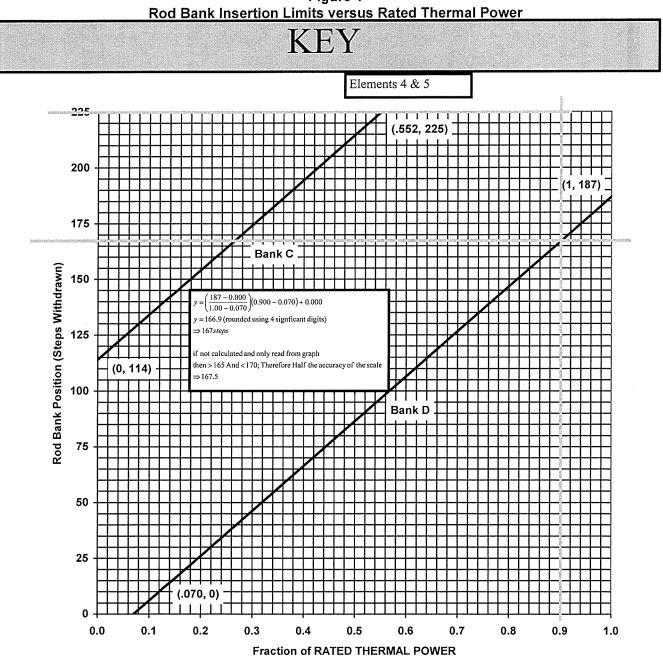


Figure 1

Fully Withdrawn shall be the condition where control rods are at a position within the interval \geq 225 and \leq 231 steps withdrawn.

Note: The Rod Bank Insertion Limits are based on the control bank withdrawal sequence A, B, C, D and a control bank tip-to-tip distance of 128 steps.

A.2.1.A

CONDITIONS

When I tell you to begin, you are to **Determine if Shutdown Margin is adequate using STP-29.5**, **SHUTDOWN MARGIN CALCULATION IN MODES 1 AND 2 (TAVG \geq 547°F)**, for Unit 1. The conditions under which this task is to be performed are:

- a. Unit 1 is stable at 90% with the ramp on hold
- b. Bank D indicates 192 by Group Demand.
- c. Seven of the Bank D rods (H2, B8, H14, F6, F10, K10, K6) are at 192 steps by DRPI.
- d. Rod P8, in the D bank, has been determined to be Stuck.
- e. Rod P8 is at 162 steps by DRPI.
- f. All other rods are at 229 steps.
- g. Core burnup is 9,800 MWD/MTU burnup.
- h. FNP-1-STP-29.5, SHUTDOWN MARGIN CALCULATION IN MODES 1 AND 2 (TAVG ≥ 547°F), initial conditions are satisfied.
- i. The Shift Supervisor has directed you to complete FNP-1-STP-29.5 starting at step 5.1 and identify whether or not emergency boration is required.

UNIT 1

FNP-1-STP-29.5 April 21, 2000 Revision 4

FARLEY NUCLEAR PLANT

SURVEILLANCE TEST PROCEDURE

FNP-1-STP-29.5

SHUTDOWN MARGIN CALCULATION IN MODES 1 AND 2 (TAVG ≥ 547°F)					
PROCEDURE USAGE REQUIREMENTS PER FNP-0-AP-6	SECTIONS				
Continuous Use	ALL				
Reference Use					
Information Use					

Approved:

C. D. COLLINS Operations Manager

Date Issued <u>4-27-00</u>



FARLEY NUCLEAR PLANT SURVEILLANCE TEST REVIEW SHEET

SURVEILLANCE TEST NO.	TECHNICAL SPECIFICATION REFERENCE			
FNP-1-STP-29.5	TR 13	13.1.1; LCO 3.1.4; LCO 3.1.5; LCO 3.1.6		
TITLE		MODE(S) REQUIRING TEST:		
SHUTDOWN MARGIN CALCULATION IN MO	ODES 1 AND 2	1*,2*		
$(TAVG \ge 547^{\circ}F)$		*See special test exceptions of above specifications		
TEST RESULTS (TO BE COMPLETED BY TEST	PERFORMER)			
PERFORMED BY		DATE/TIME		
COMPONENT OR TRAIN TESTED (if applicable)				
[] ENTIRE STP PERFORMED		[] FOR SURVEILLANCE CREDIT		
[] PARTIAL STP PERFORMED:		[] <u>NOT</u> FOR SURVEILLANCE CREDIT		
REASON FOR PARTIAL:				
TEST COMPLETED: [] Satisfac	ctory	[] Unsatisfactory		
[] The following deficiencies occurred:				
[] Corrective action taken or initiated:				
SHIFT FOREMAN REVIEW				
REVIEWED BY		DATE		
[] Procedure properly completed and satisfactory				
[] Comments:				
TECHNICAL GROUP- REACTOR ENG REVIEW REVIEWED BY		DATE		
REACTOR ENG REVIEW REVIEWED BT		DATE		
[] Satisfactory and Approved [] Comments:				



TABLE OF CONTENTS

Procedure Contains	Number of Pages
Body	
Shutdown Margin	
STRS	



FARLEY NUCLEAR PLANT UNIT 1 SURVEILLANCE TEST PROCEDURE STP-29.5

SHUTDOWN MARGIN CALCULATION IN MODES 1 AND 2 (TAVG ≥ 547°F)

1.0 <u>Purpose</u>

- 1.1 The purpose of this procedure is to verify that the SHUTDOWN MARGIN is greater than the limits of the Technical Requirements Manual TR 13.1.1 as directed by Technical Specifications in Modes 1 or 2:
 - 1.1.1 One or more rod(s) untrippable (LCO 3.1.4),
 - 1.1.2 One or more rod(s) not aligned within 12 steps of their group step counter demand position (LCO 3.1.4),
 - 1.1.3 One or more shutdown banks not within insertion limits specified in the COLR (LCO 3.1.5),
 - 1.1.4 Control bank insertion, sequence, or overlap not within limits specified in the COLR (LCO 3.1.6). (This condition does not affect shutdown margin unless control banks are below insertion limits)

2.0 Acceptance Criteria

- 2.1 The Shutdown Margin shall be greater than or equal to the value specified in the COLR.
- 3.0 Initial Conditions
- HBF 3.1 The revision of this procedure has been verified to be the current revision and correct unit for the task. (OR 1-98-498)
- <u>HBF</u> 3.2 $T_{AVG} \ge 547 \circ F$.
- <u>HBF</u> 3.3 $T_{AVG} \pm 1 \circ F$ of programmed value. (Needed for Power Defect to be accurate)
- <u>HBF</u> 3.4 The plant is in Mode 1 or 2 with Keff ≥ 1 .
- HBF 3.5 Technical Specifications required action entered to verify SDM to be within the limits provided in the COLR <u>OR</u> Shift Supervisor desires to perform.

06/18/01 10:31:04

UNIT 1

L

- 4.0 <u>Precautions and Limitations</u>
 - 4.1 Read all curves as accurately as possible <u>OR</u> most conservatively.
 - 4.2 Observe proper algebraic sign notation throughout the calculation.
 - 4.3 <u>IF</u> necessary to emergency borate due to inadequate shutdown margin, <u>THEN</u> consideration should be given to tripping the reactor and entering FNP-1-EEP-0, REACTOR TRIP OR SAFETY INJECTION concurrent with the emergency boration.
- 5.0 <u>Instructions</u>

NOTE: • For calculating shutdown margin at power, the amount of reactivity by which the reactor would be subcritical from its present condition must be determined. If the reactor were to shutdown instantaneously, the changes in reactivity would be from control rod position and power defect. In the instant that the reactor shut down, reactivity changes from xenon, samarium and boron concentration would be zero.

5.1 Enter the information required on the attached calculation sheets and calculate the shutdown margin.

NOTE: • Verification of shutdown margin calculation by a licensed individual other than the test performer, should take place as soon as practical, and any differences resolved immediately.

- A Shift Foreman that serves as verifier of the calculation may also serve as reviewer on the Surveillance Test Review Sheet.
- 5.2 Verify shutdown margin calculated in step 5.1.
- 6.0 <u>References</u>
 - 6.1 Technical Specifications: LCOs 3.1.4, 3.1.5, & 3.1.6.
 - 6.2 Technical Requirement Manual TR 13.1.1
 - 6.3 Core Operating Limits Report (COLR).



SHUTDOWN MARGIN IN MODES 1 AND 2

- A. **PRESENT CONDITIONS**
- A.1 Core Burnup _____ MWD/MTU
- A.2 Power Level. _____ %
- A.3 Determine number of penalty steps for ROD BANKS below RIL. (Use COLR or convert the RIL computer reading from % to steps)

A.3.a Record data in table

ROD	BANK RIL	BANK	STEPS BELOW
BANKS	HEIGHT	DEMAND	RIL
CBA	FULL OUT		
CBB	FULL OUT		
CBC			
CBD			
SDA	FULL OUT		
SDB	FULL OUT		

TOTAL STEPS BELOW RIL

-			-		-	-		-	
L									1
I									I
_	_	-	_	_	-	-	1	-	ы

VITT 1

- A.4 Determine number of penalty steps for RODS below RIL which were not counted in A.3 (Rods below RIL on DRPI when the BANK demand is above RIL) (Use COLR or convert the RIL computer reading from % to steps)
 - A.4.a Record data in table

ROD NUMBER	RIL POSITION	DRPI POSITION	DIFFERENCE

TOTAL STEPS BELOW RIL

B. SHUTDOWN MARGIN

NOTE: Write the values from Curves 77 & 78 directly into the surveillance test. The correct sign convention has been entered in the STP.

B.1	Rod worth for all control and shutdown banks at zero	o steps at
	Present Burnup $(A.1)$ and Power Level $(A.2)$.	(-)pcm (Curve 77 Page 1)
B.2	Penalty value of rod banks below insertion limit:	
	$\underline{\qquad}steps \times 75 \text{ pcm/step} = (A.3.a)$	(+)pcm
В.3	Penalty value of individual rods below RIL which we (Rods below RIL on DRPI when the BANK demand	

steps × 10 pcm/step	 (+)po	m
(A.4.a)		

06/18/01 10:31:04

FNP-1-STP-29.5

B.4	Stuck / Untrippable Rod penalty: (B.4.a is N/A and B.4.b is zero if there are no stuck/untrippable rods)
	B.4.a Worth of most reactive rod worth at present burnup (A.1) (–)pcm from Curve 77 pg. 2
	B.4.b Calculate worth of Stuck/untrippable rods
B.5	$\begin{bmatrix} & & (-) & & \times 1.75 \end{bmatrix} + \begin{bmatrix} (-) & & \times 0.75 \end{bmatrix} = (-) & pcm$ (# Stuck/ (B.4.a) (B.4.a) untrippable rods) (Most reactive (Most reactive rod worth) rod worth) Penalized rod worth considering stuck/untrippable rods, misaligned rods, rods below the insertion limit, and uncertainty:
	$[(-)_{(B.1)} + (B.2) + (B.3) - (-)_{(B.4,b)} \times 0.9 = [()_{(D.4,b)} - (-)_{(D.4,b)}] \times 0.9 = [()_{(D.4,b)} - (-)_{(D.4,b)}]$
B.6	Power Defect at Power Level (A.2) and Burnup (A.1) (Curve 78). (-)pcm
B.7	Void Collapse Defect. (+) <u>50</u> pcm
B.8	Available Shutdown Reactivity:
	$()_{(B.5)} - (-)_{(B.6)} + \frac{50}{(B.7)}$
B.9	Shutdown Margin in excess of required Shutdown Margin (B.8 – Required SDM from the COLR):
	$() _ pcm - (-) _ 1770 pcm = [() _ pcm] \\ (B.8) Required SDM \\ from the COLR [(SDM_{Excess})] \\ (SDM_{Excess}) \\ (SDM_{Exces$
B.10	If B.9 is positive, <u>THEN</u> emergency borate per FNP-1-AOP-27.0, EMERGENCY BORATION, to establish the required shutdown margin otherwise Shutdown Margin is adequate for the Present plant condition.
Date:	Performed by:
	ττ · /• 11

UNIT 1

Date:_____ Verified by: _____

UNIT 1 CYCLE 23 CURVE 77 Control Rod Worth for SDM Calculations

REV._8 DES APPROVED: Visiting & Piley 4-15-09 For Brvan Griner ENGINEERING SUPPORT MANAGER DATE

ARI-1 Rod Worth	(pcm) for Shutdown	Margin Calculations
-----------------	--------------------	---------------------

Burnup Range	Power Level (%)										
(MWD/MTU)	0	10	20	30	40	50	60	70	80	90	100
≤ 150	4587	4710	4831	5071	5311	5483	5655	5792	5927	6162	6397
> 150 ≤ 1000	4667	4801	4935	5180	5425	5594	5762	5905	6048	6285	6523
> 1000 ≤ 2000	4717	4867	5017	5267	5517	5680	5844	5995	6145	6384	6623
> 2000 ≤ 3000	4755	4909	5063	5320	5578	5740	5902	6052	6201	6442	6683
> 3000 ≤ 4000	4818	4975	5131	5396	5660	5814	5969	6113	6257	6483	6708
> 4000 ≤ 5000	4767	4920	5072	5346	5619	5778	5938	6073	6208	6439	6670
> 5000 ≤ 6000	4717	4865	5013	5296	5579	5743	5906	6033	6159	6395	6631
> 6000 ≤ 7000	4689	4827	4965	5254	5542	5714	5885	6001	6118	6355	6593
> 7000 ≤ 8000	4660	4788	4916	5211	5506	5685	5864	5970	6076	6316	6555
> 8000 ≤ 9000	4646	4765	4884	5182	5480	5669	5857	5955	6052	6292	6531
> 9000 ≤10000	4632	4742	4852	5154	5455	5652	5850	5939	6028	6268	6507
>10000 ≤11000	4622	4725	4828	5129	5431	5641	5850	5933	6016	6253	6490
>11000 ≤12000	4612	4707	4803	5105	5408	5629	5850	5927	6004	6239	6473
>12000 ≤13000	4617	4706	4795	5096	5398	5631	5865	5937	6010	6242	6475
>13000 ≤14000	4621	4704	4787	5087	5387	5633	5879	5947	6015	6245	6476
>14000 ≤15000	4631	4709	4787	5086	5385	5642	5900	5964	6028	6256	6485
>15000 ≤16000	4641	4714	4787	5085	5382	5652	5921	5981	6041	6267	6493
>16000 ≤17000	4662	4731	4800	5096	5391	5669	5947	6004	6062	6286	6510
>17000 ≤18000	4682	4748	4813	5107	5400	5687	5973	6028	6083	6304	6526
>18000 ≤19000	4709	4771	4833	5125	5418	5710	6002	6056	6109	6328	6547
>19000 ≤20000	4735	4794	4852	5144	5435	5734	6032	6083	6135	6351	6568
>20000 ≤20885	4760	4818	4876	5165	5454	5759	6063	6112	6161	6377	6592

Notes:

1. Rod worth data assumes the starting point is rods at the Rod Insertion Limit. If a bank is below the RIL, reduce the table value by 75 pcm for each step below the RIL.

- 2. The rod worth data represents negative reactivity. However, STP-29.1, STP-29.2 and STP-29.5 have been written to handle the correct sign convention when the above data is entered as a positive number. Enter the above numbers directly into the STP.
- 3. **ARI-1** is defined as **All Rods In** -- less the most reactive rod. The SDM calculation requires that one rod be assumed stuck. Therefore, use the data directly from the table above when there are not any known stuck rods.

UNIT 1 CYCLE 23 CURVE 77 Control Rod Worth for SDM Calculations

rev. <u>8</u>		12h	
APPROVED:	Vander K. Flag	for Biyan Crimer	4-15-09
-		UPPORT MANAGER	DATE

Worth of Most Reactive Rod (pcm) for Shutdown Margin Calculations

Burnup	Power Level	
(MWD	/MTU)	0% to 100%
	≤ 150	658
> 150	≤ 1000	676
> 1000	≤ 2000	732
> 2000	≤ 3000	781
> 3000	≤ 4 000	889
> 4000	≤ 5000	1024
> 5000	≤ 6000	1160
> 6000	≤ 7000	1232
> 7000	≤ 8000	1304
> 8000	≤ 9000	1355
> 9000	≤10000	1406
>10000	≤11000	1450
>11000	≤12000	1494
>12000	≤13000	1528
>13000	≤14000	1561
>14000	≤15000	1592
>15000	≤16000	1623
>16000	≤17000	1653
>17000	≤18000	1684
>18000	≤19000	1713
>19000	≤20000	1741
>20000	≤20885	1767

Notes:

- 1. Rod worth data assumes the starting point is rods at the Rod Insertion Limit.
- 2. The rod worth data represents negative reactivity. However, STP-29.1, STP-29.2 and STP-29.5 have been written to handle the correct sign convention when the above data is entered as a positive number. Enter the above numbers directly into the STP.
- 3. ARI-1 is defined as All Rods In -- less the most reactive rod.
- 4. For multiple stuck rods, the ARI-1 value on Page 1 of this curve should be reduced by the following calculation: [KUR x WSR x 1.75] + [WSR x 0.75]

where KUR = Number of known untrippable rods (does not include rod assumed stuck in ARI-1 table) and WSR = Worst stuck rod (i.e. most reactive rod)

PCB-1-VOL1-CRV78

UNIT 1 CYCLE 23 CURVE 78 Total Power Defect for SDM Calculations

REV. 8


APPROVED: <u>Vandensk fille</u> for Bryan Griner 445-09 ENGINEERING SUPPORT MANAGER DATE


						_					
Burnup Range					Ром	ver Level	(%)				
(MWD/MTU)	0	10	20	30	40	50	60	70	80	90	100
≤ 150	0	361	537	717	898	958	1019	1119	1219	1326	1432
$> 150 \le 1000$	0	351	522	701	879	943	1006	1106	1206	1307	1409
$> 1000 \leq 2000$	0	330	495	667	839	903	967	1068	1169	1265	1361
> 2000 ≤ 3000	0	317	476	647	818	879	941	1041	1142	1237	1332
> 3000 ≤ 4000	0	326	489	664	839	901	964	1062	1161	1261	1360
> 4000 ≤ 5000	0	344	514	697	879	942	1004	1103	1202	1306	1410
> 5000 ≤ 6000	0	362	539	729	919	982	1045	1144	1242	1351	1459
> 6000 ≤ 7000	0	388	576	774	972	1037	1103	1202	1301	1416	1531
> 7000 ≤ 8000	0	414	613	818	1024	1092	1160	1260	1360	1481	1603
> 8000 ≤ 9000	0	440	651	863	1074	1147	1220	1326	1431	1558	1684
> 9000 ≤10000	0	466	690	907	1124	1202	1280	1391	1503	1634	1765
>10000 ≤11000	0	492	728	950	1173	1258	1344	1461	1579	1717	1854
>11000 ≤12000	0	518	766	994	1222	1315	1408	1531	1655	1800	1944
>12000 ≤13000	0	543	804	1035	1267	1369	1471	1603	1734	1884	2034
>13000 ≤14000	0	567	841	1077	1313	1424	1535	1674	1813	1968	2123
>14000 ≤15000	0	589	875	1115	1356	1477	1597	1744	1890	2054	2217
>15000 ≤16000	0	611	908	1153	1399	1529	1660	1813	1967	2139	2310
>16000 ≤17000	0	633	940	1189	1438	1578	1718	1882	2046	2223	2400
>17000 ≤18000	0	654	971	1225	1478	1627	1777	1951	2125	2307	2489
>18000 ≤19000	0	673	1001	1259	1516	1677	1837	2020	2203	2392	2582
>19000 ≤20000	0	692	1031	1293	1554	1726	1897	2089	2280	2477	2674
>20000 ≤20885	0	709	1057	1323	1590	1771	1953	2152	2351	2554	2757

Power Defect (pcm) for Shutdown Margin Calculations

Notes:

1. STP-29.1, STP-29.2 and STP-29.5 have been written to handle the correct sign convention when the above data is entered as a positive number. Enter the above numbers directly into the STP.



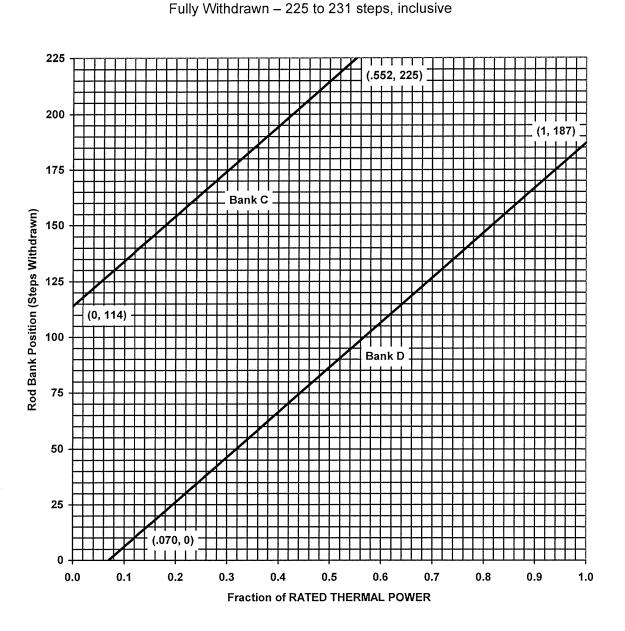

Fully Withdrawn shall be the condition where control rods are at a position within the interval \geq 225 and \leq 231 steps withdrawn.

Note: The Rod Bank Insertion Limits are based on the control bank withdrawal sequence A, B, C, D and a control bank tip-to-tip distance of 128 steps.

A.3.1.R Radiation Control ADMIN G2.3.9 - RO

CRO-A.3.1.R

TITLE: Calculate the Maximum Permissible Stay Time within Emergency Dose Limits.
PROGRAM APPLICABLE: SOT OLT _X LOCT
ACCEPTABLE EVALUATION METHOD: <u>X</u> PERFORM <u>SIMULATE</u> DISCUSS
EVALUATION LOCATION: SIMULATOR CONTROL ROOM X_CLASSROOM
PROJECTED TIME: SIMULATOR IC NUMBER: N/A
ALTERNATE PATH TIME CRITICAL PRA

JPM DIRECTIONS:

- 1. Initiation of task may be in group setting, evaluation performed individually upon completion.
- 2. The references for this task will be provided as listed or the student may be provided a computer with a generic exam login and access to the EXAM reference disk.
- 3. Elements 1 through 7 may be evaluated by reviewing the responses on the Handout.

TASK STANDARD: Required for successful completion of this JPM:

- Calculate dose expected for Tasks 1 through 3
- Determine if a Repair team would exceed equipment protection emergency dose limits of EIP-14.0, Personnel Movement, Relocation, Re-Entry and Site Evacuation.
- Calculate the maximum allowable stay time for a task; or determine what tasks can be performed, if any, without exceeding limits.

Examinee:				
Overall JPM Performance:	Satisfactory		Unsatisfactory	
Evaluator Comments (attach a	dditional sheets i	f necessa	ry)	

EXAMINER: _____

Developer	Howard Fitzwater	11/06/09
NRC Approval	SEE NUREG 1021	FORM ES-301-3

FNP HLT-33 ADMIN

A.3.1.R

CONDITIONS

When I tell you to begin, you are to Calculate the Maximum Permissible Stay Time within Emergency Dose Limits. The conditions under which this task is to be performed are:

- a. A General Emergency has been declared on Unit 1.
- b. 1A RHR pump is air bound and must be vented per AOP-12, Attachment 1, RHR Pump Venting.
- c. The TSC has requested that 1B RHR pump motor bearing oil levels be checked and filled as required after restoring 1A RHR and suggests using the same Repair team. The time required to perform this task is unknown, but is estimated to range between 1 to 20 minutes.
- d. You have been selected to perform the task.
- e. The tasks are provided in the table below, and estimated times and doses have been provided.
- f. Each task must be completed in the order listed.
- g. The Emergency Director (ED) directs you to perform the following with the information provided:
 - Calculate the expected dose for tasks 1 through 3 and document in the table.
 - Determine the tasks, if any, for which you could be permitted to perform without exceeding the equipment protection emergency dose limits of 10 REM.
 - If you will NOT exceed emergency dose limits prior to performing task 4, THEN calculate the maximum allowable stay time to complete task 4, and remain within the dose limits.
 - IF you WILL exceed emergency dose limits prior to performing task 4, THEN identify the last tasks (if any) that you can complete without exceeding dose limits.

Task #	Location/Task description	Time allowed/ req'd (minutes)	Dose Rate (R/hr)	Dose
1	83' 1A RHR Pump and HX rooms/ Vent rig installation and venting	30	5.31	
2	100' piping penetration room/ Vent rig installation and venting	15	19.75	
3	121' piping penetration room/ Vent rig installation and venting	20	5.65	
4	Inspect 1B RHR pump motor bearing oil levels and fill as required		7	

Can you perform all of the tasks? (Circle one) YES / NO

IF yes, then state the maximum permitted stay time for task #4.

IF no, then state the highest sequential task # that can be performed, if any.

INITIATING CUE: "You may begin."

A.3.1.R

EVALUATION CHECKLIST

ELEMENTS:	STANDARDS:	RESULTS: (CIRCLE)
START TIME		
1. Determine the dose received for tasks 1 through 3. * a. Task #1 $(30 \min) \times 5.31 R / hr \times \left(\frac{1hr}{60 \min}\right) = 2.66 REM$	1) Calculates (in REM) a. 2.66 { Range 2.6 to 2.7 }	S / U
* b. Task #2 (15 min)×19.75 R / hr × $\left(\frac{1hr}{60 \min}\right)$ = 4.938 REM	b. 4.938 {4.9 to 5.0}	S / U
* c. Task #3 (20 min)×5.65 R / hr × $\left(\frac{1hr}{60 \min}\right) = 1.88 REM$	c. 1.88 {1.8 to 1.9}	S / U
NOTE: • A Cue may be required to obtain respon	ses for each element if the candidat	te does not

NOTE: • A Cue may be required to obtain responses for each element if the candidate does not clearly document results. Provide the Cue as stated on the Handout.

- * 2. Evaluates exposure within 10 REM for completion of tasks 1 through 3.
 - a. Summation of Task 1 through 3 $10REM - (2.66 + 4.94 + 1.88)REM \ge 0$ $0.52REM \ge 0$
 - b. Determines all tasks can be completed.
- 2) Circles YES on handout –OR– S / U states that all tasks can be completed.
 - a. 10 R is limit
 - b. 0.52 R remains available
 - c. Circles the YES choice
- 3) Documents or States: STAY S / U time is 4.5 mins
- * 3. Calculates stay time for task #4. $(0.52 \operatorname{Re} m) \left(\frac{hr}{7REM} \right) \left(\frac{60 \min}{hr} \right) = 4.493 \min$

 $\{RANGE: 3 \min_{to}_{6} \min \}$

{Range: 3 min to 6 min}

_ STOP TIME

Terminate when all elements of the task have been completed.

<u>CRITICAL ELEMENTS</u>: Critical Elements are denoted with an asterisk (*) before the element number.

GENERAL REFERENCES:

- 1. FNP-0-EIP-14.0, ver 22
- 2. FNP-0-M-1.0, ver 18.0
- 3. KA: G2.3.4 RO 3.2 SRO 3.7

GENERAL TOOLS AND EQUIPMENT:

Provide/Acquire:

- 1. Computer with access to Exam Reference Disk, or EIP 14.0, ver 22.0 and M-1.0, version 18.0.
- 2. Calculator
- 3. pens/pencils
- 4. Scrap paper

Critical ELEMENT justification:

<u>STEP</u>

Evaluation

- 1.a CRITICAL Task Objective
- 1.b CRITICAL Task Objective
- 1.c CRITICAL Task Objective
- 2 CRITICAL Task Objective
- 3 CRITICAL Task Objective

COMMENTS:

CONDITIONS

When I tell you to begin, you are to Calculate the Maximum Permissible Stay Time within Emergency Dose Limits. The conditions under which this task is to be performed are:

- a. A General Emergency has been declared on Unit 1.
- b. 1A RHR pump is air bound and must be vented per AOP-12, Attachment 1, RHR Pump Venting.
- c. The TSC has requested that 1B RHR pump motor bearing oil levels be checked and filled as required after restoring 1A RHR and suggests using the same Repair team. The time required to perform this task is unknown, but is estimated to range between 1 to 20 minutes.
- d. You have been selected to perform the task.
- e. The tasks are provided in the table below, and estimated times and doses have been provided.
- f. Each task must be completed in the order listed.
- g. The Emergency Director (ED) directs you to perform the following with the information provided:
 - Calculate the expected dose for tasks 1 through 3 and document in the table.
 - Determine the tasks, if any, for which you could be permitted to perform without exceeding the equipment protection emergency dose limits of 10 REM.
 - If you will NOT exceed emergency dose limits prior to performing task 4, THEN calculate the maximum allowable stay time to complete task 4, and remain within the dose limits.
 - IF you WILL exceed emergency dose limits prior to performing task 4, THEN identify the last tasks (if any) that you can complete without exceeding dose limits.

Task #	Location/Task description	Time allowed/ req'd (minutes)	Dose Rate (R/hr)	Dose
1	83' 1A RHR Pump and HX rooms/ Vent rig installation and venting	30	5.31	
2	100' piping penetration room/ Vent rig installation and venting	15	19.75	
3	121' piping penetration room/ Vent rig installation and venting	20	5.65	
4	Inspect 1B RHR pump motor bearing oil levels and fill as required		7	

Can you perform all of the tasks? (Circle one) YES / NO

IF yes, then state the maximum permitted stay time for task #4.

IF no, then state the highest sequential task # that can be performed, if any.

A.3.1.S Radiation Control ADMIN G2.3.9 - SRO

CRO-A.3.1.S

TITLE: Calculate the Maximum Permissible Stay Time within Emergency Dose Limits.
PROGRAM APPLICABLE: SOT SOCT OLT _X LOCT
ACCEPTABLE EVALUATION METHOD: <u>X</u> PERFORM <u>SIMULATE</u> DISCUSS
EVALUATION LOCATION: SIMULATOR CONTROL ROOM X_CLASSROOM
PROJECTED TIME: 20 MIN SIMULATOR IC NUMBER: N/A
ALTERNATE PATH TIME CRITICAL PRA

JPM DIRECTIONS:

- 1. Initiation of task may be in group setting, evaluation performed individually upon completion.
- 2. The references for this task will be provided as listed or the student may be provided a computer with a generic exam login and access to the EXAM reference disk.
- 3. Elements 1 through 7 may be evaluated by reviewing the responses on the Handout.

TASK STANDARD: Required for successful completion of this JPM:

- Calculate dose expected for Tasks 1 through 3
- Determine if a Repair team would exceed equipment protection emergency dose limits of EIP-14.0, Personnel Movement, Relocation, Re-Entry and Site Evacuation.
- Calculate the maximum allowable stay time for a task; or determine what tasks can be performed, if any, without exceeding limits.

Examinee:				
Overall JPM Performance:	Satisfactory		Unsatisfactory	
Evaluator Comments (attach a	dditional sheets i	f necessary))	
			· · · · · · · · · · · · · · · · · · ·	
				and the second secon

EXAMINER: _____

Developer	Howard Fitzwater	11/06/09
NRC Approval	SEE NUREG	1021 FORM ES-301-3

A.3.1.S

CONDITIONS

When I tell you to begin, you are to determine if exposure is within emergency dose limits of EIP-14.0, Personnel Movement, Relocation, Re-Entry and Site Evacuation. The conditions under which this task is to be performed are:

- a. A General Emergency has been declared on Unit 1.
- b. 1A RHR pump is air bound and must be vented per AOP-12, Attachment 1, RHR Pump Venting.
- c. The TSC has requested that 1B RHR pump motor bearing oil levels be checked and filled as required after restoring 1A RHR and suggests using the same Repair team. The time required to perform this task is unknown, but is estimated to range between 1 to 20 minutes.
- d. Ted and Joel have been selected to perform the task, their exposure information is stated below.
- e. The Tasks are provided in the table below, and estimated times and doses have been provided.
- f. Each task must be completed by both operators, and must be performed in the order listed.
- g. Both operators are expected to receive equal dose for each job.
- h. The Emergency Director (ED) directs you to perform the following with the information provided:
 - Calculate the expected dose for tasks 1 through 3 and document in the table.
 - Determine the tasks, if any, for which the members of the team could be permitted to perform without exceeding the equipment protection emergency dose limits of EIP-14.0.
 - If any member of the team will NOT exceed emergency dose limits prior to performing task 4, THEN calculate the maximum allowable stay time to complete task 4, and remain within the dose limits.
 - IF any member of the team WILL exceed emergency dose limits prior to performing task 4, THEN identify the last tasks (if any) that the team can complete without either member exceeding dose limits.

Task #	Location/Task description	Time allowed/ req'd (minutes)	Dose Rate (R/hr)	Dose
1	83' 1A RHR Pump and HX rooms/ Vent rig installation and venting	30	5.31	
2	100' piping penetration room/ Vent rig installation and venting	15	19.75	
3	121' piping penetration room/ Vent rig installation and venting	20	5.65	
4	Inspect 1B RHR pump motor bearing oil levels and fill as required		7	
Year-	to-date DOSE Records (REM TEDE)			<u>, , , , , , , , , , , , , , , , , , , </u>
TED	1.26			

Can this team perform all of the tasks? (Circle one) YES / NO

IF yes, then state the maximum permitted stay time for task #4.

0.4

IF no, then state the highest sequential task # that can be performed, if any.

INITIATING CUE: "You may begin."

JOEL

EVALUATION CHECKLIST

-	ELEMENTS:	STANDARDS:	RESULTS: (CIRCLE)
	START TIME		
*	1. Determine the dose received for tasks 1 through 3. a. Task #1 $(30 \text{ min}) \times 5.31 R / hr \times \left(\frac{1hr}{60 \text{ min}}\right) = 2.66 REM$	1) Calculates (in REM) a. 2.66 {Range 2.6 to 2.7}	S / U
*	b. Task #2 (15 min)×19.75 <i>R</i> / <i>hr</i> × $\left(\frac{1hr}{60 \min}\right)$ = 4.938 <i>REM</i>	b. 4.938 {4.9 to 5.0}	S / U
*	c. Task #3 (20 min)×5.65 <i>R</i> / $hr \times \left(\frac{1hr}{60 \min}\right) = 1.88REM$	c. 1.88 {1.8 to 1.9}	S / U

A Cue may be required to obtain responses for each element if the candidate does not NOTE: • clearly document results. Provide the Cue as stated on the Handout.

- * 2. Evaluates Team exposure within emergency limits of EIP-14.0 for completion of tasks 1 through 3.
 - Emergency Dose limit for equipment a. protection is 10 R and DOES NOT include current exposure.
 - Summation of Task 1 through 3 b. $10REM - (2.66 + 4.94 + 1.88)REM \ge 0$

STOP TIME

- Determines BOTH team members can c. complete all tasks.
- * 3. Calculates stay time for task #4.

$$(0.52 \operatorname{Re} m) \left(\frac{hr}{7REM}\right) \left(\frac{60 \min}{hr}\right) = 4.493 \min \left\{RANGE : 3 \min_{to}_{0.56} 6 \min\right\}$$

- 2) Circles YES on handout -OR-S / U states that team can perform tasks 1 through 3.
 - a. 10 R is limit
 - b. 0.52 R remains available
 - c. Circles the YES choice
- 3) Documents or States: STAY S / U time is 4.5 mins
- {Range: 3 min to 6 min)

Terminate when all elements of the task have been completed.

<u>CRITICAL ELEMENTS</u>: Critical Elements are denoted with an asterisk (*) before the element number.

 $^{0.52}REM \ge 0$

FNP HLT-33 ADMIN

GENERAL REFERENCES:

- 1. FNP-0-EIP-14.0, ver 22
- 2. FNP-0-M-1.0, ver 18.0
- 3. KA: G2.3.4 RO 3.2 SRO 3.7

GENERAL TOOLS AND EQUIPMENT:

Provide/Acquire:

- 1. Computer with access to Exam Reference Disk, or EIP 14.0, ver 22.0 and M-1.0, version 18.0.
- 2. Calculator
- 3. pens/pencils
- 4. Scrap paper

Critical ELEMENT justification:

<u>STEP</u>

Evaluation

- 1.a CRITICAL Task Objective
- 1.b CRITICAL Task Objective
- 1.c CRITICAL Task Objective
- 2 CRITICAL Task Objective
- 3 CRITICAL Task Objective

COMMENTS:

IF Ted's year to date dose is used, the emergency dose limit will be exceeded and the expected response for element 2 is "NO" and highest task that can be completed is Task #3.

IF Joel's year to date dose is used and the Emergency dose is reduced by this value then the stay time will range from 0 mins to 1.1 mins.

IF emergency dose limit of 25 Rem Then Stay time will be excessive.

IF ADMIN dose limit of 2 REM used then NONE of the tasks can be performed, or Legal limit of 5 REM then Task #2 will be the highest.

A.3.1.S

CONDITIONS

When I tell you to begin, you are to determine if exposure is within emergency dose limits of EIP-14.0, Personnel Movement, Relocation, Re-Entry and Site Evacuation. The conditions under which this task is to be performed are:

- a. A General Emergency has been declared on Unit 1.
- b. 1A RHR pump is air bound and must be vented per AOP-12, Attachment 1, RHR Pump Venting.
- c. The TSC has requested that 1B RHR pump motor bearing oil levels be checked and filled as required after restoring 1A RHR and suggests using the same Repair team. The time required to perform this task is unknown, but is estimated to range between 1 to 20 minutes.
- d. Ted and Joel have been selected to perform the task, their exposure information is stated below.
- e. The Tasks are provided in the table below, and estimated times and doses have been provided.
- f. Each task must be completed by both operators, and must be performed in the order listed.
- g. Both operators are expected to receive equal dose for each job.
- h. The Emergency Director (ED) directs you to perform the following with the information provided:
 - Calculate the expected dose for tasks 1 through 3 and document in the table.
 - Determine the tasks, if any, for which the members of the team could be permitted to perform without exceeding the equipment protection emergency dose limits of EIP-14.0.
 - If any member of the team will NOT exceed emergency dose limits prior to performing task 4, THEN calculate the maximum allowable stay time to complete task 4, and remain within the dose limits.
 - IF any member of the team WILL exceed emergency dose limits prior to performing task 4, THEN identify the last tasks (if any) that the team can complete without either member exceeding dose limits.

Task #	Location/Task description	Time allowed/ req'd (minutes)	Dose Rate (R/hr)	Dose
1	83' 1A RHR Pump and HX rooms/ Vent rig installation and venting	30	5.31	
2	100' piping penetration room/ Vent rig installation and venting	15	19.75	
3	121' piping penetration room/ Vent rig installation and venting	20	5.65	
4	Inspect 1B RHR pump motor bearing oil levels and fill as required		7	
Year-	to-date DOSE Records (REM TEDE)			
TED	1.26			
JOEL	0.4			

Can this team perform all of the tasks? (Circle one) YES / NO

IF yes, then state the maximum permitted stay time for task #4.

IF no, then state the highest sequential task # that can be performed, if any.

CRO-362

TITLE: Make Initial Notifications As Required for an Emergency

PROGRAM APPLICABLE: SOT ____ SOCT ___ OLT _X LOCT _X

ACCEPTABLE EVALUATION METHOD: X PERFORM X SIMULATE

EVALUATION LOCATION: X Classroom

PROJECTED TIME: 20 MIN

TIME CRITICAL \underline{X}

THIS JPM IS TIME CRITICAL

JPM DIRECTIONS:

- 1. This task will be done in the simulator area where the Southern Link phones can be accessed.
- 2. The Candidate will have 15 minutes from the start time to complete the initial notifications, and then time to activate the ERO call-out system.
- 3. The evaluator, upon commencement of the JPM, shall fill in data on the Guideline 1 handout then provide both EIP-9.0 Guideline 1 and EIP-8.3 table 2 to the candidate.

TASK STANDARD: Required for successful completion of this JPM:

- Complete the ERO callout system per EIP-8.3 Table 2.
- Initiate notification using the Emergency Notification Network (ENN) to at least ONE state agency within 15 mins.
- Complete EIP-9.0 Guideline 1, form actions beginning at Step O through step X.

Examinee:				
Overall JPM Performance:	Satisfactory		Unsatisfactory	
Evaluator Comments (attach a	additional sheets i	f necessar	y)	
			44449 - 1 kon an an an an an an an an Arri an Malakin Andron an an Andron an Andron an Andron an an an an an an	

EXAMINER: _____

Developer	Howard Fitzwater	03/21/2010
NRC Approval	SEE NUREG 1021 FORM ES-301-3	

CONDITIONS

When I tell you to begin, you are to make initial notifications as required for an emergency and activate the emergency callout system. The conditions under which this task is to be performed are:

- a. A General Emergency has just been declared by the Shift Manager due to an event on Unit 1.
- b. The Shift Manager has handed you EIP-8.3, Table 2, and EIP-9.0, Guideline 1, GENERAL EMERGENCY RED INITIAL NOTIFICATION FORM.
- c. The Shift Manager has directed you to:
 - **PERFORM** the initial ENN notification over the Southern LINC ENN.
 - **USE** the SOUTHERN LINC and <u>actually</u> perform this function.
 - The SOUTHERN LINC will be selected to **WIDE AREA TRN ENN** on the display.
 - ACTIVATE the ERO callout system per EIP-8.3, Table 2.
 - SIMULATE the phone call. DO NOT actually press any buttons on the telephone.
 - If a FAX is required, SIMULATE transmitting the FAX. DO NOT actually press any buttons on the FAX machine.
- d. This JPM contains time critical elements.
- e. A pre-job brief is not required.

Read Notes prior to giving JPM to student – The Evaluator <u>MUST</u> enter the following Dates and Times on the Notification Form.

- LINE 10 : "DECLARATION" TIME/DATE; use time at which the JPM is started.
- LINE 12: "Shutdown at Time" TIME/DATE; use declaration time minus 10 minutes.
- LINE 17: "APPROVAL Time/DATE"; use time at which the JPM is started.

ALSO FILL IN AN APPROPRIATE TIME/DATE FOR AFFECTED UNIT SHUTDOWN. EVALUATION CHECKLIST

ELEMENTS:

STANDARDS:

RESULTS: (CIRCLE)

TIME CRITICAL ELEMENT and JPM START TIME UP

UP TO 15 MINUTES

- NOTE: Element 1 shall be simulated
 - The time it takes to complete element 2 through 3 is time critical and is required to be completed within 15 minutes of the declaration time which is the start time of the JPM.
 - Element 1 can be accomplished after the initial notification.

ELEMENTS:	STANDARDS:	RESULTS: (CIRCLE)
*1. Initiate the ERO callout system per EIP-8.3 Table 2 provided by the Shift Manager.	From any plant telephone dial the number specified on the table to contact the ERO callout system.	S / U
prompts that the system would provide: "Enter the scenario activation password, followed by the pound sign." "you have entered (#entered). Is that correct? Enter 9 for yes, or 6 for no"	When prompted, the SCENARIO ACTIVATION PASSWORD (123456789) and the SCENARIO ID (87246) from EIP-8.3 Table 2 is entered.	S / U
 "Enter 9 for yes, or o for no" "Enter the scenario activation number, followed by the pound sign." "you have entered (#entered). Is that correct? Enter 9 for yes, or 6 for no" 	When directed the three (3) key is pushed.	S / U
"press 3 to build the scenario" "the scenario is building"	(Cue. "The security tower called and indicated that their pager activated with 800-204-8196, and that the ERO callout system called and delivered message 3".	
*2. Verify the Southern LINC ENN Radio being used is turned on	Red light on power supply is lit and radio is actually turned on.	S / U
	sions to emergency agencies occur. <i>NN should be used</i> in lieu of "WIDE A	AREA, FEP
*3. Initiate initial notifications using the Emergency Notification Network (ENN).	Press group pushbutton, verify display shows WIDE AREA, TRN ENN. An Instructor will be on the other Southern LINC ENN Radio. See below for student announcement.	S / U
Press PTT, wait for the chirp and announce "This is GENERAL EMERGENCY RED initial notification pushbutton.		

____ TIME CRITICAL ELEMENT STOP TIME

When the candidate presses the PTT pushbutton and says the above statement, the time will be recorded as the stop time.

ELE]	MENTS:	STANDARDS:	RESULTS: (CIRCLE)
*4.	Contact ONE Alabama State Agency.	Contact one of the Alabama State Agencies listed on Guideline 1 form. When the candidate asks for the first state agency in each category the instructor will say the following:	S / U
•	E: "Alabama Radiation Control at Montgomery a asked, the INSTRUCTOR will say, "John Br		N").
*5.	Contact ONE Georgia State Agency.	Contact with the Georgia State Agencies listed on Guideline 1 form is attempted until one agency acknowledges.	S / U
(CUE	: "GEMA acknowledges manning the ENN, <u>E</u>	d Stern is on the line.")	
*6.	Contact Houston County.	Contacts Houston County per Guideline 1 form.	S / U
(CUE	: "Houston County acknowledges manning the	e ENN, <u>Steve Smith is on the line</u> .").	
*7.	Contact Early County.	Contacts Early County per Guideline 1 form	S / U
(CUE	: "Early County acknowledges manning the E	NN, <u>Chuck Tew is on the line</u> .").	
8.	Fill in the date and time on line 2 using the time that the first state agency contact ATTEMPT was made.	The correct date and time are entered on the Guideline 1 form.	S / U
9.	Conduct pre-message announcement.	Initial notification preparation message is read per Guideline 1 form, step U. See below:	S / U
	se prepare to receive a GENERAL EMERG owledgment"	· •	sage with
*10.	Slowly read initial notification message over the ENN.	Guideline 1 form read. The following is the REQUIRED	S / U
1 2 4 5	 A DRILL Message # 001 A INITIAL D General Emergency RG1 B Evacuate A B-5 C-5 J-5 K-5 	minimum information to be read.	S / U S / U S / U S / U S / U

ELE	MENTS:	STANDARDS:	RESULTS: (CIRCLE)
	D Advise Remainder of EPZ to Monitor Local Radio/TV Stations/ TARs for Additional Information and CONSIDER THE USE OF KI (POTASSIUM IODIDE) IN ACCORDANCE WITH STATE PLANS AND POLICY.		S / U
6 7 8 9	 B is Occurring C Above normal operating limits B Stable wind direction from <u>335</u> degrees wind speed <u>3.4</u> mph precipitation <u>none</u> stability class <u>E</u> 		S / U S / U S / U S / U S / U
10	A declaration time Date Whatever is written		S / U
11	Affected unit(s) 1		S / U
<u>#12 a</u>	nd 13 is not required to be read		
17	approved by W.T. DOOR, Emergency Director, and read Time and Date		S / U
*11.	Verify acknowledgment from Alabama Radiation Control at Montgomery EOC and GEMA.	Alabama Radiation Control at Montgomery EOC and GEMA questioned regarding receipt of initial notification message. (CUE: "Alabama Radiation Control at Montgomery EOC and GEMA acknowledge receipt of initial notification message").	S / U
*12.	Verify acknowledgment from Houston County and Early County Delow action is to be simulated only.	Houston County and Early County questioned regarding receipt of initial notification message. (CUE: "Houston County and Early County acknowledge receipt of initial notification message").	S / U
<u>ine</u> L	below action is to be simulated only.		
13.	Fax a copy of the Guideline 1 form to the state of Florida.	Guideline 1 form transmitted to Florida using speed dial button number 10. (CUE: "The fax machine sends the form to Florida").	S / U

ELEMENTS:

14. After receiving the fax report, Verify the state of Florida received the fax.

STANDARDS:

RESULTS: (CIRCLE)

Contacts the State of Florida to S / U confirm receipt of the Guideline 1 form (CUE: Florida acknowledges receipt of the form).

_ STOP TIME

Terminate JPM when initial notification message is faxed to Florida and the ERO callout has been accomplished.

<u>CRITICAL ELEMENTS</u>: Critical Elements are denoted with an Asterisk (*) preceding the element number.

GENERAL REFERENCES:

- 1. FNP-0-EIP-8.3 version 12
- 2. FNP-0-EIP-9.0 Guideline 1, GENERAL EMERGENCY RED INITIAL NOTIFICATION FORM version 60
- 3. KAs: G2.4.43 RO-3.2 SRO-3.8

GENERAL TOOLS AND EQUIPMENT:

None

COMMENTS:

SOUTHERN LINC Phone talker communication GUIDE

Give this to the Instructor performing phone talker duties

- #4 (CUE: "Alabama Radiation Control at Montgomery EOC acknowledges manning the ENN"). When asked, the INSTRUCTOR will say, "John Brown is on the line."
- #5 (CUE: "GEMA acknowledges manning the ENN, <u>Ed Stern is on the line</u>.")
- #6 (CUE: "Houston County acknowledges manning the ENN, Steve Smith is on the line.").
- #7 (CUE: "Early County acknowledges manning the ENN, Chuck Tew is on the line.").
- #11 (CUE: "Alabama Radiation Control at Montgomery EOC and GEMA acknowledge receipt of initial notification message").
- #12 (CUE: "Houston County and Early County acknowledge receipt of initial notification message").
- #14 (CUE: Florida acknowledges receipt of the form).

A.4.1.A CONDITIONS

When I tell you to begin, you are to make initial notifications as required for an emergency and activate the emergency callout system. The conditions under which this task is to be performed are:

- a. A General Emergency has just been declared by the Shift Manager due to an event on Unit 1.
- b. The Shift Manager has handed you EIP-8.3, Table 2, and EIP-9.0, Guideline 1, GENERAL EMERGENCY RED INITIAL NOTIFICATION FORM.
- c. The Shift Manager has directed you to:
 - **PERFORM** the initial ENN notification over the Southern LINC ENN.
 - USE the SOUTHERN LINC and <u>actually</u> perform this function.
 - The SOUTHERN LINC will be selected to **WIDE AREA TRN ENN** on the display.
 - ACTIVATE the ERO callout system per EIP-8.3, Table 2.
 - SIMULATE the phone call. DO NOT actually press any buttons on the telephone.
 - If a FAX is required, SIMULATE transmitting the FAX. DO NOT actually press any buttons on the FAX machine.
- d. This JPM contains time critical elements.
- e. A pre-job brief is not required.

INFORMATION FOR EMERGENCY RESPONSE NOTIFICATION SYSTEM ACTIVATION

 Obtain the <u>SCENARIO ACTIVATION PASSWORD</u> and the <u>SCENARIO</u> <u>IDENTIFICATION NUMBERS</u> from the Unit 2 Shift Supervisor, the SAS Operator, or the Security Shift Foreman.

SCENARIO ACTIVATION PASSWORD:__

123456789

2. Operations Shift Superintendent, Shift Supervisor (Emergency Director) determine the message to be sent from step 10.

Message Number: **3**

SCENARIO IDENTIFICATION NUMBER:

87246

- 3. Call the Farley Emergency Callout System in Dothan at **9-702-2548** and follow the phone instructions to activate a scenario. If the Farley Emergency Callout System cannot be activated at this number then, go to step 9 to activate the backup system.
- 4. When the system requests it, input the <u>SCENARIO ACTIVATION PASSWORD</u> obtained in step 1 and the <u>SCENARIO IDENTIFICATION NUMBER</u> associated with the message number determined in step 2.
- 5. When directed press the three key on the phone to activate the scenario.
- 6. When the system informs you that the scenario is building hang up the phone.
- 7. If there was a problem activating the Farley Emergency Callout System then, go to step 9 to activate the backup system.
- 8. When the Farley Emergency Callout System or the backup activates, the following will occur:
 - 8.1 Emergency Response Organization pagers will be activated with the (800) number.
 - 8.2 The SFM in the SAS should call the Shift Clerk when the ERO pager activated.
 - 8.3 The system will call the Shift Clerk. The call from the SAS and this phone call allows verification that the system has activated.
 - 8.4 For eight to ten minutes, the system will accept calls from individuals that have called in from the pager activation.
 - 8.5 After eight to ten minutes the system will continue to accept inbound calls and will also call all of the individuals in the database that have not responded to the 800 number.
 - 8.6 As individuals call in or are called, they will have to identify themselves by entering their employee number, receive the message selected in step 2, respond if they are coming to the plant and enter the number of minutes if they are coming to the plant

- 8.7 Every 15 minutes for the duration of the callout, a printout will be sent to the Shift Clerks office and/or the fax machine in the TSC listing the people that have responded.
- 9. If the system has failed to activate, call the backup system at (800) 475-9705. Enter the company ID code of **1044** and proceed as described in steps 4 through 7.
- 10. If both systems have failed to activate, proceed to FNP-0-EIP-8.3, step 11, to manually callout the emergency response staff.
- 11. Message Numbers

Message 1 EMERGENCY CALL OUT 99911 Scenario Identification Number:_____

THIS IS NOT A DRILL, I repeat THIS IS NOT A DRILL. This is a call-out of the Farley Emergency Response Organization due to a declared emergency. Respond to your Emergency Response Facility as quickly and safely as possible. THIS IS NOT A DRILL.

Message 2 SECURITY EVENT CALL OUT **54321** Scenario Identification Number:_____

THIS IS NOT A DRILL, I repeat THIS IS NOT A DRILL. This is a call-out of the Farley Emergency Response Organization. An emergency has been declared at the plant due to a security event. If responding from off site, the TSC staff should respond to the Emergency News Center in Dothan as quickly and safely as possible. If you are currently on site, do not try to leave the plant or report to your emergency response facility. Follow the directions issued over the plant public address system. THIS IS NOT A DRILL

Message 3 DRILL CALL OUT Scenario Identification Number: 87246

THIS IS A DRILL, I repeat THIS IS A DRILL. This is a call-out of the Farley Emergency Response Organization due to a drill or exercise. Respond to your Emergency Response Facility as quickly and safely as possible. THIS IS A DRILL

Message 4 COMMUNICATIONS TEST **11199** Scenario Identification Number:_____

THIS IS A DRILL, I repeat THIS IS A DRILL. This is a communication test of the Farley Emergency Response Organization. An emergency classification has not been declared. There is no required activation. Do not physically report to your designated Emergency Response Facility. This is a communication test only. THIS IS A DRILL.

GUIDELINE 1 GENERAL EMERGENCY RED VERBAL NOTIFICATION FORM

_	RED	VERBAL NOT	FIFICATION	FORM			001
1 ADRILL BACTUAL EV	'ENT				M	ESSAGE #	\mathcal{N}_{-}
	NOTIFICA	TION: TIME		DATE//	AUTHEN	TICATION #	<u>N/A</u>
3. SITE: FARLEY NUCLEAR PI	ANT	0	onfirmation Db	<u>(334) 814-</u> one # <u>(334) 794-</u> 0	4662, 814-466		4662)
4. EMERGENCY CLASSIELCAT	ION [.]	C(0110 # <u>(334) 794-</u> (Digenera	and the second	State of the second
BASED ON EAL#							
5. PROTECTIVE ACTION RECO	 OMMENDATIONS:						
		5 D-5	E-5	F-5	1-5		
		┙ <u></u> <u></u>	C-3	F-3	1-5		
B-10	C-10 D-1	D E- 10	F-10	G10 H1	D I-10	J-10	K-10
	B-5 C-5	D-5	E-5	F-5 I-5	J-5	K-5	
D Advise Remainder of	of EPZ to Monitor L	ocal Radio/TV S	Stations/ TARs	for Additional Inf	ormation and		
CONSIDER THE USE O	F KI (POTASSIUM IOD	IDE) IN ACCORDAI	NCE WITH STATE	E PLANS AND POLIC	Υ.		
E OTHER		A					-
6. EMERGENCY RELEASE:	A None		irring	C Has O	curred		
7. RELEASE SIGNIFICANCE:	A Not applicat		normal ng limits	C Above operat	normal ing limits	D Under evaluat	ion
8. EVENT PROGNOSIS:	A Improving	Bstable		C Degrad	ing		
9. METEOROLOGICAL DATA:	Wind Direc	ion from 33	5 degrees	Wind Sp	_{eed} <u>3, 4</u> m	ph _	
35 foot elevation preferm	ed Precipitatio	none		Stability G	Class A B)e
		Time _		Date	//		
11. AFFECTED UNIT(S):							
12. UNIT STATUS:		X U1 %	Power Shutd	own at Time <u>declar</u>	ation time minus	10 minutes	Date
(Unaffected Unit(s) Status N Initial Notifications)	Not Required for	_	Today	L			
	tional remarka			own at Time	Date	//	
13. REMARKS: No addi	tional remarks		al remarks on	-			
17. APPROVED BY:	W. 7. 2	Joor Title	e Emergenc	y Director_	[ime]	Date/_	/
NOTE: The information that is high				tion to be considered	ed correct.		
A. Line 1 check box A or B. B. Line 1 Number each verba				at 001 for the first	verbal message.		
C. Line 2 Notification time to						- 1-A to	
D. Line 4 Line 4 Enter the (o right method of evaluation							
on line 4.	100 Dustastiva Astic	n Daaamman dati	ana ta datarmin	a annuanziata Duata	ative Astion		
ELine 5 Refer to NMP-EP- Recommendations (PARs)						narked.	
Mark and complete box E FLine 6 An emergency rele					ar and above nor		
operating levels OR is in a 29B(NG)							
• Mark box A if no em	ergency release is in	progress or has o	ccurred				
• Mark box B if an eme	ergency release is in	progress					

• Mark box C if an emergency release has occurred, but is currently stopped

FNP-0-EIP-9.0

<u>GUIDELINE 1</u> GENERAL EMERGENCY RED VERBAL NOTIFICATION FORM

G. Line 7 Release Significance. Mark box A, B, C or D. Normal limits are being exceeded if an effluent monitor listed in step F above is in alarm

- Mark box A if 6A is marked
- Mark box B if 6B or 6C is marked and <u>NO</u> effluent monitor is or has been in alarm.
- Mark box C if 6B or 6C is marked and ANY effluent monitor is or has been in alarm.
- Mark box D if 6B or 6C is marked and it can not be determined if an effluent monitor is or has been in alarm.

H. Line 8 Event Prognosis. Mark box A, B or C.

- A should be marked if mitigation efforts appear successful, progressing toward termination/recovery.
- B should be marked if escalation to a higher classification is unlikely based on current conditions.
- C should be marked if escalation to a higher emergency classification or PAR change is likely.
- Line 9 Meteorological Data
 - Fill in the meteorological data required (35 foot elevation preferred).
 - When possible use 15 minute average data, available from EP_WEATHER on the IPC.
 - If EP_WEATHER. Is not available then use the guidance in FNP-0-EIP-9.3 Data Sheet 1 for obtaining meteorological data.
 - If stability class is not available it can be calculated from delta temperature from the below table ΔT (200' elev. temp, °F - 35' elev. temp, °F)
 Stability Class

temp, 1	~ -55 elev. temp, 10	Stability C.
<-1.74		А
-1.74	to <-1.56	В
-1.56	to <-1.38	С
-1.38	to <-0.46	D
-0.46	to < 1.38	E
1.38	to 3.60	F
>3.60		G

J. _____Line 10 Time is for the declaration checked in line 4

K. Line 11 Mark the unit that is involved with the emergency declaration, or all if both units are affected.

- Line 12 Fill in the per cent power or the time of shutdown for units involved with the event
- M. Line 13 If additional remarks are required mark the box for additional remarks and write them on a separate
 - paper and have them read over the ENN, or mark the box for no additional remarks
- N. The Emergency Director must sign the form with time and date.
- 0. Within 15 minutes of declaration time, using the ENN contact the state and local agencies listed below.
- P.____Verify the Southern LINC ENN Radio being used is turned on
- Q.____If the Southern LINC display does not show "WIDE AREA, FEP ENN" when group is pressed in step R, THEN perform the following:
 - Press the button with the square until the top line is indicated, then press the arrow buttons until "WIDE AREA" is displayed, then press the button under OK. Press the button with the square until the second line is indicated then press the arrow buttons until "FEP ENN" is displayed, and then press the button under OK.
- R_____Press group pushbutton, verify display shows WIDE AREA, FEP ENN. Correct per above step if necessary. Pickup handset or leave in cradle, press to talk (PTT), wait for the chirp and announce "This is name/title at Farley Nuclear Plant. Please obtain a GENERAL EMERGENCY RED initial notification form and monitor the ENN." Release the PTT.
- S.____Contact one state and county agency listed in each of the four boxes below.

Indicate the time of initial attempt to contact any Alabama agency. Circle agency actually contacted. Indicate the name of the individual contacted. Underlined phone numbers staffed 24 hours a day

PTT and request one Alabama agency in the order listed below acknowledge manning of the ENN. State agency name and ask if they are on the line. Release the PTT after each request.

ALABAMA State Agencies In preferred order

- Alabama Radiation Control at Montgomery EOC. ENN (1305), OPX (6628), (334-206-5391), (334-324-0076)
- AEMA ENN (1306), OPX(6619), (205-280-2312, 205-280-2310)
- Alabama Radiation Control at Alabama Forward EOC, ENN (1307), OPX 6621), (334-793-1565)
- HOUSTON COUNTY ENN (1307), OPX (6621), (334-794-9720, 793-9655, 677-4807, 4808)

Time

Name

Acknowledged

GUIDELINE 1 GENERAL EMERGENCY **RED VERBAL NOTIFICATION FORM**

Indicate the time of initial attempt to contact any Georgia agency. Circle agency actually contacted. Indicate the name of the individual contacted. Underlined phone numbers staffed 24 hours a day
PTT and request one Georgia agency in the order listed below acknowledge manning of the ENN. State agency name and ask if they are on the line. Release the PTT after each request.
 GEORGIA State Agencies In preferred order GEMA at Atlanta EOC, <u>ENN (1304), OPX (6629), (404-635-7200)</u> GEMA at Georgia Forward EOC, ENN (1308) OPX (6626), (229-723-4826) EARLY COUNTY, <u>ENN(1308)</u> OPX (6622),(229-723-3577, 3578, 4826)
TimeNameAcknowledged
Indicate the time of initial attempt to contact Houston County. Indicate the name of the individual contacted. Underlined phone numbers staffed 24 hours a day
PTT and request Houston County acknowledge manning of the ENN. State agency name and ask if they are on the line. Release the PTT after each request.
HOUSTON COUNTY • HOUSTON COUNTY, <u>ENN(1307)</u> , OPX (6621), (334-794-9720, 793-9655, <u>334-677-4807, 4808</u>)
TimeNameAcknowledged
Indicate the time of initial attempt to contact Early County. Indicate the name of the individual contacted. Underlined phone numbers staffed 24 hours a day
PTT and request Early County acknowledge manning of the ENN. State agency name and ask if they are on the line. Release the PTT after each request.
EARLY COUNTY • EARLY COUNTY, <u>ENN(1308)</u> OPX (6622), (<u>229-723-3577, 3578</u> , 4826)
Time Name Acknowledged

U._

- ____PTT and announce on the ENN "Please prepare to receive a GENERAL EMERGENCY, RED initial notification message with acknowledgment", then slowly read the GE initial notification form over the ENN. Release the PTT after reading two or three lines to allow individuals to respond.
- V.____Have the agencies contacted above, acknowledge receipt of the message and fill in the acknowledge checkbox above when they do.
- W.____If any required agency could not be contacted on the ENN, then use numbers listed with each agency or in FNP-0-EIP-8.1 to contact them by any available means as soon as possible.
- X _____Fax a copy of the previous page GENERAL EMERGENCY RED VERBAL NOTIFICATION FORM to the State of Florida, EOF using speed dial #10
- Y.____Wait for the Fax report indicating the fax was received then verify the state of Florida has received the Fax by calling. (800-320-0519) (850-413-9911)