JAMES A. FITZPATRICK					
	JAIVIES A. FIIZPATKICK				
	Job Performance Measure				
c	Core Thermal Power Calculated Manual	У			
	JPM Number: RO A-1-1				
	Revision Number: 0				
	Date: <u>03/04/2010</u>				
Developed Dev	Thedree	02/04/40			
Developed By:	Author	<u>03/04/10</u> Date			
		Duto			
Validated By:					
	Facility Technical Representative	Date			
Deview Dev					
Review By:	Examiner	Date			
		2410			
Approved By:					
	Chief Examiner	Date			

JOB PERFORMANCE MEASURE VALIDATION CHECKLIST

NOTE: All steps of this checklist should be performed upon initial validation. Prior to JPM usage, revalidate JPM using steps 8 through 11 below.

 Task description and number, JPM description and number are identified.
 2. Knowledge and Abilities (K/A) references are included.
 Performance location specified. (in-plant, control room, or simulator)
 4. Initial setup conditions are identified.
 5. Initiating and terminating cues are properly identified.
 6. Task standards identified and verified by Examiner review.
 Critical steps meet the criteria for critical steps and are identified with an asterisk (*).
 Verify the procedure referenced by this JPM matches the most current revision of that procedure: Procedure Rev Date
 Pilot test the JPM: a. verify cues both verbal and visual are free of conflict, and b. ensure performance time is accurate.
 If the JPM cannot be performed as written with proper responses, then revise the JPM.
 When JPM is revalidated, Examiner sign and date JPM cover page.

Technical changes and modifications:

1. Not Applicable

REVISION RECORD (Summary):

1. This JPM is the original revision 0.

JPM Setup Instructions:

IT	Έ	Μ	:

1. 502	6. 0.85	12. 3.95
2. 420	7.47	13. 4.00
3. 159	8. 1026	14. 392/392
4. 155	9. 59	15. 391.9/391.9
5. 0.85	11. 625	

Provide applicant with the following:

- JPM handout sheet
- RAP-7.3.03, CORE THERMAL POWER EVALUATION , Rev 13
- Calculator
- ASME Steam Tables
- Attachment 1 partially filled out.

TASK CONDITIONS:

Plant data has been recorded for steps 1 through 15 of attachment 1.

INITIATING CUE:

Calculate Core Thermal Power manually per section 9.2 of RAP-7.3.03, CORE THERMAL POWER EVALUATION. EPIC computer points are not available. Items 14 and 15 were obtained from 02TT-168A/C and B/D on attachment 3.

Information for Evaluator's Use:

UNSAT requires written comments on respective step.

* Denotes CRITICAL steps.

Number any comments in the "Comment Number" column. Then annotate that comment in the "Comments" section. The comment section should be used to document the reason that a step is marked as unsatisfactory and to document unsatisfactory performance relating to management expectations.

Some operations that are performed from outside of the control room may require multiple steps. These items may be listed as individual steps in this JPM. It is acceptable for the candidate to direct the local operator to perform groups of procedure steps instead of calling for each individual item to be performed.

The time clock starts when the candidate acknowledges the initiating cue.

Operator's Name:	
Job Title: RO	
JPM Title: Core Thermal Power Calculated M	anually
JPM Number: RO A-1-1 F	Revision Number: 0
K/A Number and Importance: K/A 2.1.18	IR: 3.6
Suggested Testing Environment: Classroo	m/Simulator
Actual Testing Environment:	
Testing Method: Table-Top	
Alternate Path: No	
Time Critical: No	
Estimated Time to Complete: 15 minutes	Actual Time Used:minutes
References: RAP-7.3.03, CORE THERMAL POWER EVA RAP-7.3.16, PLANT POWER CHANGES, Re ST-5D, APRM CALIBRATION, REV. 3	
EVALUATION SUMMARY: 1. Were all the Critical Elements performed sa 2. Was the task standard met?	atisfactorily?
The operator's performance was evaluated agains determined to be:	t the standards contained in this JPM, and has been Unsatisfactory
Comments:	
Note: Any grade of UNSAT requires a comme	ent.
Evaluator's Name:	(Print)
Evaluator's Signature:	Date:

RO ADMIN JPM A-1-1.doc

NOTE: Critical Element(s) indicated by * in Performance Checklist.

PERFORMANCE CHECKLIST:

JPM Start Time _____

	ELEMENT	STANDARD	SAT	UNSAT	Comment Number
1.	(*) Applicant calculates average feedwater temperature and compensated feed flow. Records data on Attachment 1 items 16 through 23.	Correctly calculates feedwater compensated flow. 16. 392 17. 391.9 1828 1928.1 20. 1.01031 21. 1.01034 22. A=3.99 (3.96-4.02)			
		23. B=4.04 (4.01-4.07) Correctly determines enthalpy			
2.	(*) Applicant uses the ASME steam tables to calculate Items 24 through 30 on attachment 1.	from steam tables. 24. 1191.9 (1191.2-1192.6) 25. 645.5 (639.9-651.1) 26. 367.4 (363.9-370.9) 27. 367.3 (363.8-370.8) 28. 490.1 (486.1-494.2)			
		29. 397.6 (393.6-401.6)			
		30. 65.8 (61.8-69.8)			
3.	(*) Applicant calculates items 31 through 34 on attachment 1.	Correctly calculates Q to feedwater.			
		31. 8.03 (7.97-8.09)			
		32. 367.4 (363.9-370.9)			
		33. 1191.9 (1191.2-1192.6)			
		34. 1940.4 (1935.4-1945.4)			

ELEMENT	STANDARD	SAT	UNSAT	Comment Number
4. (*) Applicant calculates items 35 through 36 on attachment 1.	Correctly calculates Q to CRD flow.			
· · · · · · · · · · · · · · · · · · ·	35037 (.036038)			
	36. 12.2 (11.9-12.5)			
5. (*) Applicant calculates items 37 through 39 on attachment 1.	Correctly calculates Q to Cleanup system. 37156 (.154158)			
	38. 92.5 (90.5-94.5) 39. 4.24 (4.04-4.44)			
 (*) Applicant calculates items 41 on attachment 1. 	Correctly calculates QPUMP 41. 1.58 (1.38-1.78)			
7. (*) Applicant calculates items 42 through 43 on attachment 1.	Correctly determines core thermal power.			
	42. 1956.3 (1947.5-1965.1)			
	43. 77.1 (76.8-77.5)			
Task is complete.				

JPM Stop Time _____

EXAM KEY

HEAT BALANCE CALCULATION SHEET

Page 1 of 1

I

I

DATE/TIME: ____

PERFORMED BY:

•.

Ì., •

•. •

PURPOSE: VALUE UNITS PANEL INSTRUMENT PARAMETER ITEM Cleanup Inlet Temp 9-4 12TSS-142 POS 1 502 1. ۰F 12TSS-142 POS 4 9-4 420 Cleanup Outlet Temp. 2 GPM 9-4 12FI-126A 159 3. Cleanup Flow A GPM Cleanup Flow B 9-4 12FI-126B 155 4. Power to Recirc. Pump A 9-4 RWR MG A GEN PWR 0.85 MW 5 RWR MG B GEN PWR MW 9-4 0,85 6. Power to Recirc. Pump B Mlb/hr 9-5 02-3DPR/FR-95 **Total Core Flow** 47 Reactor Pressure (psig + 14.7) 9-5 06PR/FR-98 1026 PSIA 8. 03FI-310 GPM CRD Flow to Reactor 9-5 59 9 15 GPM RWR & RWCU Pump Seal Flows Constant 9a 95 °F CRD System Temp Constant 10. GMWE 9-7 MAIN GEN MW 625 11. Gross MW Electric 3.95 MLB/HR 9-5 06FI-89A *12. Feedwater Flow Loop A 06FI-89B MLB/HR 9-5 4.00 ML 392/392°F *13. Feedwater Flow Loop B 02TT-168A/C 9-21 14. TFWA, use PTID 407/410 or 02TT-168B/D 391.9 /391.9°F TFW8, use PTID 408/411 or 9-21 15. FEEDWATER FLOW CALCULATIONS 392 *16. Average TFWA (407 + 410)/2 or (168A + 168C)/2 PE 391.9 *17. Average TFWB (408 + 411)/2 or (1688 + 168D)/2 ٩F ٩F Delta T Loop A (DTA) = TFWA - 420 -28 *18. ۴F *19. Delta T Loop B (DTB) = TFWB - 420 -28.1 *20. C.F. = 1.0 + {DTA*[-3.8064E-4 + (DTA*-4.4310E-7)]} 1.01031 C.F. = 1.0 + {DTB*[-3.8064E-4 + {DTB*-4.4310E-7]]} 1,01034 *21. (#12 * #20) 3.99 (3.96 - 4.02) (#13 * #21) 4.04 (4.01 - 4.07) (#13 * #21) VALUE MLB/HR *22. Compensated Flow A MLB/HR *23. Compensated Flow B ITEM UNITS PARAMETER HS #8, ASME Table 1191.9 (1191.2-1/2, BTU/LB 24 ASME Table 645.5 (639.9-651.1) BTU/LB #8. 25. HFG 367.2 (363.9 - 3)0.9BTULB 367.2 (363.9 - 3)0.9BTULB 367.2 (363.8 - 3)0.8BTULB 397.6 (393.6 - 40.6 BTULB 65.6 (61.8 - 69.8 BTULB VALUE UNITS #8, #16, ASME Table *26. HFWA ASME Table *27. HFWB #8, #17, #8, #1, ASME Table 28. HCUI ASME Table #8, #2, 29. HCUO ASME Table #8, #10, 30. HCR EQUATION (ITEM #"S) PARAMETER UNITS 2.03 (7.97-8.04) MLB/HR (#22 + #23) 31. **Total Feedflow** $\begin{array}{c} g. 03(7,9) = 5.64 \\ \hline MLB/HR \\ 3(2,4) = (363,9-320,9) \\ \hline H191(9(1)91,2-1)92,(4) \\ \hline H191(9(1)9$ [(#26*#22) + (#27*#23)]/#31 32. Feedwater Enthalpy [#24 - (0.000*#25)] 33. Steam Enthalpy Q to feedwater (QFW) [#31*(#33 - #32)]/3.413 34. [(#9 * 0.498E-3) + (#9a * 0.498E-3)] 35. CRD flow (WCR) [#35 * (#33 - #30)]/3.413 Q to CRD flow (QCR) 36. (#3 + #4) *(0.498E-3) Total CU flow (WCU) 37. (#28 - #29) 38. HCUI - HCUO Q to Cleanup Sys (#38 * #37)/3.413 39. 1.1 MWt 40. Vessel ambient loss (#5 + #6) • 0.93 (#34 + #36 + #39 + #40 - #41) 1956, 3 (1947.5-1965.) MWt (#5 + #6) • 0.93 41. **OPUMP** 42. Core Thermal Power 43 CTP/2536 (#42/2536) * 100 77.1(76.8-77.5) * Not Applicable when Attachment 5 is used. YES 🗌 NO Contact Operations to determine if this is performed to satisfy Tech. Specs: * If Yes, Second Verifier: Date/Time:____ Date/Time: Reviewed By: ____ Reactor Engineering Superintendent - This IS a Quality Record -CORE THERMAL POWER EVALUATION RAP-7.3.03 ATTACHMENT 1 Rev. No. <u>13</u> KEY EXAM Page 11 of 16

HANDOUT PAGE

TASK CONDITIONS:

Plant data has been recorded for steps 1 through 15 of attachment 1.

INITIATING CUE:

Calculate Core Thermal Power manually per section 9.2 of RAP-7.3.03, CORE THERMAL POWER EVALUATION. EPIC computer points are not available. Items 14 and 15 were obtained from 02TT-168A/C and B/D on attachment 3.

HEAT BALANCE CALCULATION SHEET

Page 1 of 1

I

l

DATE/TIME: PERFORMED BY: ____ PURPOSE: ____ VALUE UNITS INSTRUMENT PARAMETER PANEL ITEM 0F 12TSS-142 POS 1 502 9-4 Cleanup Inlet Temp 1. ٩F 12TSS-142 POS 4 420 Cleanup Outlet Temp. 9-4 2. GPM Cleanup Flow A 9-4 12FI-126A З. 9-4 12FI-126B 155 GPM Cleanup Flow B 4 RWR MG A GEN PWR 0.85 MW 9-4 Б. Power to Recirc. Pump A RWR MG B GEN PWR 6.85 MW 9-4 Power to Recirc. Pump B 6. MIb/hr 9-5 02-3DPR/FR-95 47 **Total Core Flow** 7. 06PR/FR-98 1026 PSIA 9-5 Reactor Pressure (psig + 14.7) 8. 59 GPM 03FI-310 9-5 9. **CRD** Flow to Reactor 15 GPM RWR & RWCU Pump Seal Flows Constant 9a 95 °F CRD System Temp Constant 10. MAIN GEN MW 625 GMWE 9-7 11. Gross MW Electric MLB/HR 06FI-89A 3.95 9-5 *12. Feedwater Flow Loop A MLB/HR 06FI-89B 9-5 •13. Feedwater Flow Loop B 4.00 392 / 392 °F 391,9 /391,9°F 02TT-168A/C TFWA, use PTID 407/410 or 9-21 14. 9-21 15. TFWB, use PTID 408/411 or 02TT-168B/D FEEDWATER FLOW CALCULATIONS ۴F *16. Average TFWA (407+410)/2 or (168A+168C)/2 *17. Average TFWB (408 + 411)/2 or (168B + 168D)/2 *18. Delta T Loop A (DTA) = TFWA - 420 °F ٩F ٩F Delta T Loop B (DTB) = TFWB - 420 *19, C.F. = 1.0 + {DTA*[-3.8064E-4 + (DTA*-4.4310E-7)]} *20. *21. C.F. = 1.0 + [DTB*[-3.8064E-4 + (DTB*-4.4310E-7)]] MLB/HR (#12 #20) *22. Compensated Flow A MLB/HR (#13 * #21) *23. Compensated Flow B VALUE DATA USED UNITS PARAMETER ITEM ASME Table BTU/LB #8. 24 HS ASME Table BTU/LB #8, 25. HFG BTU/LB #8, #16, ASME Table *26. HFWA #8, #17, ASME Table BTU/LB *27. HFWB #8, #1, BTU/LB ASME Table 28. HCUI BTU/LB ASME Table #8, #2, HCUO 29. BTU/LB #8, #10, ASME Table 30. HCR VALUE EQUATION (ITEM #"S) UNITS PARAMETER (#22 + #23) MLB/HR 31. **Total Feedflow** [(#26*#22) + (#27*#23)]/#31 BTU/LB 32. Feedwater Enthalpy [#24 - (0.000*#25)] BTU/LB 33. Steam Enthalpy 34. Q to feedwater (QFW) [#31*(#33 - #32)]/3.413 MWt MLB/HR [(#9 * 0.498E-3) + (#9a * 0.498E-3)] 35. CRD flow (WCR) [#35 * (#33 - #30)]/3.413 MWt Q to CRD flow (QCR) 36 (#3 + #4) *(0.498E-3) MLB/HR Total CU flow (WCU) 37. BTU/LB (#28 - #29) HCUI - HCUO 38. (#38 * #37)/3.413 MWt Q to Cleanup Sys 39. Vessel ambient loss 1.1 MWt 40. (#5 + #6) * 0.93 MWt 41. OPUMP (#34 + #36 + #39 + #40 - #41) (#42/2536) * 100 MWt 42. **Core Thermal Power** 43 CTP/2536 % * Not Applicable when Attachment 5 is used. 🗌 YES Contact Operations to determine if this is performed to satisfy Tech. Specs: * If Yes, Second Verifier: ____ Date/Time: Date/Time: Reviewed By: ____ Reactor Engineering Superintendent - This IS a Quality Record -CORE THERMAL POWER EVALUATION RAP-7.3.03 ATTACHMENT 1 Rev. No. 13 Page 11 of 16

.1

•

1

1.

21

ļ

2

	JAMES A. FITZPATRICK	
	Job Performance Measure	
	Work Hour Restrictions	
	JPM Number: RO A-1-2	
	Revision Number: 0	
	Date: <u>03/11/2010</u>	
Developed By:	B. Litkett	3/11/2010
	Author	Date
Validated By:		
	Facility Technical Representative	Date
Review By:		
	Examiner	Date
Approved By:		
	Chief Examiner	Date

ADMIN RO JPM #A-1-2 JOB PERFORMANCE MEASURE VALIDATION CHECKLIST

NOTE: All steps of this checklist should be performed upon initial validation. Prior to JPM usage, revalidate JPM using steps 8 through 11 below.

	 Task description and number, JPM description and number are identified.
	2. Knowledge and Abilities (K/A) references are included.
	 Performance location specified. (in-plant, control room, or simulator)
	4. Initial setup conditions are identified.
	5. Initiating and terminating cues are properly identified.
	6. Task standards identified and verified by Examiner review.
	 Critical steps meet the criteria for critical steps and are identified with an asterisk (*).
	 Verify the procedure referenced by this JPM matches the most current revision of that procedure: Procedure Rev Date
<u> </u>	 Pilot test the JPM: a. verify cues both verbal and visual are free of conflict, and b. ensure performance time is accurate.
	 If the JPM cannot be performed as written with proper responses, then revise the JPM.
	 When JPM is revalidated, Examiner sign and date JPM cover page.

Technical changes and modifications:

1. Not Applicable

ADMIN RO JPM #A-1-2

REVISION RECORD (Summary): 1. This JPM is the original revision 0.

JPM Setup Instructions:

Provide applicant with the following:

• JPM handout sheet

TASK STANDARD:

Determine any work hour restrictions

ADMIN RO JPM #A-1-2

TASK CONDITIONS:

A Reactor Operator has called out sick for Thursday, May 6th Day Shift.

The following is the recent work hour history of 4 Reactor Operators. Their hours worked were and are in the Main Control Room during Mode 1, except for the training week.

 Dayshift
 7:00 am - 7:00 pm

 Nightshift
 7:00 pm - 7:00 am

 Training
 7:00 am - 3:30 pm

The schedules show the day that each work shift begins.

RO – John Smith	M	T	W	Т	F	S	S
Week of April 12	T	T	T	T	T		Ŭ
Week of April 19	<u> </u>	· ·		•	'	D	D
Week of April 26	D	D				N	N
Week of May 3	N	N			D	D	D
Week of May 10	+		N	N	N		-
RO – Bill Waters	Μ	Т	W	Т	F	S	S
Week of April 5	Т	Т	Т	Т	Т		
Week of April 12	D				D	D	D
Week of April 19	D			N	N	N	
Week of April 26		D	D	D	D		N
Week of May 3	N	Ν	Ν				
RO – Mike Hill	Μ	דן	W	T	F	S	S
Week of April 19	T	Т	Т	Т	T		
Week of April 26			D		D	D	D
Week of May 3	D	D			Ν	N	N
Week of May 10			D	D	D		
Week of May 17	Ν	Ν	N	Ν			
<u>RO –</u> Jane Riley	M	Т	W	Т	F	S	S
Week of April 26	T	Т	T	Т	Т		
Week of May 3	D	D			D	D	D
Week of May 10	D			Ν	N	Ν	
Week of May 17		D	D	D	D		Ν
Week of May 24	N	N	Ν				

ADMIN RO JPM #A-1-2

INITIATING CUE:

Evaluate the work hour history for each of the 4 Reactor Operators. Determine which operators can take the scheduled watch for a full dayshift of 12 hours today, May 6th.

If applicable, describe the conditions that would make any operator(s) ineligible to work.

Consider all days after May 6th as scheduled shifts. Consider all days before May 6th as actual worked shifts.

Information for Evaluator's Use:

UNSAT requires written comments on respective step.

* Denotes CRITICAL steps.

Number any comments in the "Comment Number" column. Then annotate that comment in the "Comments" section. The comment section should be used to document the reason that a step is marked as unsatisfactory and to document unsatisfactory performance relating to management expectations.

Some operations that are performed from outside of the control room may require multiple steps. These items may be listed as individual steps in this JPM. It is acceptable for the candidate to direct the local operator to perform groups of procedure steps instead of calling for each individual item to be performed.

The time clock starts when the candidate acknowledges the initiating cue.

On anotaria Nama			ADMIN RO JPM #A-1-2
Operator's Name: _ Job Title:	RO		
JPM Title: Work Hou	ur restrictions		
JPM Number: RO A-	-1-2	Revision Number: 0	
K/A Number and Im	portance: K/A 2.1. 5	IR: 2.9	
Suggested Testing	Environment: Classro	om	
Actual Testing Envi	ronment:		
Testing Method: Ta	ble-Top		
Alternate Path: No		,	
Time Critical: No			
Estimated Time to C	complete: 15 minutes	Actual Time Used:	minutes
References: 1. EN-OM-123, F	Rev.0; Fatigue Managen	nent program	
EVALUATION SUMM 1. Were all the Critica 2. Was the task stand	al Elements performed s	satisfactorily? 🗆 Yes	s 🗆 No
The operator's perform determined to be:	ance was evaluated agair		ned in this JPM, and has been tory
Comments:			
Note: Any grade of L	JNSAT requires a comm	nent.	
Evaluator's Name: _		(Print)	
Evaluator's Signatu	re:		Date:

ADMIN RO JPM #A-1-2

NOTE: Critical Element(s) indicated by * in Performance Checklist.

PERFORMANCE CHECKLIST:

JPM Start Time _____

ELEMENT	STANDARD	SAT	UNSAT	Comment Number
1. Obtain a controlled copy of procedure EN-OM-123 Rev.0; Fatigue Management program	The applicant obtains a controlled copy of EN-OM-123 Rev.0; Fatigue Management program			
	EXAMINER NOTE: AP-11.03 used to contain overtime rules for key station personnel. However, this information is now contained in EN-OM-123; Fatigue Management Program. AP- 11.03 no longer applies to operators on shift.			

ADMIN RO JPM #A-1-2

1					
		STANDARD	SAT	UNSAT	Comment Number
	 Step 5.2. Working hour limits for covered individuals. A. Work hour limits for individuals performing Covered work consist of three concurrent components; maximum ceilings, minimum breaks and Minimum Days Off (MDO) (1) The maximum ceilings which apply at all times are a maximum of: 16 work hours in any 24 hour period, 26 work hours in any 48 hour period, and 72 hours in any 7 day period. (2) The minimum break times which apply at all times are a minimum of: (a) 10-hour break between successive work periods, except that an 8-hour break is allowed when necessary to accommodate a crew's scheduled transition between work schedules or shifts, and (b) 34-hour break in any 9 – day period. (3) EN-OM-123; step 5.2.4 describes MDO: (a) For Operators working a 12 hour shift, the requirement is to average a minimum of 2.5 days off per week. The average days off per week is averaged over a shift cycle of up to 6 weeks in duration. 	Applicant evaluates each listed operator against limitations of EN-OM-123.			
RO	ADMIN JPM A-1-2.doc				

ADMIN RO JPM #A-1-2

ELEMENT	STANDARD	SAT	UNSAT	Comment Number
*3. Evaluate John Smith for overtime.	Applicant determines John Smith can NOT take the watch because he would not have a 34 hour uninterrupted break in the nine days from May 1 to May 9.			
*4. Evaluate Bill Waters for overtime.	Applicant determines Bill Waters can NOT take the shift because he would exceed the 16 hours in a 24 hour period requirement. The night shift of May 5 will end at 7 am and Day shift May 6 starts at 7 am. So with no time off between shifts, will end up working 24 hours straight.			
*5. Evaluate Mike Hill for overtime.	Mike Hill can work the shift. He would have a 36 hour break from May 4 to May 6 and for the week he will have 72 hours which is allowed, and for the cycle he will have 13 days off. The MDO, when working a five week cycle requires 12.5 days off, which rounded up is 13 days off. Therefore he meets the MDO requirement.			
*6. Evaluate Jane Riley for overtime.	Jane Riley can NOT take the shift because she would exceed the MDO of 2.5 days off per week. For a 5-week cycle she needs 12.5 days off over the entire cycle to average 2.5 per week. She currently has 13 days off, but working one additional day will take her to 12 days off which is below the required minimum amount of days off.			
Examine	er: Terminate the task at this point			

ADMIN RO JPM #A-1-2

JPM Stop Time _____

Handout Page

TASK CONDITIONS:

A Reactor Operator has called out sick for Thursday, May 6th Day Shift.

The following is the recent work hour history of 4 Reactor Operators. Their hours worked were and are in the Main Control Room during Mode 1, except for the training week.

 Dayshift
 7:00 am - 7:00 pm

 Nightshift
 7:00 pm - 7:00 am

 Training
 7:00 am - 3:30 pm

The schedules show the day that each work shift begins.

RO – John Smith	Μ	Τ	W	Т	F	S	S
Week of April 12	Т	Т	T	Т	Т		
Week of April 19						D	D
Week of April 26	D	D				Ν	Ν
Week of May 3	N	N			D	D	D
Week of May 10			N	Ν	Ν		
RO – Bill Waters	Μ	Т	W	Т	F	S	S
Week of April 5	Т	Т	Т	Т	Т		
Week of April 12	D				D	D	D
Week of April 19	D			Ν	Ν	N	
Week of April 26		D	D	D	D		Ν
Week of May 3	Ν	Ν	N				
RO – Mike Hill	Μ	T	W	Т	F	S	S
Week of April 19	Т	T	Т	Т	Т		
Week of April 26			D		D	D	D
Week of May 3	D	D			N	Ν	Ν
Week of May 10			D	D	D		
Week of May 17	N	N	N	Ν			
RO – Jane Riley	M		W	Т	F	S	S
Week of April 26	Т	Т	Т	Т	Т		
Week of May 3	D	D			D	D	D
Week of May 10	D			Ν	Ν	Ν	
Week of May 17		D	D	D	D		Ν
Week of May 24	N	N	N				

Handout Page

INITIATING CUE:

Evaluate the work hour history for each of the 4 Reactor Operators. Determine which operators can take the scheduled watch for a full dayshift of 12 hours today, May 6th.

If applicable, describe the conditions that would make any operator(s) ineligible to work.

Consider all days after May 6th as scheduled shifts. Consider all days before May 6th as actual worked shifts.

	JAMES A. FITZPATRICK						
	Job Performance Measure						
Initiate a manual tagout for 'B' RHR pump discharge check valve replacement							
JPM Number: RO A-2							
Revision Number: 1							
٦	Date: <u>03/09/2010</u>						
Developed By:	B. Litkett Author	<u>03/09/10</u> Date					
Validated By:	Facility Technical Representative	Date					
Review By:	Examiner	 Date					
Approved By:	Approved By: Chief Examiner						

JOB PERFORMANCE MEASURE VALIDATION CHECKLIST

NOTE: All steps of this checklist should be performed upon initial validation. Prior to JPM usage, revalidate JPM using steps 8 through 11 below. 1. Task description and number, JPM description and number are identified. 2. Knowledge and Abilities (K/A) references are included. 3. Performance location specified. (in-plant, control room, or simulator) 4. Initial setup conditions are identified. 5. Initiating and terminating cues are properly identified. 6. Task standards identified and verified by Examiner review. 7. Critical steps meet the criteria for critical steps and are identified with an asterisk (*). 8. Verify the procedure referenced by this JPM matches the most current revision of that procedure: Procedure Rev. ____ Date ____ 9. Pilot test the JPM: a. verify cues both verbal and visual are free of conflict, and b. ensure performance time is accurate. 10. If the JPM cannot be performed as written with proper responses, then revise the JPM. 11. When JPM is revalidated, Examiner sign and date JPM cover page.

Technical changes and modifications:

1. Not Applicable

REVISION RECORD (Summary):

1. This JPM is the original revision 01

2. REFERENCES

- a. EN-OP-102 Rev.12
- b. EN-OP-102-01 Rev.6
- c. OP-13 Rev. 94
- d. FM- 20B Rev. 68

3. TOOLS AND EQUIPMENT

a. Current copies of OP index and references.

4. SET UP REQUIREMENTS

a. Applicant has been assigned to prepare a tagout.

5. EVALUATOR NOTES

- a. Examiner's copy of component positions (Answer Key) is provided.
- b. The Applicant should demonstrate proper use of all HU tools during the performance of the procedure.
- c. Manual tag sheet is used. If Applicants ask, then, state "SOMs is out of service and SM has directed use of manual tagout for this work".
- d. If Applicant asks for a copy of the work order state this was reviewed and no additional information was obtained.

Information for Evaluator's Use:

UNSAT requires written comments on respective step.

* Denotes CRITICAL steps.

Number any comments in the "Comment Number" column. Then annotate that comment in the "Comments" section. The comment section should be used to document the reason that a step is marked as unsatisfactory and to document unsatisfactory performance relating to management expectations.

Some operations that are performed from outside of the control room may require multiple steps. These items may be listed as individual steps in this JPM. It is acceptable for the Applicant to direct the local operator to perform groups of procedure steps instead of calling for each individual item to be performed.

RO ADMIN JPM A-2.doc

The time clock starts when the Applicant acknowledges the initiating cue.

Operator's Name:

Job Title: RO

JPM Title: Initiate a manual tagout for 'B' RHR pump discharge check valve replacement

JPM Number: RO A-2	Revision Number: 1
K/A Number and Importance: K/A 2.2.13	R: 4.1
Suggested Testing Environment: Classro	om
Actual Testing Environment:	
Testing Method: Table-Top	
Alternate Path: No	
Time Critical: No	
Estimated Time to Complete: 15 minutes	Actual Time Used:minutes
References:	
EVALUATION SUMMARY: 1. Were all the Critical Elements performed 2. Was the task standard met?	satisfactorily?
The operator's performance was evaluated agai has been determined to be:	
Comments:	
Note: Any grade of UNSAT requires a comr	nent.
Evaluator's Name:	(Print)
Evaluator's Signature:	Date:

RO ADMIN JPM A-2.doc

TASK CONDITIONS:

Currently all systems are operable

INITIATING CUE:

A tagout is required on the "B" RHR system to conduct repairs on 10RHR-42B; discharge check valve. Work scope is to replace valve internals per WR 123456789. eSOMs is out of service and the SM has directed the use of a manual tagout required for this work.

You have been directed to prepare a manual tagout. You are responsible for required hang positions and sequence of the components. Inform the Operations Supervisor when you have completed the tagout.

PERFORMANCE CHECKLIST:

JPM Start Time _____

ELEMENT	STANDARD	SAT	UNSAT	Comment Number
1. Applicant determines EN-OP-102-01; attachment 9.2 and 9.3; OP-13; FM-20A and drawings	Applicant uses EN-OP-102-01; attachment 9.2 and 9.3; OP- 13;FM-20A and drawings			
Evaluator CUE: Can provide blank copy of EN-OP-102-01; attachment 9.2 and 9.3 after applicant determines tagging sheets.	Evaluator CUE: Can provide blank copy of EN-OP-102-01; attachment 9.2 and 9.3 after applicant determines tagging sheets.			
2. Applicant reviews the isolation boundaries.	The Applicant determines tagout boundary			
3.(*) 1-10 - 10P-3B; RHR B PUMP CONTROL SWITCH in auto after stop; sequence 1.	Applicant selects 1-10 - 10P- 3B; RHR B PUMP CONTROL SWITCH in auto after stop; sequence 1.			
4. (*) 1-10 -10P-2B; RHR B KEEPFULL PUMP CONTROL SWITCH; STOP; sequence 1.	Applicant selects 1-10 -10P- 2B; RHR B KEEPFULL PUMP CONTROL SWITCH; STOP; sequence 1.			
5. (*)1-71-71MCC-163-OE1; 10P-2B; RHR B KEEPFULL PUMP BREAKER; OFF/REMOVED, sequence 2.	Applicant selects 1-71- 71MCC-163-OE1; 10P-2B; RHR B KEEPFULL PUMP BREAKER; OFF/REMOVED, sequence 2.			
6. (*) 1-71 - -71-10540 BKR CLOSE FUSE; Fuses removed; sequence 2.	Applicant selects 1-7171- 10540 BKR CLOSE FUSE; Fuses removed; sequence 2.			
7. (*) 1-71 – CKTBKR-71-10540 racked out/removed; sequence 3.	Applicant selects 1-71 – CKTBKR-71-10540 racked out/removed; sequence 3.			
8. (*) 1-7171-10540 BKR TRIP FUSES; fuses removed; sequence 4.	Applicant selects 1-7171- 10540 BKR TRIP FUSES; fuses removed; sequence 4.			

ELEMENT	STANDARD	SAT	UNSAT	Comment Number
9.(*) 1-10 –VALVE 10RHR-45B; 'B' RHR discharge isolation valve, CLOSED, sequence 5.	Applicant selects 1-10 – VALVE 10RHR-45B; 'B' RHR discharge isolation valve, CLOSED, sequence 5.			
10.(*) 1-1010MOV-13B [KEYLOCK SW] TORUS SUCT VALVE; CLOSED; sequence 6.	Applicant selects 1-10 10MOV-13B [KEYLOCK SW] TORUS SUCT VALVE; CLOSED; sequence 6.			
11. (*) 1-10 – 10MOV-15B (SW); SHUTDOWN CLG VLV; CLOSED; sequence 6.	Applicant selects 1-10 – 10MOV-15B (SW); SHUTDOWN CLG VLV; CLOSED; sequence 6.			
12. (*)1-71 - 71 MCC-163-OJ4; 10MOV- 13B RHR PUMP B SUCT FROM SUPPRESSION POOL ISOL VALVE;OFF/REMOVED; sequence 7.	Applicant selects 1-71 - 71 MCC-163-OJ4; 10MOV-13B RHR PUMP B SUCT FROM SUPPRESSION POOL ISOL VALVE; OFF/REMOVED; sequence 7.			
13. (*) 1-71 - 71MMC-163-OD1; 10MOV- 15B RHR PUMP SUCT SHUTDOWN COOLING ISOL VALVE; OFF/REMOVED; sequence 7.	Applicant selects 1-71 - 71MMC-163-OD1; 10MOV- 15B RHR PUMP SUCT SHUTDOWN COOLING ISOL VALVE; OFF/REMOVED; sequence 7.			
14. (*) 1-10 – VALVE- 10MOV-15B; RHR PUMP B SUCT Shutdown Cooling ISOL, CLOSED, sequence 8.	Applicant selects 1-10 – VALVE- 10MOV-15B; RHR PUMP B SUCT Shutdown Cooling ISOL, CLOSED, sequence 8.			
15. (*) 1-10-VALVE- 10MOV-13B; RHR PUMP B SUCT TORUS ISOL VALVE; CLOSED, sequence 8.	Applicant selects 1-10-VALVE- 10MOV-13B; RHR PUMP B SUCT TORUS ISOL VALVE; CLOSED, sequence 8.			
16. (*) 1-10-VALVE-10RHR-251B; RHR PUMP B SUCT DRAIN VALVE; CLOSED; sequence 9.	Applicant selects 1-10-VALVE- 10RHR-251B; RHR PUMP B SUCT DRAIN VALVE; CLOSED; sequence 9.			
17. (*) 1-10 –VALVE-10RHR-28B; RHR PUMP B MIN FLOW ISOL VALVE; CLOSED; sequence 9.	Applicant selects 1-10 – VALVE-10RHR-28B; RHR PUMP B MIN FLOW ISOL VALVE; CLOSED; sequence 9.			

ELEMENT	STANDARD	SAT	UNSAT	Comment Number
18.(*) 1-10-VALVE-10RHR-91B; RHR KEEP-FULL PUMP B SUCT ISOL VALVE;CLOSED; sequence 9.	Applicant selects 1-10-VALVE- 10RHR-91B; RHR KEEP- FULL PUMP B SUCT ISOL VALVE; CLOSED; sequence 9.			
19.(*) 1-10-VALVE-10RHR-250D; RHR Pump D DISCH DRAIN VALVE, CLOSED, sequence 9.	Applicant selects 1-10-VALVE- 10RHR-250D; RHR Pump D DISCH DRAIN VALVE, CLOSED, sequence 9.			
20. (*) 1-10-VALVE-10RHR-250B; RHR PUMP B DISCH DRAIN VALVE; OPEN; sequence 10.	Applicant selects 1-10-VALVE- 10RHR-250B; RHR PUMP B DISCH DRAIN VALVE; OPEN; sequence 10.			
21.(*) 1-10-VALVE-10RHR-253; RHR Pumps B & D DISCH DRAINS TO EQUIP SUMP ISOL VALVE; OPEN; sequence 10.	Applicant selects 1-10-VALVE- 10RHR-253; RHR Pumps B & D DISCH DRAINS TO EQUIP SUMP ISOL VALVE; OPEN; sequence 10.			
22.(*) 1-10-VALVE-10RHR-682; RHR PUMP B DISCH DRAIN VALVE; UNCAPPED & OPEN; sequence 10.	Applicant selects 1-10-VALVE- 10RHR-682; RHR PUMP B DISCH DRAIN VALVE; UNCAPPED & OPEN; sequence 10.			
23.1-10-VALVE-10RHR-698: RHR PUMP B DISCH SPARE INSTRUMENTATION ISOLATION VALVE; UNCAPPED & OPEN; sequence 10.	Applicant selects 1-10-VALVE- 10RHR-698: RHR PUMP B DISCH SPARE INSTRUMENTATION ISOLATION VALVE; UNCAPPED & OPEN; sequence 10.			
Task is complete.				

ANSWER KEY

Protective and Caution Tagging Forms & Checklist TAGOUT COVER SHEET **ATTACHMENT 9.2** Tagout: <u>10-RHR-42B-MAN</u> **Clearance: Manual** Component to be worked: 'B' RHR pump discharge check valve Description: Repair 10RHR- 42B - replace valve internals Placement Inst: 1.) Ensure MOVs are CLOSED prior to tagging open breakers. 2.) Ensure condensate transfer is for keepfull for 'D' RHR Pump. 10P-2B and 10P-3B are out of service 3.) Rack out breaker 71-10540 per OP-46A Hazards: 1.) Residual water in piping is possible. Possible contaminated water **Restoration Inst:** 1.)Ensure RHR B is filled and vented prior to restoration 2.) Rack in breaker 71-10540 per OP-46A

Attribute Description	Attribute Value
LCO	N

Work Order Number	Description
123456789	Replace 10RHR-42B internals

Status	Description	User	Verification Date
Prepared	Prepared		
Technical Reviewed	Reviewed		
Approved	Approved		
Tags Verified Hung	Tags Verified Hung		
Removal Approved	Removal Approved		
Tags Verified Removed	Tags Verified Removed		

ATTACHMENT 9.3

ANSWER KEY

TAGOUT TAGS SHEET

(Clearan	ce: MANUAL		Tagout:		<u>_</u>					
Tag Serial No.	Tag Type	Equipment Equipment Description Equipment Location	Place. Seq.	Placement Configuration	Place. 1st Verif Date/Time	Place. 2nd Verif Date/Time	Rest .Seq	Restoration Configuratio n	Rest. 1 st Verif Date/Time	Rest. 2 nd Verif Date/Time	Placement/ Removal Tag Notes
	D	10P-3B; 'B' RHR pump control switch	1	Auto after Stop							
	D	10P-2B; 'B' RHR Keep full pump control switch	1	Stop							
	D	1-71-71MCC-163-OE1	2	OFF/ REMOVED							
	D	1-7171-10540 BKR CLOSE FUSE	2	Fuses removed							
	D	1-71 CKTBKR-71-10540	3	Racked out/Removed							
	D	1-7171-10540 BKR TRIP FUSES	4	Fuses removed							
	D	1-10 –VALVE 10RHR-45B; 'B' RHR DISCHARGE ISOLATION VALVE,	5	CLOSED							
	D	1-1010MOV-13B [KEYLOCK SW] TORUS SUCT VALVE.	6	CLOSED							
	D	1-10 – 10MOV-15B (SW); SHUTDOWN CLG VLV	6	CLOSED							
	D	1-71-71MCC-163-OJ4; 10MOV- 13B breaker	7	OFF/ REMOVED							
	D	1-71-71MCC-163-OD1;10MOV- 15B breaker	7	OFF/ REMOVED							
	D	1-10 – VALVE- 10MOV-15B; RHR PUMP B SUCT Shutdown Cooling ISOL	8	CLOSED							
	D	1-10-VALVE- 10MOV-13B; RHR PUMP B SUCT TORUS ISOL VALVE	8	CLOSED							
	D	1-10-VALVE-10RHR-251B; RHR PUMP B SUCT DRAIN VALVE	9	CLOSED							
	D	1-10 VALVE-10RHR-28B; RHR PUMP B MIN FLOW ISOL VALVE	9	CLOSED							

RO ADMIN JPM A-2.doc

ADMIN RO JPM #A-2

ATTACHMENT 9.3

ANSWER KEY

TAGOUT TAGS SHEET

 					-		
D	1-10-VALVE-10RHR-91B; RHR KEEP-FULL PUMP B SUCT ISOL	9	CLOSED				
	VALVE						
D	1-10-VALVE-10RHR-250D; RHR	9	CLOSED				
	Pump D DISCH DRAIN VALVE						
D	1-10-VALVE-10RHR-250B; RHR	10	OPEN				
	PUMP B DISCH DRAIN VALVE						
 D	10RHR-253; 'B' and 'D' RHR B & D	10	OPEN				
	DISCH DRAINS TO EQUIP SUMP						
	ISOL VALVE						
D	1-10-VALVE-10RHR-682; RHR	10	UNCAPPED				
	PUMP B DISCH DRAIN VALVE		and OPEN				
 D	1-10-VALVE-10RHR-698; RHR	10	UNCAPPED			1	
	PUMP B DISCH SPARE		and OPEN				
	INSTRUMENTATION ISOLATION						
	VALVE						

JPM Stop Time _____

HANDOUT PAGE

ADMIN RO JPM #A-2

TASK CONDITIONS:

Currently all systems are operable

INITIATING CUE:

A tagout is required on the "B" RHR system to conduct repairs on 10RHR-42B; discharge check valve. Work scope is to replace valve internals per WR 123456789. eSOMs is out of service and the SM has directed the use of a manual tagout required for this work.

You have been directed to prepare a manual tagout. You are responsible for required hang positions and sequence of the components. Inform the Operations Supervisor when you have completed the tagout.

	JAMES A. FITZPATRICK								
Job Performance Measure									
Liquid Radwaste Potentiometer Settings									
JPM Number: RO A-3									
Revision Number: 0									
Date: <u>03/04/2010</u>									
Developed By:	T. Hedigan Author	<u>03/04/10</u> Date							
Validated By:	Facility Technical Representative	 Date							
Review By:	– Examiner	 Date							
Approved By:	Chief Examiner	Date							

JOB PERFORMANCE MEASURE VALIDATION CHECKLIST

NOTE:	All steps of this checklist should be performed upon initial validation. Prior to JPM usage revalidate JPM using steps 8 through 11 below.
	 Task description and number, JPM description and number are identified.
	 Knowledge and Abilities (K/A) references are included.
	 Performance location specified. (in-plant, control room, or simulator)
	4. Initial setup conditions are identified.
	5. Initiating and terminating cues are properly identified.
	 Task standards identified and verified by Examiner review.
	 Critical steps meet the criteria for critical steps and are identified with an asterisk (*).
	 8. Verify the procedure referenced by this JPM matches the most current revision of that procedure: Procedure Rev Date
	 9. Pilot test the JPM: a. verify cues both verbal and visual are free of conflict, and b. ensure performance time is accurate.
	10. If the JPM cannot be performed as written with proper responses, then revise the JPM.
	11. When JPM is revalidated, Examiner sign and date JPM cover page.

Technical changes and modifications: 1. Not Applicable

REVISION RECORD (Summary):

1. This JPM is the original revision 0.

JPM Setup Instructions:

- Provide applicant with the following:
- JPM handout sheet
- Attachment 10 of SP-01.05, Wastewater Sampling and Analysis
- Sample Activity vs. Alarm Pot Setting graph

TASK CONDITIONS:

Current plant conditions are as follows:

- The plant is at 70% power
- 2 Circulating water pumps (36P-1A/B) running
- 2 Service water pumps (46P-1A/C) running
- Liquid rad monitor (17RM-350) reading from EPIC-A-1209
- Liquid rad monitor (17RM-350) background from the 09-14 Panel
- Liquid rad monitor (17RM-350) K-factor from the 09-14 Panel

29.8cps 22.0cps 2.10E-7uci/ml/cps

INITIATING CUE: The Shift Manager has directed you to independently verify the following data, complete SP-01.05, Wastewater Sampling and Analysis, Attachment 10, and determine HI/HI and HI potentiometer settings.

Tank Discharge Flow Rate (maximum) DFR	200gpm
Tank Activity (ACT) uCi/ml (from discharge permit)	2.29E-6uci/ml
Required Dilution Factor (DF) (from discharge permit)	1.0
Tempering gate/flow	0%

Information for Evaluator's Use:

UNSAT requires written comments on respective step.

* Denotes CRITICAL steps.

Number any comments in the "Comment Number" column. Then annotate that comment in the "Comments" section. The comment section should be used to document the reason that a step is marked as unsatisfactory and to document unsatisfactory performance relating to management expectations.

Some operations that are performed from outside of the control room may require multiple steps. These items may be listed as individual steps in this JPM. It is acceptable for the Applicant to direct the local operator to perform groups of procedure steps instead of calling for each individual item to be performed.

The time clock starts when the Applicant acknowledges the initiating cue.

Operator's Name:			
Job Title: RC)		
JPM Title: Liquid Rady	waste Potentiometer Sett	lings	
JPM Number: RO A-3	Revi	sion Number: 0	
K/A Number and Impo	rtance: K/A 2.3.11Abil	ity to control radiation	n releases. IR: 3.8
Suggested Testing En	vironment: Classroom/S	imulator	
Actual Testing Enviro	nment:		
Testing Method: Table	ә-Тор		
Alternate Path: No			
Time Critical: No			
Estimated Time to Co	mplete: 15 minutes Ac	tual Time Used:	_minutes
 SP-03.07, Liquid Pro EVALUATION SUMMA Were all the Critical E Was the task standard 	Elements performed satisfand rd met?	Rev. 6 actorily? □ Yes	□ No
The operator's performan determined to be:	ce was evaluated against the		this JPM, and has been
	SAT requires a comment.		
Evaluator's Name:		(Print)	
Evaluator's Signature	:	Date	:
RO ADMIN JPM A-3.do	0C		

NOTE: Critical Element(s) indicated by * in Performance Checklist.

PERFORMANCE CHECKLIST:

JPM Start Time _____

	ELEMENT	STANDARD	SAT	UNSAT	Comment Number
1.	APPLICANT TRANSCRIBES DATA TO ATTACHMENT 1 #1 THROUGH 9.	APPLICANT TRANSCRIBES DATA TO ATTACHMENT 1 #1 THROUGH 9.			
2.	APPLICANT CALCULATES Canal Flow Rate (CFR) ATTACHMENT 1 #10.	APPLICANT CALCULATES Canal Flow Rate (CFR) ATTACHMENT 1 #10.			
		10. 276,000			
3.	APPLICANT CALCULATES Canal Dilution Factor (CDF)	APPLICANT CALCULATES Canal Dilution Factor (CDF)			
	ATTACHMENT 1 #11.	11. 7.25 E-4			
4.	APPLICANT CALCULATES Fraction of Allowed Dilution (FL) ATTACHMENT 1 #12.	APPLICANT CALCULATES Fraction of Allowed Dilution (FL)			
		12. 7.25 E-4			
5.	APPLICANT CALCULATES Background Correction Activity	APPLICANT CALCULATES Background Correction Activity			
	(BCA) ATTACHMENT 1 #13.	13. 1.638 E-6			
6.	APPLICANT CALCULATES Hi/Hi setpoint value ATTACHMENT 1	APPLICANT CALCULATES Hi/Hi setpoint value			
	#14.	14. 1.58 E-3			
7.	APPLICANT CALCULATES Hi setpoint value ATTACHMENT 1	APPLICANT CALCULATES Hi setpoint value			
	#15.	15. 7.91 E-4			

ELEMENT	STANDARD	SAT	UNSAT	Comment Number
8. (*)Obtain 17RM-350 potentiometer setting for Hi-Hi setpoint from Sample Activity vs. Alarm Pot Setting graph	Applicant determines and records 17RM-350 potentiometer setting for Hi-Hi setpoint from Sample Activity vs. Alarm Pot Setting graph			
	16. 7.3 turns (7.2-7.4)			
9. (*) Obtain 17RM-350 potentiometer setting for Hi setpoint from Sample Activity vs. Alarm Pot Setting graph	Applicant determines and records 17RM-350 potentiometer setting for Hi setpoint from Sample Activity vs. Alarm Pot Setting graph 17. 7.4 turns (7.3-7.5)			
Task is complete.				

JPM Stop Time _____

NR	C JAMES A. FITZPATRIC	CK INITIAL	EXAMINATIO	V
			ŀ	ADMIN RO JPM
LIGUID RA	DETERMINATION NORKSHEET	RM POT SETTI	NG PAGE 1 ()F 2
DATA COLLECTION			7	
1. Number of running circul	ating water pumps (36P-1A/B/C):		4	
2. Number of running servic	e water pumps 46P-1A/8/C):			
3. Tank Discharge Flow Rate	(Neximum) (DFR);		200 00	L
4. Tank Activity (ACT):			2,29 E-6 pci	/ml
5. Required Dilution Pactor	(DP)		1.0	
6. Current Liquid Radwaste	Nonitor (1784-350) reading (EPIC	-A-1209) -	29.8	1
MOTE: Background should be	maintained LARS THAN 1000 cps.		-	
7. Liquid Radwaste Monitor	(17RM-350) posted background:		22.0 cps	
8. Liquid Radwaste Monitor	(17RH-350) K-Pactor:	2,100	-7_ µci/m1/	срв
9. Tempering gate flow (SPI	C-A-3547)	-	<u> </u>	
CALCULATIONS				
10. Canal Flow Rate (CFR) (g	pm)			
CFR = [(# Circ pumps X 120,0	00) + (# service water pumps X 1	8,000)] x [1 -	(% tempering / 14	30)]
	x 18,000)) x [1 - (#9 / 100)]			
CFR - [(X 120,0	00) + (<u>2</u> x 1	8,000)] x (1 -	(/ 1)	1 (00
CPR = 276,000	abar Ali			
11. Canal Dilution Pactor (C	DF)			
CDF = (Tank Discharge Flow R	ate) / (Canal Flow Rate)			
CDF = (#3) / (#10)				
$cor = \frac{700}{7.25 \times 10^{-1}}$	1276000,			
$CDF = \frac{7}{2} \frac{2}{5} \frac{10}{5}$	•			
12. Fraction of Allowed Dilu	tion (F _s)			
WOTH: F, must be LERS THAN 1	0 for discharge.			
Fi = (Canal Dilution Pactor)	X (Required Dilution Pactor)			
F1 = (#11) X (#5)	,			
r. = <u>7.25×10⁻⁴</u> × r. = <u>7.25×10⁻⁴</u> ×				
1 = 7.25 × 10-4				

EXAM KEY

0% L

RO ADMIN JPM A-3.doc

EXAM KEY NRC JAMES A. FITZPATRICK INITIAL EXAMINATION ADMIN RO JPM #A-3 LIQUID RADWASTE REFLUENT MONITOR ALARM POT SETTING DETERMINATION WORKSHEET PAGE 2 OF 2 CALCULATIONS (Cont) 13. Background Correction Activity (BCA) in µCi/ml BCA = (Current 17RM-350 reading - 17RM-350 background) X 17RM-350 K-Factor BCA = (#6 - #7) X (#8) 22.0 * 2.10×10-) 29.8 BCA - 11638 × 10-6 #Ci/ml 14. Calculate Hi/Hi setpoint value in pCi/ml: Hi/Hi setpoint value = [Tank Activity / $(2 \times F_L)$ + (BCA) Hi/Hi setpoint value = $\frac{132}{150} \times \frac{100}{100} + \frac{100}{100} + \frac{100}{100} + \frac{1000}{100} +$ 15. Calculate Hi setpoint value in µCi/ml: Hi setpoint value = [Tank Activity / (4 X FL)) + BCA Hi setpoint value = [#4 / (4 X #12)] + (#13) Hi setpoint value = $\frac{12.29 \times 10^{-9}}{14 \times 7.25 \times 10^{-1}}$ (4 x 7.25 $\times 10^{-1}$ Hi setpoint value = $\frac{7.91 \times 10^{-7}}{1.91 \times 10^{-7}}$ uCi/ml Obtain 17RN-350 Ri/Hi alarm potentiometer setting, using Ri/Hi setpoint value activity, from current Liquid Radwaste Monitor "Sample Activity vrs. Alarm Pot Setting" graph. Hi/Hi Alarm potentiometer setting 7.3 (7.2-7.4) 17. Obtain 17RN-350 Hi alarm potentiometer setting, using Hi setpoint value activity, from current Liquid Radwaste Monitor "Sample Activity vrs. Alarm Pot Setting" graph.
 Hi Alarm potentiometer setting 2.4 (2.3-2.5) Applicant fills in. Print / Sign / Date Performed by: 18. Independently verify calculations and alarm potentionater settings. Independent verification : Print / Sign / Date 18. Enter Hi and Hi/Ni alarm potentiometer settings on Discharge permit (Attachment 2). COMPLETED ATTACHMENT 10 19 ATTACHED TO DISCHARGE PERMIT SP-01.05 WASTEWATER SAMPLING AND ATTACHMENT 10 Rev. 10 ANALYSIS Page __65_ of __65

EXAM KEY

RO ADMIN JPM A-3.doc

RU ADMIN JPM A-3.doc

HANDOUT PAGE TASK CONDITIONS: Current plant conditions are as follows:

- The plant is at 100% power
- 2 Circulating water pumps (36-1A/B) running
- 2 Service water pumps (46-1A/C) running
- Liquid Rad Monitor (17RM-350) reading from EPIC-A-1209
- Liquid Rad Monitor (17RM-350) background from the 09-14 Panel
- Liquid rad monitor (17RM-350) K-factor from the 09-14 Panel

INITIATING CUE: The Shift Manager has directed you to independently verify the following data, complete SP-01.05, Wastewater Sampling and Analysis, Attachment 10, and determine HI/HI and HI potentiometer settings.


29.8cps

22.0cps

2.10E-7uci/ml/cps

Tank Discharge Flow Rate (maximum) DFR	200gpm
Tank Activity (ACT) uCi/ml (from discharge permit)	2.29E-6uci/ml
Required Dilution Factor (DF) (from discharge permit)	1.0
Tempering gate/flow	0%



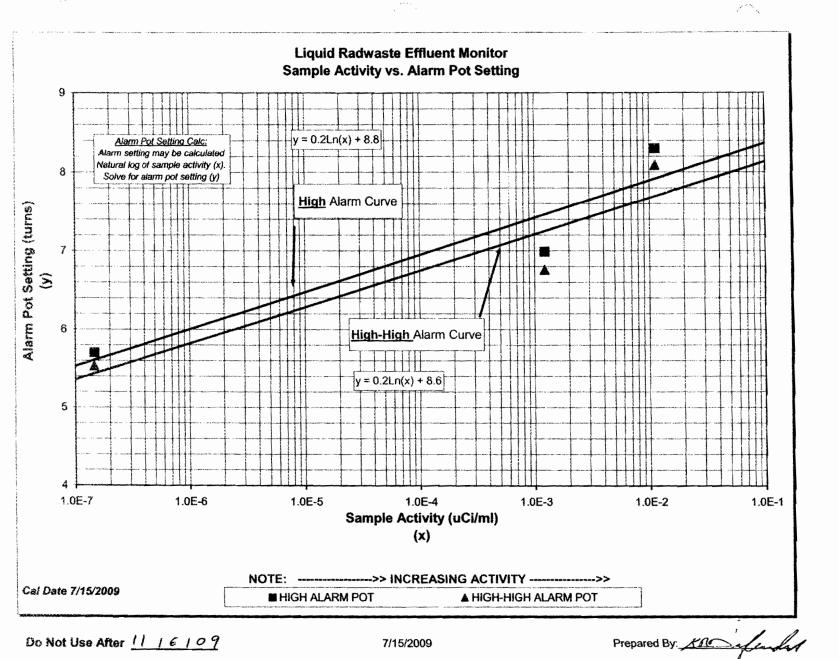

LIQUID RADWASTE EFFLUENT MONITOR ALARM POT SETTING DETERMINATION WORKSHEET PAGE	1 OF 2
DATA COLLECTION	
1. Number of running circulating water pumps (36P-1A/B/C):	
 Number of running service water pumps 46P-1A/B/C): 	
3. Tank Discharge Flow Rate (Maximum) (DFR):	gpm
4. Tank Activity (ACT):	µCi/ml
5. Required Dilution Factor (DF)	
6. Current Liquid Radwaste Monitor (17RN-350) reading (EPIC-A-1209):	cps
NOTE: Background should be maintained LESS THAN 1000 cps.	
7. Liquid Radwaste Monitor (17RM-350) posted background:	срв
B. Liquid Radwaste Monitor (17RM-350) K-Factor: #CL	/ml/cps
9. Tempering gate flow (EPIC-A-3547)	. 8
CALCULATIONS	
10. Canal Flow Rate (CFR) (gpm)	
CFR = {(# Circ pumps X 120,000) + {# service water pumps X 18,000)} X [1 - {% tempering	/ 1001]
CFR = [(#1 X 120,000) + (#2 X 18,000)] X [1 - (#9 / 100)]	
CFR = [(X 120,000) + (X 18,000)] X [1 - (/ 100)]
CFR = gpm	
11. Canal Dilution Pactor (CDF)	
CDF = (Tank Discharge Flow Rate) / (Canal Flow Rate)	
CDF = (#3) / (#10)	
CDF = ()	
CDF =	
12. Fraction of Allowed Dilution (F_{L}) .	
NOTE: F. must be LESS THAN 1.0 for discharge.	
F ₁ = (Canal Dilution Pactor) X (Required Dilution Factor)	
F ₂ = (#11) X (#5)	
F. *	
F ₂ =	

SP-01.05	WASTEWATER SAMPLING AND	ATTACHMENT 10
Rev. 10	ANALYSIS	Page <u>64</u> of <u>65</u>

LIQUID RADWASTE EFFLUENT MONITOR ALARM POT SETTING DETERMINATION WORKSHEET PAGE 2 OF
CALCULATIONS (Cont)
13. Background Correction Activity (BCA) in μ Ci/ml
BCA = (Current 17RM-350 reading - 17RM-350 background) X 17RM-350 K-Factor
BCA = (#6 - #7) X (#8)
BCA = () X
BCA = µCi/ml
14. Calculate Hi/Hi setpoint value in µCi/ml:
Hi/Hi setpoint value = [Tank Activity / $(2 \times F_{L})$] + (BCA)
<pre>Hi/Hi setpoint value = [#4 / (2 X #12)] + (#13)</pre>
Hi/Hi setpoint value = [/ (2 X)] +
Hi/Hi setpoint value = µCi/ml
15. Calculate Hi setpoint value in #Ci/ml:
Hi setpoint value = [Tank Activity / $(4 \times F_t)$] + BCA
Hi setpoint value = [#4 / (4 x #12)] + (#13)
Hi setpoint value = (/ (4 X); +
Hi setpoint value = µCi/ml
16. Obtain 17RM-350 Hi/Hi alarm potentiometer setting, using Hi/Hi setpoint value activity, from current Liquid Radwaste Monitor *Sample Activity vrs. Alarm Pot Setting* graph.
Hi/Hi Alarm potentiometer setting
17. Obtain 17RM-350 Hi alarm potentiometer setting, using Hi setpoint value activity, from current Liquid Radwaste Monitor "Sample Activity vrs. Alarm Pot Setting" graph.
Hi Alarm potentiometer setting
Performed by: Print / Sign / Date
18. Independently verify calculations AND alarm potentiometer settings.
Independent verification : Print / Sign / Date
18. Enter Hi and Hi/Hi alarm potentiometer settings on Discharge permit (Attachment 2).
COMPLETED ATTACHMENT 10 IS ATTACHED TO DISCHARGE PERMIT
SP-01.05 WASTEWATER SAMPLING AND ATTACHMENT 10 Rev. 10 ANALYSIS Page _65_ of _65

2

LIQUID RADWASTE EFFLUENT MONITOR ALARM POT SETTING DETERMINATION WORKSHEET (CANDIDATE HANDOUT)

DATA COLLECTION

1. Number of running circulating water pumps (36P-1A/B/C):	
2. Number of running service water pumps (46P-1A/B/C):	
3. Tank Discharge Flow Rate (Maximum) (DFR):	gpm
4. Tank Activity (ACT):	uCi/ml
5. Required Dilution Factor (DF):	
6. Current Liquid Radwaste Monitor (17RM-350) reading (EPIC-A-1209):	cps
Note: Background should be maintained LESS THAN 1000 cps.	
7. Liquid Radwaste Monitor (17RM-350) posted background:	cps
8. Liquid Radwaste Monitor (17RM-350) K-Factor:	uCi/ml/cps
9. Tempering Gate Flow (EPIC-A-3547):	%
CALCULATIONS	
10. Canal Flow Rate (CFR) (gpm)	
CFR = [(# Circ pumps x 120,000) + (# Service water pumps x 18,000)] x [1 - (% CFR = [(#1 x 120,000 + (#2 x 18,000)] x [1 - (#9 / 100)] CFR = [(x 120,000) + (x 18,000)] x [1 - (CFR = gpm	
11. Canal Dilution Factor (CDF)	,
CDF = (Tank Discharge Flow Rate) / (Canal Flow Rate) CDF = (#3) / (#10) CDF = () / () CDF =)	
12. Fraction of Allowed Dilution (F _L)	
Note: FL must be LESS THAN 1.0 for discharge.	
F_L = (Canal Dilution Factor) x (Required Dilution Factor) F_L = (#11) x (#5)	
FL = () × ()	

LIQUID RADWASTE EFFLUENT MONITOR ALARM POT SETTING DETERMINATION WORKSHEET (CANDIDATE HANDOUT)

CALCULATIONS (Cont.)

13. Background Correction Activity (BCA) in uCi/mI

BCA :	= [(Current 17RM-350 reading	g) – (17RM-350 background)] x (17RM-350 K-Factor)
BCA :	= (#6 - #7) x (#8)		,
BCA :	= ()×
BCA :	=	uCi/ml	

14. Calculate Hi/Hi setpoint value in uCi/ml:

Hi/Hi setpoint value =	[Tank Activity / (2 x FL)] + (BCA)	
Hi/Hi setpoint value =	[#4 / (2 x #12)] + (#13)	
Hi/Hi setpoint value =	/ (2 x)]	+
Hi/Hi setpoint value =	uCi/ml	

15. Calculate Hi setpoint value in uCi/ml:

Hi setpoint value =	[Tank Activity / (4 x F _L)] + (BCA)	
Hi setpoint value =	[#4 / (4 x #12)] + (#13)	
Hi setpoint value =	[/(4 x/)]+
Hi setpoint value =	uCi/ml	

16. Obtain 17RM-350 Hi/Hi alarm potentiometer setting, using Hi/Hi setpoint value activity, from current Liquid Radwaste Monitor "Sample Activity vs. Alarm Pot Setting" graph.

Hi/Hi Alarm Potentiometer setting _____

17. Obtain 17RM-350 Hi alarm potentiometer setting, using Hi setpoint value activity, from current Liquid Radwaste Monitor "Sample Activity vs. Alarm Pot Setting" graph.

Hi Alarm Potentiometer setting _____

Performed by:

Print / Sign / Date

18. Independently verify calculations AND alarm potentiometer settings.

Independent Verification:

Print / Sign / Date

19. Enter Hi and Hi/Hi alarm potentiometer settings on Discharge permit (Attachment 2).

	JAMES A. FITZPATRICK	
	JAWES A. FITZPATRICK	
	Job Performance Measure	
C	Core Thermal Power Calculated Manual	ly
	JPM Number: SRO A-1-1	
	Revision Number: 0	
	Date: <u>03/04/2010</u>	
Developed By:		<u>03/04/10</u>
	Author	Date
Validated By:		
	Facility Technical Representative	Date
Review By:		
	Examiner	Date
Approved By:		
	Chief Examiner	Date

JOB PERFORMANCE MEASURE VALIDATION CHECKLIST

<u>NOTE:</u>		os of this checklist should be performed upon initial validation. Prior to JPM usage, ate JPM using steps 8 through 11 below.
	1.	Task description and number, JPM description and number are identified.
	2.	Knowledge and Abilities (K/A) references are included.
	3.	Performance location specified. (in-plant, control room, or simulator)
	4.	Initial setup conditions are identified.
· · ·	5.	Initiating and terminating cues are properly identified.
	6.	Task standards identified and verified by Examiner review.
	7.	Critical steps meet the criteria for critical steps and are identified with an asterisk (*).
	8.	Verify the procedure referenced by this JPM matches the most current revision of that procedure: Procedure Rev Date
	9.	Pilot test the JPM: a. verify cues both verbal and visual are free of conflict, and b. ensure performance time is accurate.
	10	 If the JPM cannot be performed as written with proper responses, then revise the JPM.
	11	 When JPM is revalidated, Examiner sign and date JPM cover page.

Technical changes and modifications: 1. Not Applicable

REVISION RECORD (Summary):

1. This JPM is the original revision 0.

JPM Setup Instructions:

IT	EI	М	
		¥1.	

1. 512	6. 3.55	12. 5.44
2. 425	7.79	13. 5.55
3. 160	8. 1057	14. 423.6/423.6
4. 155	9. 59	15. 423.6/423.6
5. 3.85	11. 870	

Turbine first stage pressure is 667.4 psig

Provide applicant with the following:

- JPM handout sheet
- RAP-7.3.03, CORE THERMAL POWER EVALUATION , Rev 13
- Calculator
- ASME Steam Tables
- Attachment 1 partially filled out.
- Attachment 2 partially filled out.

TASK CONDITIONS:

Current indicated reactor power is 100% on APRM's.

Plant data has been recorded for steps 1 through 15 of attachment 1.

Turbine first stage pressure is 667.4 psig and has been recorded on attachment 2.

INITIATING CUE:

Perform section 9.3, Core Thermal Heat Balance Verification, of RAP-7.3.03, CORE THERMAL POWER EVALUATION. EPIC computer points are not available. Items 14 and 15 were obtained from 02TT-168A/C and B/D on attachment 3.

Determine what action, if any, is required.

Information for Evaluator's Use:

UNSAT requires written comments on respective step.

* Denotes CRITICAL steps.

Number any comments in the "Comment Number" column. Then annotate that comment in the "Comments" section. The comment section should be used to document the reason that a step is marked as unsatisfactory and to document unsatisfactory performance relating to management expectations.

Some operations that are performed from outside of the control room may require multiple steps. These items may be listed as individual steps in this JPM. It is acceptable for the candidate to direct the local operator to perform groups of procedure steps instead of calling for each individual item to be performed.

The time clock starts when the candidate acknowledges the initiating cue.

Operator's Name: Job Title:	SRO		
JOD Hile.	510		
JPM Title: Core Th	ermal Power Calculated	Manually	
JPM Number: SRC	D A-1-1	Revision Number: 0	
K/A Number and Ir	mportance: K/A 2.1.18	IR: 3.8	
Suggested Testing	g Environment: Classro	om/Simulator	
Actual Testing Env	vironment:		
Testing Method: 1	Table-Top		
Alternate Path: No	,		
Time Critical: No			
Estimated Time to	Complete: 15 minutes	Actual Time Used:	minutes
-	THERMAL POWER EV T POWER CHANGES, R IBRATION, REV. 3		
EVALUATION SUM 1. Were all the Criti 2. Was the task sta	cal Elements performed	satisfactorily? 🗆 Yes	□ No
The operator's perfor determined to be:	•	nst the standards contain	ed in this JPM, and has been tory
Comments:			
Note: Any grade of	UNSAT requires a comr	nent.	
Evaluator's Name:		(Print)	
Evaluator's Signat	ure:		Date:

SRO ADMIN	JPM /	A-1-1	.doc
-----------	-------	-------	------

NOTE: Critical Element(s) indicated by * in Performance Checklist.

PERFORMANCE CHECKLIST:

JPM Start Time _____

	ELEMENT	STANDARD	SAT	UNSAT	Comment Number
1.	(*) Applicant calculates reactor	Applicant calculates reactor			
	power using first stage turbine pressure.	power using first stage turbine pressure.			
		100.2			
2.	(*) Applicant calculates average feedwater temperature and compensated feed flow. Records data on Attachment 1 items 16 through 23.	Correctly calculates feedwater compensated flow. 16. 423.6 17. 423.6 18. 3.6 19. 3.6 20. 0.99862 21. 0.99862 22. A=5.43 (5.40-5.46)			
		23. B=5.54 (5.51-5.57)			
3.	(*) Applicant uses the ASME steam tables to calculate Items 24 through 30 on attachment 1.	Correctly determines enthalpy from steam tables.			
	30 on attachment 1.	24. 1190.7 (1190-1191.4)			
		25. 639.6 (638-641.2)			
		26. 401.5 (398-405)			
		27. 401.5 (398-405)			
		28. 502.0 (498-506)			
		29. 403.0 (399-407)			
		30. 65.9 (61.9-69.9)			

.

ELEMENT	STANDARD	SAT	UNSAT	Comment Number
 (*) Applicant calculates items 31 through 34 on attachment 1. 	Correctly calculates Q to feedwater.			
	31. 10.97 (10.91-11.03)			
	32. 401.5 (398-405)			
	33. 1190.7 (1190-1191.4)			
	34. 2537.9 (2532.9-2542.9)			
 (*) Applicant calculates items 35 through 36 on attachment 1. 	Correctly calculates Q to CRD flow.			
	35037 (.036038)			
	36. 12.2 (11.9-12.5)			
5. (*) Applicant calculates items 37 through 39 on attachment 1.	Correctly calculates Q to Cleanup system. 37157 (.155159) 38. 98.98 (96.98-100.98)			
	39. 4.55 (4.35-4.75)			
 (*) Applicant calculates items 41 on attachment 1. 	Correctly calculates QPUMP 41. 6.88 (6.68-7.08)			
7. (*) Applicant calculates items 42 through 43 on attachment 1.	Correctly determines core thermal power.			
	42. 2548.8 (2540-2557.6)			
	43. 100.5 (100.1-100.9)			
8. (*) Applicant compares the two methods and determines that they are within 5%. No further action required per attachment 2.	Applicant compares the two methods and determines that they are within 5%. No further action required per attachment 2.			

ELEMENT	STANDARD	SAT	UNSAT	Comment Number
9. (*) Applicant states that current reactor power is above license limit and would lower power to ensure below 100% License Limit, 2536 Mwth.	RAP-7.3.16 step 7.1.1 requires power to be lowered if the 12 minute average exceeds the Licensed Power Level.			
	Applicant may also state that would adjust APRM's per ST- 5d APRM Calibration.			
Task is complete.				
			-	

JPM Stop Time _____

	VERIFICATION OF CORE THERMAL HEAT BA	LANCE	Page 1 of 1
DAT	E/TIME://	-	
Α.	First stage pressure from EPIC 1299:	667.	+_psig
	[(0.1362 * 1 st stg pr) + 9.3] =	100.2	∠ % power
в.	Reactor power calculated from heat balance =		- 100.9)
c.	The two methods are within 5% of rated power of each other.	YES YES	
D.	If <u>Not</u> within 5%, investigation initiated.	🗌 YES	🗌 NO
Ε.	If GREATER THAN 5%, and unexplained, General Manager Plant Operations notified.	YES	ои 🗌
	Print Sign Formed By: <u>Applicant</u> Fills out		Date
		p	Date
	Eormed By: <u>Applicant</u> Fills out	Ţ	Date
	Eormed By: <u>Applicant</u> Fills out	p	Date
	Eormed By: <u>Applicant</u> Fills out	F	Date
	Eormed By: <u>Applicant</u> Fills out	P	Date
	Eormed By: <u>Applicant</u> Fills out Lewed By: <u>REACTOR ENGINEERING SUPERINTENDEN</u>	T	Date

EXAM KEY HEAT BALANCE CALCULATION SHEET Page 1 of 1

	PARAMETER	PANEL	INSTRUMEN	IT VALUE	UN
1.	Cleanup Inlet Temp	9-4	12TSS-142 POS 1	5/2	•F
2.	Cleanup Outlet Temp.	9-4	12TSS-142 POS 4	425	°F CPM
3.	Cleanup Flow A	9-4	12FI-126A	160	GPM
4.	Cleanup Flow B	9-4	12FI-126B RWR MG A GEN PWR	155	GPM
5.	Power to Recirc, Pump A	9-4		3.85	MW
6.	Power to Recirc. Pump B	9-4	RWR MG B GEN PWR	3.55	_MW MIb/h
7.	Total Core Flow	9-5	02-3DPR/FR-95	<u> </u>	
8.	Reactor Pressure (psig + 14.7)	9-5	06PR/FR-98 03FI-310	1057	_
9.	CRD Flow to Reactor RWR & RWCU Pump Seal Flows	3-0	Constant	<u>59</u>	GPM
9a 10.	CRD System Temp		Constant		°F
11.	Gross MW Electric	9-7	MAIN GEN MW	870	
+12.	Feedwater Flow Loop A	9-5	06FI-89A	5.44	
*13.	Feedwater Flow Loop B	9-5	06F1-89B	5,55	MLB/
14.	TFWA, use PTID 407/410 or	8-21	02TT-168A/C	423,61423.	
15.	TFWB, use PTID 408/411 or	9-21	02TT-168B/D	423.61423	CF
	11110/0001110 1001111 01		W CALCULATIONS		
*16.	Average TFWA (407 + 410)/2 or (168A			423.6	°F
•17.	Average TFWB (408+411)/2 or (1688	+168D)/2	· · · · · · · · · · · · · · · · · · ·	423,10	٩F
*18.	Delta T Loop A (DTA) = TFWA - 420			3.6	۴
*19.	Delta T Loop B (DTB) = TFWB - 420			3.6	۴F
•20.	$C.F. = 1.0 + (DTA^{+}I-3.8064E-4 + (D$	TA*-4.4310E-7]]}		0.99862	
*21.	C.F. = 1.0 + (DTB*1-3.8064E-4 + (D	TB*-4.4310E-711		0,99862	
*22.	Compensated Flow A		(#12 * #20)	5.43 (5.40-5.46)	MLB/
*23.	Compensated Flow B		(#13 * #21)	5.54 (5.51-5.57)	MLB/
	PARAMETER	171		USED VALUE	UN
24.	HS	#8,	ASME Table	1190,7 (1190-1191.	FBTU/L
25.		#8,		639,6(638-641,2)	BTU/
*26.	HFWA	#8, #16,	ASME Table	401.5 (398-405)	BTUA
	HFWB	#8, #17,	ASME Table	401.5(398.405)	BTU/
28.	HCUI	#8, #1,	ASME Table	502.0 (448-506)	BTU/
29.	HCUO	#8, #2,	ASME Table	403.0 (399-402)	810/
30.	HCR	#8, #10,	ASME Table	65.9 (61.9-69.9)	BIU/L
	PARAMETER	1400 . #	EQUATION (ITEM #"S		
		(#22 + #		10,97 (10,91-11.03)	WLD/
31.	Total Feedflow	114967 49	ウレール・ノ #ウフォ #クロ\\/#Q1	11-1-1	DT11/4
32.	Feedwater Enthalpy		2) + (#27*#23)]/#31	401.5 (398-405)	BTU/
32. 33.	Feedwater Enthelpy Steam Enthelpy	[#24 - [0.	000*#25)]	1190.2 (1190-1191.4	BTU/L
32. 33. 34.	Feedwater Enthalpy Steam Enthalpy Q to feedwater (QFW)	[#24 - (0.) [#31*(#3	000*#25)] 3 - #32)]/3.413	1199.7 (1190-1191.4	BTU/L
32. 33. 34. 35.	Feedwater Enthalpy Steam Enthalpy Q to feedwater (QFW) CRD flow (WCR)	[#24 - (0. 	000°#25)] 3 - #32)]/3.413 98E-3 + (#9a ° 0.498E-3)	1194.7 (1190-1191.9 2537.9 (2532.9-2542.1 1 - 037 (,036-,038)) BTU/L)MWt MLB/L
32. 33. 34. 35. 36.	Feedwater Enthalpy Steam Enthalpy Q to feedwater (QFW) CRD flow (WCR) Q to CRD flow (QCR)	[#24 - (0.) [#31*(#3 [[#9 * 0.4 [#35 * (#	000*#25)] 3 - #32))/3.413 98E-3 + (#9a * 0.498E-3) 33 - #30)]/3.413	1190.7 (1190-1191.9) 2537.9 (2532.9-2542.) 0.037 (1036-1038) 12.2 (11.9-12.5)	MWt MWt
32. 33. 34. 35. 36. 37.	Feedwater Enthalpy Steam Enthalpy Q to feedwater (QFW) CRD flow (WCR) Q to CRD flow (WCR) Total CU flow (WCU)	[#24 - [0.] [#31*(#3] [[#9 * 0.4 [#35 * (# (#3 + #4	000*#25)] 3 - #32))/3.413 98E-3 + (#9a * 0.498E-3) 33 - #30))/3.413) *(0.498E-3)	1190.7 (1190-1191.4) 2537.9 (2532.9-2542.1) 10.37 (1036-1038) 10.3 (11.9-12.5) 15.7 (1155-159)) BTU/)MWt MLB/ MWt MLB/
32. 33. 34. 35. 36. 37. 38.	Feedwater Enthalpy Steam Enthalpy Q to feedwater (QFW) CRD flow (WCR) Q to CRD flow (WCR) Q to CRD flow (QCR) Total CU flow (WCU) HCUI - HCUO	[#24 - (0.] [#31*(#33 [[#9 * 0.4]#35 * (# (#3 + #4 (#28 - #2)	000*#25)] 3 - #32))/3.413 198E-3 + (#9a * 0.498E-3) 33 - #30)]/3.413) *(0.498E-3) 9) 9 9 9 9	1190.7 (1190-1191.4 2537.9 (2532.9-2542.4 10.037 (2532.9-2542.4 10.2 (11.9-12.5) 10.2 (11.9-12.5) 157 (1155-159 .93 (96.98-100.98)	BTU/L MWt MLB/L MWt MLB/L BTU/L
32. 33. 34. 35. 36. 37. 38. 39.	Feedwater Enthalpy Steam Enthalpy Q to feedwater (QFW) CRD flow (WCR) Q to CRD flow (QCR) Total CU flow (WCU) HCUI - HCUO Q to Cleanup Sys	[#24 - [0.] [#31*(#3] [[#9 * 0.4 [#35 * (# (#3 + #4	000*#25)] 3 - #32))/3.413 198E-3 + (#9a * 0.498E-3) 33 - #30)]/3.413) *(0.498E-3) 9) 9 9 9 9	1194.7 (1190-1191.4 2537.9 (2532.9.2542.4 1.037 (.036038) 12.2 (11.9-12.5) 157 (.155159) .157 (.155159) .187 (4.98-100.98) 4.55 (4.35-4.75)	BTU/I MUB/I MWt MLB/I BTU/I MWt
32. 33. 34. 35. 36. 37. 38. 39. 40.	Feedwater Enthalpy Steam Enthalpy Q to feedwater (QFW) CRD flow (WCR) Q to CRD flow (QCR) Total CU flow (WCU) HCUI - HCUO Q to Cleanup Sys Vessel ambient loss	(#24 - [0.] [#31*(#3: [[#9 * 0.4 [#35 * [# (#3 + #4 (#28 - #2: [#38 * #3	000*#25)] 3 - #32))/3.413 98E-3] + (#9a * 0.498E-3) 33 - #30)]/3.413) *{0.498E-3} 9)	$\begin{array}{c} 1 & (94.7) \begin{pmatrix} 11.90 - 11.91.4 \\ 25.37.9 \\ (25.32.9 \\ 25.32.9 \\ (25$	BTU/I MWt MLB/I MWt BTU/I MWt MWt
32. 33. 34. 35. 36. 37. 38. 39.	Feedwater Enthalpy Steam Enthalpy Q to feedwater (QFW) CRD flow (WCR) Q to CRD flow (QCR) Total CU flow (WCU) HCUI - HCUO Q to Cleanup Sys	(#24 - [0.] [#31*(#3: [[#9 * 0.4 [#35 * [# (#3 + #4 (#28 - #2: [#38 * #3 (#5 + #6	000*#25)] 3 - #32)]/3.413 198E-3 + (#9a * 0.498E-3) 33 - #30)]/3.413 1 *{(0.498E-3) 9)	1194.7 (1190-1191.4 2537.9 (2532.9.2542.4 1.037 (.036038) 12.2 (11.9-12.5) 157 (.155159) .157 (.155159) .187 (4.98-100.98) 4.55 (4.35-4.75)	BTU/I MWt MLB/I MUB/I BTU/I MWt MWt

.

=

EXAM KEY

ATTACHMENT 1 Page <u>11</u> of <u>16</u>

HANDOUT PAGE

TASK CONDITIONS:

Current indicated reactor power is 100% on APRM's.

Plant data has been recorded for steps 1 through 15 of attachment 1.

Turbine first stage pressure is 667.4 psig and has been recorded on attachment 2.

INITIATING CUE:

Perform section 9.3, Core Thermal Heat Balance Verification, of RAP-7.3.03, CORE THERMAL POWER EVALUATION. EPIC computer points are not available. Items 14 and 15 were obtained from 02TT-168A/C and B/D on attachment 3.

Determine what action, if any, is required.

		VERIFICATION OF CORE THERMAL HEAT BA	LANCE P	age 1 of 1	
110 - A.	DATE	/TIME://			
•	Α.	First stage pressure from EPIC 1299:	667.4	_psig	
		[(0.1362 * 1 st stg pr) + 9.3] =		_% power	
• • • • •	в.	Reactor power calculated from heat balance =		_% power	
	c.	The two methods are within 5% of rated power of each other.	🗌 YES	no 🗌	
-	D.	If <u>Not</u> within 5%, investigation initiated.	🗌 YES	D NO	
	Ε.	If GREATER THAN 5%, and unexplained, General Manager Plant Operations notified.	YES	🗌 NO	•
		Print Sign		Date	
••	Perf	ormed By:			
	Revi	ewed By:			
		REACTOR ENGINEERING SUPERINTENDEN	r		
				,	
	• .				
	•				
	· · ·		· · · · · · · · · · · · · · · · · · ·		
	i National International Internationa International International Internationa International International Internationa International International International International International International International International Internat				.:
		- This <u>IS</u> a Quality Record -			······
	<u>, 11</u>	- a guarter record -			
		7.3.03 CORE THERMAL POWER EVALUATION No. 13		ACHMENT 2 12 of <u>16</u>	
			· · · ·		

SRO A

HEAT BALANCE CALCULATION SHEET

Page 1 of 1

I

ļ

DATE/TIME: PERFORMED BY: ____ PURPOSE: PANE INSTRUMENT VALUE UNITS PARAMETER ITEM PF 9-4 12TSS-142 POS 1 512 1. Cleanup Inlet Temp 9-4 12TSS-142 POS 4 425 만 Cleanup Outlet Temp. 2. 12FI-126A GPM 8-4 З. Cleanup Flow A 160 12FJ-126B 155 GPM 9-4 Cleanup Flow B 4 RWR MG A GEN PWR MW Б. Power to Recirc. Pump A 9-4 3.85 Power to Recirc. Pump B 9-4 RWR MG B GEN PWR 3.55 MW 6. 02-3DPR/FR-95 79 Mlb/hr 9-5 Total Core Flow 7 06PR/FR-98 PSIA 9-5 1057 Reactor Pressure (psig + 14.7) 8. GPM 03FI-310 9. **CRD** Flow to Reactor 9-5 59 15 GPM RWR & RWCU Pump Seal Flows Constant 9a 95 °F Constant CRD System Temp 10. 8 10 GMWE 5.44 MLB/HR 9-7 MAIN GEN MW 11. Gross MW Electric *12. Feedwater Flow Loop A 9-5 06FI-89A 5155 MLB/HR *13. Feedwater Flow Loop B 9-5 06FI-89B TFWA, use PTID 407/410 or 02TT-168A/C 423,61423.6F 9-21 14. TFWB, use PTID 408/411 or 02TT-168B/D 423. 61423.GF 15. 9-21 FEEDWATER FLOW CALCULATIONS Average TFWA (407 + 410)/2 or (168A + 168C)/2 ٩F *16. Average TFWB (408+411)/2 or (168B+168D)/2 ٩F •17. ٩F •18. Delta T Loop A (DTA) = TFWA - 420 ۴F •19. Delta T Loop B (DTB) = TFWB - 420 C.F. = 1.0 + {DTA*[-3.8064E-4 + (DTA*-4.4310E-7)]} *20. •21. C.F. = 1.0 + (DTB*[-3.8064E-4 + (DTB*-4.4310E-7)]) (#12 * #20) MLB/HR *22. Compensated Flow A (#13 * #21) MLB/HR *23. Compensated Flow B DATA USED VALUE UNITS PARAMETER ITEM #8, ASME Table BTU/LB 24. HS #8, ASME Table BTU/LB HFG 25. #8, #16, ASME Table BTU/LB •26, HFWA ASME Table #8, #17, BTU/LB •27. HFWB BTU/LB 28. HCUI #8, #1, ASME Table #8, #2, ASME Table BTU/LB 29. HCUO ASME Table BTU/LB #8, #10, 30. HCR VALUE PARAMETER EQUATION (ITEM #"S) UNITS MLB/HR (#22 + #23) 31. **Total Feedflow** [(#26*#22) + (#27*#23)]/#31 32. Feedwater Enthalpy BTU/LB [#24 - (0.000*#25)] BTU/LB Steam Enthalpy 33. Q to feedwater (QFW) [#31*(#33 - #32)]/3.413 MWt 34. [(#9 * 0.498E-3) + (#9a * 0.498E-3)] MLB/HR 35. CRD flow (WCR) [#35 * (#33 - #30)]/3.413 MW_t Q to CRD flow (QCR) 36. Total CU flow (WCU) (#3 + #4) *{0.498E-3) MLB/HR 37. HCUI - HCUO Q to Cleanup Sys (#28 - #29) BTU/LB 38. (#38 * #37)/3.413 MWt 39. 1.1 MWt 40 Vessel ambient loss (#5 + #6) * 0.93 41. OPUMP MWt (#34 + #36 + #39 + #40 - #41) **Core Thermal Power** MWt 42. 43 CTP/2536 (#42/2536) * 100 % * Not Applicable when Attachment 5 is used.

•	Contact Operations to de	termine if this is performed to	satisfy Tech. Specs:		С
·	* If Yes, Second Verifier		Date/Time:		_
• .	Reviewed By:	actor Engineering Superintendent	Date/Time:		-
		- This <u>IS</u> a Qu	ality Record -		
	RAP-7.3.03 Rev. No. <u>13</u>	CORE THERMAL PO	WER EVALUATION	ATTACHMENT : Page <u>11</u> of <u>16</u>	1

......

• .

۰.

. 2

7

, . .

1

2

NRC JAMES A. FITZPATRICK INITIAL EXAMINATION 5/2010 CONTAINS SENSITIVE INFORMATION -- NOT FOR PUBLIC DISCLOSURE

	JAMES A. FITZPATRICK	
	Job Performance Measure	
	Determine Required Event Followup	
	JPM Number: SRO A-1-2	
	Revision Number: 0	
	Date: <u>03/05/2010</u>	
Developed By:	P. Presby	<u>03/05/10</u>
	Author	Date
Validated By:	Facility Technical Representative	Date
		Duto
Review By:		
	Examiner	Date
Approved By:		
	Chief Examiner	Date

NRC JAMES A. FITZPATRICK INITIAL EXAMINATION CONTAINS SENSITIVE INFORMATION – NOT FOR PUBLIC DISCLOSURE

JOB PERFORMANCE MEASURE VALIDATION CHECKLIST

NOTE: All steps of this checklist should be performed upon initial validation. Prior to JPM usage, revalidate JPM using steps 8 through 11 below.

 1.	Task description and number, JPM description and number are identified.
 2.	Knowledge and Abilities (K/A) references are included.
 3.	Performance location specified. (in-plant, control room, or simulator)
 4.	Initial setup conditions are identified.
 5.	Initiating and terminating cues are properly identified.
 6.	Task standards identified and verified by Examiner review.
 7.	Critical steps meet the criteria for critical steps and are identified with an asterisk (*).
 8.	Verify the procedure referenced by this JPM matches the most current revision of that procedure: Procedure Rev Date
 9.	Pilot test the JPM: a. verify cues both verbal and visual are free of conflict, and b. ensure performance time is accurate.
 10	. If the JPM cannot be performed as written with proper responses, then revise the JPM.
 11	. When JPM is revalidated, Examiner sign and date JPM cover page.

Technical changes and modifications:

1. Not Applicable

NRC JAMES A. FITZPATRICK INITIAL EXAMINATION CONTAINS SENSITIVE INFORMATION -- NOT FOR PUBLIC DISCLOSURE

REVISION RECORD (Summary):

1. This JPM is the original revision 0.

JPM Setup Instructions:

Provide applicant with the following:

- JPM handout sheet
- Access to all plant procedures

TASK CONDITIONS:

The plant is operating normally at full power with no evolutions in progress when the following events occur.

At T = 0

• An electrician reports a large fire at Normal Station Service Transformer T-4. There are several wooden pallets laying against the transformer engulfed in flames. A large gas can is on the ground beside the pallets.

At T= 2 min

- Alarm 09-8-5-16, NSS XSFMR T-4 SUDDEN PRESS is received as the control room is dispatching the fire brigade,
- The reactor scrams automatically. All rods fully insert.
- EDG B and D have started and are carrying their buses.
- At T = 8 min
 - Breakers 10212 and 10412 CANNOT be closed to restore power to Buses 10200 and 10400, respectively.
 - An operator reports it appears someone has wedged steel rods into the front of the breaker housings, jamming the trip mechanisms for Breakers 10212 and 10412. Maintenance must be performed before these breakers can be closed.

At T = 13 min

- The fire brigade leader reports the fire is out, Transformer T-4 appears intact, NO oil is leaking from the transformer.
- The 10100, 10300 and 10500 buses are now powered from Reserve Station Transformer T-3.

NRC JAMES A. FITZPATRICK INITIAL EXAMINATION CONTAINS SENSITIVE INFORMATION – NOT FOR PUBLIC DISCLOSURE

INITIATING CUE:

You are an extra SRO on shift. The Shift Manager directs you to determine:

- 1) the operations procedures that must be entered to mitigate the event conditions
- 2) regarding off-site notification(s), what organization(s) or individual(s) must be notified and the required time limit(s) if applicable
- 3) The procedures which identify regulatory basis for any required notification(s) determined in Item #2 above

Information for Evaluator's Use:

UNSAT requires written comments on respective step.

* Denotes CRITICAL steps.

Number any comments in the "Comment Number" column. Then annotate that comment in the "Comments" section. The comment section should be used to document the reason that a step is marked as unsatisfactory and to document unsatisfactory performance relating to management expectations.

Some operations that are performed from outside of the control room may require multiple steps. These items may be listed as individual steps in this JPM. It is acceptable for the candidate to direct the local operator to perform groups of procedure steps instead of calling for each individual item to be performed.

The time clock starts when the candidate acknowledges the initiating cue.

NRC JAMES A. FITZPATRICK INITIAL EXAMINATION CONTAINS SENSITIVE INFORMATION -- NOT FOR PUBLIC DISCLOSURE

Revision Number: 0

JPM Title: Determine Required Event Followup

JPM Number: SRO A-1-2

K/A Number and Importance: K/A 2.1.20 IR: 4.6

Suggested Testing Environment: Classroom/Simulator

Actual Testing Environment:

Testing Method: Table-Top

Alternate Path: No

Time Critical: No

Estimated Time to Complete: 15 minutes Actual Time Used: _____ minutes

References: AP-03.04, Information Reporting Requirements, Rev 13 EOP-2, RPV Control, Rev 9 AOP-1, Reactor Scram, Rev 43 AOP-70, Security Threat, Rev AOP-17, Loss of 10400 Bus, Rev 17 IAP-2, Classification of Emergency Conditions, Rev 28 EAP-1.1, Offsite Notifications, Rev 64 IAP-1, Emergency Plan Implementation Checklist AP-12.11, Notifications and Response to Operational Concerns EAP-3; Fire

EVALUATION SUMMARY:

1. Were all the Critical Elements performed satisfactorily?	🗆 Yes	🗆 No
2. Was the task standard met?		

The operator's performance was	evaluated against th	ne standards contained in this JPN	M, and has been
determined to be:	Satisfactory	Unsatisfactory	

Comments:

NRC JAMES A. FITZPATRICK INITIAL EXAMINATION CONTAINS SENSITIVE INFORMATION – NOT FOR PUBLIC DISCLOSURE

Note: Any grade of UNSAT requires a comment.

Evaluator's Name:	(Print)

Evaluator	s Signature:	_	
	-		

NOTE: Critical Element(s) indicated by * in Performance Checklist.

PERFORMANCE CHECKLIST:

Date: ____

JPM Start Time _____

	ELEMENT	STANDARD	SAT	UNSAT	Comment Number
1.	(*) The applicant determines the operations procedures that must be entered to mitigate the event conditions.	 Applicant identifies each of the following procedures: EOP-2 (low RPV level, normal for a scram) AOP-1 (for the scram) AOP-17 (for the scram) AOP-70 (for the security event / tampering) Note: Applicant may also identify other procedures that provide administrative guidance. Their identification is not critical to the JPM. However, any additional identified procedures must be appropriate to the plant conditions. Examples include: Emergency Plan (IAP-2, EAP-1.1, EAP-3) OP system procedures for electrical bus re-alignment 			

NRC JAMES A. FITZPATRICK INITIAL EXAMINATION CONTAINS SENSITIVE INFORMATION – NOT FOR PUBLIC DISCLOSURE

	ELEMENT	STANDARD	SAT	UNSAT	Comment Number
	nt determines NRC n requirement per AP-	Applicant identifies NRC prompt notification required within 1 hour by ENS phone per AP-03.04 Attachment 2, Item 138, based on 50.72(a)(3) after declaration of an Emergency Class (Alert under IAP-2, Category 8.1.4.)			
	nt determines E-Plan ut required.	Applicant identifies E-Plan ERO callout required.			
	nt determines off-site tification requirements lan.	Applicant identifies personnel / agencies that must be contacted 1) under EAP-1.1 Offsite Notifications:			
		 New York State Oswego County Nine Mile Point Unit #1 Nine Mile Point Unit #2 NRC Operations Center NRC Resident Inspector Security Call-outs 			
		within 15 minutes of making EAL declaration.			
		 under IAP-1, Emergency Plan Implementation Checklist Item B: 			
		NRC via ENS phone			
		within 15 minutes of recognition of security- based emergency.			
Task is compl	ete.				
	_				

JPM Stop Time _____

NRC JAMES A. FITZPATRICK INITIAL EXAMINATION CONTAINS SENSITIVE INFORMATION -- NOT FOR PUBLIC DISCLOSURE

HANDOUT PAGE

TASK CONDITIONS:

The plant is operating normally at full power with no evolutions in progress when the following events occur.

At T = 0

 An electrician reports a large fire at Normal Station Service Transformer T-4. There are several wooden pallets laying against the transformer engulfed in flames. A large gas can is on the ground beside the pallets.

At T= 2 min

- Alarm 09-8-5-16, NSS XSFMR T-4 SUDDEN PRESS is received as the control room is dispatching the fire brigade,
- The reactor scrams automatically. All rods fully insert.
- EDG B and D have started and are carrying their buses.

At T = 8 min

- Breakers 10212 and 10412 CANNOT be closed to restore power to Buses 10200 and 10400, respectively.
- An operator reports it appears someone has wedged steel rods into the front of the breaker housings, jamming the trip mechanisms for Breakers 10212 and 10412. Maintenance must be performed before these breakers can be closed.

At T = 13 min

- The fire brigade leader reports the fire is out, Transformer T-4 appears intact, NO oil is leaking from the transformer.
- The 10100, 10300 and 10500 buses are now powered from Reserve Station Transformer T-3.

INITIATING CUE:

You are an extra SRO on shift. The Shift Manager directs you to determine:

- 1) the operations procedures that must be entered to mitigate the event conditions
- 2) regarding off-site notification(s), what organization(s) or individual(s) must be notified and the required time limit(s) if applicable
- 3) the procedural or regulatory basis for any required notification(s) determined in Item #2 above

JAMES A. FITZPATRICK					
Job Performance Measure					
Use Station Draw	ing to Predict Impact of Component Fai Technical Specification Implications	ilure and Evaluate			
	JPM Number: SRO A-2				
	Revision Number: 0				
	Date: <u>03/10/2010</u>				
Developed By:	P. Presby	<u>03/10/10</u>			
	Author	Date			
Validated By:	Facility Technical Representative	Date			
		Dale			
Review By:					
	Examiner	Date			
Approved By:					
	Chief Examiner	 Date			

JOB PERFORMANCE MEASURE VALIDATION CHECKLIST

<u>NOTE:</u>	•	os of this checklist should be performed upon initial validation. Prior to JPM usage, ate JPM using steps 8 through 11 below.
	1.	Task description and number, JPM description and number are identified.
•	2.	Knowledge and Abilities (K/A) references are included.
	3.	Performance location specified. (in-plant, control room, or simulator)
	4.	Initial setup conditions are identified.
	5.	Initiating and terminating cues are properly identified.
	6.	Task standards identified and verified by Examiner review.
	7.	Critical steps meet the criteria for critical steps and are identified with an asterisk (*).
	8.	Verify the procedure referenced by this JPM matches the most current revision of that procedure: Procedure Rev Date
	9.	Pilot test the JPM: a. verify cues both verbal and visual are free of conflict, and b. ensure performance time is accurate.
	10	 If the JPM cannot be performed as written with proper responses, then revise the JPM.
	11	. When JPM is revalidated, Examiner sign and date JPM cover page.

Technical changes and modifications: 1. Not Applicable

REVISION RECORD (Summary):

1. This JPM is the original revision 0.

JPM Setup Instructions:

- 1. Stage the following references for the applicant's use:
 - HPCI System Elementary Diagrams Sheets 1 thru 9 (File Numbers 1.61-140 thru 1.61-148, also referenced as Vendor Dwgs 791E471 Sh1 thru 9)
 - Fitzpatrick Station Technical Specifications
 - Entergy Nuclear Management Manual EN-OP Series Procedures
 - Plant Piping Drawings (to include the HPCI system drawings)

TASK STANDARD:

- 1. Determine broken lead causes Relay 23-K51 to initiate 1 of 2 required signals to automatically open HPCI Torus Suction Isolation Valves 23MOV-57 and 23MOV-58.
- 2. Determine HPCI Torus Suction Isolation Valves 23-57 and 23-58 will not automatically re-position on the failure.
- 3. Determine system remains functional as valves will reposition upon valid CST low level signal (low level initiation is one out of two, taken twice, with one signal effectively actuated).
- 4. Determine HPCI remains OPERABLE, based on TS 3.3.5.1 Action D completion time and bases discussion. (TS Table 3.3.5.1-1, Item 3.d.)
- 5. Identify required Tech Spec actions as follows:
 - Per 3.3.5.1 Action D, place affected low level channels in trip OR align HPCI pump suction to the suppression pool within 24 hours

TASK CONDITIONS:

You are the CRS

The plant is operating in a normal alignment at stable 75% power conditions.

Electricians have reported a broken (disconnected) power supply lead to HPCI Relay 23-K51 at Terminal Point 9-39/CC-14.

NO other damage is apparent.

INITIATING CUE:

You are directed to:

- determine how this failure impacts HPCI components
- determine if the HPCI system is functional
- determine if the HPCI system is operable
- identify required Tech Spec actions, if any

Information for Evaluator's Use:

UNSAT requires written comments on respective step.

* Denotes CRITICAL steps.

Number any comments in the "Comment Number" column. Then annotate that comment in the "Comments" section. The comment section should be used to document the reason that a step is marked as unsatisfactory and to document unsatisfactory performance relating to management expectations.

Some operations that are performed from outside of the control room may require multiple steps. These items may be listed as individual steps in this JPM. It is acceptable for the candidate to direct the local operator to perform groups of procedure steps instead of calling for each individual item to be performed.

The time clock starts when the candidate acknowledges the initiating cue.

Operator's	Name:		
Job Title:	SRO		
JPM Title:	Use Station Drawing Specification Implication		nt Failure and Evaluate Technical
JPM Numb	ber: SRO A-2	Revision Number:	0
K/A Numbo	er and Importance:	K/A 2.2.41, Ability to obtain an mechanical drawings. (3.5, 3.9	d interpret station electrical and)
Suggested	l Testing Environme	nt: Classroom/Simulator	
Actual Tes	ting Environment:		
Testing Me	ethod: Table-Top		
Alternate F	Path: No		
Time Critic	al: No		
Estimated	Time to Complete: 2	27 minutes Actual Time Used	I:minutes
148 • Fitz • En	CI System Elementar 8, also referenced as zpatrick Station Techr tergy Nuclear Manage	ry Diagrams Sheets 1 thru 8 (File Vendor Dwgs 791E471 Sh1 thru nical Specifications ement Manual EN-OP-104Rev.4 ings; FM-25A, Rev.71 and FM-2	u 9) ., Operability Determinations
1. Were all	ON SUMMARY: the Critical Elements task standard met?	performed satisfactorily? \Box Y	′es □ No
determined t	to be:	aluated against the standards cont Satisfactory	actory
Note: Any	grade of UNSAT requ	ires a comment.	
Evaluator's	s Name:	(Print))
Evaluator's	s Signature:		Date:

NOTE: Critical Element(s) indicated by * in Performance Checklist.

PERFORMANCE CHECKLIST:

JPM Start Time _____

	ELEMENT	STANDARD	SAT	UNSAT	Comment Number
1.	Applicants review the handout sheet and ask any questions	Applicants review initial conditions and initiating cues.			
	regarding the initial conditions or initiating cues.	Examiner Cue: Hand the applicant HPCI Elementary Drawings (9 drawings, see references) and the cue handout sheet.			
*2.	Review HPCI System Elementary Drawings. Determine how this failure impacts HPCI components.	Applicant determines 23-K51, normally energized, is de- energized by the failure, resulting in one of the two required signals to auto open HPCI suppression pool suction valves 23MOV-57 and 23MOV-58. Applicant identifies valves do not auto open on the failure but would open if low CST level sensed on other CST via channels (LS 23-74A or LS 23-75A)			
		Examiner Note: • Sht 3 (H-9) • Sht 1 (A-2/3, K-6) • Sht 8 (H-5, H-6)			
*3.	Determine system functionality.	Applicant determines system remains functional as valves will reposition upon valid CST low level signal from the other CST (low level initiation is one out of two, taken twice, with one signal effectively actuated). A low level in CST 'A' will still perform the auto suction swap function. Valves can still be operated manually.			

	ELEMENT	STANDARD	SAT	UNSAT	Comment Number
*4.	Determine system operability.	Applicant determines HPCI remains operable.			
		Examiner Note: TS 3.3.5.1 Action D directs system INOPERABILITY declaration. However, the completion time is "from discovery of <u>loss of</u> <u>HPCI initiation capability</u> , which indicates the inoperability call is <u>only</u> required for failures that result in loss of ability to auto swap. The TS bases explain "For Required Action D.1, the Completion Time only begins upon discovery that the HPCI System cannot be automatically aligned to the suppression pool due to two inoperable, untripped channels in the same Function."			
*5.	Determine required Tech Spec actions.	Applicant identifies required Tech Spec actions as follows:			
		 TS 3.3.5.1 Action D.2.1, place affected low level channels in trip OR TS 3.3.5.1 Action D.2.2, align HPCI pump suction to the suppression pool within 24 hours 			
		Examiner Note: See note in preceding JPM step. Critical that applicant identifies 3.3.5.1 Actions D.2.1 or D.2.2 and no other actions.			

HANDOUT PAGE

TASK CONDITIONS:

You are the CRS

The plant is operating in a normal alignment at stable 75% power conditions.

Electricians have reported a broken (disconnected) power supply lead to HPCI Relay 23-K51 at Terminal Point 9-39/CC-14.

NO other damage is apparent.

INITIATING CUE:

You are directed to:

- determine how this failure impacts HPCI components
- determine if the HPCI system is functional
- determine if the HPCI system is operable
- identify required Tech Spec actions, if any

NRC J	NRC JAMES A. FITZPATRICK INITIAL EXAMINATION				
	Job Performance Measure				
	Determine Radiation Controls				
	JPM Number: SRO A-3				
	Revision Number: 1				
	Date: <u>03/30/2010</u>				
Developed By:	Bernard Litkett	<u>03/30/2010</u> Date			
Validated By:	Facility Representative	Date			
Review By:	Examiner	Date			
Approved By:	Chief Examiner	Date			

SRO ADMIN JPM A-3

JOB PERFORMANCE MEASURE VALIDATION CHECKLIST

NOTE: All steps of this checklist should be performed upon initial validation. Prior to JPM usage, revalidate JPM using steps 8 through 11 below.

 Task description and number, JPM description and number are identified.
 2. Knowledge and Abilities (K/A) references are included.
 Performance location specified. (in-plant, control room, or simulator)
 Initial setup conditions are identified.
 5. Initiating and terminating cues are properly identified.
 6. Task standards identified and verified by Examiner review.
 Critical steps meet the criteria for critical steps and are identified with an asterisk (*).
 Verify the procedure referenced by this JPM matches the most current revision of that procedure: Procedure Rev Date
 Pilot test the JPM: a. verify cues both verbal and visual are free of conflict, and b. ensure performance time is accurate.
 If the JPM cannot be performed as written with proper responses, then revise the JPM.
 When JPM is revalidated, Examiner sign and date JPM cover page.

Review Questions and Comments:

SRO ADMIN JPM A-3

REVISION RECORD (Summary):

1. New JPM.

JPM Setup Instructions:

Ensure the following documents are available in the exam area:

- EN-RP-201, Rev.3, Dosimetry Administration
- EN-RP-202, Rev.7, Personnel Monitoring
- EAP-15, Rev. 11 Emergency Radiation Exposure Criteria and control. Copies of attachment 4; Emergency Exposure authorization form.

Instructions for explaining how to administer;

- 1. Provide page 1 of handout sheet to applicant.
- 2. If/when applicant returns handout with explanation that needs to authorize an emergency radiation exposure then, provide page 2 of handout sheet to applicant.

TASK STANDARD:

Determine which 2 workers must have Emergency exposure controls put in place due to anticipated dose during response to emergency conditions.

SRO ADMIN JPM A-3

TASK CONDITIONS:

- 1. The plant is at 15% power.
- 2. A Site Area Emergency has been declared due to a steam line rupture with significant fuel damage.
- 3. Entry is required into the MSIV Room to close the outboard MSIVs to prevent event escalation.
- 4. Job conditions are as follows:
 - Two individuals are required to complete the job.
 - Each worker is expected to receive 500 mR in transit to the Main Steam line access door AND the same amount again while exiting the plant.
 - Each worker is expected to spend 2 minutes in an 800 mR/hr field in transit from the Main Steam line access door to the job site <u>AND</u> the same amount again while exiting the plant.
 - The job site is against the outer Containment Wall in a 2 R/hr field.
 - The job will take 1.5 hours at the job site with both workers working the full time.

Technician	Sex	Age	SSN	Marital Status	Dept	Volunteer	TLD	Pregnant
1. John Tech	M	45	123-45-6789	Married	Maint	No	145678	N/A
2. Henry Work	M	33	987-65-4321	Single	Ops	Yes	235699	N/A
3. Jane Riley	F	35	345-54-2456	Married	Ops	Yes	875231	No
4. Bill Smith	M	40	587-14-8741	Single	Maint	Yes	632587	N/A
5. Mike Long	M	47	512-57-2358	Married	Ops	Yes	421489	N/A

5. Five workers are preparing to be briefed to complete the task.

- 6. None of the individuals has ever received an emergency exposure.
- 7. During an initial entry under a modified RWP the workers received the following dose:
 - Technician 1 received 600 mR on his Electronic Dosimeter from his first entry, resulting in a total exposure of 1399 mR for the year.
 - Technician 2 received 600 mR on his Electronic Dosimeter from his first entry, resulting in a total exposure of 1399 mR for the year.
 - Technician 3 did not enter the area, has 1000 mR total exposure for the year.
 - Technician 4 received 900 mR on his Electronic Dosimeter from his first entry, resulting in a total exposure of 1678 mR for the year.
 - Technician 5 received 900 mR on his Electronic Dosimeter from his first entry, resulting in a total exposure of 1678 mR for the year.
- 8. The TSC has not been staffed yet.
- 9. Emergency exposure controls have not been implemented.

INITIATING CUE:

- 1. Anticipate dose to be accumulated by each worker.
- 2. Select two (2) workers to complete the task.
- 3. Authorize work using the appropriate exposure limits to allow completion of the required task.

SRO ADMIN JPM A-3

Information For Evaluator's Use:

UNSAT requires written comments on respective step.

* Denotes CRITICAL steps.

Number any comments in the "Comment Number" column. Then annotate that comment in the "Comments" section. The comment section should be used to document the reason that a step is marked as unsatisfactory and to document unsatisfactory performance relating to management expectations.

Some operations that are performed from outside of the control room may require multiple steps. These items may be listed as individual steps in this JPM. It is acceptable for the candidate to direct the local operator to perform groups of procedure steps instead of calling for each individual item to be performed.

The time clock starts when the candidate acknowledges the initiating cue.

SRO ADMIN JPM A-3

Operator's	Name:				
Job Title:		🗆 RO	🛛 SRO	□ STA	□ SRO Cert
JPM Title:	Perform E	D Functions			
JPM Numbe	r: SRO A-3	8 Revision Nu	ı mber: 0		
K/A Number K/A Generic	•	ance:			
Suggested 1	Festing Envi	ironment: Cla	assroom		
Actual Testi	ng Environr	nent: Cla	assroom		
Testing Me	thod: Simu	late			
Alternate Pa	ith: No				
Time Critica	I: No				
Estimated T	ime to Com	plete: 30 min	utes Actual	Time Used:	minutes
 2. EN-RP-2 3. EAP-15, EVALUATION 	01, Rev.3, D 02, Rev.7, P Rev. 11, Em DN SUMMA ne Critical Ele	ARY: ements perform			
The operator determined to	•		ted against the s sfactory	standards cont Unsatis	tained in this JPM, and has beer factory
Comments:					
Note: Any g	grade of UN	SAT requires	a comment.		
Evaluator's	Name:			(Print	:)
Evaluator's	Signature	:			Date:
SRO ADMII	V JPM A-3.0	doc			6

SRO ADMIN JPM A-3

Description:

This JPM is used to test generic knowledge in calculation of overall dose and control mechanisms to allow the selection of individuals to continue or perform work in high dose areas. This JPM tests basic mathematics and understanding of stay times and the authorization of emergency radiation exposure.

This is a new JPM.

SRO ADMIN JPM A-3

NOTE: Critical Element(s) indicated by * in Performance Checklist.

PERFORMANCE CHECKLIST:

JPM Start Time

		ELEMENT	STANDARD	SAT	UNSAT	Comment Number
E. of	xamir	IER NOTE: ner to provide page 1 out sheet to nt.	EXAMINER NOTE: Examiner to provide page 1 of handout sheet to applicant.			
1.		rmine dose to be received ach worker	N/A			
*2	. For e	ach worker, the applicant:				
_	2.a	Determine anticipated dose from task performance in the work area.	Dose * Time = Task Rate Dose 2000 mR/hr * 1.5 hr = 3000 mR			
	2.b	Determine anticipated dose from transit to and from the Main Steam chase	Dose+ Dose= TravelToFromDoseLocationLocation500mR+ 500 mR= 1000 mR			
	2.c	Determine anticipated dose from transit to the work area in the steam chase.	Dose * Time = Transit Rate Dose 800 mR/hr * (2 min/60) = 26 mR			
	2.d	Determine anticipated dose from transit from the work area in the steam chase.	Dose * Time = Task Rate Dose 800 mR/hr * (2 min/60) = 26 mR			
	*2.e	Determine the total dose for each worker from @a through 2d.	Task + Travel + Transit = TotalDoseDoseDoseDose3000 + 1000 + (26*2)= 4052 mR			
	perfor	mine that task mance is not allowable ormal controls.	* The applicant determines that total dose is greater than the annual 4500 mR administrative limit for radiation exposure per EN-RP-201 and the 5000 mR federal limit			

SRO ADMIN JPM A-3

ELEMENT	STANDARD	SAT	UNSAT	Comment Number
*4. Determines that emergency exposure controls are required per EAP-15.	*The applicant evaluates the total expected dose and recognizes that emergency exposure controls are required to raise the limit above 5 R for each individual per EAP-15			
EXAMINER NOTE: Examiner should only provide EAP-15 and handout sheet page 2 if the applicant determines emergency radiation exposure authorization is required.	EXAMINER NOTE: Examiner should only provide EAP-15 and handout sheet page 2 if the applicant determines emergency radiation exposure authorization is required.			

SRO ADMIN JPM A-3

ELEMENT	STANDARD	SAT	UNSAT	Comment Number
*4.a Implements EAP-15; step 4.2.1	The applicant Implements EAP- 15;step 4.2.1 Selects a TEDE Limit of up to 10 Rem from dose limit			
4.3 Selects personnel for Task per Step 4.3	 The applicant using currently identified workers verifies workers: Personnel selected have volunteered are not declared pregnant workers Volunteers should be more than 45 years of age, if possible. have not received a previous emergency exposure have not received a planned special exposure Recognizes no initial condition specifies one of these abnormal conditions			
* 5. Applicant does not complete Attachment 4 for Technician 1 to authorize the emergency exposure.	Applicant does NOT complete Attachment 4 for Technician 1 to authorize the emergency exposure. John Tech did not volunteer			
* 6. Applicant does not complete Attachment 4 for Technician 2 to authorize the emergency exposure.	Applicant does NOT complete Attachment 4 for Technician 2 to authorize the emergency exposure. Henry Work is the youngest of the five technicians.			
* 7. Applicant does not complete Attachment 4 for Technician 3 to authorize the emergency exposure.	Applicant does NOT complete Attachment 4 for Technician 3 to authorize the emergency exposure. Jane Riley is the second youngest of the five technicians.			
*8. Completes Attachment 4 for Technician 4 to authorize the emergency exposure based on he has volunteered for the emergency exposure and his age. Although he is only 40 years, procedure EAP-15 step 4.3.4 states, volunteers should be more than 45 years of age, if possible.	 * Completes Attachment 4 Section A for Technician 4, Bill Smith per the attached mark-up of attachment 4. Note: The Employer / JAF Dept block is NOT a Critical component of this Step. 			

SRO ADMIN JPM A-3

ELEMENT	STANDARD	SAT	UNSAT	Comment Number
*9. Completes Attachment 4 for Technician 5 to authorize the emergency exposure based on his age and that he has volunteered for the emergency exposure.	 * Completes Attachment 4 Section A for Technician 5, Mike Long per the attached mark-up of attachment 4. Note: The Employer / JAF Dept block is NOT a Critical 			
(<u>Examiner Cue:</u> "You may stop	component of this Step.			
here, you have met the termination criteria for this JPM")				

JPM Stop Time _____

SRO ADMIN JPM A-3

	ATTACHMENT 4	Page :
	CY EXPOSURE AUTHORIZAT	IUN FORM
SECTION A		
Name of Individual to 1 Exposure: Bill Smith		
SSN: 587-14-8	<u>-41 · · · · · · · · · · · · · · · · · · ·</u>	
TLD Badge No: 4325	\$87	• ,
Employer/JAF Department	E: ENtergy - Mainten	ance
Date of Authorization:		. · · »
Authorized Exposure Lin	mit: 10 Rem	
Emergency	Signature	-
	(Signature)	
Date: Today's Da	te,	
<u>SECTION B</u> I have volunteered to preceive the emergency of		
potential biological co exposure.		
Individual to Receive Exposure:	Smith .	
(1	Signature)	
J 1		
Date: Tuday's Dat	e	
Date: <u>Today's Dat</u> Individual Conducting H	C Briefing:	ч.
	<u>C</u> Briefing: (Signature)	4,
		9.
Individual Conducting H		1
Individual Conducting H	(\$ignature)	<u>xxxxxxxxxxxxxxxxxxxxxxxxxxxxxxxxxxxxx</u>

AND CONTROL

SRO ADMIN JPM A-3

+	INSWER KEY ATTACHMENT 4	Page 1 of 3
	EMERGENCY EXPOSURE AUTHORIZATION FORM	ſ
	SECTION A	-
	Name of Individual to Receive Exposure: <u>Mike Long</u>	
	SSN: 5/2-57-2358	
	TLD Badge No: 421489	•
	Employer/JAF Department: ENtergy - Operations	· · · · · · · · · · · · · · · · · · ·
	Date of Authorization: <u>Juday's Date</u>	
	Authorized Exposure Limit: 10 Rem	·
	Emergency	4
	Director: Your Signature	
	(Signature)	
	Date: <u>Tuday's bate</u>	and and a second se
		•
	<u>xxxxxxxxxxxxxxxxxxxxxxxxxxxxxxxxxxxxx</u>	xxxxxxxxxx
	SECTION B I have volunteered to perform the task(s) during whi receive the emergency exposure and I have been brief potential biological consequences of the proposed em	ch I will ed on the
	SECTION B I have volunteered to perform the task(s) during whi receive the emergency exposure and I have been brief potential biological consequences of the proposed em exposure.	ch I will ed on the
	SECTION B I have volunteered to perform the task(s) during which receive the emergency exposure and I have been brief potential biological consequences of the proposed em- exposure. Individual to Receive Exposure:	ch I will ed on the
	SECTION B I have volunteered to perform the task(s) during which receive the emergency exposure and I have been brief potential biological consequences of the proposed em- exposure. Individual to Receive Exposure: (Signature)	ch I will ed on the
	<u>SECTION B</u> I have volunteered to perform the task(s) during whit receive the emergency exposure and I have been brief potential biological consequences of the proposed em- exposure. Individual to Receive Exposure: <u>Mult Long</u> (Signature) Datc: <u>Today's Dafe</u>	ch I will ed on the
	SECTION B I have volunteered to perform the task(s) during which receive the emergency exposure and I have been brief potential biological consequences of the proposed em- exposure. Individual to Receive Exposure: (Signature)	ch I will ed on the
	<u>SECTION B</u> I have volunteered to perform the task(s) during whit receive the emergency exposure and I have been brief potential biological consequences of the proposed em- exposure. Individual to Receive Exposure: <u>Mult Long</u> (Signature) Datc: <u>Today's Dafe</u>	ch I will ed on the
	<u>SECTION B</u> I have volunteered to perform the task(s) during which receive the emergency exposure and I have been brief potential biological consequences of the proposed em- exposure. Individual to Receive Exposure: (Signature) Date: <u>Today's Dafe</u> Individual Conducting Briefing:	ch I will ed on the
	SECTION B I have volunteered to perform the task(s) during which receive the emergency exposure and I have been brief potential biological consequences of the proposed em- exposure. Individual to Receive Mile Long (Signature) Date: <u>Today's Dafe</u> Individual Conducting Briefing: (Signature)	ch I will ed on the
	SECTION B I have volunteered to perform the task(s) during which receive the emergency exposure and I have been brief potential biological consequences of the proposed em- exposure. Individual to Receive Mile Long (Signature) Date: <u>Today's Dafe</u> Individual Conducting Briefing: (Signature)	ch I will ed on the ergency
	SECTION B I have volunteered to perform the task(s) during whitreceive the emergency exposure and I have been briefly potential biological consequences of the proposed emexposure. Individual to Receive Mile Long	ch I will ed on the ergency

SRO ADMIN JPM A-3

HANDOUT PAGE 2

TASK CONDITIONS:

1. Five workers are preparing to be briefed to complete the task:

Technician	Sex	Age	SSN	Marital Status	Dept	Volunteer	TLD	Pregnant
1. John Tech	M	45	123-45-6789	Married	Maint	No	145678	N/A
2. Henry Work	M	33	987-65-4321	Single	Ops	Yes	235699	N/A
3. Jane Riley	F	35	345-54-2456	Married	Ops	Yes	875231	No
4. Bill Smith	M	40	587-14-8741	Single	Maint	Yes	632587	N/A
5. Mike Long	M	47	512-57-2358	Married	Ops	Yes	421489	N/A

2. None of the individuals has ever received an emergency exposure.

SRO ADMIN JPM A-3

HANDOUT PAGE 1

TASK CONDITIONS:

- 1. The plant is at 15% power.
- 2. A Site Area Emergency has been declared due to a steam line rupture with significant fuel damage.
- 3. Entry is required into the MSIV Room to close the outboard MSIVs to prevent event escalation.
- 4. Job conditions are as follows:
 - Two individuals are required to complete the job.
 - Each worker is expected to receive 500 mR in transit to the Main Steam line access door <u>AND</u> the same amount again while exiting the plant.
 - Each worker is expected to spend 2 minutes in an 800 mR/hr field in transit from the Main Steam line access door to the job site <u>AND</u> the same amount again while exiting the plant.
 - The job site is against the outer Containment Wall in a 2 R/hr field.
 - The job will take 1.5 hours at the job site with both workers working the full time.
- 5. Five workers are preparing to be briefed to complete the task.
- 6. During an initial entry under a modified RWP the workers received the following dose:
 - Technician 1 received 600 mR on his Electronic Dosimeter from his first entry, resulting in a total exposure of 1399 mR for the year.
 - Technician 2 received 600 mR on his Electronic Dosimeter from his first entry, resulting in a total exposure of 1399 mR for the year.
 - Technician 3 did not enter the area, has 1000 mR total exposure for the year.
 - Technician 4 received 900 mR on his Electronic Dosimeter from his first entry, resulting in a total exposure of 1678 mR for the year.
 - Technician 5 received 900 mR on his Electronic Dosimeter from his first entry, resulting in a total exposure of 1678 mR for the year.
- 7. The TSC has not been staffed yet.
- 8. Emergency exposure controls have not been implemented.

INITIATING CUE:

- 1. Anticipate dose to be accumulated by each worker.
- 2. Select two (2) workers to complete the task.
- 3. Authorize work using the appropriate exposure limits to allow completion of the required task.

	JAMES A. FITZPATRICK			
	Job Performance Measure			
Determine Protective Action Recommendations and Complete Event Notification Form				
	JPM Number: SRO A-4			
	Revision Number: 1			
	Date: <u>03/29/2010</u>			
Developed By:	P. Presby	<u>03/29/10</u>		
	Author	Date		
Validated By:				
	Facility Technical Representative	Date		
Review By:				
	Examiner	Date		
Approved By:				
	Chief Examiner	Date		

JOB PERFORMANCE MEASURE VALIDATION CHECKLIST

NOTE: All steps of this checklist should be performed upon initial validation. Prior to JPM usage, revalidate JPM using steps 8 through 11 below.

 Task description and number, JPM description and number are identified.
 2. Knowledge and Abilities (K/A) references are included.
 Performance location specified. (in-plant, control room, or simulator)
 4. Initial setup conditions are identified.
 5. Initiating and terminating cues are properly identified.
 6. Task standards identified and verified by Examiner review.
 Critical steps meet the criteria for critical steps and are identified with an asterisk (*).
 Verify the procedure referenced by this JPM matches the most current revision of that procedure: Procedure Rev Date
 Pilot test the JPM: a. verify cues both verbal and visual are free of conflict, and b. ensure performance time is accurate.
 If the JPM cannot be performed as written with proper responses, then revise the JPM.
 When JPM is revalidated, Examiner sign and date JPM cover page.

Technical changes and modifications:

1. Not Applicable

REVISION RECORD (Summary):

1. This JPM is the original revision 0.

JPM Setup Instructions:

- 1. Hand out the following materials:
 - Calculator
 - Blank EAP-1.1 Attachment 1 Notification Form
 - Legible EAL Flowchart
 - Legible EAP-4 Attachment 1 Flowchart
- 2. Handout copies of following procedures:
 - EAP-4.1, Release Rate Determination, Rev 19
 - EAP-42, Obtaining Meteorological Data, Rev 23
 - IAP-2, Classification of Emergency Conditions, Rev 28
 - IAP-1, Emergency Plan Implementation Checklist, Rev 39
 - EAP-1.1, Offsite Notifications, Rev 64
 - EAP-4, Dose Assessment Calculations, Rev 39

TASK STANDARD:

1. Complete the upgrade offsite notification message form, including correct PARs.

TASK CONDITIONS:

At 0342 today (May 12, 2010), an earthquake with a magnitude of 0.08g caused a loss of offsite power.

Plant conditions:

- At 0342, a large break LOCA occurred.
- The reactor automatically scrammed.
- Multiple failures in safety systems caused the operators to conduct an emergency depressurization.
- RPV level dropped to minus (-) 9".
- Drywell pressure peaked at 55 psig.
- Secondary containment radiation levels increased to >EOP-5 Maximum Normal values in the Reactor Building 344 foot elevation.
- At 0352, a Site Area Emergency was declared with a release in progress based on an unisolable MSL break outside primary containment.
- At 0401, the initial offsite notification message was transmitted.
- ERO is staffing the emergency response facilities. Neither the TSC nor the EOF has been fully activated (the earthquake caused damage to local roads).
- Emergency and Plant Information Computer (EPIC) System is NOT available.
- Emergency Dose Assessment Modeling System (EDAMS) is **NOT** available.

At 0412, (when you start the JPM) the following plant conditions exist:

- Drywell pressure has dropped rapidly to 3 psig.
- RPV level = minus (-) 9", going up slowly.
- You are the Emergency Director until relieved and have just declared an EAL upgrade to General Emergency at Time 0412.
- EAL upgrade based on radioactivity release as indicated on effluent radiation monitors, exceeding EAL threshold for >15 minutes.
- NO other General Emergency EAL thresholds have been reached.
- Stack high range effluent radiation monitor = 11,700 mr/hr.
- Stack flow rate = 12,000 cfm, with 1 SGT train and 1 stack dilution fan operating.
- Meteorological conditions are listed in the following table:

Site Meteorological Conditions			
Parameter	Data		
Avg Wind Direction 200 foot	271 degrees		
Avg Wind Direction 100 foot	263 degrees		
Avg Wind Direction 90 foot	261 degrees		
Avg Wind Speed – 200 foot	6.1 mph		
Avg Wind Speed – 100 foot	4.5 mph		
Avg Wind Speed – 90 foot	4.7 mph		
Avg Wind Speed – 30 foot	3.8 mph		
Avg Wind Direction Variation	14 degrees		
Avg Delta T – 30 to 200 foot	minus (-) 1.49 degrees F		
Avg Delta T – 30 to 100 foot	minus (-) 0.56 degrees F		

INITIATING CUE:

Complete the required E-plan upgrade notification form for the current conditions.

THIS IS A TIME-CRITICAL JPM.

Information for Evaluator's Use:

UNSAT requires written comments on respective step.

* Denotes CRITICAL steps.

Number any comments in the "Comment Number" column. Then annotate that comment in the "Comments" section. The comment section should be used to document the reason that a step is marked as unsatisfactory and to document unsatisfactory performance relating to management expectations.

Some operations that are performed from outside of the control room may require multiple steps. These items may be listed as individual steps in this JPM. It is acceptable for the candidate to direct the local operator to perform groups of procedure steps instead of calling for each individual item to be performed.

The time clock starts when the candidate acknowledges the initiating cue.

Operator's Name: ____

Job Title: SRO

JPM Title: Determine Protective Action Recommendations and Complete Event Notification Form

JPM Number: SRO A-4 Revision Number: 0

K/A Number and Importance: K/A 2.4.38, Ability to take actions called for in the facility emergency plan, including supporting or acting as emergency coordinator if required. (4.4)

Suggested Testing Environment: Classroom/Simulator

	Actual	Testing	Environme	ent:
--	--------	---------	-----------	------

Testing Method: Table-Top

Alternate Path: No

Time Critical: Yes

Estimated Time to Com	plete: 12 minutes	Actual Time Used:	minutes

References:

- IAP-2, Classification of Emergency Conditions, Rev 28
- EAP-1.1, Offsite Notifications, Rev 64
- IAP-1, Emergency Plan Implementation Checklist, Rev 39
- EAP-4.1, Release Rate Determination, Rev 19
- EAP-4, Dose Assessment Calculations, Rev 39
- EAP-42, Obtaining Meteorological Data, Rev 23

EVALUATION SUMMARY:

- 2. Was the task standard met?

The operator's performance was	evaluated against the sta	ndards contained in this JPM	, and has been
determined to be:	Satisfactory	Unsatisfactory	

Comments:_____

Note: Any grade of UNSAT requires a comment.

Evaluator's Name:	(Print)

Evaluator's Signature:	Date:
------------------------	-------

NOTE: Critical Element(s) indicated by * in Performance Checklist.

PERFORMANCE CHECKLIST:

JPM Start Time _____

	ELEMENT	STANDARD	SAT	UNSAT	Comment Number
1.	Applicants review the handout sheet and ask any questions regarding the initial conditions or initiating cues.	Applicants review initial conditions and initiating cues.			
2.	Handout the references with the handout sheet and the initiating cue sheet.	Start the JPM.			
	Examiner Cue: Remind applicant the task is time critical.	Record START Time:			
3.	Obtains Notification Form (Attachment 1 of EAP-1.1, Offsite Notifications)	Applicant completes Notification Form Item #2, circling " <u>B. Actual Event</u> ".			
*4.	Record the correct event classification.	Applicant completes Notification Form Item #3, circling " <u>D. General</u> <u>Emergency</u> ".			
*5.	Record the correct declaration date and time.	Applicant completes Notification Form Item #4, recording today's date (<u>5/12/2010</u>) and event declaration time (<u>0412</u>)			
*6.	Determine release rate using EAP-4 and EAP-4.1 (Step 4.1.2 or Attachment 2 from mr/hr * 2.54 factor)	Applicant determines release rate is 29,718 Ci/sec.			
*7.	Record the radioactive release information based on EAP-4.1 Attachment 11.	Applicant completes Notification Form Item #5, circling " <u>C. Release ABOVE</u> federal limits Technical Specification".			

	ELEMENT	STANDARD	SAT	UNSAT	Comment Number
*8.	Determine and record the protective active recommendations using EAP-4 Attachment 1, Tables 4.1.1 and 4.1.2.	Applicant completes Notification Form Item #6, circling " <u>B. EVACUATE and</u> <u>IMPLEMENT the KI PLAN for</u> the following ERPAs and All remaining ERPAs MONITOR the EMERGENCY ALERT <u>SYSTEM</u> " and by circling ERPAs # 1,2,3,4,7,9,26,27. Examiner Note: These are 2 mile radius and 5 mile			
		mile radius and 5 mile downwind ERPAs.			
*9.	Record appropriate EAL number and brief description.	Applicant completes Notification Form Item #7, recording EAL # 5.1.4 and brief description "high elevated rad release rate from main vent stack".			
*10.	Record reactor status.	Applicant completes Notification Form Item #8, circling "B. Shutdown" and date time of 5/12/10 at 0342.			
*11.	Record appropriate wind speed	Records wind speed by filling in Notification Form Item #9 as "A. <u>6.1</u> Miles/Hour at elevation <u>200</u> Feet (Elevated)".			
*12.	Record meteorological stability class as determined using provided data per EAP-42.	Determines Stability Class " <u>C</u> ", based on wind direction variation and 30 to 200 foot delta T. Records stability class by circling "C Neutral" in Notification Form Item #11.			
*13.	Turn in notification form within required time.	Applicant turns in notification form within 15 minutes of start of JPM.			
		Record Stop Time:			

JPM ANSWER KEY PART ONE GENERAL INFORMATION

Page 1 of 1

	NEW YORK STATE UPSTATE RADIOLOGICAL EMERGENCY DATA FORM					
	PART 1 Notification #					
abons:) R OM:	o report an incident at the James A. FitzPatrick Power Plant. Standby for confirmation * (Conduct rol call to include the following) DNew York State Warning Point Doswego County Warning Point DNine Mile Point Unit #1 DNine Mile Point Unit #2 (CR, TSC, EOF, OTHER) ED Approval: <u>Applicant Signature</u> ERAL INFORMATION (Note: O When checked indicates change in status, NOT for place keeping)					
01	Message transmitted on: (Date) et (Time) 24 Hour Clock Via' A. RECS B. Other					
21						
	NY State : 516-292-2200					
	Oswego Co : 591-9150 gr 911					
	NMP # 1: 349-5201 or Control Room Hotline					
	NMP # 2: 349-5202 gr Control Room Hotline					
12	This is : A. An Actual Emergency B. An Exercise					
33	The Emergency Classification is:					
	A UNUSUAL EVENT C. SITE AREA EMERGENCY E. EMERGENCY TERMINATED					
5 _{4.}	B ALERT D. GENERAL EMERGENCY F. Other This Emergency Classification declared on: 05/12/2010 at 0412					
14.	(date) (time-24 hr clock)					
)5.	Release of Radioactive Materials due to the classified event:					
	A. No Rolease					
	B. Release BELOW federal limits Technical Specification					
Г	C. Release ABOVE federal limits Technical Specification					
1	To Atmosphere a To Water					
	D. Unmonitored release requiring evaluation The following Protective Actions are recommended to be implemented as soon as practicable:					
fi.						
	A. NO NEED for PROTECTIVE ACTIONS outside the site boundary					
	B. EVACUATE and IMPLEMENT the KI PLAN for the following ERPAs and All compaining ERPAs MONTTOR the EMERGENCY ALERT SYSTEM 1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 NOTE: OFFSITE AUTHORITIES SHOULD CONSIDER SHELTER-IN-PLACE + TAKE KI IF EVACUATION IS NOT FEASIBLE					
1	C. SHELTER-IN-PLACE and IMPLEMENT the KI PLAN for the following ERPAs and					
	All remaining ERPAs MONITOR the EMERGENCY ALERT SYSTEM					
57. 1	1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 FAL# 5.1.4					
	High playated radioactivity release from main yent stack					
	escription &					
	lormanon					
	Reactor Status: A Decrational B. Shudown 05/12/2010 at 0342					
Ž8. –	Reactor Status: A. Operational B. Shutdown 05/12/2010 at 0342 (date) (time 24 hr clock)					
<u>9</u>	Wind Speed: A. 6.1 Miles/Hour at elevation 200 Feet (Elevated)					
	B Miles/Hour at elevation Feet (Ground)					
10.	Wind Direction: A. (From) 271 Degrees at elevation 200 Feet (Elevated)					
	B. (From) Degrees at elevation Feet (Ground)					
11.	Stability Class Elevated: Unstable - A B C Neutral - D Stable - E F G					
12.	Reported By - Communicator's name: Telephone #					
	me of Agency), Do you have any questions?" ew York State Warning Point 🛛 Oswego County Warning Point 🔲 Nina Mile Point Unit #1 🗍 Nine Mile Point Unit #2					
"Jam	es A. FitzPatrick Nuclear Power Plant out at (date, time)*					
	JPM ANSWER					
_						
	-1.1 OFFSITE NOTIFICATIONS ATTACHMENT 1 V. No. <u>64</u> OFFSITE NOTIFICATIONS Page <u>31</u> of <u>59</u>					

HANDOUT PAGE

TASK CONDITIONS:

At 0342 today (May 12, 2010), an earthquake with a magnitude of 0.08g caused a loss of offsite power.

Plant conditions:

- At 0342, a large break LOCA occurred.
- The reactor automatically scrammed.
- Multiple failures in safety systems caused the operators to conduct an emergency depressurization.
- RPV level dropped to minus (-) 9".
- Drywell pressure peaked at 55 psig.
- Secondary containment radiation levels increased to >EOP-5 Maximum Normal values in the Reactor Building 344 foot elevation.
- At 0352, a Site Area Emergency was declared with a release in progress based on an unisolable MSL break outside primary containment.
- At 0401, the initial offsite notification message was transmitted.
- ERO is staffing the emergency response facilities. Neither the TSC nor the EOF has been fully activated (the earthquake caused damage to local roads).
- Emergency and Plant Information Computer (EPIC) System is **NOT** available.
- Emergency Dose Assessment Modeling System (EDAMS) is **NOT** available.

At 0412, (when you start the JPM) the following plant conditions exist:

- Drywell pressure has dropped rapidly to 3 psig.
- RPV level = minus (-) 9", going up slowly.
- You are the Emergency Director until relieved and have just declared an EAL upgrade to General Emergency at Time 0412.
- EAL upgrade based on radioactivity release as indicated on effluent radiation monitors, exceeding EAL threshold for >15 minutes.
- **NO** other General Emergency EAL thresholds have been reached.
- Stack high range effluent radiation monitor = 11,700 mr/hr.
- Stack flow rate = 12,000 cfm, with 1 SGT train and 1 stack dilution fan operating.
- Meteorological conditions are listed in the following table:

HANDOUT PAGE

Site Meteorological Conditions				
Parameter	Data			
Avg Wind Direction 200 foot	271 degrees			
Avg Wind Direction 100 foot	263 degrees			
Avg Wind Direction 90 foot	261 degrees			
Avg Wind Speed – 200 foot	6.1 mph			
Avg Wind Speed – 100 foot	4.5 mph			
Avg Wind Speed – 90 foot	4.7 mph			
Avg Wind Speed – 30 foot	3.8 mph			
Avg Wind Direction Variation	14 degrees			
Avg Delta T – 30 to 200 foot	minus (-) 1.49 degrees F			
Avg Delta T – 30 to 100 foot	minus (-) 0.56 degrees F			

INITIATING CUE:

Complete the required E-plan upgrade notification form for the current conditions.

THIS IS A TIME-CRITICAL JPM.

	Job Performance Measure						
Changing In-service CRD Pump Suction Filters							
	JPM Number: P-1						
	Revision Number: 1						
	Date: <u>1/15/10</u>						
Developed By:	Developed By: <u>Bernard Litkett</u>						
	Author	Date					
Validated By:	Facility Representative	Date					
Review By:							
	Examiner	Date					
Approved By:	Chief Examiner	Date					

JPM P-1

JOB PERFORMANCE MEASURE VALIDATION CHECKLIST

NOTE: All steps of this checklist should be performed upon initial validation. Prior to JPM usage, revalidate JPM using steps 8 through 11 below.

 Task description and number, JPM description and number are identified.
 2. Knowledge and Abilities (K/A) references are included.
 Performance location specified. (in-plant, control room, or simulator)
 4. Initial setup conditions are identified.
 5. Initiating and terminating cues are properly identified.
 6. Task standards identified and verified by Examiner review.
 Critical steps meet the criteria for critical steps and are identified with an asterisk (*).
 Verify the procedure referenced by this JPM matches the most current revision of that procedure: Procedure Rev Date
 Pilot test the JPM: a. verify cues both verbal and visual are free of conflict, and b. ensure performance time is accurate.
 If the JPM cannot be performed as written with proper responses, then revise the JPM.
 When JPM is revalidated, Examiner sign and date JPM cover page.

Review Questions and Comments:

JPM P-1

REVISION RECORD (Summary):

1. None

JPM Setup Instructions:

1. Copy of procedure OP-25; Rev. 79; section G.11

Tools and Equipment

1. None

TASK STANDARD:

Successfully swap in-service CRD suction filters

TASK CONDITIONS:

- **1.** The plant is at 100% power.
- 2. The in-service CRD pump suction filter indicates 1 psid on 03PIS-246.

INITIATING CUE:

You are directed to change the in-service CRD pump suction filter.

Information For Evaluator's Use:

UNSAT requires written comments on respective step.

* Denotes CRITICAL steps.

Number any comments in the "Comment Number" column. Then annotate that comment in the "Comments" section. The comment section should be used to document the reason that a step is marked as unsatisfactory and to document unsatisfactory performance relating to management expectations.

Some operations that are performed from outside of the control room may require multiple steps. These items may be listed as individual steps in this JPM. It is acceptable for the applicant to direct the local operator to perform groups of procedure steps instead of calling for each individual item to be performed.

The time clock starts when the applicant acknowledges the initiating cue.

Operator's	Name:	· .			
Job Title:		RO	SRO		□ SRO Cert
JPM Title:	Successfu	ully swap in-se	ervice CRD	suction filte	rs
JPM Numbe	er: P-1		Revisi	ion Number:	1
K/A Numbe	r and Impo	rtance: KA 201	001 A2.06;	2.9; 2.9	
Suggested	Testing Env	vironment:	Plant		
Actual Test	ing Environ	ment: Plant			
Testing Met	thod: Simul	ate			
Alternate Pa	ath: No				
Time Critica	al: No				
Estimated 1	Time to Con	nplete: 15	Actual T	ime Used:	minutes
		201001 A2.06; 2 ction G.11	.9; 2.9		
EVALUATIO 1. Were all t 2. Was the t	he Critical E	lements perfor	med satisfac	torily? 🗆 Ƴ	∕es □ No
The operator' determined to	•		•	standards cont	tained in this JPM, and has bee factory
Comments:					
Note: Any g	rade of UNS	SAT requires a	comment.		
Evaluator's	Name:			(Print)
Evaluator's	Signature:				Date:

JPM P-1

<u>Description</u>: This JPM has the applicant place the standby CRD suction filter in service and isolate the previously in-service filter.

JPM P-1

NOTE: Critical Element(s) indicated by * in Performance Checklist.

PERFORMANCE CHECKLIST:

JPM Start Time _____

	ELEMENT	STANDARD	SAT	UNSAT	Comment Number
 Obtain a controlled copy of procedure OP-25; REV.79; G.11, changing in-service CRD suction filter 		The applicant determines where to obtain a controlled copy OP-25; Rev. 79;G.11, changing CRD suction filters			
		EVALUATOR; Provide trainee a current copy of OP-25			
2.	Select the correct section to perform the task.	Selects section G.11 from OP-25; REV.79.			
		EVALUATOR: Provide applicant with copy of section G.11.			
3.	Applicant notifies the control room that CRD suction filter will be changed.	Applicant notifies the control room that CRD suction filter will be changed.			
4.	Applicant notifies Radiation Protection that potentially radioactive water will be vented from the CRD pump suction filter.	Applicant notifies Radiation Protection that potentially radioactive water will be vented from the CRD pump suction filter.			
* 5	 Perform the following for the filter to be placed in- service. a.) Verify open inlet isolation valve 03CRD-151A (CRD water pump 'A' Suct filter 'A' inlet isol valve) 	 Applicant opens inlet isolation valve. 03CRD-151A (CRD water pump 'A' Suct filter 'A' inlet isol valve) or 03CRD-151B (CRD water pump 'B' Suct filter 'B' inlet isol valve) 			
	or • 03CRD-151B (CRD water pump 'B' Suct filter 'B' inlet isol valve)	Cue: After correct operation is simulated, inform applicant that handwheel turns several rotations in CCW direction, then hits a hard stop.			

JPM P-1

				JPM P-1
ELEMENT	STANDARD	SAT	UNSAT	Comment Number
* 5b. Crack open vent valve:	Applicant cracks open:			
 03CRD-400A (CRD water pump 'A' suct filter 'A' vent valve 	 03CRD-400A (CRD water pump 'A' suct filter 'A' vent valve 			
or	or			
 03CRD-400B (CRD water pump 'B' suct filter 'B' vent valve 	 03CRD-400B (CRD water pump 'B' suct filter 'B' vent valve 			
	EVALUATOR CUE: Valve is cracked open, water is flowing free of air from the vent.		•	
* 5c. When water flowing from the vent is free of air, close the vent valve.	Applicants closes the vent valve when the water flowing is free of air. EVALUATOR CUE: Valve is closed.			
 * 5d. Slowly open outlet isolation valve: 03CRD-152A (CRD water pump 'A' suct filter 'A' 	 Applicant slowly opens outlet isolation valve. 03CRD-152A (CRD water pump 'A' suct filter 'A' outlet isol valve) 			
outlet isol valve) or • 03CRD-152B (CRD water pump 'B' suct filter 'B' outlet isol valve)	or • 03CRD-152B (CRD water pump 'B' suct filter 'B' outlet isol valve) EVALUATOR CUE: After correct operation is simulated, inform applicant that handwheel turns several rotations in CCW direction, then hits a hard stop.			

JPM P-1

ELEMENT	STANDARD	SAT	UNSAT	Comment Number	
* 6. Close outlet isolation valve for the filter to be removed from service	 Applicant closes outlet isolation valve. 03CRD-152A (CRD water pump 'A' suct filter 'A' outlet isol valve) or 03CRD-152B (CRD water pump 'B' suct filter 'B' outlet isol valve) <u>EVALUATOR CUE:</u> After correct operation is simulated, inform applicant that handwheel turns several rotations in CW direction, then hits a hard stop. 				
EVALUATOR: Terminate the task at this point					

JPM Stop Time _____

JPM P-1

HANDOUT PAGE

TASK CONDITIONS:

- **1.** The plant is at 100% power.
- 2. The in-service CRD pump suction filter indicates 1 psid on 03PIS-246.

INITIATING CUE:

You are directed to change the in-service CRD pump suction filter.

NRC JAMES A. FITZPA	TRICK INITIAL	EXAMINATION
---------------------	---------------	-------------

Job Performance Measure							
EOP Isolation Interlock Overrides – HPCI System Isolation Valves on Low Steam Supply Pressure							
	JPM Number: P-2						
	Revision Number: NRC 2010						
	Date: <u>1/14/10</u>						
Developed By:	Bernard Litkett Author	 Date					
Validated By:	Validated By: Facility Representative						
Review By:	Examiner	 Date					
Approved By:	Chief Examiner	Date					

.

JPM P-2

JOB PERFORMANCE MEASURE VALIDATION CHECKLIST

NOTE: All steps of this checklist should be performed upon initial validation. Prior to JPM usage, revalidate JPM using steps 8 through 11 below.

 1.	Task description and number, JPM description and number are identified.
 2.	Knowledge and Abilities (K/A) references are included.
 3.	Performance location specified. (in-plant, control room, or simulator)
 4.	Initial setup conditions are identified.
 5.	Initiating and terminating cues are properly identified.
 6.	Task standards identified and verified by Examiner review.
 7.	Critical steps meet the criteria for critical steps and are identified with an asterisk (*).
 8.	Verify the procedure referenced by this JPM matches the most current revision of that procedure: Procedure Rev Date
 9.	Pilot test the JPM: a. verify cues both verbal and visual are free of conflict, and b. ensure performance time is accurate.
 10	. If the JPM cannot be performed as written with proper responses, then revise the JPM.
 11	. When JPM is revalidated, Examiner sign and date JPM cover page.

Review Questions and Comments:

JPM P-2

REVISION RECORD (Summary):

1. None

JPM Setup Instructions:

- 1. Performance of this JPM shall be simulated. Inadvertent manipulation of a component could result in unwanted system actuations.
- 2. When opening cabinets with energized equipment inside, ensure appropriate EN-IS-123 requirements are met.
- 3. Make a copy of EP-2; Section 5.8 for use by applicant.
- 4. Obtain Shift Manager approval prior to entering panel 09-32 and 09-39.

TOOLS AND EQUIPMENT:

Screwdriver/Nutdriver (JPM is to be simulated)

TASK STANDARD:

Install EOP Isolation Interlock Overrides – HPCI System Isolation Valves on Low Steam Supply Pressure

TASK CONDITIONS:

- 1. Emergency depressurization has been ordered due to high secondary containment temperature (EOP-5), but only 3 SRV's can be opened.
- 2. The SM has issued direction to override the HPCI System low steam pressure isolation interlock to allow use of HPCI to rapidly depressurize the RPV IAW EOP-2.

INITIATING CUE:

You are the RO. The CRS directs you to override the isolation on low steam supply pressure for the HPCI System per EP-2, Isolation/Interlock Overrides.

Information For Evaluator's Use:

UNSAT requires written comments on respective step.

* Denotes CRITICAL steps.

Number any comments in the "Comment Number" column. Then annotate that comment in the "Comments" section. The comment section should be used to document the reason that a step is marked as unsatisfactory and to document unsatisfactory performance relating to management expectations.

Some operations that are performed from outside of the control room may require multiple steps. These items may be listed as individual steps in this JPM. It is acceptable for the applicant to direct the local operator to perform groups of procedure steps instead of calling for each individual item to be performed.

The timeclock starts when the applicant acknowledges the initiating cue.

JPM	P- 2
------------	-------------

Operator's	Name				
Job Title:		RO	SRO		□ SRO Cert
JPM Title: I Supply Pres		n Interlock Ov	verrides – HP0	CI System Isc	lation Valves on Low Steam
JPM Numb	er: P-2		Revis	ion Number:	NRC 2010
K/A Numbe	r and Impo	rtance: KA 20	06000; A2.10	; 4.0; 4.1	
Suggested	Testing En	vironment:	Plant		
Actual Test	ing Enviror	ment: Plai	nt		
Testing Me	thod: Simul	ate			
Alternate P	ath: No				
Time Critic	al: No				
Estimated ⁻	Time to Con	nplete: 15	Actual	նime Used։	minutes
	123, 206000 /	A2.10; 4.0; 4.1 I Steam Supply	y Valves - Low	Steam Supply	Pressure Isolation, Rev 7
1. Were all t	DN SUMMAI the Critical E task standar	lements perfo	ormed satisfac	ctorily? 🗆 Y	′es □ No
The operator determined to			ed against the states		tained in this JPM, and has be factory
Comments:					
Note: Any g	grade of UNS	SAT requires a	a comment.		
Evaluator's	Name:			(Print)
Evaluator's					
Plant JPM F					

JPM P-2

<u>Description:</u> This JPM has the applicant defeat HPCI System Isolation on Low Steam Supply Pressure

JPM P-2

NOTE: Critical Element(s) indicated by * in Performance Checklist.

PERFORMANCE CHECKLIST:

JPM Start Time _____

ELEMENT	STANDARD	SAT	UNSAT	Comment Number
1. Obtain a controlled copy of procedure EP-2, Isolation/Interlock Overrides	The applicant determines where to obtain a controlled copy of EP-2. (EOP supply cabinet, Control Room, Merlin)			
	EVALUATOR; Provide trainee a current copy of EP-2			
2. Select the correct section to	Selects section 5.8 from EP-2.			
perform the task.	EVALUATOR: Provide applicant with copy of section 5.8.			
* 3. For 23MOV-15, disconnect lead from one of the following terminals in panel 09-32: (_) TBC-5 Or (_) TBC-7	EVALUATOR: When the applicant proceeds to panel 09-32 in the Relay Room and locates and identifies terminals and states that he/she would disconnect a lead from either terminal TBC-5 or TBC-7, then inform the applicant "Lead disconnected".			
4. Initials for lifting lead.	Initials block for lifting lead from terminal.			
 * 5. For 23MOV-16 and 60, disconnect lead from one of the following terminals in panel 09- 39: (_) DD-17 Or (_) DD-18 	EVALUATOR: When the applicant proceeds to panel 09-39 in the Relay Room and locates and identifies terminals and states that he/she would disconnect a lead from either terminal DD-17 or DD-18, then inform the applicant "Lead disconnected".			
6. Initials step for lifting lead.	Initials block for lifting lead from terminal.			
7. Contact the Control Room and inform them that the low steam pressure isolation has been overridden per EP-2	EVALUATOR: Acknowledge the communication as the CRS.			
	EVALUATOR : Terminate the task at this point	nt.		

JPM Stop Time

JPM P-2

HANDOUT PAGE

TASK CONDITIONS:

- 1. Emergency depressurization has been ordered due to high secondary containment temperature (EOP-5), but only 3 SRV's can be opened.
- 2. The SM has issued direction to override the HPCI System low steam pressure isolation interlock to allow use of HPCI to rapidly depressurize the RPV IAW EOP-2.

INITIATING CUE:

You are the RO. The CRS directs you to override the isolation on low steam supply pressure for the HPCI System per EP-2, Isolation/Interlock Overrides.

	Job Performance Measur	e
Alternat	e Depressurization Using SRVs From	Panel 02ADS-71
	JPM Number: P-3	
	Revision Number: 1	
	Date: <u>1/19/10</u>	
Developed By:	Bernard Litkett	<u> 1/19/10 </u> Date
Validated By:	Facility Representative	Date
Review By:	Examiner	Date
Approved By:	Chief Examiner	Date

JPM P-3

JOB PERFORMANCE MEASURE VALIDATION CHECKLIST

NOTE: All steps of this checklist should be performed upon initial validation. Prior to JPM usage, revalidate JPM using steps 8 through 11 below.

 Task description and number, JPM description and number are identified.
 2. Knowledge and Abilities (K/A) references are included.
 Performance location specified. (in-plant, control room, or simulator)
 4. Initial setup conditions are identified.
 5. Initiating and terminating cues are properly identified.
 6. Task standards identified and verified by Examiner review.
 Critical steps meet the criteria for critical steps and are identified with an asterisk (*).
 Verify the procedure referenced by this JPM matches the most current revision of that procedure: Procedure Rev Date
 Pilot test the JPM: a. verify cues both verbal and visual are free of conflict, and b. ensure performance time is accurate.
 If the JPM cannot be performed as written with proper responses, then revise the JPM.
 When JPM is revalidated, Examiner sign and date JPM cover page.

Review Questions and Comments:

JPM P-3

REVISION RECORD (Summary):

1. None

JPM Setup Instructions:

- 1. EP-11;Rev.1, Alternate depressurization using SRVs from 02ADS-71
- 2. Obtain Shift Manager's permission prior to performing this task.
- 3. Ensure Control Room is aware that the door to the remote ADS panel will be opened.

TOOLS AND EQUIPMENT:

- 1. Key for Remote ADS Cabinet 02ADS-71 is located in equipment cabinet near Remote Shutdown Panel 25RSP, RB 300 el., north.
- 2. Key to access equipment cabinet near Remote Shutdown Panel 25RSP, RB 300 el., north.

TASK STANDARD:

Successfully perform alternate depressurization using SRVs from panel 02ADS-71

TASK CONDITIONS:

- 1. Torus water level is 13.9 feet
- 2. The Shift Manager has identified the need to use the remote ADS cabinet 02ADS-71to depressurize the RPV,per EP-11; Rev.1.
- 3. No SRVs have been opened from the Control Room.

INITIATING CUE:

You are the RO. The CRS has directed you to emergency depressurize the RPV per EP-11.

Information For Evaluator's Use:

UNSAT requires written comments on respective step.

* Denotes CRITICAL steps.

Number any comments in the "Comment Number" column. Then annotate that comment in the "Comments" section. The comment section should be used to document the reason that a step is marked as unsatisfactory and to document unsatisfactory performance relating to management expectations.

Some operations that are performed from outside of the control room may require multiple steps. These items may be listed as individual steps in this JPM. It is acceptable for the applicant to direct the local operator to perform groups of procedure steps instead of calling for each individual item to be performed.

The time clock starts when the applicant acknowledges the initiating cue.

JPM	P-3
------------	-----

Operator's	Namo				
Job Title:		RO	SRO		□ SRO Cert
		ilternate depi		-	from panel 02ADS-71
JPM Numbe	er: P-3		Revis	ion Number:	1
K/A Numbe NUREG 1123	•				
Suggested	Testing En	vironment:	Plant		
Actual Test	ing Enviroi	nment: Pla	nt		
Testing Met	t hod: Simu	late			
Alternate Pa	ath: No				
Time Critica	al: No				
Estimated 1	Γime to Cor	mplete: 15	Actual 1	նաе Used:	minutes
	23; 239002	A2.04; 4.1; 4.2 remote ADS ca	abinet 02ADS-7	71 to depressu	rize the RPV
EVALUATIC 1. Were all t 2. Was the t	he Critical E	Elements perfo	ormed satisfac	ctorily? 🗆 א	∕es □ No
determined to	be:	🗆 Satis	ed against the s sfactory	🗆 Unsatis	tained in this JPM, and has bee factory
Note: Any g	rade of UN	SAT requires	a comment.		
Evaluator's	Name:			(Print)
Evaluator's	Signature:				Date:

JPM P-3

Description: This JPM has the applicant perform an emergency depressurization IAW EP-11.

JPM P-3

NOTE: Critical Element(s) indicated by * in Performance Checklist.

PERFORMANCE CHECKLIST:

JPM Start Time _____

	ELEMENT	STANDARD	SAT	UNSAT	Comment Number
1.	Obtain a controlled copy of procedure	Obtains a controlled copy of EP-11; Rev.1.			
2.	Reviews precautions associated with the procedure:	Applicant reviews applicable section of the procedure and verifies Torus water level is >5.5 ft.			
•	Torus water level shall be greater than or equal to 5.5 feet to open an SRV. Opening an SRV with Torus water level less than 5.5 feet will cause direct pressurization of the containment and possible containment damage.	EVALUATOR CUE: When applicant requests information regarding Torus water level, inform applicant level is greater than 13.9 ft.			
3.	Reviews prerequisites associated with the procedure:	Applicant reviews applicable sections of the procedure.			
•	Performance of this procedure has been directed by the EOPs or SAOGs.				
4.	Reviews special instructions associated with the procedure	Applicant reviews applicable section of the procedure.			
•	Tools and materials for this procedure are located in the equipment cabinets near Remote Shutdown Panel 25RSP and panel 02ADS- 71.				
•	Notify RES prior to entering the RB due to potentially changing radiation conditions.				

					<u>JPM P-3</u>
	ELEMENT	STANDARD	SAT	UNSAT	Comment Number
5.	Establish communications between the Control Room and ADS RELIEF VALVE CONTROL PANEL 02ADS- 71.	Applicant proceeds to RB 300 el. and establishes communications. EVALUATOR CUE: Inform applicant that communications have been established and you will respond as control room operator.			
6. • • • •	Verify the following control switches are in SOL DEENG at panel 02ADS- 71: ADS & SRV 02RV-71C SRV 02RV-71F SRV 02RV-71J SRV 02RV-71L ADS & SRV 02RV-71B ADS & SRV 02RV-71B ADS & SRV 02RV-71E ADS & SRV 02RV-71H SRV 02RV-71K ADS & SRV 02RV-71A ADS & SRV 02RV-71D ADS & SRV 02RV-71G	Applicant verifies the control switches are in SOL DEENG. EVALUATOR CUE: When applicant identifies the switches, inform applicant that switches are in SOL DEENG.			
	7.Place CONTROL POWER breaker in ON at panel 02ADS-71. Verify in the control room, annunciator 09-4-3-3 ADS REMOTE CNTRL PNL BKR CLOSED is in alarm.	Applicant places CONTROL POWER breaker in ON. <u>EVALUATOR CUE:</u> When applicant requests information regarding response, inform applicant that control power is ON. Applicant verifies the alarm has actuated. <u>EVALUATOR CUE:</u> When applicant requests, inform applicant that alarm has actuated.			

JPM	P-3
------------	-----

			JPM P-3
STANDARD	SAT	UNSAT	Comment Number
Applicant verifies each of the indications while performing Step 11 of this JPM (Procedure step 5.1.7).			
Applicant verifies that torus water level is >5.5 ft.			
EVALUATOR CUE: When applicant verifies the torus water level, inform applicant that level is 13.9 ft.			
Applicant opens seven SRVs. EVALUATOR CUE: When applicant indicates the switch for opening an SRV, inform applicant that SRV has opened.			
	Applicant verifies each of the indications while performing Step 11 of this JPM (Procedure step 5.1.7). EVALUATOR CUE: When applicant requests each SRV indication, inform applicant that each has occurred. Applicant verifies that torus water level is >5.5 ft. EVALUATOR CUE: When applicant verifies the torus water level, inform applicant that level is 13.9 ft. Applicant opens seven SRVs. EVALUATOR CUE: When applicant indicates the switch for opening an SRV, inform applicant that SRV has	Applicant verifies each of the indications while performing Step 11 of this JPM (Procedure step 5.1.7). EVALUATOR CUE: When applicant requests each SRV indication, inform applicant that each has occurred. Applicant verifies that torus water level is >5.5 ft. EVALUATOR CUE: When applicant verifies that torus water level is >5.5 ft. EVALUATOR CUE: When applicant verifies the torus water level, inform applicant that level is 13.9 ft. Applicant opens seven SRVs. EVALUATOR CUE: When applicant seven SRVs.	STANDARDSATUNSATApplicant verifies each of the indications while performing Step 11 of this JPM (Procedure step 5.1.7).IEVALUATOR CUE: requests each SRV indication, inform applicant that each has occurred.IApplicant verifies that torus water level is >5.5 ft.IEVALUATOR CUE: when applicant verifies the torus water level, inform applicant that level is 13.9 ft.IApplicant opens seven SRVs.IEVALUATOR CUE: when applicant verifies the torus water level, inform applicant that level is 13.9 ft.IApplicant opens seven SRVs.IEVALUATOR CUE: when applicant plicant that SRV hasI

JPM	P-3
-----	-----

ELEMENT	STANDARD	SAT	UNSAT	Comment Number
 * 12. IF any SRV was opened from panel 02ADS-71, THEN perform the following: Close and lock panel door. Notify Control Room. Do not perform subsection 5.2 until directed by the SM or CRS. 	Applicant closes the door and Control room notified. EVALUATOR CUE: Acknowledge when applicant informs the control room. Subsection 5.2 is the restoration section.			
EVALUATOR: Terminate the task at this point.				

JPM Stop Time

JPM P-3

HANDOUT PAGE

TASK CONDITIONS:

- 1. Torus water level is 13.9 feet.
- 2. The Shift Manager has identified the need to use the remote ADS cabinet 02ADS-71 to depressurize the RPV per EP-11.
- 3. No SRVs have been opened from the Control Room.

INITIATING CUE:

You are the RO. The CRS has directed you to emergency depressurize the RPV per EP-11.

	James A. Fitzpatrick Generating Station			
	Job Performance Measure			
Ir	Initiate RCIC in Pressure Control with Speed Control Failure			
	JPM Number: S-	1		
	Revision Number:	1		
	Date: <u>1/13/10</u>	_		
Developed By:	Bernard Litkett	<u>1/13/10</u>		
	Author	Date		
Validated By:	Facility Representative	Date		
Review By:	Examiner	Date		
Approved By:	Chief Examiner	Date		

JOB PERFORMANCE MEASURE VALIDATION CHECKLIST

<u>NOTE</u>: All steps of this checklist should be performed upon initial validation. Prior to JPM usage, revalidate JPM using steps 8 through 11 below.

- Task description and number, JPM description and number are identified.
 Knowledge and Abilities (K/A) references are included.
 - Performance location specified. (in-plant, control room, or simulator)
- 4. Initial setup conditions are identified.
 - 5. Initiating and terminating cues are properly identified.
 - 6. Task standards identified and verified by Examiner review.
 - 7. Critical steps meet the criteria for critical steps and are identified with an asterisk (*).
 - Verify the procedure referenced by this JPM matches the most current revision of that procedure:

Procedure Rev. ____ Date _____

- Pilot test the JPM:
 a. verify cues both verbal and visual are free of conflict, and
 b. ensure performance time is accurate.
- 10. If the JPM cannot be performed as written with proper responses, then revise the JPM.
- 11. When JPM is revalidated, Examiner sign and date JPM cover page.

REVISION RECORD (Summary):

1. Rev 0

JPM Setup Instructions:

- 1. Initialize the simulator to IC-38.
- 2. Establish the following simulator conditions:
 - A. Plant in a post scram condition with RPV level between 177" and 222.5"
 - B. RPV pressure between 700 psig and 1000 psig and rising slowly
 - C. Main Steam Isolation Valves closed.
- 3. Insert malfunction RC07 selected high speed failure

TOOLS AND EQUIPMENT

None

TASK STANDARD:

Successfully initiate RCIC in the Pressure Control Mode re-establish control after a with speed control failure.

TASK CONDITIONS:

- 1. Plant is in a post-scram condition with RPV level between 177" and 222.5".
- 2. RPV pressure is between 700 psig and 1000 psig and rising slowly.
- 3. Main Steam Isolation valves are closed.

INITIATING CUE:

You are the RO, 'The CRS directs you to start the RCIC System for RPV pressure control using OP-19; D.2. Maximize heat removal with RCIC to minimize SRV operations.

Information for Evaluator's Use:

UNSAT requires written comments on respective step.

* Denotes CRITICAL steps.

Number any comments in the "Comment Number" column. Then annotate that comment in the "Comments" section. The comment section should be used to document the reason that a step is marked as unsatisfactory and to document unsatisfactory performance relating to management expectations.

Some operations that are performed from outside of the control room may require multiple steps. These items may be listed as individual steps in this JPM. It is acceptable for the applicant to direct the local operator to perform groups of procedure steps instead of calling for each individual item to be performed.

The timeclock starts when the applicant acknowledges the initiating cue.

Operator's Name			0.00		
Job Title:		RO	II SRO	🗆 STA	□ SRO Cert
JPM Title: Initiate control failure.	RCIC in the	Pressure Co	ontrol Mode re	-establish co	ntrol after a speed
JPM Number: S-1	I				
Revision Number	: 0				
K/A Number and	Importance:	KA 217000; /	44.07; 3.9; 3.8		
Suggested Testin	ng Environm	ent: Simula	tor		
Actual Testing Er	nvironment:				
Testing Method:	Perform in S	imulator			
Alternate Path: Y	′es				
Time Critical: No					
Estimated Time to	o Complete:	20 min.	Actual Time	Used:	minutes
References : 1. NUREG 1123, 2 2. OP-19; D.2 Rea the 09-4 panel.			System, Curre	nt Revision or	or posted attachment at
3. EN-OP-115, Con	nduct of Opera	tions, Paragra	aph 5.3 Manual	Control of Aut	tomatic Systems
EVALUATION SU 1. Were all the Crit 2. Was the task sta	MMARY: tical Element	-			
The operator's perfo determined to be: Comments:	E	□ Satisfactor	y ⊡l	Insatisfactory	
Note: Any grade o	of UNSAT rec	juires a comi			
Evaluator's Name):			_(Print)	
Evaluator's Signa	ature:			Da	te:
SIM JPM S-1.doc	·				

<u>Description:</u> This JPM has the applicant initiate RCIC in the Pressure Control Mode using OP-19. Maximize heat removal with RCIC to minimize SRV operations.

JPM S-1

NOTE: Critical Element(s) indicated by * in Performance Checklist.

PERFORMANCE CHECKLIST:

JPM Start Time _____

ELEMENT	STANDARD	SAT	UNSAT	Comment Number
1. Obtain a controlled copy of posted attachment, RCIC MANUAL START UP FOR RPV PRESSURE CONTROL; OP-	The applicant locates and obtains from a controlled copy of OP-19; D.2.			
19,D.2 or posted attachment at the 09-4 panel.	Applicant should verify that CST level is greater than 79.5 inches.			
<u>Caution</u> : Operating RCIC in pressure control mode with suction from the CST and CST level below 79.5 inches could cause vortexing.				
2. (step D.2.1) Verify HPCI auto- initiation condition is clear	Applicant verifies that there is no HPCI automatic initiating condition present of high drywell pressure or low RPV water level.			
3. (Step D.2.2) Verify Annunciator 09-4- 0-32 RCIC LOGIC RX LVL HI is clear.	Applicant verifies Annunciator 09-4-0-32 RCIC LOGIC RX LVL HI is clear.			
4. (Step D.2.3) Align RCIC to CSTs as follows.	Applicant verifies: a. CST Suct VLV 13MOV-			
a. Ensure open CST SUCT VLV 13MOV-18	18 red open indicating light is on.			
b. Ensure closed the following valves:	 b. INBD TORUS SUCT 13MOV-41 – closed 			
INBD TORUS SUCT 13MOV-41	c. OUTBD TORUS SUCT			
OUTBD TORUS SUCT 13MOV- 39	13MOV-39 - closed			
SIMULATOR BOOTH OPERATOR	EVALUATOR NOTE:			
Insert malfunction RC07; RCIC speed control failure high.	This malfunction will cause RCIC speed control to fail to high speed stop if operating in automatic.			

				JPM S-1
ELEMENT	STANDARD	SAT	UNSAT	Comment Number
* 5.(Step D.2.4)Open HPCI and RCIC TEST VLV TO CST 23MOV-24.	Applicant at Panel 09-3, opens 23MOV-24 by placing its control switch to the OPEN position.			
* 6. (Step D.2.5) Start VAC PMP 13P-3.	Applicant at Panel 09-4, starts pump 13P-3 by placing its control switch to the START position.			
* 7.(Step D.2.6) Open OIL CLR WTR SUPP 13MOV-132.	Applicant at Panel 09-4 opens 13MOV-132 by placing its control switch to the OPEN position.			
* 8. (Step D.2.7) Open TEST VLV TO CST 13MOV-30.	Applicant at Panel 09-4 opens 13MOV-30, by placing its control switch to the OPEN position.			
* 9. (Step D.2.8) Opens TURB STM SUPP VLV 13MOV-131.	Applicant at Panel 09-4, opens 13MOV-131, by placing its			
CAUTION: Operating RCIC at less than 2200 rpm could cause improper oil system operation and insufficient exhaust flow resulting in check valve banging or steam flow reversals.	control switch to the OPEN position.			
* 10. (Step D.2.9) Verify RCIC Flow rate is approximately 400 gpm.	Applicant adjusts RCIC flow rate is approximately 400 gpm on 13FI-91.			

				JPM S-1
ELEMENT	STANDARD	SAT	UNSAT	Comment Number
EVALUATOR NOTE: Applicant should recognize RCIC speed as failed high.	Applicant should inform the CRS of the failure of automatic speed control of the RCIC turbine; follow guidance of EN- OP-115 to place the RCIC turbine speed controller in manual. Examiner Note: The applicant may trip RCIC manually when speed fails high in order to			
	protect the RCIC turbine. Examiner: Role Play as CRS to direct the RO candidate to take manual control and establish pressure control with RCIC.			
	For SRO candidates ask them what they recommend for this situation.			
* 11. Applicant places RCIC flow controller in manual to control speed	Applicant places RCIC flow controller in manual to control speed			
 12. (Step D.2.10) Ensure closed the following valves: MIN FLOW VLV 13MOV-27. STM LINE DRN TO RADW 13AOV-34 STM LINE DRN TO RADW 13AOV-35 	Applicant observes that the green – closed indicating light for: • 13MOV-27 is on. • 13AOV-34 is on. • 13AOV-35 is on.			
NOTE	NOTE			
As RPV pressure lowers, indicated level on 02-3LI-283A may rise and result in an undesired trip at the red line high level trip value. Posted attachment 3 will give an equivalent trip level for 06LI- 94/A/B/C indicators on panel 09-5.	As RPV pressure lowers, indicated level on 02-3LI-283A may rise and result in an undesired trip at the red line high level trip value. Posted attachment 3 will give an equivalent trip level for 06LI- 94/A/B/C indicators on panel 09-5.			

ELEMENT	STANDARD	SAT	UNSAT	Comment Number
CAUTION	CAUTION			
Operating RCIC at less than 2200 rpm could cause improper oil system operation and insufficient exhaust flow resulting in check valve banging or steam flow reversals.	Operating RCIC at less than 2200 rpm could cause improper oil system operation and insufficient exhaust flow resulting in check valve banging or steam flow reversals.			
* 15.(Step D.2.11) <u>WHILE</u> controlling RPV pressure, maintain RCIC speed GREATER THAN 2200 rpm by throttling closed TEST VLV TO CST 13MOV-30.	At 09-4 Panel, monitors RCIC turbine speed on 13SPI-1 and throttles closed 13MOV-30 to ensure RCIC only runs below 2200 rpm during transient operation.			
* 16. (Step D.2.12) Throttle TEST VLV TO CST 13MOV-30, to obtain the desired RPV pressure control.	At Panel 09-4, throttles closed 13MOV-30 to begin the RPV depressurization by minimizing SRV operation.			
17. (Step D.2.13) Startup RHR Torus cooling per Section D of OP-13B, as soon as practicable.	EVALUATOR : Inform the applicant that another operator has been tasked with initiating Torus cooling.			
18. (Step D.2.14) Monitor Torus water temperature and level.	Observes EPIC or 09-3 Panel indicators to monitor Torus water temperature and level.			
19. (Step D.2.15) WHEN time permits, verify the following RCIC parameters:	Applicant verifies the following RCIC parameters:			
 Oil pump discharge pressure: 12 to 15 psig. 	Oil pump discharge pressure: 12 to 15			
 Oil temperature from cooler: GREATER THAN 60°F. 	Oil temperature from			
 Oil temperature from the turbine bearings: LESS THAN 160°F 	cooler: GREATER THAN 60°F.			
	 Oil temperature from the turbine bearings: LESS THAN 160°F 			
EVALUATOR: Terminate the task at this point.				

JPM Stop Time _____

HANDOUT PAGE

JPM S-1

TASK CONDITIONS:

- 1. Plant is in a post-scram condition with RPV level between 177" and 222.5".
- 2. RPV pressure is between 700 psig and 1000 psig and rising slowly.
- 3. Main Steam Isolation valves are closed.

INITIATING CUE:

You are the RO, 'The CRS directs you to start the RCIC System for RPV pressure control using OP-19; D.2. Maximize heat removal with RCIC to minimize SRV operations.

James A. Fitzpatrick Generating Station					
	Job Performance Measure				
	HPCI Full Flow Test				
	JPM Number: S-2				
	Revision Number: 1				
	Date: <u>02/04/2010</u>				
Developed By:	<u>B. Litkett</u> Author	<u>02/04/10</u> Date			
Validated By:	Facility Representative	 Date			
Review By:	Examiner	 Date			
Approved By:	Chief Examiner	Date			

Б

JOB PERFORMANCE MEASURE VALIDATION CHECKLIST

NOTE: All steps of this checklist should be performed upon initial validation. Prior to JPM usage, revalidate JPM using steps 8 through 11 below.

1. Task description and number, JPM description and number are identified. Knowledge and Abilities (K/A) references are included. 3. Performance location specified. (in-plant, control room, or simulator) 4. Initial setup conditions are identified. 5. Initiating and terminating cues are properly identified. 6. Task standards identified and verified by Examiner review. 7. Critical steps meet the criteria for critical steps and are identified with an asterisk (*). 8. Verify the procedure referenced by this JPM matches the most current revision of that procedure: Procedure Rev. ____ Date ____ 9. Pilot test the JPM: a. verify cues both verbal and visual are free of conflict, and b. ensure performance time is accurate. 10. If the JPM cannot be performed as written with proper responses, then revise the JPM. 11. When JPM is revalidated, Examiner sign and date JPM cover page.

REVISION RECORD (Summary):

1. Rev 0

JPM Setup Instructions:

- 1. Reset simulator to IC-41.
- 2. Place RHR in torus cooling mode IAW OP-13B, Section D.
- 3. Start GLAND SEAL CNDSR BLOWER 23P-140.
- 4. Throttle open TEST VALVE TO CST 23MOV-21 for 5 seconds.
- 5. Simulator operator override RED light ON, GREEN light OFF for TEST VALVE TO CST 23MOV-24. ZLO23A59-1, GREEN and ZLO23A59-2, RED.
- Simulator operator override TEST VALVE TO CST 23MOV-24 handswitch to CLOSE. ZD123A59. (Setup Steps #5 and #6 above simulate sheared valve stem. 23MOV-24 is closed, but indicates open.)
- 7. Simulator operator override MIN FLOW VALVE 23MOV-25 handswitch to CLOSE. ZD123A58. (simulates switch problem which maintains min flow valve closed).
- 8. Markup copy of ST-4N, HPCI QUICK-START, INSERVICE, AND TRANSIENT MONITORING TEST (IST), completed through Section 8.3. and Venting Torus per OP-37, Section E..
- 9. Initiate EPIC four-parameter plot TRHPCI.

TOOLS AND EQUIPMENT

- Marked-up copy of ST-4N, HPCI QUICK-START, INSERVICE, AND TRANSIENT MONITORING TEST (IST), completed through Section 8.3 and thru Step 8.4.6.
- Stopwatch

TASK STANDARD:

Start HPCI for testing in accordance with procedure. Identify the pump has inadequate (no) flow and trip HPCI before the pump is damaged.

TASK CONDITIONS:

- 1. The plant is operating at-power.
- 2. Field personnel are briefed and stationed to support performance of ST-4N.
- 3. One loop of RHR is in Torus Cooling Mode.
- 4. Another operator is monitoring and controlling Torus level and temperature.
- 5. Venting Torus per OP-37 section E.

INITIATING CUE:

You are directed to continue performance of ST-4N, HPCI QUICK-START, INSERVICE, AND TRANSIENT MONITORING TEST (IST) at Step 8.4.7

HPCI Full Flow Test JPM Title:

JPM Number: S-2

Revision Number: 0

K/A Number and Importance:

206000 A2.06 - High Pressure Coolant Injection System. The ability to (a) predict the impacts of the following on the HIGH PRESSURE COOLANT INJECTION SYSTEM; and (b) based on those predictions, use procedures to correct, control, or mitigate the consequences of those abnormal conditions or operations: Inadequate system flow (3.3, 3.5)

Suggested Testing Environment: Simulator

Actual Testing Environment:

Testing Method: Perform in Simulator

Alternate Path: Yes

Time Critical: No

Estimated Time to Complete: 15 min Actual Time Used:	minutes
--	---------

References:

- 1. NUREG 1123, Knowledge and Abilities Catalog for Nuclear Power Plant Operators Boiling Water Reactors
- 2. ST-4N, HPCI QUICK-START, INSERVICE, AND TRANSIENT MONITORING TEST (IST)
- 3. OP-37; Venting the Torus per section E.

EVALUATION SUMMARY:

- 2. Was the task standard met?

The operator's performance was evaluated against the standards contained in this JPM, and has been Satisfactory Unsatisfactory determined to be: Comments:____

Note: Any grade of UNSAT requires a comment.

Evaluator's Name: _____(Print)

Evaluator's Signature:

Date: _____

SIM JPM S-2.doc

Description: This JPM has the applicant start the HPCI pump for a full flow test from the Torus back to the CST through Test MOVs 24 and 21. Upon start, the flow will remain at 0 gpm due to MOV-24 sheared stem and a failure of the Min Flow MOV-25 to open. The applicant is expected to recognize the unacceptable operational conditions and trip the HPCI pump turbine before the pump is damaged.

JPM S-2

NOTE: Critical Element(s) indicated by * in Performance Checklist.

PERFORMANCE CHECKLIST:

JPM Start Time _____

ELEMENT	STANDARD	SAT	UNSAT	Comment Number
1. Obtain procedure	Applicant reviews completed sections of ST and begins implementation at Section 8.4			
* 2. (Step 8.4.7) IF RPV pressure is GREATER THAN OR EQUAL TO 165 psig, THEN open and time OUTBD STM SUPP VLV 23MOV-16.	Applicant opens 23MOV-16 and records open stroke time within limits of 4.9 to 8.2 seconds.			
Opening time secs (IST: 4.9 to 8.2)				
3. (Step 8.4.8) Ensure open OUTBD STM SUPP VLV 23MOV-16.	Applicant verifies OUTBD STM SUPP VLV 23MOV-16 is open.			
 4(Step 8.4.9) Verify the following: EPIC-D-457 HPCI STM OUTB ISO-C indicates OPEN EPIC-D-458 HPCI STM OUTB ISO-0 indicates NFC 	Applicant calls up EPIC points and verifies D-457 OPEN and D-458 NFC			
Note: Loss of inventory to torus will cause hotwell level will trend down.				
5. (Step 8.4.10) Automatic or manual compensation may be required to maintain hotwell level.	No response required.			

			JFI	M S-2
ELEMENT	STANDARD	SAT	UNSAT	Comment Number
 6. (Step 8.4.11) Perform the following in any order, just before turbine startup: A. Initiate EPIC manual transient data capture per CDSO-3.600. B. IF RPV pressure is GREATER THAN OR EQUAL TO 165 psig, THEN direct I&C to start all installed transient recorder(s) at desired speed (normally 25 mm/sec). 	Evaluator Cue: I&C has started all installed transient recorders at the desired speed.			
 7. (Step 8.4.12) IF test is being performed to satisfy SR 3.5.1.9, THEN RPV pressure must be >150 psig but ≤165 psig and HPCI steam supply pressure must be ≥135 psig. 	No response required.			
 8. * (Step 8.4.13) Simultaneously perform the following: Open TURB STM SUPP VLV 23MOV-14. Start AUX OIL PMP 23P-150. IF RPV pressure is GREATER THAN OR EQUAL TO 165 psig, THEN Start stopwatches. 	Applicant simultaneously opens 23MOV-14 and starts 23P-150. Evaluator Cue: Record time HPCI was started. HPCI start time			
 9. (Step 8.4.14) IF RPV pressure is GREATER THAN OR EQUAL TO 970 psig, THEN record null voltage for approximately 1 to 2 minutes during turbine startup (cold condition). 	Evaluator Cue: I&C are recording voltage.			

JPM S-2

			JP	<u>M S-2</u>
ELEMENT	STANDARD	SAT	UNSAT	Comment Number
 10. *(Step 8.4.15) Verify the following: Turbine speed stabilized after startup transient and remained LESS THAN 4200 rpm during the startup transient (23SPI-161 or EPIC TRHPCI speed trace) 23HOV-1 opens smoothly by local observation. Turbine vibration is LESS THAN OR EQUAL TO limits (0.385 IPS) Turbine accelerates smoothly (by observing TURB SPEED 23SPI- 161 OR EPIC TRHPCI speed trace). HPCI pump discharge flow rate stabilizes at GREATER THAN OR EQUAL TO 3400 gpm on 23FI- 108-1 MIN FLOW VLV 23MOV-25 is closed. STM LINE DRN TO RADW 23AOV-43 is closed. STM LINE DRN TO RADW 23AOV-42 is closed. 	Applicant notes HPCI pump discharge flow rate does NOT stabilize at ≥3400 gpm AND Min Flow Valve 23MOV-25 is closed. CUE: If applicant informs CRS that pump is running without adequate flow, then acknowledge the report. EXAMINER NOTE: Applicant may trip the HPCI pump at this time. If so, terminate the JPM.			
11. Acknowledge alarms.	Applicant acknowledges alarms and refers to 09-3-3-15 HPCI PMP FLOW LO			
12. (ARP Step 1) Verify open MIN FLOW VLV 23MOV-25.	Applicant determines MOV-25 is not open.			
 (ARP Step 2) Verify expected turbine speed and pump discharge pressure. 	Applicant determines speed is normal and pump discharge pressure is high.			
 14. (ARP Step 3) IF HPCI initiation signal is present, THEN ensure open: INJ VLV 23MOV-19 PMP DISCH VLV 23MOV-20 	No response required. HPCI initiate signal not present.			
15. * (ARP Step 4) Consider securing HPCI if flow can not be restored.	Applicant trips HPCI pump.			

JPM S-2

			<u>JP</u>	M S-2
ELEMENT	STANDARD	SAT	UNSAT	Comment Number
2. IF applicant does NOT stop H opportunity for applicant to sto	b, <u>THEN TERMINATE THE JP</u> IPCI pump, <u>THEN ALLOW JP</u> op HPCI pump before it becom be terminated after several m	M TO C nes dam	laged from	I
The following steps may be performed by the performance of the steps may be performed by the performance of	ormed if applicant does not im n	nediatel	y recogniz	e need to
 16. (Step 8.4.16) IF RPV pressure is GREATER THAN OR EQUAL TO 165 psig, THEN perform the following in any order or concurrently: A. WHEN all parameters have stabilized on EPIC plot TRHPCI, AND AT LEAST two minutes have elapsed, direct I&C to stop all installed transient recorder(s). B. Record the following: 23HOV-1 response time 23HOV-1 opening time (IST: 15.4 to 25.6 secs) 23MOV-14 opening time (IST: 6.4 to 10.5 secs) 	 EVALUATOR CUE: I&C has stopped recorders. Times are as follows: 23HOV-1 response time = 19.3 sec 23HOV-1 opening time = 17.4 sec 23MOV-14 opening time = 8.1 sec 			
NOTE 1: TRHPCI printout is required wind 15 minutes of turbine startup to starting transient is included or	o ensure			
NOTE 2: Test may be continued before step is complete.	the next			

JPM	S-2
-----	-----

				VI 3-2
ELEMENT	STANDARD	SAT	UNSAT	Comment Number
 17. (Step 8.4.17) IF RPV pressure is GREATER THAN OR EQUAL TO 165 psig, THEN 1&C or Engineering review recorder trace and verify the following: HPCI flow rate reached GREATER THAN OR EQUAL TO 3400 gpm within 60 seconds of initiation. HPCI flow rate remained GREATER THAN OR EQUAL TO 3400 gpm after 60 seconds from initiation and through stabilization. 	EVALUATOR CUE: I&C is reviewing data.			
NOTE: HPCI response time is measured from Step 8.4.13 until flow rate reaches and remains GREATER THAN OR EQUAL TO 3400 gpm.				
 HPCI response time from recorder trace is <i>LESS</i> <i>THAN</i> 60 seconds. 				
 18. (Step 8.4.18) IF RPV pressure is LESS THAN 165 psig, THEN review EPIC TRHPCI trace and verify the following: HPCI flow rate reached GREATER THAN OR EQUAL TO 3400 gpm. HPCI flow rate remained GREATER THAN OR EQUAL TO 3400 gpm through stabilization. 	No response required. RPV pressure is greater than 165 psig.			

			JPM S-2		
ELEMENT	STANDARD	SAT	UNSAT	Comment Number	
CAUTION	<u> </u>				
Failure to closely monitor HPC could result in exceeding HPC 1320 psig.					
 19. (Step 8.4.19) Establish HPCI pump discharge pressure as follows: A. IF RPV pressure is GREATER THAN OR EQUAL TO 970 psig, THEN throttle TEST VLV TO CST 23MOV-21 to establish BOTH of the following conditions: HPCI turbine speed GREATER THAN 2100 rpm on TURB SPEED 23SPI-161 AND HPCI pump discharge pressure GREATER THAN OR EQUAL TO 1250 psig on DISCH PRESS 23PI-109 					
 20. (Step 8.4.19 continued) B. IF RPV pressure is LESS THAN 970 psig, 	Not applicable. RPV pressure is greater than 970 psig.				
	EXAMINER:		I,		
The pump has been running without	flow for several minutes. Ter	minate t	he task at t	his point.	

JPM Stop Time _____

HANDOUT PAGE

TASK CONDITIONS:

- 1. The plant is operating at-power.
- 2. Field personnel are briefed and stationed to support performance of ST-4N.
- 3. One loop of RHR is in Torus Cooling Mode.
- 4. Another operator is monitoring and controlling Torus level and temperature.
- 5. Venting Torus per OP-37 section E.

INITIATING CUE:

You are directed to continue performance of ST-4N, HPCI QUICK-START, INSERVICE, AND TRANSIENT MONITORING TEST (IST) at Step 8.4.7.

JPM S-2

J	James A. Fitzpatrick Generating Station				
	Job Performance Measure				
Reacto	or Scram with a Control Rod Inserti	on Failure			
	JPM Number: S-3				
	Revision Number: 1				
	Date: <u>1/13/10</u>				
Developed By:	Bernard Litkett	<u>1/13/10</u>			
Validated By:	Author	Date			
	Facility Representative	Date			
Review By:					
Approved By:	Examiner	Date			
	Chief Examiner	Date			

JOB PERFORMANCE MEASURE VALIDATION CHECKLIST

<u>NOTE</u>: All steps of this checklist should be performed upon initial validation. Prior to JPM usage, revalidate JPM using steps 8 through 11 below.

 1. Task description and number, JPM description and number are identified.
 2. Knowledge and Abilities (K/A) references are included.
 3. Performance location specified. (in-plant, control room, or simulator)
 4. Initial setup conditions are identified.
 5. Initiating and terminating cues are properly identified.
 6. Task standards identified and verified by Examiner review.
 Critical steps meet the criteria for critical steps and are identified with an asterisk (*).
 8. Verify the procedure referenced by this JPM matches the most current revision of that procedure: Procedure Rev Date
 Pilot test the JPM: a. verify cues both verbal and visual are free of conflict, and b. ensure performance time is accurate.
 10. If the JPM cannot be performed as written with proper responses, then revise the JPM.
 11. When JPM is revalidated, Examiner sign and date JPM cover page.

REVISION RECORD (Summary):

1. Rev 0

JPM Setup Instructions:

Reset the simulator to appropriate IC-40, Reactor Power should be approximately 5%. Insert Malfunction (RD13; 18:27) for Stuck Rod for a Full-out Control Rod 18:27.

TOOLS AND EQUIPMENT

1. Key to bypass RWM

TASK STANDARD:

Insertion of Manual Reactor Scram with a Control Rod insertion failure

TASK CONDITIONS:

- 1. The reactor is operating near 5% reactor power and conditions exist that require a reactor scram.
- 2. The Shift Manager has directed a manual scram and performance of AOP-1, Reactor Scram immediate actions.

INITIATING CUE:

You are the RO. The CRS directs you to manually scram the reactor and carry out the actions of AOP-1.

Information for Evaluator's Use:

UNSAT requires written comments on respective step.

* Denotes CRITICAL steps.

Number any comments in the "Comment Number" column. Then annotate that comment in the "Comments" section. The comment section should be used to document the reason that a step is marked as unsatisfactory and to document unsatisfactory performance relating to management expectations.

Some operations that are performed from outside of the control room may require multiple steps. These items may be listed as individual steps in this JPM. It is acceptable for the applicant to direct the local operator to perform groups of procedure steps instead of calling for each individual item to be performed.

The timeclock starts when the applicant acknowledges the initiating cue.

Operator's Name: _ Job Title:		S		SRO Cer	t		
JPM Title: Insertion	n of Manual Rea	ctor Scra	m with a C	ontrol Rod	insertion	failure	
JPM Number: S-3							
Revision Number:	0						
K/A Number and Im	portance: KA 21	2000 A4.0	01 4.6 (SR0	C)			
Suggested Testing	Environment: S	imulator					
Actual Testing Envi	ronment:						
Testing Method:	Perform in Sim	ulator					
Alternate Path: YE	S						
Time Critical: No							
Estimated Time to	Complete:	15 min.	Actual Ti	me Used:		minutes	
References : 1. NUREG 1123, 21 2. AOP-1; Reactor S	•	SRO)					
EVALUATION SUM 1. Were all the Critic 2. Was the task stan	al Elements perfo	ormed sati	sfactorily?	□ Yes □ N	0		•
The operator's perfo determined to be: Comments:	rmance was eval □ Satisfactory 		inst the sta Jnsatisfac		ained in th	nis JPM, and ha	as been
Note: Any grade of	UNSAT requires	a commen	nt.				
Evaluator's Name:		_		_(Print)			
Evaluator's Signatu	ıre:				Date:		-

Description: This JPM will require insertion of Manual Reactor Scram with a Control Rod insertion failure

JPM S-3

NOTE: Critical Element(s) indicated by * in Performance Checklist.

PERFORMANCE CHECKLIST:

JPM Start Time _____

ELEMENT	STANDARD	STANDARD SAT UN		Comment Number
* 1.(Step E.1) If a manual scram is required, THEN depress the following pushbuttons:	Applicant depresses the manual scram pushbuttons.			
MANUAL SCRAM A MANUAL SCRAM B	NOTE: The applicant should observe:			
	Annunciators 09-5-1-13, 14, RPS MAN SCRAM alarms.			
	SCRAM GROUPS 1, 2, 3, 4 lights are off.			
* 2. (Step E.2) Place RX MODE switch in SHUTDOWN.	Applicant places RX MODE switch in the SHUTDOWN position.			
NOTE: The immediate operator actions i	n Steps 3 through 7 may be perfe	ormed co	oncurrently.	
* 3. (Step E.3) Fully insert the IRMs and SRMs. <u>NOTE:</u> Since low power IRMs are already	Applicant select and drive in fully all IRMs and SRMs. <u>NOTE:</u> Since low power IRMs are already inserted.			
inserted.				
 4. (Step E.4) Verify reactor power is rapidly lowering using any of the following nuclear instrumentation responses: APRMs recorders or downscale indicating lights Fully inserted IRMs trending down (recorder selector switch to IRM position) Fully inserted SRMs trending down 	 Applicant verifies power rapidly lowering using one of the following: APRM recorders indicate downscale and/or observing that the APRM downscale lights are lit Fully inserted IRMs trending down for those IRMs selected on the recorder Fully inserted SRMs trending down on recorder or meters 			

		_	JF	<u>PM S-3</u>
ELEMENT	STANDARD	SAT	UNSAT	Comment Number
 * 5. (Step E.5) Verify the reactor will remain shutdown under all conditions without boron using one or more of the following methods: Green FULL IN light on full core display (preferred method) Rods In Monitor Program indication (EPIC Screen RIMP) SPDS plant display control rods full-in indication Four rod display notch position indication EPIC full core rod scan notch position 	Applicant using one or more of the methods listed observes that one control rod is full out, all others are full in and informs CRS that one rod is full out.			
6. (Step E.6) If multiple rods are withdrawn, then initiate ARI.	Applicant observes that only 1 rod is full out, all others are full in. NOTE: It is plausible that the applicant could initiate ARI due to the rod not full in. This would however, be contrary to the guidance in AOP-1. With the RD13 simulator malfunction inserted the rod will not insert.			
7. (Step E.7) Ensure closed SDIV vent and drain valves.	Applicant observes SDIV vent and drain valve position indicating lights. Verify that the green (closed) lights come on after the red (open) indicating lights go off.			

			_JP	M S-3
ELEMENT	STANDARD	SAT	UNSAT	Comment Number
8. (Step E.8) WHEN APRM's are downscale, THEN perform the following: a. Ensure Main Turbine is tripped.	 Applicant ensure main turbine is tripped by observing: a. Annunciator 09-5-2-9 MAIN TURB TRIP is in alarm Amber (tripped) light is 			
b. Verify 4 KV loads transfer to reserve power.	on at EHC control on 09-5 Panel Position indicating meters for main turbine SV's, CV's and CIV's indicate 0% at EHC control.			
	 b. Verify 4KV loads transferred by observing greater than 3.9 KV on: Bus 10500 volt meter on Panel 09-8. Bus 10600 voltmeter on Panel 09-8. 			
9. (Step E.9) If circulating water pumps are tripped, then ensure closed MSIV's.	Applicant observes circulating water pumps A and/or B running with red indicating light on.			
10. (Step E.10) If both recirc pumps are tripped, then minimize RPV bottom head cooldown per Attachment 6 of AOP-1.	Applicant observes Recirc pumps status by checking red/green light indication and/or pump flows.			
EVALUATOR CUE : If recirc pumps have tripped, inform applicant that Attachment 6 of AOP-1 will be performed by another operator	EVALUATOR CUE : If recirc pumps have tripped, inform applicant that Attachment 6 of AOP-1 will be performed by another operator.			
11. (Step F.1.1) IF any control rod <u>IS</u> <u>NOT</u> full in, AND <u>NO</u> EOP-3 entry condition is present, THEN perform attachment 4 or 5 as directed by the SM or CRS.	EVALUATOR CUE : When asked, CRS directs inserting control rod with RMCS. Applicant selects attachment 4.			
EVALUATOR CUE: When asked, CRS directs inserting control rod with RMCS applicant selects attachment 4.				

			<u>M S-3</u>	
ELEMENT	STANDARD	SAT	UNSAT	Comment Number
* 12. (Attachment 4, step 2) Place RWM keylock switch in BYPASS in RWM console.	Applicant places RWM keylock switch in BYPASS.			
13.(Attachment 4, step 3) Reset Reactor Scram as follows: If ARI has actuated then reset ARI. EVALUATOR CUE : ARI should not have actuated during the scram, but if it did then reset it per Attachment 4, step 3	EVALUATOR CUE: ARI should not have actuated during the scram, but if it did then reset it per Attachment 4, step 3			
14. (Attachment 4, step 3.b) Verify Annunciator 09-5-1-33 MODE SW IN SHUTDOWN TRIP BYPASSED is in alarm.	Applicant verifies 09-5-1-33 is in alarm.			
15. (Attachment 4, step 3.c) Place SDIV HI LVL TRIP keylock switch in BYPASS.	Applicant places SDIV HI LVL TRIP keylock switch in BYPASS.			
16. (Attachment 4, step 3.d) Place RX SCRAM RESET switch to group 2 & 3 then to 1 & 4, spring return to NORM.	Applicant places RX SCRAM RESET switch in group 2 & 3, then to group 1 & 4, spring return to NORM.			
CAUTION: If only RPS Group 1 and 4 is reset, SDIV vent and drain valves will open, creating a drain path from the RPV, through the RPS Group 2 and 3 scram outlet valves, to the Reactor Building equipment drain sumps.				
17. (Attachment 4,step 3.e) Verify RPS A and B Scram Group 1, 2, 3, and 4 lights are on.	Applicant verifies RPS A and B Scram Groups 1, 2, 3, and 4 lights are on.			
 18. (Attachment 4,step 3.f) Verify closed all scram inlet and outlet valves using one or a combination of the following methods: Blue SCRAM lights on FULL CORE DISPLAY Local valve position indication 	Applicant verifies all blue SCRAM lights are out on FULL CORE DISPLAY.			
19. (Attachment 4,step 3.h) Verify open SDIV vent and drain valves.	Applicant verifies red open lights are on and green closed lights are out for SDIV vent and drain valves at panel 09-5.			

.

JPM S-3

ELEMENT	STANDARD	SAT	UNSAT	Comment Number
 20a. (Attachment 4,step 3.i) When the following annunciators are clear: 09-5-1-1 SDIV A or B HI LVL TRIP 09-5-1-44 SDIV A or B NOT DRAINED Place SDIV HI LVL TRIP keylock switch 	 a. Applicant observes that annunciators 09-5-1-1 and 09-5-1-44 are clear. Applicant places SDIV HI LVL TRIP keylock switch in NORMAL. 			
in NORMAL.				
	e performed after rod insertion a	s there is	s only one <u>r</u>	od out.
21. (Attachment 4,step 3.j) Perform post scram reset control rod	Goes to section G.2 for post scram reset control rod			
position check per section G.2. as soon as practicable.	position check.			

JPM S-3			M S-3	
ELEMENT	STANDARD	SAT	UNSAT	Comment Number
 * 22. (Attachment 4, step 6) Raise CRD drive water differential pressure using one or more of the following methods in the listed order of priority: 	Applicant closes or throttles closed 03MOV-20 without exceeding 600 psid drive water D/P to establish elevated drive water D/P.			
CAUTION: Drive water differential pressure is limited to less than 600 psid with reactor pressure below 650 psig to prevent damage to drive mechanism seals.	inform applicant to use the first priority option. Other options may be selected and utilized.			
EVALUATOR CUE: If asked, inform applicant to use the first priority option. Other options may be selected and utilized.				
Close CRD DRV WTR PRESS VLV 03MOV-20				
 Raise CRD System flow using CRD FLOW CNTRL 03FIC-301 				
Start second CRD pump				
 Close 03CRD-56 (CRD charging water supply header isol valve) 				
 Close the following valves: 03CRD-177A (CRD water pump A min flow isol valve) 03CRD-177B (CRD water pump B min flow isol valve) 				
 * 23.(Attachment 4, step 7) Attempt to insert each withdrawn control rod in the order specified in Attachments 1,2 and 4 as follows: a. Select control rod on ROD SEL matrix. b. Insert control rod using one of the following switches: ROD MOVEMENT CNTRL ROD EMERG IN NOTCH 	 Applicant selects stuck rod on ROD SEL matrix. Inserts rod to full in using either the ROD MOVEMENT CNTRL held in the IN position. OR Holding the ROD EMERG IN NOTCH OVERRIDE IN EMERG 			
OVERRIDE 25. Reports that all rods are full in.	ROD IN. Reports all rods are full in.			

JPM S-<u>3</u>

Applicant verifies all control rods have settled from the overtravel position back to notch position (00) by observing onelights are on except for the rod stuck out. • Resets the ROD					
 Applicant verifies all control rods have settled from the overtravel position back to notch position (00) by observing one or more of the following: Green FULL IN lights are on and red DRIFT lights are off at full core display. Full core scram indicates 00. Four rod display indicates 00. Four rod display indicates 00. Verifies four rod display indicates 00. Verifies four rod display indicates 00. Verifies four rod display indicates 00 for all rods except the one stuck out. 	ELEMENT	STANDARD	SAT	UNSAT	
EVALUATOR: Terminate the task at this point.	 settled from the overtravel position back to notch position (00) by observing one or more of the following: Green FULL IN lights are on and red DRIFT lights are off at full core display. Full core scram indicates 00. 	 lights are on except for the rod stuck out. Resets the ROD DRIFT and verifies the red DRIFT lights are off at full core display OR Runs and verifies Full Core Scram indicates 00 for all rods except the one stuck out OR Verifies four rod display indicates 00 for all rods except the one 			
	EVALUATOR: Terminate the task at this	point.			

JPM Stop Time _____

HANDOUT PAGE

JPM S-3

TASK CONDITIONS:

- 1. The reactor is operating near 5% reactor power and conditions exist that require a reactor scram.
- 2. The Shift Manager has directed a manual scram and performance of AOP-1, Reactor Scram immediate actions.

INITIATING CUE:

You are the RO. The CRS directs you to manually scram the reactor and carry out the actions of AOP-1.

James	James A. Fitzpatrick Generating Station			
	Job Performance Measure			
SPRA	Y THE DRYWELL WITH RHRSW (ALTE	RNATE PATH)		
	JPM Number: S-4			
	Revision Number: 2			
	Date: <u>1/20/10</u>			
Developed By:	<u>Bernard Litkett</u> Author	<u>1/20/10</u> Date		
Validated By:	Facility Representative	 Date		
Review By:	 Examiner	 Date		
Approved By:	Chief Examiner	Date		

JOB PERFORMANCE MEASURE VALIDATION CHECKLIST

<u>NOTE:</u> All steps of this checklist should be performed upon initial validation. Prior to JPM usage, revalidate JPM using steps 8 through 11 below.

 Task description and number, JPM description and number are identified. 2. Knowledge and Abilities (K/A) references are included. 3. Performance location specified. (in-plant, control room, or simulator) 4. Initial setup conditions are identified. 5. Initiating and terminating cues are properly identified. 6. Task standards identified and verified by Examiner review. 7. Critical steps meet the criteria for critical steps and are identified with an asterisk (*). 8. Verify the procedure referenced by this JPM matches the most current revision of that procedure: Procedure Rev. ____ Date _____ 9. Pilot test the JPM: a. verify cues both verbal and visual are free of conflict, and b. ensure performance time is accurate. 10. If the JPM cannot be performed as written with proper responses, then revise the JPM. 11. When JPM is revalidated, Examiner sign and date JPM cover page.

REVISION RECORD (Summary):

1. Rev 0

JPM Setup Instructions:

- 1. Simulator should be reset to an IC-46 that has the following conditions:
 - Reactor level is at TAF
 - DW spray is required with temperature and pressure within DWSIL
 - RHR Pump 'A' and 'C' is not available for DW spray. RHR 'A' and 'C' breakers are racked out. (RH42A RHR A racked out and RH42C RHR C racked out.)
 - Insert RH12 TORUS OUTLET VLV (151B) TO RHR LOOP B to close valve and use override to have the valve indicate open. (OL-RHZL010151B(1) Mimic RHR Suct from JP (green light off)- reset

(OL-RHZ1010151B(2) Mimic RHR Suct from JP (red light on) - reset

TOOLS AND EQUIPMENT

1. None

TASK STANDARD:

Due to RHR strainers clogged, drywell sprays will be performed using RHRSW as alternate containment spray in service IAW EP-14; Rev. 3

TASK CONDITIONS:

- 1. A steam leak in the drywell has occurred and a reactor scram was performed.
- 2. The CRS has implemented the appropriate EOPs.
- 3. ESW is in service.
- 4. Suppression chamber pressure is greater than 15 psig.
- 5. 'A' loop of RHR was OOS for maintenance prior to the transient and is unavailable.
- 6. Both reactor Recirc pumps are shutdown and all drywell cooling fans have been stopped.
- 7. Drywell sprays are required for High Drywell temperature IAW with the EOPs.
- 8. RPV level is being restored with HPCI.
- 9. Torus Spray Valve 10MOV-38B has failed to open.

INITIATING CUE:

You are the RO. The CRS has directed you to lineup to spray the Drywell using 'B' and 'D' RHR pumps per posted attachment for Drywell spray.

Information for Evaluator's Use:

UNSAT requires written comments on respective step.

* Denotes CRITICAL steps.

Number any comments in the "Comment Number" column. Then annotate that comment in the "Comments" section. The comment section should be used to document the reason that a step is marked as unsatisfactory and to document unsatisfactory performance relating to management expectations.

Some operations that are performed from outside of the control room may require multiple steps. These items may be listed as individual steps in this JPM. It is acceptable for the applicant to direct the local operator to perform groups of procedure steps instead of calling for each individual item to be performed.

The timeclock starts when the applicant acknowledges the initiating cue.

Operator's Name: Job Title:		RO	SRO		□ SRO Cert
JPM Title: SPRAY	THE DRYW	ELL WITH RHF	- RSW (ALTERN	ATE PATH)	
JPM Number: S-4					
Revision Number	: 2				
K/A Number and I	mportance	: KA 226001 A	2.15 3.6, 3.8		
Suggested Testin	g Environn	nent: Simulat	or		
Actual Testing En	vironment	:			
Testing Method:	Perform in S	Simulator			
Alternate Path: Y	ES				
Time Critical: No					
Estimated Time to	o Complete	: 20 min.	Actual Time	Used:	minutes
References: 1. NUREG 1123, 22 2. Posted instructio 3. EP-14, Alternate	ns for Drywe	II Spray startup		R Containment	Control, Attachment 3.
EVALUATION SUI 1. Were all the Crit 2. Was the task sta	ical Elemen	•	satisfactorily?	🗆 Yes 🗆 N	lo
The operator's perfo determined to be: Comments:		Satisfactory	/ 🗆 L	Insatisfactory	
Note: Any grade o	f UNSAT re	quires a comr	ment.		<u> </u>
Evaluator's Name	:		_	_(Print)	
Evaluator's Signa	ture:			Dat	e:

SIM .	JPM	S-4.	doc
-------	-----	------	-----

<u>Description:</u> This JPM will have the applicant place drywell spray using 'B' and 'D' RHR pumps in service IAW the posted attachment but due to strainer clogging will have to re-align and spray the Drywell with alternate containment sprays - RHRSW loop 'B' cross-tie containment spray (drywell) in service.

JPM S-4

NOTE: Critical Element(s) indicated by * in Performance Checklist.

PERFORMANCE CHECKLIST:

JPM Start Time _____

ELEMENT	STANDARD	SAT	UNSAT	Comment Number
1. Applicant obtains posted instructions for Drywell Spray	Applicant obtains posted instructions for Drywell Spray			
2. Ensure the following components are tripped:	Applicant ensures the following components are tripped:			
RWR Pumps • 02-2P-1A • 02-2P-1B	RWR Pumps • 02-2P-1A • 02-2P-1B			
Drywell Cooling Fans • 68FN-2A, B, C, and D • 68FN-4A, B, C, and D	Drywell Cooling Fans • 68FN-2A, B, C, and D			
3. Applicant verifies drywell temperature and pressure are within the Drywell Spray Initiation Limit	68FN-4A, B, C, and D Applicant verifies drywell temperature and pressure are within the Drywell Spray Initiation Limit.			
* 4. IF RPV water level is LESS THAN 10 inches on fuel zone water level indication, AND the EOPs permit diverting LPCI flow, THEN place DW & Torus Spray VLV OVERRIDE OFFUEL ZONE LVL10A-S18A(B) keylock in MANUAL OVERRD	Applicant verifies IF RPV water level is LESS THAN 10 inches on fuel zone water level indication, AND the EOPs permit diverting LPCI flow, THEN place DW & Torus Spray VLV OVERRIDE OFFUEL ZONE LVL10A- S18A(B) keylock in MANUAL OVERRD			
* 5. Place SPRAY CNTRL 10A-S17B switch to MANUAL, spring return to normal.	Applicant places SPRAY CNTRL 10A-S17B switch to MANUAL, spring return to normal.			
6. Verify white SPRAY PERM 10A- DS67B light is on.	Applicant verifies white SPRAY PERM 10A-DS67B light is on.			

JPM S	S-4
-------	-----

				<u></u>
ELEMENT	STANDARD	SAT	UNSAT	Comment Number
CAUTION Starting an RHR pump in an RHR loop that is not full could result in severe water hammer and equipment damage. RHR piping shall be full prior to manually starting an RHR pump in that loop.	CAUTION Starting an RHR pump in an RHR loop that is not full could result in severe water hammer and equipment damage. RHR piping shall be full prior to manually starting an RHR pump in that loop.			
 7. Ensure available RHR pumps in RHR Loop B are running: RHR PMP 10P-3B RHR PMP 10P-3D 	Applicant ensures available RHR pumps in RHR Loop B are running: • RHR PMP 10P-3B • RHR PMP 10P-3D			
* 8. Open DW SPRAY OUTBD VLV 10MOV-26B.	Applicant opens DW SPRAY OUTBD VLV 10MOV-26B.			
SIMULATOR BOOTH OPERATOR Insert RH12 TORUS OUTLET VLV (151B) TO RHR LOOP B to close valve and use override to have the valve indicate open. Malfunction to clog RHR Suction strainers and produce indications of severe cavitation due to insufficient NPSH will be evident once flow is commenced.	SIMULATOR BOOTH OPERATOR Insert RH12 TORUS OUTLET VLV (151B) TO RHR LOOP B to close valve and use override to have the valve indicate open. Malfunction to clog RHR Suction strainers and produce indications of severe cavitation due to insufficient NPSH will be evident once flow is commenced.			
* 9. Throttle DW SPRAY INBD VLV 10MOV-31B to establish desired drywell spray flow rate.	Applicant throttles DW SPRAY INBD VLV 10MOV-31B to establish desired drywell spray flow rate.			
10. WHEN RHR Loop B flow is GREATER THAN 1500 gpm, ensure closed MIN FLOW VLV 10MOV-16B	Applicant ensures WHEN RHR Loop B flow is GREATER THAN 1500 gpm, ensure closed MIN FLOW VLV 10MOV-16B			
* 11. Applicant should recognize RHR strainer are clogged by fluctuating motor amps and discharge pressure.	Applicant should recognize RHR strainer are clogged by fluctuating motor amps and discharge pressure.			

			JPM_S-4	
ELEMENT	STANDARD	SAT	UNSAT	Comment Number
12. Applicant ensures WHEN RHR Loop B flow is LESS THAN 1500 gpm, ensure open MIN FLOW VLV 10MOV- 16B	Applicant ensures WHEN RHR Loop B flow is LESS THAN 1500 gpm, ensure open MIN FLOW VLV 10MOV-16B			
CAUTION Blockage of ECCS pump suction strainers could occur due to debris in the Torus. Within the latitude provided by EOPs to restore and maintain parameters within specified limits, potential mitigative actions may include: • Minimizing ECCS flow or removing affected ECCS pumps from service • Alternating ECCS pumps from one division to another, if available. • Shifting ECCS pump suction to another source, if available • Operation of alternate injection sources	CAUTION Blockage of ECCS pump suction strainers could occur due to debris in the Torus. Within the latitude provided by EOPs to restore and maintain parameters within specified limits, potential mitigative actions may include: • Minimizing ECCS flow or removing affected ECCS pumps from service • Alternating ECCS pumps from one division to another, if available. • Shifting ECCS pump suction to another source, if available • Operation of alternate injection sources			
 * 13. Ensure the following RHR pumps are stopped: RHR PMP 10P-3B RHR PMP 10P-3D 	Applicant ensures pumps are stopped. <u>EVALUATOR:</u> Observe applicant identifies the pumps are stopped.			
* 14. Applicant should recognize the need to use Alternate Drywell Spray <u>EVALUATOR CUE FOR SRO:</u> If necessary ask applicant to recommend a course of action.	Applicant should recognize the need to use Alternate Drywell Spray; EP-14			
EVALUATOR CUE FOR RO: If necessary ask applicant What alternate methods are available for to spray the drywell? 1. RHRSW 2. FIRE PROTECTION	EVALUATOR NOTE: Applicant may perform step F.8 of OP-13B; RHR Loop B shutdown from Torus Cooling or Containment Spray Mode before going to EP-14.			

			JPM S-4	
ELEMENT	STANDARD	SAT	UNSAT	Comment Number
15. Obtain a controlled copy of procedure and selects the correct section to perform.	Obtains a controlled copy of EP-14 and selects section 5.2 to perform.			
 Reviews precautions, prerequisites and special instructions associated with the procedure: This procedure shall be used only when no RHR pumps are available for containment spray. This procedure secures LPCI injection in order to maximize spray flow. The SM or CRS will determine the priority between containment spray or RPV injection. If using only one RHR subsystem, drywell and torus should be sprayed individually to maximize spray flow. The minimum drywell spray flow for an effective spray pattern is 5260 gpm for RHR Subsystem A and 4420 gpm for RHR Subsystem B. Minimum torus spray flow for an effective spray pattern is 600 gpm. Fire water cross-tie spray flow is approximately 1000 gpm. Using this method for drywell spray might not achieve the desired effect. 	Reviews applicable section of the procedure and notes requirements for Drywell spray flow rate.			
17. Verify the following RHR pumps are stopped:RHR PMP 10P-3B	Applicant verifies pumps are stopped.			
RHR PMP 10P-3D	<u>EVALUATOR:</u> Observe applicant identifies the pumps are stopped.			
 18. Ensure closed at least one of the following valves: DW SPRAY OUTBD VLV 10MOV-26B DW SPRAY INBD VLV 10MOV-31B 	Applicant ensures at least one of the valves is closed. <u>EVALUATOR:</u> Observe applicant identifies the valves are closed.			
 19. Ensure closed at least one of the following valves: RHR TEST TORUS CLG & SPRAY 10MOV-39B 	Applicant ensures at least one of the valves is closed.			
TORUS SPRAY INBD VLV 10MOV- 38B	<u>EVALUATOR:</u> Observe applicant identifies the valves are closed.			

JPM S-4

JP/VI 3-4				
ELEMENT	STANDARD	SAT	UNSAT	Comment Number
 20. Ensure closed at least one of the following valves: RHR TEST TORUS CLG & SPRAY 	Applicant ensures at least one of the valves is closed.			
10MOV-39B • RHR TEST & TORUS CLG 10MOV- 34B	<u>EVALUATOR:</u> Observe applicant identifies the valves are closed.			
 21. Ensure closed at least one of the following valves: LPCI INBD INJ VLV 10MOV-25B LPCI OUTBD INJ VLV 10MOV-27B 	Applicant ensures at least one of the valves is closed. <u>EVALUATOR:</u> Observe applicant identifies the valves are closed.			
 * 22. Ensure available RHRSW pumps in RHRSW Loop B are running: RHRSW PMP 10P-1B RHRSW PMP 10P-1D 	Applicant ensures pumps are started.			
	<u>EVALUATOR:</u> Observe applicant starts the pumps.			
* 23. Ensure RHRSW DISCH VLV FROM HX B 10MOV-89B is throttled to establish 2500 to 4000 gpm per RHRSW pump.	Applicant throttles HX discharge valve 2500 to 4000 gpm.			
	<u>EVALUATOR:</u> Observe applicant throttles valve to required flow.			
24. NOTE: Steps 5.2.8 and 5.2.9 may be performed and repeated in any order to alternate between drywell and torus spray.	Reviews NOTE and requirements for alternating between drywell and torus as necessary. <u>EVALUATOR:</u> Acknowledge if applicant states that the order may be alternated as necessary.			
 * 25. IF drywell spray is required, THEN perform the following: Ensure open the following valves: RHRSW to RHR 10MOV-148B 	Applicant opens the valves. o RHRSW to RHR 10MOV- 148B			
○ RHRSW to RHR 10MOV-149B	o RHRSW to RHR 10MOV- 149B			

			JP	M S-4
ELEMENT	STANDARD	SAT	UNSAT	Comment Number
26. Verifies the following are tripped: o RWR PMP 02-2P-1A o RWR PMP 02-2P-1B o DW CLG FN 68FN-2A o DW CLG FN 68FN-2B o DW CLG FN 68FN-2C o DW CLG FN 68FN-2D o DW CLG FN 68FN-4A o DW CLG FN 68FN-4B o DW CLG FN 68FN-4C o DW CLG FN 68FN-4D	Applicant verifies the pumps and fans are tripped or trips them. <u>EVALUATOR:</u> This step was previously performed.			
* 27. Verify drywell temperature and pressure are within the Drywell Spray Initiation Limit.	Applicant verifies the DWSIL within the curve. <u>EVALUATOR:</u> Acknowledge when applicant states that the drywell temperature and pressure are within the DWSIL.			
28. IF RPV water level is less than 10 inches on fuel zone water level indication, THEN place DW & TORUS SPRAY VLV OVERRIDE OF FUEL ZONE LVL 10A-S18B keylock switch in MANUAL OVERRD.	Applicant verifies the RPV level is less than TAF and places keylock switch in OVERRIDE. <u>EVALUATOR:</u> This step was previously performed			
NOTE: The following step must be performed each time drywell spray is initiated or re-initiated.	Applicant reviews NOTE and requirements for DW spray initiation.			
*29. Place SPRAY CNTRL 10A-S17B switch to MANUAL, spring return to normal.	Applicant places spray control switch to MANUAL.			
30. Verify white SPRAY PERM 10A- DS67B light is on.	Applicant verifies SPRAY PERM light is ON.			
31. Ensure closed RHRSW DISCH VLV FROM HX A 10MOV-89B.	Applicant ensures RHRSW DISCH VLV FROM HX A 10MOV-89B is closed.			

JPM S-4

ELEMENT	STANDARD	SAT	UNSAT	Comment Number
* 32. Ensure open DW SPRAY OUTBD VLV 10MOV-26B.	Applicant ensures DW SPRAY OUTBD VLV 10MOV-26B is open.			
* 33. Throttle DW SPRAY INBD VLV 10MOV-31B to establish desired flow while maintaining RHRSW pump motor current LESS THAN OR EQUAL TO max normal amps.	Applicant throttles DW SPRAY INBD VLV 10MOV-31B spray control switch to establish desired flow and pump ampere relationship.			
EVALUAT	OR: Terminate the task at this poir	nt	•	

JPM Stop Time _____

HANDOUT PAGE

JPM S-4

TASK CONDITIONS:

- 1. A steam leak in the drywell has occurred and a reactor scram was performed.
- 2. The CRS has implemented the appropriate EOPs.
- 3. ESW is in service.
- 4. Suppression chamber pressure is greater than 15 psig.
- 5. 'A' loop of RHR was OOS for maintenance prior to the transient and is unavailable.
- 6. Both reactor Recirc pumps are shutdown and all drywell cooling fans have been stopped.
- 7. Drywell sprays are required for High Drywell temperature IAW with the EOPs.
- 8. RPV level is being restored with HPCI.
- 9. Torus Spray Valve 10MOV-38B has failed to open.

INITIATING CUE:

You are the RO. The CRS has directed you to lineup to spray the Drywell using 'B' and 'D' RHR pumps per posted attachment for Drywell spray.

James A. Fitzpatrick Generating Station				
	Job Performance Measure			
Manual Isolation a	and Verification of Reactor Building V	entilation System		
	JPM Number: S-5			
	Revision Number: 0			
	Date: <u>1/13/10</u>			
Developed By:	Bernard Litkett	<u>1/13/10</u> Date		
Validated By:	Facility Representative	Date Date		
Review By:				
Approved By:	Examiner	Date		
	Chief Examiner	Date		

Г

JOB PERFORMANCE MEASURE VALIDATION CHECKLIST

NOTE: All steps of this checklist should be performed upon initial validation. Prior to JPM usage, revalidate JPM using steps 8 through 11 below.

1. Task description and number, JPM description and number are
 identified.
 2. Knowledge and Abilities (K/A) references are included.
 Performance location specified. (in-plant, control room, or simulator)
 4. Initial setup conditions are identified.
5. Initiating and terminating cues are properly identified.
6. Task standards identified and verified by Examiner review.
 Critical steps meet the criteria for critical steps and are identified with an asterisk (*).
 Verify the procedure referenced by this JPM matches the most current revision of that procedure: Procedure Rev Date
 Pilot test the JPM: a. verify cues both verbal and visual are free of conflict, and b. ensure performance time is accurate.
 If the JPM cannot be performed as written with proper responses, then revise the JPM.
 When JPM is revalidated, Examiner sign and date JPM cover page.

REVISION RECORD (Summary):

1. Rev 0

JPM Setup Instructions:

- 1. Reset to IC-114 or any IC that supports isolating Reactor Building Ventilation.
- 2. A copy of OP-51A; Reactor Building Ventilation, section G.1
- 3. A copy of OP-20; Standby Gas treatment, section D.1

TOOLS AND EQUIPMENT

1. None

TASK STANDARD:

Manual Isolation and Verification of Reactor Building Ventilation System

TASK CONDITIONS:

- 1. Reactor Building Ventilation manual isolation is required to support a maintenance activity.
- 2. Standby Gas Treatment System must be started to support the manual isolation of the Reactor Building.

INITIATING CUE:

You are the RO. The CRS has directed you to manually isolate the Reactor Building Ventilation System per OP-51A.

Information for Evaluator's Use:

UNSAT requires written comments on respective step.

* Denotes CRITICAL steps.

Number any comments in the "Comment Number" column. Then annotate that comment in the "Comments" section. The comment section should be used to document the reason that a step is marked as unsatisfactory and to document unsatisfactory performance relating to management expectations.

Some operations that are performed from outside of the control room may require multiple steps. These items may be listed as individual steps in this JPM. It is acceptable for the applicant to direct the local operator to perform groups of procedure steps instead of calling for each individual item to be performed.

The timeclock starts when the applicant acknowledges the initiating cue.

Operator's Name:					
Job Title:		RO	SRO	□ STA	□ SRO Cert
JPM Title: Manual	Isolation a	nd Verificat	ion of Reacto	r Building Ve	entilation System
JPM Number: S-5					
Revision Number:	0				
K/A Number and Ir	nportance	: KA 288000	K4.02 3.6, 3.8	3	
Suggested Testing	g Environm	nent: Simula	tor		
Actual Testing Env	vironment:				
Testing Method: F	Perform in S	Simulator			
Alternate Path: No	C				
Time Critical: No					
Estimated Time to	Complete	: 15 min.	Actual Time	Used:	minutes
References: 1. NUREG 1123, 28	8000 K4.02	3.6, 3.8			
2. Reactor Building	and Ventilati	on System OF	-51A; Sections	G.1 and G.2, I	Rev.47
3. Standby Gas Trea	atment Syste	em OP-20: sec	tion D.1, Rev. 3	36	
EVALUATION SUM 1. Were all the Critic 2. Was the task sta	cal Elemen		satisfactorily?	🗆 Yes 🗆 N	10
The operator's perfor determined to be: Comments:		□ Satisfactor	y 🗆 U	Insatisfactory	
Note: Any grade of	UNSAT re	quires a com	ment.		
Evaluator's Name:	, 			_(Print)	
Evaluator's Signat	ture:			Dat	te:

Ş	ĺМ	JPM	S-5.	doc
---	----	-----	------	-----

<u>Description</u>: This JPM has the applicant perform a manual isolation and verification of reactor building ventilation system

JPM S-5

NOTE: Critical Element(s) indicated by * in Performance Checklist.

PERFORMANCE CHECKLIST:

JPM Start Time _____

ELEMENT	STANDARD	SAT	UNSAT	Comment Number
1. Obtain a controlled copy of procedure OP-51A; Sections G.1 and G.2 and OP-20.	The applicant determines where to obtain a controlled copy of OP-51A and OP-20. (Control Room, Merlin)			
2. Review precautions associated with the procedure	Applicant review Section C of the procedure and notes precaution relating to changing building ventilation line-ups.			
3. Selects the correct section to perform the task.	Applicant reviews Section G of the procedure and selects Section G.1 for Manual Isolation.			
4. Ensure SBGT is running per OP-20.	Applicant obtains a current copy of OP-20 and reviews precautions associated with the operation of the SBGT System.			
5. Selects the correct section to perform the task.	Applicant reviews the procedure and selects Section D.1 for the "A" SBGT Train.			
EVALUATOR CUE: Act as the CRS/SNO and when asked, order the "A" SBGT Train started. If asked, inform operator that no painting, welding or smoke fumes have been in the Reactor Building in the last 24 hours.	EVALUATOR CUE: Act as the CRS/SNO and when asked order the "A" SBGT Train started. If asked, inform operator that no painting, welding or smoke fumes have been in the Reactor Building in the last 24 hours.			
* 6. Ensure OPENS the following: ABOVE EL 369' SUCT.	Applicant at the 09-75 panel locates the control switch and OPENS the following valve:			
01-125MOV-11	01-125MOV-11			

JPM S-5

			1	<u>N 3-5</u>
	STANDARD	SAT	UNSAT	Comment Number
* 7.Ensure OPEN "A" Inlet Valve:	Applicant locates and OPENS			
01-125MOV-14A	01-125MOV-14A			
8. Verify the following system response on startup:	Applicant observes and verifies component operation during the startup of the "A" SBGT Train			
 White light for AIR HTR 01- 125E-5A is ON. 	 White light for AIR HTR 01-125E-5A is ON. 			
 Red light for AIR HTR 01-125E- 5A is ON. 	Red light for AIR HTR 01-			
 TRAIN A CLG VLV 01-125MOV- 100A is CLOSED. 	125E-5A is ON . • TRAIN A CLG VLV 01-			
 FN DISCH 01-125MOV-15A is OPEN. 	125MOV-100A is CLOSED .			
 TRAIN A FN 01-125FN-1A is running. 	 FN DISCH 01-125MOV- 15A is OPEN. 			
	TRAIN A FN 01-125FN-1A is running.			
9. SBGT to Support:	EVALUATOR CUE:			
 TORUS Venting 	SBGT "A" <u>is not</u> being used to			
Drywell Venting	support any of these activities.			
HPCI Operation				
 MSLCS Operation 				
AGT System Operation				
10. IF SBGT "B" is shutdown"	For the "B" SBGT train:			
Verify open 01-125MOV-100B	Applicant verifies open TRAIN "B" CLG VLV 01-125MOV-			
Verify flowrate on SGT flow 01-125FI- 106A	100B			
	Applicant verifies flowrate on SGT flow 01-125FI-106A			
	 RB un-isolated – Approximately 6000 SCFM 			
	 RB isolated – Approximately 5600 to 5800 			

JPM S-5

ELEMENT	STANDARD	SAT	UNSAT	Comment Number
11. Applicant verifies Rx Building differential pressure	Applicant verifies Rx Building DIFF Pressure			
	01-125DPI-100A is less negative than25 inches			
* 12. Depress pushbuttons: (OP-51A; G.1):	Applicant at the 09-75 panel, locates the isolation			
RB VENT ISOL A	pushbuttons and depresses both isolation pushbuttons.			
RB VENT ISOL B				

JPM S-5

ELEMENT	STANDARD	SAT	UNSAT	Comment
				Number
13. Verifies the following to ensure Reactor Building Ventilation Isolation (OP-51A; G.2)	Applicant at the 09-75 panel verifies the isolation using the posted attachment or OP-51A			
 INBD SUPP ISOL 66AOV-100A CLOSED 	 INBD SUPP ISOL 66AOV- 100A; CLOSED 			
 OUTBD EXH ISOL 66AOV-101A CLOSED 	OUTBD EXH ISOL 66AOV-101A; CLOSED			
 BELOW EL 369' RECIRC 66AOD- 105 	 BELOW EL 369' RECIRC 66AOD-105; OPEN 			
• EL 369' RECIRC 66AOD-108;	 EL 369' RECIRC 66AOD- 108; OPEN 			
 OPEN OUTBD SUPP ISOL 66AOV-100B; 	OUTBD SUPP ISOL 66AOV-100B; CLOSED			
 CLOSED INBD EXH ISOL 66AOV-101B 	 INBD EXH ISOL 66AOV- 101B; CLOSED 			
 CLOSED SUPP FN 66FN-5A, 5B, 5C (2 OF 	 SUPP FN 66FN-5A, 5B, 5C (TWO OF 3); ON 			
3) ON	• BELOW EL 369' EXH FN			
 BELOW EL 369' EXH FN 66FN-12A OR 66FN-12B: ON 	66FN-12A OR 66FN-12B; ON			
 EL 369' EXH FN 66FN-13A 	 EL 369' EXH FN 66FN-13A AND 66FN-13B; OFF 			
AND 13B; OFF	• TK EXH FN 66FN-35; OFF			
• TK EXH FN 66FN-35; OFF	CRESC SUPP FN 66FN-			
 CRESC SUPP FN 66FN-26A OR 66FN-26B; ON 	26A OR 66FN-26B; ON			
• SBGT SYSTEM; RUN PER OP-20	 SBGT SYSTEM; RUN PER OP-20 			
 RX BLDG D/P; -0.25 TO –2.5 in. WATER GAUGE 	 RX BLDG D/P; -0.25 TO2.5 in. WATER GAUGE 			
EVALUAT	OR : Terminate the task at this poin	nt.		

JPM Stop Time _____

JPM S-5

HANDOUT PAGE

TASK CONDITIONS:

- 1. Reactor Building Ventilation manual isolation is required to support a maintenance activity.
- 2. Standby Gas Treatment System must be started to support the manual isolation of the Reactor Building.

INITIATING CUE:

You are the RO. The CRS has directed you to manually isolate the Reactor Building Ventilation System per OP-51A.

James	James A. Fitzpatrick Generating Station			
	Job Performance Measure			
PERFORM ST	-9BB, EDG B & D FULL LOAD TEST A OPERABILITY TEST	ND ESW PUMP		
	JPM Number: S-6			
	Revision Number: 1			
	Date: <u>2/02/10</u>			
Developed By:	Bernard Litkett Author	<u>2/02/10</u> Date		
Validated By:	Facility Representative	 Date		
Review By:	Examiner	 Date		
Approved By:	Chief Examiner	Date		

JOB PERFORMANCE MEASURE VALIDATION CHECKLIST

<u>NOTE</u>: All steps of this checklist should be performed upon initial validation. Prior to JPM usage, revalidate JPM using steps 8 through 11 below.

 Task description and number, JPM description and number are identified.
 2. Knowledge and Abilities (K/A) references are included.
 Performance location specified. (in-plant, control room, or simulator)
4. Initial setup conditions are identified.
 5. Initiating and terminating cues are properly identified.
 6. Task standards identified and verified by Examiner review.
 Critical steps meet the criteria for critical steps and are identified with an asterisk (*).
 Verify the procedure referenced by this JPM matches the most current revision of that procedure: Procedure Rev Date
 Pilot test the JPM: a. verify cues both verbal and visual are free of conflict, and b. ensure performance time is accurate.
 If the JPM cannot be performed as written with proper responses, then revise the JPM.
 When JPM is revalidated, Examiner sign and date JPM cover page.

REVISION RECORD (Summary):

1. Rev 1

- JPM Setup Instructions:
 - 1. Initialize the simulator to IC-39
 - Obtain a controlled copy of ST-9BB, EDG B & D FULL LOAD TEST AND ESW PUMP OPERABILITY TEST. Initial as complete Section 4.0, 5.0 and Steps 8.1 through and including Steps 8.12.
 - 3. Copies of EDG Demand Log for EDG B & D forms from OP-22, DIESEL GENERATOR EMERGENCY POWER.
 - 4. Simulator booth operator simulate strainer clogging sometime after EDG carrying bus load by:
 - a.) Overriding ESW pump strainer d/p alarm on (09-6-2-24)
 - b.) Indications on control board should show pump running when model knows it is not running, EPIC flow point will show no flow
 - 5. Simulator booth operator to override MAINT switches for EDG B and D and place in MAINT.

TOOLS AND EQUIPMENT

- 1. Stopwatch
- 2. Synchronizing Switch

TASK STANDARD:

Perform surveillance test ST-9BB EDG B & D FULL LOAD TEST AND ESW PUMP OPERABILITY TEST. Determine EDGs have no cooling and shutdown prior to engine damage.

TASK CONDITIONS:

- 1. The plant is at power.
- 2. All steps up to step 8.12 have been completed sat

INITIATING CUE:

You are the RO. The CRS directs you to perform ST-9BB, EDG B & D FULL LOAD TEST AND ESW PUMP OPERABILITY TEST, commencing at Step 8.13 for EDG B & D.

Information for Evaluator's Use:

UNSAT requires written comments on respective step.

* Denotes CRITICAL steps.

Number any comments in the "Comment Number" column. Then annotate that comment in the "Comments" section. The comment section should be used to document the reason that a step is marked as unsatisfactory and to document unsatisfactory performance relating to management expectations.

Some operations that are performed from outside of the control room may require multiple steps. These items may be listed as individual steps in this JPM. It is acceptable for the applicant to direct the local operator to perform groups of procedure steps instead of calling for each individual item to be performed.

The timeclock starts when the applicant acknowledges the initiating cue.

Operator's Name:					
Job Title:		RO	SRO	□ STA	SRO Cert
JPM Title: Perform	۱ the Emerg	gency Diese	l Generator L	oad Test (S/I	J and Load EDG's)
JPM Number: S-6					
Revision Number:	1				
K/A Number and I	mportance	: KA 264000	; A4.04; 3.7; 3	3.7	
Suggested Testing	g Environm	ent: Simula	tor		
Actual Testing En	vironment:				
Testing Method:	Perform in	Simulator			
Alternate Path: Ye	es				
Time Critical: No					
Estimated Time to	Complete:	: 30 min.	Actual Tir	ne Used:	minutes
References: 1. NUREG 1123, 2 2. ST-9BB; Rev.11 3. OP-22; Rev. 53 4. Alarm response	I, EDG B & ; DIESEL G	D FULL LOA ENERATOR	EMERGENC		OPERABILITY TEST.
EVALUATION SUN 1. Were all the Criti 2. Was the task sta	ical Element	•	satisfactorily?	🗆 Yes 🗆 N	٩o
has been determine Comments:	ed to be:	□ Satisfa	ictory 🛛 🗆 L	Insatisfactor	
Note: Any grade of	f UNSAT red	quires a com	ment.		
Evaluator's Name	:			_(Print)	
Evaluator's Signa	ture:			Da	te:
SIM JPM S-6.doc					

<u>Description:</u> This JPM asks the applicant to perform ST-9BB; EDG B & D FULL LOAD TEST AND ESW PUMP OPERABILITY TEST.

JPM S-6

NOTE: Critical Element(s) indicated by * in Performance Checklist.

PERFORMANCE CHECKLIST:

JPM Start Time _____

ELEMENT	STANDARD	SAT	UNSAT	Comment Number
1. Obtain a controlled copy of procedure ST-9BB; Rev.11, EDG B & D FULL LOAD TEST AND ESW PUMP OPERABILITY TEST	Obtains a controlled copy of ST-9BB; Rev.11			
2. Reviews the precautions	Reviews the precautions, making note of any that are applicable			
3. Select the correct section to perform the task.	Applicant selects step 8.13 of ST-9BB			
	EVALUATOR CUE: If asked, the other ROs will perform the stopwatch function.			
* 4. Simultaneously place the EDG B & D control switches to START and start stopwatch	Applicant simultaneously places the EDG B & D control switches in START and starts			
EVALUATOR CUE: If asked, the second RO will perform the stopwatch function.	stopwatch <u>EVALUATOR CUE</u> : If asked, the other ROs will perform the stopwatch function.			
5. If EDG frequency does not stabilize between 58 and 62 Hz after reaching normal voltage, then immediately place the affected EDG CNTRL switch in STOP.	If EDG frequency does not stabilize between 58 and 62 Hz after reaching normal voltage, then applicant immediately places the affected EDG CNTRL switch in STOP.			

			JP	M <u>S-6</u>
ELEMENT	STANDARD	SAT	UNSAT	Comment Number
 6. <u>EVALUATOR CUE</u>: If asked, the other ROs perform the stopwatch function. Step 8.15 Operator 1 time: 6.92 sec Step 8.16 Operator 2 time: 7.05 sec Step 8.17 Operator 3 time: 8.46 sec Step 8.18 Operator 1 to record frequency and voltage 	 <u>EVALUATOR CUE</u>: If asked, the other ROs perform the stopwatch function. Step 8.15 Operator 1 time: 6.92 sec Step 8.16 Operator 2 time: 7.05 sec Step 8.17 Operator 3 time: 8.46 sec Step 8.18 Operator 1 to record frequency and voltage 			
 7. Verify the following: EDG B & D TIE BKR 10604 is 	Applicant verifies the following: • EDG B & D TIE BKR			
closed.ESW Pump 46P-2B is running.	 10604 is closed. ESW Pump 46P-2B is running. 			
* 8. Trip EDG B & D TIE BKR 10604, allow switch to spring return to AUTO and record time.	Applicant trips EDG B & D TIE BKR 10604, allow switch to spring return to AUTO and record time.			
9. Applicant records frequency.	Applicant records frequency.			
10. Verify EPIC-D-732 closed and open on alarm typer.	Applicant verifies EPIC-D-732 closed and open on alarm typer.			

			JP	M S-6
ELEMENT	STANDARD	SAT	UNSAT	Comment Number
* 11. Place the following switches in DROOP:	Applicant places the following switches in DROOP:			
EVALUATOR NOTE:	EDG B GOV MODE			
(When placed in droop the following alarms will annunciate.)	EDG D GOV MODE			
09-8-4-5 EDG B FUEL CUTOFF OR CNTRLS OFF NORMAL				
09-8-4-8 EDG D FUEL CUTOFF OR CNTRLS OFF NORMAL				
EDG B GOV MODE				
EDG D GOV MODE				
 12. IF an EDG functions improperly while paralleled with 10600 bus, THEN perform the following: Trip associated EDG load breaker. 	Applicant reviews steps.			
Shut down malfunctioning EDG per Section G of OP-22 (Single EDG Shutdown from Control Room).				
 Shut down other EDG per Section G of OP-22 (Single EDG Shutdown from Control Room) 				
• Initiate a WR to troubleshoot EDG.				
OR				
Applicant may determine OP-22 G.17 Emergency EDG Shutdown is more appropriate.				
EVALUATOR CUE: If asked, the other ROs will initiate a WR				
CAUTION	CAUTION			
Operation of the T-4 load tap changer during paralleling and loading of the EDG could cause the EDG to trip.	Operation of the T-4 load tap changer during paralleling and loading of the EDG could cause the EDG to trip.			
13. While performing the next 2 steps do not operate the T-4 load tap changer.	While performing the next 2 steps do not operate the T-4 load tap changer.			

				<u>M S-6</u>
ELEMENT	STANDARD	SAT	UNSAT	Comment Number
NOTE	NOTE			
Steps 14 and 15 may be performed in any order per SM direction.	Steps 14 and 15 may be performed in any order per SM direction.			
14. Parallel EDG B with the 10600 Bus as follows.	Parallel EDG B with the 10600 Bus as follows			
* 15. Place EDG B LOAD BKR SYNCH SW in ON.	Applicant places EDG B LOAD BKR SYNCH SW in ON.			
* 16. Adjust EDG B VOLT REG to match INCOMING and RUNNING voltages.	Applicant matches INCOMING (EDG) and RUNNING (bus 10600) voltages with EDG B VOLT REG adjustments.			
* 17. Adjust EDG B GOV to rotate synchroscope slowly in the FAST direction (clockwise).	Applicant adjusts EDG B GOV to rotate synchroscope slowly in fast direction.			
NOTE	NOTE			
Steps 18 and 19 may be checked after step 19 is complete	Steps 18 and 19 may be checked after step 19 is complete			
* 18. When EDG B and the 10600 BUS are in phase (synchroscope at 12 o'clock) close EDG B LOAD BKR 10602.	Applicant places the control switch 10602, EDG B LOAD BKR, to CLOSE when synchroscope is at 12:00.			
* 19. Adjust EDG B GOV to raise EDG B load between 100 to 300 kW.	Applicant places the EDG B GOV switch to RAISE and loads EDG B between 100 to 300 kW.			
20. Place EDG B LOAD BKR SYNCH SW in OFF and removes sync switch handle.	Applicant places the EDG B LOAD BKR SYNCH SW to OFF removes sync switch handle.			
21. IF EDG B is THEN the second diesel paralleled, balance EDG B and D using voltage regulator(s) to establish LESS THAN 100 KVAR difference between EDG B and EDG D.	IF EDG B is THEN the second diesel paralleled, balance EDG B and D using voltage regulator(s) to establish LESS THAN 100 KVAR difference between EDG B and EDG D.			

JPM S-6

			JE	
	STANDARD	SAT	UNSAT	Comment Number
* 22. Adjust EDG B GOV to raise EDG B load to 2600 kW over 3 to 5 minutes in approximately 800 kW increments	Applicant adjusts EDG B GOV to raise EDG B load to 2600 kW over 3 to 5 minutes in 800 kW increments			
EVALUATOR CUE: State," 3 minutes have passed", after each load adjustment.	<u>EVALUATOR CUE</u> : State," 3 minutes have passed", after each load adjustment.			
23. Parallel EDG D with the 10600 Bus as follows	Parallel EDG D with the 10600 Bus as follows			
* 24. Place EDG D LOAD BKR SYNCH SW in ON	Applicant places EDG D LOAD BKR SYNCH SW in ON			
* 25. Adjust EDG D VOLT REG to match INCOMING and RUNNING voltages	Applicant matches INCOMING (EDG) and RUNNING (bus 10600) voltages with EDG D VOLT REG adjustments			
* 26. Adjust EDG D GOV to rotate synchroscope slowly in the FAST direction (clockwise)	Applicant adjusts EDG D GOV to rotate synchroscope slowly in fast direction			
NOTE	NOTE			
Steps 27 and 28 may be checked after step 28 is complete	Steps 27 and 28 may be checked after step 28 is complete			
* 27. When EDG D and the 10600 BUS are in phase (synchroscope at 12 o'clock) close EDG D LOAD BKR 10612	Applicant places the control switch 10612, EDG D LOAD BKR, to CLOSE when synchroscope is at 12:00			
* 28. Adjust EDG D GOV to raise EDG B load between 100 to 300 kW	Applicant places the EDG D GOV switch to RAISE and loads EDG B between 100 to 300 kW			
29. Place EDG D LOAD BKR SYNCH SW in OFF and removes sync switch handle.	Applicant places the EDG D LOAD BKR SYNCH SW to OFF and removes sync switch handle.			
* 30. IF EDG D is THEN the second diesel paralleled, balance EDG B and D using voltage regulator(s) to establish LESS THAN 100 KVAR difference between EDG B and EDG D.	IF EDG D is THEN the second diesel paralleled, balance EDG B and D using voltage regulator(s) to establish LESS THAN 100 KVAR difference between EDG B and EDG D.			

			JP	M S-6
ELEMENT	STANDARD	SAT	UNSAT	Comment Number
* 31. Adjust EDG D GOV to raise EDG B load to 2600 kW over 3 to 5 minutes in approximately 800 kW increments	Applicant adjusts EDG D GOV to raise EDG B load to 2600 kW over 3 to 5 minutes in 800 kW increments			
<u>EVALUATOR CUE:</u> State," 3 minutes have passed", after each load adjustment.	EVALUATOR CUE: State," 3 minutes have passed", after each load adjustment.			
Simulator booth operator simulate strainer clogging a.) Overriding ESW pump strainer d/p alarm on (09-6-2-24)				
32. Applicant responds to ARP 09-6-2-24 and recognizes ESW 'B' pump strainer has HI D/P	Annunciator: 09-6-2-24 for ESW PMP A or B STRAINER DIFF PRESS HI	Log	Time	For
Simulator booth operator simulate strainer clogging a.) Indications on control board should	Applicant responses to ARP 09-6-2-24 and references EPIC point:		annuciator 09-6-2-24	
show pump running	 EPIC –A-711: ESW B Loop flow 			
EVALUATOR NOTE: Evaluator is to log the time when	ESW flow is zero			
annuciator 09-06-2-24 alarms.	EVALUATOR CUE:			
	 If applicant calls up ESW Pp B Strainer D/P. The cue is that D/P is the max value for the instrument 			
	 If applicant responds to shift strainer basket respond that the strainer baskets have been swapped. Strainer basket D/P is still high. 			

JPI	Μ	S-6

		CAT		Commont
ELEMENT	STANDARD	SAT	UNSAT	Comment Number
SIMULATOR BOOTH OPERATOR:	CRITICAL TASK			
simulate strainer clogging.				
	EVALUATOR NOTE:			
a.) if after 10 minutes of operation and the applicant has not tripped 'B'	If EDG destroyed, terminate this JPM, applicant critical task			
and 'D' EDG. The Booth Operator is	to shutdown EDG within 10			
to trip 'B' and 'D' EDG.	minutes not met.			
* 33. IF an EDG functions improperly	Applicant refers to step 8.24			
while paralleled with 10600 bus,	(or step 12 of JPM) and			
THEN applicant performs the following:	performs actions:			
	if an EDG functions improperly while paralleled with 10600			
Applicant may determine OP-22 G.17 Emergency EDG Shutdown is more	bus, THEN applicant performs			
appropriate.	the following:			
OR				
	Applicant may determine OP-			
• Trip associated EDG load breaker.	22 G.17 Emergency EDG Shutdown is more			
	appropriate.			
Shut down malfunctioning EDG per Section G of OP-22 (Single EDG	OR			
Shutdown from Control Room).	<u> </u>			
	Trip associated EDG load		*	
Shut down other EDG per Section	breaker.			
G of OP-22 (Single EDG Shutdown	Shut down malfunctioning			
from Control Room)	EDG per Section G of OP-		'	
• Initiate a WR to troubleshoot EDG.	22 (Single EDG			
	Shutdown from Control			
EVALUATOR CUE: If asked, the other	Room).			
ROs will initiate a WR	Shut down other EDG per			
	Section G of OP-22			
	(Single EDG Shutdown			
	from Control Room)			
	Initiate a WR to			
	troubleshoot EDG.			
	EVALUATOR CUE: If asked,			
	the other ROs will initiate a WR			
* 34. OP-22; G-17 EMERGENCY EDG	OP-22; G-17 EMERGENCY			
SHUTDOWN.	EDG SHUTDOWN.			

			JP	<u>M S-6</u>
ELEMENT	STANDARD	SAT	UNSAT	Comment Number
 * 35. Ensure EDG load breakers are tripped and placed in PULL TO LOCK position. EDG B; 71-10602 EDG D; 71-10612 * 36. Ensure EDG tie breaker is tripped 	Applicant ensures load breakers are tripped and placed in PULL TO LOCK position. • EDG B; 71-10602 • EDG D; 71-10612 Applicant ensures EDG tie			
• EDG B/D; 10604	 breaker is tripped. EDG B/D; 10604 			
NOTE: The EDG B/D; EDG FUEL CUTOFF OR CNTRLS OFF NORMAL annunciator will alarm at panel 09-8 in the following step. (This alarm is already in due the EDG being placed in droop) * 37. Place EDG B/D CONTROL SWITCH in MAINT at panel 93ECP-	NOTE: The EDG B/D; EDG FUEL CUTOFF OR CNTRLS OFF NORMAL annunciator will alarm at panel 09-8 in the following step. (This alarm is already in due the EDG being placed in droop) Applicant contacts in plant operator to place EDG B/D			
B/D. SIMULATOR BOOTH OPERATOR: Override MAINT switches for EDG B and D. Place in MAINT	CONTROL SWITCH in MAINT at panel 93ECP- B/D. SIMULATOR BOOTH OPERATOR: Override MAINT switches for EDG B and D. Place in MAINT.			
* 38. Place EDG B/D CNTRL switches to STOP at panel 09-8.	Applicant places EDG B/D CNTRL switches to STOP at panel 09-8.			
EVALUATOR NOTE: If the applicant chooses this method, then the JPM is complete <u>OR</u>	EVALUATOR NOTE: If the applicant chooses this method, then the JPM is complete			
If the applicant chooses the single EDG shutdown method, then continue the JPM.	OR If the applicant chooses the single EDG shutdown method, then continue the JPM.			
SIMULATOR BOOTH OPERATOR: simulate strainer clogging. a.) if after 10 minutes of operation and the applicant has not tripped 'B' and 'D' EDG. The Booth Operator is to trip 'B' and 'D' EDG.	CRITICAL TASK EVALUATOR NOTE: If EDG destroyed, terminate this JPM, applicant critical task to shutdown EDG within 10 minutes not met.			

JPM S-6

				<u>vi 3-0</u>
ELEMENT	STANDARD	SAT	UNSAT	Comment Number
EVALUATOR NOTE	EVALUATOR NOTE			
The method for single EDG shutdown	The method for single EDG			
takes a longer time to secure the	shutdown takes a longer time			
EDGs. Without ESW flow, jacket water	to secure the EDGs. Without			
and lube oil temperatures will rise and	ESW flow, jacket water and			
cause the local EDG alarm panels to	lube oil temperatures will rise			
annunciate which will cause 09-8-4-11;	and cause the local EDG			
B EDG ENG TROUBLE OR	alarm panels to annunciate			
SHUTDOWN and 09-8-4-14; D EDG	which will cause 09-8-4-11; B			
ENG TROUBLE OR SHUTDOWN	EDG ENG TROUBLE OR			
TROUBLE to alarm in the control room.	SHUTDOWN and 09-8-4-14;			
The high jacket temperature alarm has	D EDG ENG TROUBLE OR			
a setpoint of 200°F and the EDG trips	SHUTDOWN TROUBLE to			
at 205°F. The high lube oil temperature	alarm in the control room. The			
alarm has a setpoint of 240°F but no	high jacket temperature alarm		Į –	
trip function to the EDG.	has a setpoint of 200°F and			
	the EDG trips at 205°F. The			
	high lube oil temperature			
	alarm has a setpoint of 240°F.			
	but no trip function to the			
	EDG.			
EVALUATOR CUE	EVALUATOR CUE			
If applicant requests local temperature	If applicant requests local			
indications,	temperature indications,			
PRIOR to annunciators 09-8-4-11 or	PRIOR to annunciators 09-8-			
09-8-4-14 alarming, provide the	4-11 or 09-8-4-14 alarming,			
following cue: Jacket water	provide the following cue:			
temperature is 190°F and rising.	Jacket water temperature is			
Lube oil temperature is 195°F and	190°F and rising. Lube oil			
rising on 'B' and 'D' EDG.	temperature is 195°F and			
	rising on 'B' and 'D' EDG.			
EVALUATOR CUE	EVALUATOR CUE			
If applicant requests local temperature	If applicant requests local			
indications,	temperature indications,			
AFTER annunciators 09-8-4-11 or 09-	AFTER annunciators 09-8-4-			
8-4-14 alarming, provide the following	11 or 09-8-4-14 alarming,			
cue: Jacket water temperature is	provide the following cue:			
200°F and rising. Lube oil	Jacket water temperature is			
temperature is 240°F and rising on	200°F and rising. Lube oil			
'B' and 'D' EDG.	temperature is 240°F and			
	rising on 'B' and 'D' EDG.			
Using OP-22; G.6. Single EDG	Using OP-22; G.6. Single EDG			
Shutdown from Control Room	Shutdown from Control Room			

			JP	M S-6
ELEMENT	STANDARD	SAT	UNSAT	Comment Number
* 39. IF EDG B is operating in parallel with a 4.16 kV emergency bus, then perform the following: Adjust EDG B GOV to lower EDG B load to approximately 50 kW over 3 to 5 minutes in approximately 800 kW increments.	Applicant adjusts EDG B GOV to lower EDG B load to approximately 50 kW over 3 to 5 minutes in approximately 800 kW increments.			
 * 40. Trip EDG B load breaker. • EDG B; 71-10602 	Applicant trips EDG B load breaker. • EDG B; 71-10602			
* 41. Place EDG B GOV MODE switch in NORM.	Applicant places EDG B GOV MODE switch in NORM.			
* 42. Adjust EDG B GOV until SYNCHROSCOPE is as close to being stopped as practical.	Applicant adjusts EDG B GOV until SYNCHROSCOPE is as close to being stopped as practical.			
<u>NOTE:</u> EDG B VOLT REG may be adjusted to 4.3 kV when diesel shutdown is directed by a different procedure and voltage was not noted at startup.	NOTE: EDG B VOLT REG may be adjusted to 4.3 kV when diesel shutdown is directed by a different procedure and voltage was not noted at startup.			
* 43. Adjust EDG B VOLT REG until voltage on EDG B kV meter is same as noted in Step a.	Applicant adjusts EDG B VOLT REG until voltage on EDG B kV meter is same as noted in Step a.			
* 44. Verify SYNCHROSCOPE is as close to being stopped as practical.	Applicant verifies SYNCHROSCOPE is as close to being stopped as practical.			
* 45. Place EDG B LOAD BKR SYNCH SW in OFF and removes sync switch handle.	Applicant places EDG B LOAD BKR SYNCH SW in OFF and removes sync switch handle.			
* 46. WAIT until EDG B has run unloaded for AT LEAST 10 minutes to cooldown cylinders.	Applicant WAIT until EDG B has run unloaded for AT LEAST 10 minutes to cooldown cylinders.			
* 47 Sten EDC B	Applicant stans EDC D			

Applicant stops EDG B.

operator to verify:

•

٠

Applicant contacts in plant

92FN-1B is stopped.

92FN-2B is running.

Applicant stops ESW PUMP B

		46P-2B , when EDG B is stopped.
i	SIM JPM S-6.doc	

* 48. Verify the following at panel

* 49. WHEN EDG B is stopped (at

• 92FN-1B is stopped.

92FN-2B is running.

* 47. Stop EDG B.

92W-9A or B:

•

JPM S-6

ELEMENT	STANDARD	SAT	UNSAT	Comment Number	
EVALUATOR NOTE At this point EDG D is still running without ESW flow. If applicant stops ESW PUMP B with EDG D still running, terminate this JPM as unsat.	EVALUATOR NOTE At this point EDG D is still running without ESW flow. If applicant stops ESW PUMP B with EDG D still running, terminate this JPM as unsat.				
EVALUATOR: Terminate the task at this point.					

JPM Stop Time _____

JPM S-6

HANDOUT PAGE

TASK CONDITIONS:

- 1. The plant is at power.
- 2. All steps up to step 8.12 have been completed sat

INITIATING CUE:

You are the RO. The CRS directs you to perform ST-9BB, EDG B & D FULL LOAD TEST AND ESW PUMP OPERABILITY TEST, commencing at Step 8.13 for EDG B & D.

James A. Fitzpatrick Generating Station						
Job Performance Measure						
SRM SIGNAL	SRM SIGNAL TO NOISE RATIO DETERMINATION TEST (ST-5H)					
	JPM Number: S-7					
Revision Number: 1						
Date: <u>2/3/10</u>						
Developed By:	Bernard Litkett	<u>2/03/10</u> Date				
Validated By:	Facility Representative	Date				
Review By:	Examiner	Date				
Approved By:	Chief Examiner	Date				

JOB PERFORMANCE MEASURE VALIDATION CHECKLIST

NOTE: All steps of this checklist should be performed upon initial validation. Prior to JPM usage, revalidate JPM using steps 8 through 11 below.

 Task description and number, JPM description and number are identified.
 2. Knowledge and Abilities (K/A) references are included.
 Performance location specified. (in-plant, control room, or simulator)
 4. Initial setup conditions are identified.
 5. Initiating and terminating cues are properly identified.
 6. Task standards identified and verified by Examiner review.
 Critical steps meet the criteria for critical steps and are identified with an asterisk (*).
 Verify the procedure referenced by this JPM matches the most current revision of that procedure: Procedure Rev Date
 Pilot test the JPM: a. verify cues both verbal and visual are free of conflict, and b. ensure performance time is accurate.
 If the JPM cannot be performed as written with proper responses, then revise the JPM.
 When JPM is revalidated, Examiner sign and date JPM cover page.

REVISION RECORD (Summary):

1. Rev 0

JPM Setup Instructions:

- 1. Initialize the simulator to an IC-39 with the plant in Mode 4.
- 2. Copy of ST-5H; Rev.2; SRM Signal to Noise Ratio Determination Test (ST-5H); section 8.2.
- 3. Simulator Booth operator ensure remote RP-26 is installed.

TASK STANDARD:

Applicant is to perform SRM Signal to Noise Ratio Determination Test; ST-5H; Section 8.2 for SRM 'A'.

TASK CONDITIONS:

- 1. The plant is in Mode 4.
- 2. The SM has directed that the SRM Signal to Noise Ratio Determination Test; ST-5H; Section 8.2 for SRM 'A' must be completed.
- 3. Steps 8.2.1 thru 8.2.4 have been completed.

INITIATING CUE:

You are the RO. The CRS directs you to perform the SRM Signal to Noise Ratio Determination Test; ST-5H; Section 8.2 for SRM 'A'.

Information for Evaluator's Use:

UNSAT requires written comments on respective step.

* Denotes CRITICAL steps.

Number any comments in the "Comment Number" column. Then annotate that comment in the "Comments" section. The comment section should be used to document the reason that a step is marked as unsatisfactory and to document unsatisfactory performance relating to management expectations.

Some operations that are performed from outside of the control room may require multiple steps. These items may be listed as individual steps in this JPM. It is acceptable for the applicant to direct the local operator to perform groups of procedure steps instead of calling for each individual item to be performed.

The timeclock starts when the applicant acknowledges the initiating cue.

Operator's Name:					
Job Title:		RO	SRO		□ SRO Cert
JPM Title: SRM Sigr	nal to Noise F	Ratio Determir	nation Test; ST	-5H	
JPM Number: S-7					
Revision Number:	0				
K/A Number and I	mportance:	KA 21500	04; A4.07; 3.4;	; 3.6	
Suggested Testing	g Environm	ent: Simula	tor		
Actual Testing En	vironment:				
Testing Method:	Perform in S	imulator			
Alternate Path: N	0				
Time Critical: No					
Estimated Time to	Complete:	15 min.	Actual Time	e Used:	minutes
References : 1. NUREG 1123, KA 2. ST-5H; SRM Signa	•		ation Test; ST-{	5H; Section 8.2	for SRM 'A'. Rev.2
EVALUATION SUN 1. Were all the Crit 2. Was the task sta	ical Element	s performed	satisfactorily?	? 🗆 Yes 🗆 N	Ю
The operator's perford determined to be: Comments:		evaluated aga		rds contained i Jnsatisfactory	n this JPM, and has beer
Note: Any grade of	f UNSAT rec	quires a com	iment.		
Evaluator's Name	:			_(Print)	
Evaluator's Signa	ture:			Da	te:

<u>Description:</u> This JPM has the applicant perform the SRM Signal to Noise Ratio Determination Test; ST-5H; Section 8.2 for SRM 'A'.

JPM S-7

NOTE: Critical Element(s) indicated by * in Performance Checklist.

PERFORMANCE CHECKLIST:

JPM Start Time _____

ELEMENT	STANDARD	SAT	UNSAT	Comment Number
1. Obtain a controlled copy of procedure, ST-5H.	Applicant obtains a controlled copy of procedure and proceeds to the 09-12 panel in the Control Room.			
	EVALUATOR:			
	A controlled copy of the procedure is available in the SM office.			
2. Reviews prerequisites, precautions, limitations and general test methods	EVALUATOR CUE:			
associated with the procedure.	All prerequisites, precautions, limitations are satisfied.			
3. Ensure SRM A may be fully withdrawn.	Applicant ensures SRM A may be fully withdrawn.			
* 4. Ensure SRM A is fully inserted.	Applicant ensures SRM A is fully inserted.			
* 5. Ensure POWER ON light is on.	Applicant ensures POWER ON light is on.			
6. Declare SRM A inoperable	EVALUATOR CUE:			
EVALUATOR CUE: State as CRS 'A' SRM has been declared inoperable	State as CRS 'A' SRM has been declared inoperable			
* 7. Select SRM A.	Applicant selects SRM A.			*
8. Ensure SELECT lights are off for SRM B, C , and D .	Applicant ensures SELECT lights are off for SRM B, C, and D .			
* 9. Record SRM A initial count rate	Applicant records SRM A initial count rate cps.			
* 10. Depress DRIVE OUT/DRIVING OUT pushbutton.	Applicant depresses DRIVE OUT/DRIVING OUT pushbutton.			
11. Verify DRIVE OUT light is on.	Applicant verifies DRIVE OUT light is on.			
12. Verify DRIVING OUT light comes on.	Applicant verifies DRIVING OUT light is on.			

NRC JAMES A. FITZPATRICK ILOT EXAMINATION

			JP	<u>M S-7</u>
ELEMENT	STANDARD	SAT	UNSAT	Comment Number
* 13. When SRM OUT indicating light comes on, depress DRIVE OUT/DRIVING OUT pushbutton. EVALUATOR NOTE	Applicant depresses DRIVE OUT/DRIVING OUT pushbutton, when SRM OUT indicating light comes on.			
Takes 3.5 minutes for SRM to drive out.	EVALUATOR NOTE			
	Takes 3.5 minutes for SRM to drive out.			
 14. Verify the following lights are off: DRIVE OUT DRIVING OUT 	Applicant verifies the following lights are off: • DRIVE OUT • DRIVING OUT			
* 15. Record SRM A Full Out count rate.	Applicant records SRM A FULL OUT count rate cps			
* 16. Depress DRIVE IN pushbutton	Applicant depresses DRIVE IN pushbutton.			
17. Verify top half of DRIVE IN light is on.	Applicant verifies top half of DRIVE IN light is on.			
18. Verify bottom half of DRIVE IN light comes on.	Applicant verifies bottom half of DRIVE IN light comes on.			
* 19. When SRM IN indicating light comes on, depress DRIVE IN pushbutton.	Applicant depresses DRIVE IN pushbutton, When SRM IN indicating light comes on.			
EVALUATOR NOTE Takes 3.5 minutes for SRM to drive in.	EVALUATOR NOTE Takes 3.5 minutes for SRM to drive in.			
* 20. Verify DRIVE IN light is off	Applicant verifies DRIVE IN light is off			
* 21. Deselect SRM A	Applicant deselects SRM A			
22. Verify SRM A light is off.	Applicant verifies SRM A light is off.			
* 23. Calculate signal to noise ratio for SRM A as follows:	Applicant calculates signal to noise ratio for SRM A as follows:			
() /= 8.2.11 8.2.17 8.2.17 TS ≥ 2	() /= 8.2.11 8.2.17 8.2.17	 TS <u>> 2</u>		

NRC JAMES A. FITZPATRICK ILOT EXAMINATION

JPM S-7

ELEMENT	STANDARD	SAT	UNSAT	Comment Number	
24. Consider declaring SRM A operable. <u>EVALUATOR CUE:</u> Applicant should state the status of SRM A .					
EVALUATOR: Terminate the task at this point.					

JPM Stop Time _____

NRC JAMES A. FITZPATRICK ILOT EXAMINATION

JPM S-7

HANDOUT PAGE

TASK CONDITIONS:

- 1. The plant is in Mode 4.
- 2. The SM has directed that the SRM Signal to Noise Ratio Determination Test; ST-5HRev.2; Section 8.2 for SRM 'A' must be completed.
- 3. Steps 8.2.1 thru 8.2.4 have been completed.

INITIATING CUE:

You are the RO. The CRS directs you to perform the SRM Signal to Noise Ratio Determination Test; ST-5H; Section 8.2 for SRM 'A'.

James A. Fitzpatrick Generating Station							
	Job Performance Measure						
Perf	orm RPV Isolation During Plan	t Fire					
	ROONLY						
	JPM Number: S-8						
	Revision Number: 0						
	Date: <u>1/15/10</u>						
Developed By:	Bernard Litkett	1/15/10 Date					
Validated By:	Facility Representative	 Date					
Review By:	Examiner	 Date					
Approved By:	Chief Examiner	Date					

.

JOB PERFORMANCE MEASURE VALIDATION CHECKLIST

<u>NOTE:</u> All steps of this checklist should be performed upon initial validation. Prior to JPM usage, revalidate JPM using steps 8 through 11 below.

1. Task description and number, JPM description and number are identified. 2. Knowledge and Abilities (K/A) references are included. 3. Performance location specified. (in-plant, control room, or simulator) 4. Initial setup conditions are identified. 5. Initiating and terminating cues are properly identified. 6. Task standards identified and verified by Examiner review. 7. Critical steps meet the criteria for critical steps and are identified with an asterisk (*). 8. Verify the procedure referenced by this JPM matches the most current revision of that procedure: Procedure Rev. Date 9. Pilot test the JPM: a. verify cues both verbal and visual are free of conflict, and b. ensure performance time is accurate. 10. If the JPM cannot be performed as written with proper responses, then revise the JPM. 11. When JPM is revalidated, Examiner sign and date JPM cover page.

REVISION RECORD (Summary):

1. Rev 0

JPM Setup Instructions:

- 1. Initialize the simulator to IC-47, full power.
- 2. Manually scram the Reactor and stabilize vessel level and pressure.
- 3. Manually override activate the Reactor Building West Crescent indication on the fire panel; 227' RCIC RM SD to ON.
- 4. Manually override start the fire pump.
- 5. Manually override the RCIC HOV-1 trip pushbutton so the valve will not trip. Override to normal.
- 6. When contacted to open breaker 71BCB-2A-B05, Insert Malfunction RC03; Trigger 1.

TASK STANDARD:

Successfully perform RPV isolation during Plant Fire

TASK CONDITIONS:

- 1. A serious fire in the Reactor Building West Crescent has been confirmed by the Fire Brigade.
- 2. The Reactor has just been scrammed from rated power.
- 3. The CRS has determined that RPV isolation is desired.

INITIATING CUE:

You are the RO, The CRS directs you to perform the override actions of AOP-28 for a fire in the Reactor Building West Crescent Area.

Information for Evaluator's Use:

UNSAT requires written comments on respective step.

* Denotes CRITICAL steps.

Number any comments in the "Comment Number" column. Then annotate that comment in the "Comments" section. The comment section should be used to document the reason that a step is marked as unsatisfactory and to document unsatisfactory performance relating to management expectations.

Some operations that are performed from outside of the control room may require multiple steps. These items may be listed as individual steps in this JPM. It is acceptable for the applicant to direct the local operator to perform groups of procedure steps instead of calling for each individual item to be performed.

The timeclock starts when the applicant acknowledges the initiating cue.

Operator's Name: Job Title:		RO	SRO		SRO Cert
JPM Title: Perfor	m RPV Iso	lation duri	ng plant fi	re	
JPM Number: S-8					
Revision Number:	0				
K/A Number and Ir	nportance:	KA 286000;	A4.05; 3.3;	3.3	
Suggested Testing	g Environmer	nt: Simulato	r		
Actual Testing Env	vironment:				
Testing Method: F	Perform in Sim	nulator			
Alternate Path: No	0				
Time Critical: No					
Estimated Time to	Complete:	15 min. 🖌	Actual Time	Used:	minutes
References: 1. NUREG 1123, KA					
2. AOP-28, Operation	on During Plant	Fires, Rev. 1	8	·	
EVALUATION SUN 1. Were all the Critic 2. Was the task sta	cal Elements	performed sa	atisfactorily?	🗆 Yes 🗆 N	0
determined to be: Comments:		Satisfactory	□ U	nsatisfactory	
Note: Any grade of	UNSAT requ	ires a comm	ent.		
Evaluator's Name:				_(Print)	
Evaluator's Signat	ure:			Date	ə:
SIM JPM S-8.doc					4

Description: This JPM has the operator perform RPV Isolation during Plant Fire

.

.

NRC JAMES A. FITZPATRICK INITIAL EXAMINATION

JPM S-8

NOTE: Critical Element(s) indicated by * in Performance Checklist.

PERFORMANCE CHECKLIST:

JPM Start Time _____

ELEMENT	STANDARD	SAT	UNSAT	Comment Number
1. Obtain a controlled copy of procedure AOP-28, Operation During Plant Fires.	Obtains a controlled copy of AOP-28.			
2. Select the correct attachment to perform the task.	Applicant selects Attachment 2, Step 1.1 of AOP-28.			
* 3. Close CLN UP SUCT 12MOV-18.	Applicant closes CLN UP SUCT 12MOV-18 by placing associated control switch on Panel 09-3 in the CLOSE position.			
* 4.Close OUTBD STM SUPP VLV 23MOV-16.	Applicant closes 23MOV-16 by placing associated control switch on panel 09-4 in the CLOSE position.			
* 5. Close STM LINE WARMING VLV 23MOV-60	Applicant closes 23MOV-60 by placing associated control switch on panel 09-3 in the CLOSE position.			
* 6. Close Outboard MSIVs	Applicant closes outboard MSIVs by placing associated control switches (4) on panel 09-3 in the CLOSE position.			
7. Ensure closed 13MOV-16 in drywell entrance.	<u>EVALUATOR CUE</u> : Role play as in-plant operator and report 13MOV-16 has been verified closed.			
8. Attempt to trip TURB STOP VLV 13HOV-1 at panel 09-4.	Applicant attempts to trip 13HOV-1 by depressing red TURBINE TRIP pushbutton 13A-S17 09-4.			
	If 13HOV-1 fails to close then perform step 9 and 10			

NRC JAMES A. FITZPATRICK INITIAL EXAMINATION

JPM S-8

ELEMENT	STANDARD	SAT	UNSAT	Comment Number	
* 9.Open breaker DC MOTOR CONTROL CENTER 71BCB-2A-B05, (71BMCC-1) at 71BCB-2A in Station Battery Charger Room A. <u>EVALUATOR</u> : INSERT Malfunction RC03, Role play as in-plant operator and report 71BCB-2A-B05, (71BMCC- 1) at 71BCB-2A has been opened.	Contacts in-plant operator using Gaitronics or other acceptable method and directs operator to open breaker 71BCB-2A-B05, (71BMCC-1) at 71BCB-2A in Station Battery Charger Room A. <u>EVALUATOR</u> : INSERT Malfunction RC03, Role play as in-plant operator and report 71BCB-2A-B05, (71BMCC-1) at 71BCB-2A has been opened.				
10. Ensure closed, manually if required, 13MOV-16 in drywell entrance.	Contacts in-plant operator using Gaitronics or other acceptable method and directs operator to ensure closed 13MOV-16.				
EVALUAT	EVALUATOR: Terminate the task at this point.				

JPM Stop Time _____

NRC JAMES A. FITZPATRICK INITIAL EXAMINATION

JPM S-8

HANDOUT PAGE

TASK CONDITIONS:

- 1. A serious fire in the Reactor Building West Crescent has been confirmed by the Fire Brigade.
- 2. The Reactor has just been scrammed from rated power.
- 3. The CRS has determined that RPV isolation is desired.

INITIATING CUE:

You are the RO. The CRS directs you to perform the override actions of AOP-28 for a fire in the Reactor Building West Crescent Area.

Å	n	pe	n	đ	ix	D
-	~	20		u	1	~

Scenario Outline

Form ES-D-1

Facility: Fitzpatrick

Scenario No.: 1

Op-Test No.: 1

Examiners:

Operators: _

Initial Conditions: Reactor startup is in progress with power at 90%. SWS pumps 46P-1A and 46P-1B are in service with 46P-1C in standby.

Turnover: Continue power ascension to 100% IAW RAP-7.3.16. Maintenance is required on 46P-1A. Place 46P-1C in service.

52010

Event No.	Malf. No.	Event Type*	Event Description		
1	N/A	N-SNO	Swap SWS pumps. Place 46P-1C in service and remove 46P-1A.		
2	N/A	R-SNO	Raise power to 100% power using Rx recirc		
3	RR23:A	I-ATC TS-CRS	'A' Recirc Flow unit failure. TS call		
4	RR19:B	I-SNO2 TS-CRS	Upscale failure of 06LT-52B; FWLC level transmitter. TS call		
- 5	TC07:A	C-ATC	EHC System regulator escillation) hem in		
	RR15:A				
6	RP01AA		M-ALL	Coolant leakage inside primary containment. Defeat Auto Scram	
	RP01AB				
-	ED43 :A				
7	ED43 :B	M-ALL	Loss of offsite AC power		
	DG03:A				
8	DG03:C	C-ATC	Failure of 'A' and 'C' EDG output breakers to close		
9	RC07:A	I-SNO2	RCIC governor fails high and RCIC must be operated in manual to restore feed to the reactor vessel.		
10. AD07:A C-SNO2 'A' ADS fails to open					
*	* (N)ormal, (R)eactivity, (I)nstrument, (C)omponent, (M)ajor				

SCENARIO SUMMARY

Shift orders are to swap SWS pumps. Place 46P-1C in service and remove 46P-1A from service.

As part of turnover the crew is directed to raise power to 100% using recirc flow. Initial condition. 90% Continue with startup. OP-65 Startup and Shutdown procedure; step D.24.18.

The 'A' Recirc flow unit will fail downscale. This instrument failure should result in a half scram condition. The SRO must assess Tech Spec for the failed flow unit T/S 3.3.1.1 for RPS and T/S 3.3.2.1 RBM. I&C assistance will be required to bypass the 'A' Flow unit in order to reset the half scram.

The FWLC level transmitter 06LT-52B will fail upscale. Reactor feedwater controls will respond as though vessel level has increased and immediately begin to reduce feedwater flow to the RPV. The SRO must assess Tech Spec for the failed transmitter. T/S 3.3.2.2 Feedwater and Main Turbine High Water Level Trip instrumentation

EHC system regulator oscillations. CRS is to enter AOP- 6 and direct actions to place the 'B' EHC regulator in service.

A medium size LOCA will begin and progress. Drywell temperature and pressure will be rising requiring a manual scram. The auto scram functions are defeated. Upon the scram a Loss of offsite AC power will occur and the 'A' and 'C' EDG output breakers will fail to close potentially causing a challenge to ECCS systems operability.

RCIC will have a governor fails high and RCIC must be operated in manual to restore feed to the reactor vessel.

As the LOCA size increases RPV water level will continue to lower requiring emergency depressurization. When 7 ADS valves are open, the 'A' ADS valve will fail closed, requiring another SRV to be opened.

The scenario will be terminated when reactor level is being controlled in band using Low pressure ECCS pumps.

NRC Scenario #1 - 2010 Fitzpatrick Operating Test

INITIAL SIMULATOR SETUP

 ✓ 	ITEM / MALFUNCTION / REMOTE FUNCTION / CONDITION
	- Reset simulator to Protected IC -43
	 Apply Information Tags on the following components: N/A
	Take out of FREEZE and ensure the following:
	 46P-1A and 46P-1B; SWS pumps are in service
	 Service Water Pump 46P-1C is powered from the 10700 bus and will not be available when Normal Station Service Transformer T-4 is de-energized 'A' EHC regulator is in control.
	Ensure materials for applicants:
	- OP-65; Startup and Shutdown procedure. Marked up to step D.24.18
	- OP-42 : SWS; Marked up to step D.5
	- OP-27; RWR system
	- RAP-7.3.16 plant power ascension with recirc
·	- Reactivity maneuvering sheet
	Ensure the following malfunctions are loaded:
	- RR23:A; 'A' Recirc Flow unit failure; trigger 1; severity 0%
	- RR19:B; Upscale failure of 06LT-52B; FWLC level transmitter; trigger 2; severity 0%.
	- TC07:A; EHC system regulator oscillations; trigger 3
	- RR15:A; Coolant leakage inside primary containment; trigger 4, initial severity at 2 % with ramp 25 min, final severity 100%.
	- RP01AA; 'A' RPS Auto scram failure; PRESET
4	- RP01AB; 'B' RPS Auto scram failure; PRESET
	 ED43:A and B; Loss of offsite AC power; trigger 5; Manual trigger 4 minutes after D/W pressure of 2.7 psig.
	- DG03:A;failure of 'A' EDG output breaker to close: PRESET
	- DG03:C;failure of 'C' EDG output breaker to close: PRESET
	- RC07:A; RCIC governor fails high: PRESET - AD07:A : PRESET
	Ensure the following remote functions are loaded:
	- TC02; 'B' EHC regulator in service10, trigger 3; 2 minute delay
	Ensure the following overrides are loaded: None
	Ensure the following triggers are built:
	- trigger 1; RR23:A; 'A' Recirc Flow unit failure

.

 ✓ 	ITEM / MALFUNCTION / REMOTE FUNCTION / CONDITION				
	- trigger 2; RR19:B; Upscale failure of 06LT-52B; FWLC level transmitter				
	 trigger 3; TC07:A; 'A' EHC system regulator oscillations 				
	 trigger 4; RR15:A ; Severity initial 2% with ramp to 100% severity over 25 minutes 				
	- trigger 5; ED43:A and ED43:B. Manual trigger 5 minutes after Drywell pressure reaches 2.7 psig.				
	Reset any annunciators that should not be present				
	-s'tes				
	Ym.				

INSTRUCTIONS FOR SIMULATOR OPERATOR

EVENT 1: Swap SWS pumps. Place 46P-1C in service and remove 46P-1A

1	MALFUNCTION / REMOTE FUNCTION / REPORT					
	Place 46P-1C in service and remove 46P-1A from service; per OP-42;step G.1 for Startup of third SWS pump. Changing SWS pump lineup.					
	Respond as NPO during SWS pump swap					

EVENT 2: Raise power to 100% using Rx Recirc

1	MALFUNCTION / REMOTE FUNCTION / REPORT					
	Continue power ascension with Rx Recirc IAW RAP-7.3.16, OP-27and OP- 65					
	At the discretion of the Chief examiner after observing a rise in Reactor power, move to the next event.					
	Respond to request for assistance as appropriate.					

EVENT 3: 'A' Recirc Flow unit failure

1	MALFUNCTION / REMOTE FUNCTION / REPORT		
	Activate trigger 1 after events 1 and 2 are completed		
	Respond to request for assistance as appropriate.		

EVENT 4: Upscale failure of 06LT-52B; FWLC level transmitter

1	MALFUNCTION / REMOTE FUNCTION / REPORT		
	Activate trigger 2 after TS call has been made.		
	Respond to request for assistance as appropriate.		

EVENT 5: EHC system regulator oscillations

 ✓ 	MALFUNCTION / REMOTE FUNCTION / REPORT	
	Activate trigger 3 after TS call has been made.	
	Respond to request for assistance as appropriate.	

EVENT 6: Coolant leakage inside primary containment

4	MALFUNCTION / REMOTE FUNCTION / REPORT			
	Activate trigger 4 after actions are complete.			
	Auto RPS scram failure on 'A' and 'B' RPS.			
	Respond to request for assistance as appropriate.			

EVENT 7: Loss of Offsite AC power

EVENT 7:	Loss of Offsite AC power recention comment. Tind to	
 ✓ 	MALFUNCTION / REMOTE FUNCTION / REPORT SUM	A
	Manually activate trigger 5 ; 4 minutes after Drywell pressure reaches 2.7 psig.	
	Respond to request for assistance as appropriate.	

EVENT 8: Failure of 'A' and 'C' EDG output breakers to close

 ✓ 	MALFUNCTION / REMOTE FUNCTION / REPORT				
	PRESET malfunction				
	Respond to request for assistance as appropriate.				
EVENT 9:	RCIC governor fails high				
-	MALFUNCTION / REMOTE FUNCTION / REPORT				
	PRESET malfunction				

Respond to request for assistance as appropriate.

EVENT 10: Emergency RPV Depressurization

 ✓ 	MALFUNCTION / REMOTE FUNCTION / REPORT		
	When RPV level can not be maintained above -19 inches		
	Respond to request for assistance as appropriate.		

EVENT 11: 'A' ADS fails to open

1	MALFUNCTION / REMOTE FUNCTION / REPORT	
	PRESET malfunction	
	Respond to request for assistance as appropriate.	

Form ES-D-2

CRITICAL TASKS

- EOP-2: Scrams the reactor prior to 2.7 psig Drywell pressure with auto RPS scram defeated.
 - Standard: Expected action to occur when Drywell pressure is > 2.3 psig IAW OPG-13; Transient Mitigation.
 - Basis: The scram reduces the rate of energy production and thus the rate of drywell leakage. Basis from MIT-301.11C; EOP-2 basis
- 2. EOP-2 Manual closure of 'A' and 'C' EDG output breakers \mathcal{L}

Standard: Expected action to occur when auto closure of the breakers fail.

Basis: To maintain available Low Pressure ECCS injection required for adequate core cooling. Basis from MIT-301.11C; EOP-2 basis for adequate core cooling

- 3. EOP-2 Perform Emergency RPV Depressurization.
 - Standard: Before RPV water level reaches 19 inches; Emergency de-pressurizes per EOP-2, open 7 ADS valves.
 - Basis: If an injection source is available but the decreasing RPV water level trend cannot be reversed before RPV water level drops to the Minimum Steam Cooling RPV Water Level, a blowdown is performed to permit injection from low head systems, maximize flow from available injection sources, and minimize the flow through any primary system break. Basis from MIT-301.11C; EOP-2 basis for Emergency RPV depressurization.

Required Operator Actions

Form ES-D-2

SHIFT TURNOVER INFORMATION OFF GOING SHIFT D D N

DATE: Today

PART I: To be performed by the oncoming Operator before assuming the shift.

• Control Panel Walkdown (all panels) (SM,CRS,STA,RO,SNO2)

PART II: To be reviewed by the oncoming Operator before assuming the shift.

- Shift Manager Log (SM,CRS,STA)
- RO Log (RO)
- Lit Control Room Annunciators (SM,CRS,STA,RO, SNO2)
- Shift Turnover Checklist (ALL)
- LCO Status (SM,CRS,STA)
- Computer Alarm Summary (RO)

Evolutions/General information/Equipment Status:

Plant startup in progress from a refuel outage. Plant is at approximately 90% power

PART III: Remarks/Planned Evolutions:

- 1. <u>Swap SWS pumps. Place 46P-1C in service and remove 46P-1A from service following</u> pump swap.
- Continue power ascension to 100% power IAW RAP-7.3.16, OP-27 and OP-65 using Recirc.

PART IV: To be reviewed/accomplished shortly after assuming the shift:

- Review new Clearances (SM)
- Shift Crew Composition (SM/CRS)
- Test Control Annunciators (SNO2)

TITLE	NAME	TITLE	NAME
SRO			
ATC			
SNO2			

.

Required Operator Actions

Op-Test No.: 1 Event No.: 1				
Event Description: Swap SWS pumps. Place 46P-1C in service and remove 46P-1A from service				
Time	Position	Applicant's Actions or Behavior		
	CRS	Orders SNO2 to start 46P-1C per OP-42 and remove 46P-1A from service.		
		Note 1: OP-42; section G.1		
	SNO2	Informs Chemistry that SWS pumps will be swapped to 46P-1B and 46P-1C pumps in service.		
	SNO2	Coordinate with NPO to monitor SWS pump swap and screen wash booster pump alignment.		
	SNO2	Starts 46P-1C by placing pump to start		
		Note 2: OP-42 contains tap changer steps for adjusting 12500 bus voltage. This may be done		
	Sim Booth Operator	Respond as NPO that 46P-1C pump start is SAT.		
	SNO2	Remove 46P-1A from service by placing pump to stop.		
		Note 3: Reduce voltage on 125000		
		Examiner Note:		
	Proceed to the next event			

.

Required Operator Actions

Event Description: Raise Reactor Power with recirc IAW RAP-7.3.16; OP-27 and OP-65		
Time	Position Applicant's Actions or Behavior	
		If not already performed, CRS conducts reactivity brief on raising Reactor Power with recirc IAW RAP-7.3.16; OP-27; and OP-65.
	CRS	Reviews Reactor Engineering RAP-7.3.16 and reactivity maneuvering guidance, if not previously performed.
	CRS	CRS Orders SNO2 to raise reactor power with reactor recirc pumps to 100% power.
		Provides Reactivity CRS monitoring.
		IAW RAP-7.3.16 and OP-27; step E.2.1; Recirculation system commences raising Reactor Power :
		a. Guidance given in RAP-7.3.16 for adjusting reactor power, including maximum rate of power change.
		b. Maintain core flow less than or equal to 80.85 Mlb/hr.
	SNO2	c. Control mismatch between recirculation loop jet pump flow as follows:
		 if operating at less than 70% of rated core flow, THEN maintain mismatch less than or equal to 10% of rated core flow.
		 2) if operating at greater than or equal to 70% of rated core flow, then maintain mismatch less than or equal to 5% of rated core flow
		d. Adjust speed in 1 to 3% increments.
	ATC	Monitors plant for correct response as power is raised.
		Examiner Note:
		Proceed to next event when sufficient change in power level is observed.

Required Operator Actions

Op-Test I	Op-Test No.: 1 Scenario No.: 1 Event No.: 3		
Event De	Event Description: 'A' Recirc Flow unit downscale failure		
Time	ime Position Applicant's Actions or Behavior		
		Responds to alarms: 09-5-1-3 RPS A AUTO SCRAM	
		09-5-2-2 ROD WITHDRAW BLOCK	
		9-5-2-25 FLOW REF OFF NORM	
	ALL	09-5-1-41 NEUTRON MON SYS TRIP	
		9-5-2-44 APRM UPSCALE	
		9-5-2-54 APRM TRIP SYS A INOP OR UPSCALE TRIP	
	ATC/	Determines 'A' Flow unit downscale failure. Indication in back panel 09-	
	SNO2	14.	
	CRS	Enters AOP-59 for loss of RPS bus power and CRS orders ATC to bypass 'A' flow unit.	
	ATC	Bypasses 'A' Flow unit per OP-16.	
	ATC/	Places S-1 switch for 'A' Flow Unit to INT TEST.	
	SNO2		
		So is so it of	
	ATC	Resets half scram.	
	CRS	Makes Tech Spec call for an inoperable flow unit. T/S 3.3.1.1 Action A.A1 place channel in the tripped condition in 12 hours RPS and TRM 3.3.B.A.A1.1b, 7 days.	
		yound Connert Look for	
	CRS	Briefs crew on the event.	
		Examiner Note:	
	Proceed to the next event		

Required Operator Actions

Op-Test I	Op-Test No.: 1 Scenario No.: 1 Event No.: 4			
Event De	Event Description: Upscale failure of 06LT-52B; FWLC level transmitter			
Time	Position	Applicant's Actions or Behavior		
		Responds to alarms: 09-5-1-28 RX WTR LVL ALARM HI OR LO		
	ALL	09-5-2-29 FDWTR CH A or B or C RX WTR LVL HIGH TRIP		
·····				
	CRS	Enters AOP-42; Determines upscale failure of 06LT-52B.		
	CRS	Orders SNO2 to place feedwater controls in manual and attempt to maintain RPV water level between 196.5 inches and 206.5 inches. Swap to other level channel per OP-2A		
- - - -	SNO	Place feedwater in manual control to maintain RPV water level between 196.5 inches and 206.5 inches. Swap to other level channel per OP-2A.		
		Verifies the following:		
	SNO2	 Operating condensate and condensate booster and feedwater pumps lineup. 		
	· · · · · · · · · · · · · · · · · · ·			
	CRS	CRS enters OP-27A and makes Tech Spec call for failure of 06LT-52B. T/S 3.3.2.2. A. A1 Feedwater and Main Turbine High Water Level Trip Instrumentation. With 1 channel inoperable, place channel in the tripped condition within 7 days.		
	CRS	Briefs crew on the event		
		Examiner Note:		
	Proceed to the next event			

Required Operator Actions

Form ES-D-2

 Op-Test No.:
 1
 Event No.:
 5

Event Description: EHC System regulator oscillation

Time	Position	Applicant's Actions or Behavior	
		Observation of rising RPV pressure: RPV pressure rises approximately 3 psi. Backup EHC pressure regulator IN CONTROL light is on at EHC section of panel 09-5. Small dip in RPV water level. Small upscale spike in nuclear instrumentation.	
	ATC/ SNO2	Report observation of rising RPV pressure to CRS	
	CRS	 CRS enters AOP-32 and AOP-6 for EHC Malfunction for rising pressure. Orders the following to ATC/SNO2: Verify backup EHC pressure regulator stabilizes RPV pressure (approximately 3 psi greater than initial pressure). Lower reactor power level by approximately 5 percent per RAP-7.3.16. Verify EHC hydraulic fluid system is operating normally per Section E of OP-8. Demand an official 3D Monicore report and evaluate reactor power and thermal limits. Take corrective actions per RAP-7.3.16. Establish communication between the Control Room and Bay "A" of EHC Cabinet (EHP) in the Relay Room. 	
	ATC/ SNO2	 ATC verifies backup EHC pressure regulator stabilizes RPV pressure (approximately 3 psi greater than initial pressure). SNO2 reduces reactor power level by approximately 5 percent per RAP-7.3.16. 	
	CRS Examiner	Briefs crew on the event. Note: After 5% power reduction move to next malfunction	
	Proceed to the next event		

Required Operator Actions

Op-Test	No.: <u>1</u>	Scenario No.: _1 Event No.: _6		
Event De	escription: Coc	plant leakage inside primary containment		
Time	Time Position Applicant's Actions or Behavior			
	ALL	Annunciator 09-5-1-34 DW PRESS ALARM HI OR LO. Report of rising drywell pressure.		
	CRS	Enters AOP-39 for loss of coolant. Orders SNO2 to attempt to detect and locate leak per Attachment 1.		
	SNO2	Performs Attachment 1 of AOP-39.		
СТ	CRS	Orders manual scram if drywell pressure > 2.3 psig. Enters AOP-1.		
		NOTE: Auto RPS scram function are defeated.		
		 Inserts Manual Scram and perform AOP-1 Immediate Actions Depress Manual Scram pushbuttons Reactor Mode Switch to Shutdown 		
	ATC	 Fully Insert all SRM's and IRM's Verify all rods in Verify SDIV Vent and Drain valves closed Verify APRM's downscale Verify RWR pumps running Verify/Trip Main Turbine Verify electrical distribution fast transfer Verify at least 1 Circ Water pump running 		
	CRS	Orders SNO2 to control level with Feed/Condensate at 177-222.5 in.		
	SNO2	Trend level performance and manipulate GEMAC Master/Individual controllers, RFP discharge valves and RFP trip as necessary to control level.		
	CRS	Enters EOP-2 and EOP-4 when drywell pressure exceeds 2.7 psig. Other EOP entry conditions EOP-2; RPV water level below 177 inches. EOP-4; Drywell temperature above 135°F.		
		Examiner Note:		
Proceed to the next event				

Form ES-D-2

Op-Test I	No.: <u>1</u>	Scenario No.: 1 Event No.: 7 and 8
Event De	scription: Lo	oss of offsite AC power and failure of 'A' and 'C' EDG output breakers to close.
Time	Position	Applicant's Actions or Behavior
1,002	Sim Booth Oper	Trigger 5 for ED43: A and B; 4 minutes after Drywell pressure reaches 2.7 psig.
	CRS	References AOP-72; 115 KV Grid loss but performs other AOPs and EOPs.
	ATC	Verifies all EDG starts.
	SNO2	With no circ water pumps running, closes MSIVs.
	ATC	Identifies and reports to CRS the failure of 'A' and 'C'EDG output breakers to close.
-	ATC	Closes 'A' and 'C' EDG output breakers and verifies 'A' and 'C' EDG load sequencing.
	SNO2	Verifies all available ECCS pumps start.
	CRS	Orders SNO2 to maintain RPV level between 177 and 222.5 inches using RCIC and HPCI align suctions from the CST. Defeat HPCI Hi area temperature and High Torus water level suction transfer if necessary IAW EP-2. Defeat RCIC low RPV pressure and high area temperature isolations if necessary IAW EP-2.
		A real to swipt
	AD	Stime instintes premielet

NRC Scenario #1 - 2010 Fitzpatrick Operating Test

Page 15 of 21

Required Operator Actions

Op-Test I	No.: <u>1</u>	Scenario No.: 1 Event No.: 7 and 8
Event De	escription: Lo	oss of offsite AC power and failure of 'A' and 'C' EDG output breakers to close.
Time	Position	Applicant's Actions or Behavior
		Maintains RPV level between 177 and 222.5 inches using RCIC and HPCI align suctions from the CST.
	SNO2	 Defeats HPCI Hi area temperature and High Torus water level suction transfer if necessary IAW EP-2.
		 Defeats RCIC low RPV pressure and high area temperature isolations if necessary IAW EP-2.
		 HPCI HI AREA TEMPERATURE DEFEAT 5.7.1 Verify one of the following conditions exist: A steam leak does not exist in HPCI steam piping outside the containment. OR
	SNO2	 Operation of both HPCI AND RCIC is required to maintain RPV water level. 5.7.2 For 23MOV-15, place HPCI STM LEAK AUTO ISOL DIV I2F-S6A keylock switch in TEST at panel 09-21.
		5.7.3 For 23MOV-16 and 60, place HPCI STM LEAK AUTO ISOL DIV I1 2F-S6B keylock switch at panel 09-21.
		HPCI HIGH TORUS WATER LEVEL SUCTION TRANSFER DEFEAT 5.13.1 Place HPCI TORUS SUCT BYPASS SW 23A-S31 keylock switch in BYPASS at panel 09-3.
		5.13.2 Verify white HPCI TORUS SUCT BYPASS LT 23A-DS76 light is on at panel 09-3.
	SNO2	 5.13.3 Perform one of the following: A. IF HPCI not running, AND HPCI suction has swapped to torus, THEN restore HPCI to CST as follows: 1. Close the following valves: 23MOV-57 23MOV-58 2. Open 23MOV-17.
		 B. IF HPCI must remain running, AND HPCI suction has swapped to torus, THEN place in close the following valves: 23MOV-57 23MOV-58 When 23MOV-57 and 23MOV-58 have dual indication open +0 23MOV-17.

NUV 22 for ()Page 16 of 21 ()

Required Operator Actions

Op-Test	No.: <u>1</u>	Scenario No.: <u>1</u> Event No.: <u>7 and 8</u>	
Event De	escription: Lo	oss of offsite AC power and failure of 'A' and 'C' EDG output breakers to close.	
Time	Position	Applicant's Actions or Behavior	
	SNO2	 RCIC LOW RPV PRESSURE DEFEAT 5.17.1 For 13MOV-15, disconnect lead from one of the following terminals in panel 09-33: AA-71 OR AA-72 	
		5.17.2 For 13MOV-16, disconnect lead from one of the following terminals in panel 09-30: AA-28 OR AA-29	
		RCIC HIGH AREA TEMPERATURE DEFEAT 5.16.1 Verify one of the following conditions exist: A steam leak does not exist in RCIC steam piping outside the containment. OR	
	SNO2	Operation of both HPCI AND RCIC is required to maintain RPV water level.	
		5.16.2 For 13MOV-16, place RCIC STM LEAK AUTO ISOL DIV I 2F-S5A keylock switch in TEST at panel 09-21. 5.16.3 For 13MOV-15, place RCIC STM LEAK AUTO ISOL DIV I1 2F-S5B keylock switch in TEST at panel 09-21.	
	CRS	Orders SNO2 to spray the Torus before Torus pressure reaches 15 psig using the posted instructions.	

Required Operator Actions

Op-Test No.: 1 Scenario No.: 1 Event No.: 7 and 8 Event Description: Loss of offsite AC power and failure of 'A' and 'C' EDG output breakers to close.		
Time	Position	Applicant's Actions or Behavior
		Places RHR in Torus spray mode using the posted instructions.
		1. Verify torus pressure is GREATER THAN 2.7 psig.
		2. IF RPV water level is LESS THAN 10 inches on fuel zone water level indication, and the EOPs permit diverting LPCI flow, THEN place DW & TORUS SPRAY VLV OVERRIDE OF FUEL ZONE LVL 10A-S18A(B) keylock switch in MANUAL OVERRD.
		3. Place SPRAY CNTRL 10A-S17A(B) switch to MANUAL, spring return to normal.
		4. Verify white SPRAY PERM 10A-DS-67A(B) light is on.
		 5. Ensure available RHR pumps in RHR loop A(B) are running: RHR PMP 10P-3A(B) RHR PMP 10P-3C(D)
		NOTE: 10MOV-3/A(B) may be throttled when 10MOV-39A(B) has dual position indication.
	SNO2	6. Open RHR TEST TORUS CLG & SPRAY 10MOV-39A(B).
		7. Throttle TORUS SPRAY INBD VLV 10MOV-38A(B) to establish desired torus spray flow rate.
		8. WHEN RHR Loop A(B) flow is GREATER THAN ensure closed MIN FLOW VLV I0MOV-16A(B).1500 gpm,
		9. Throttle RHR TEST & TORUS CLG 10MOV-34A(B) to divert excess flow to the torus to maintain > 6,500 gpm RHR Loop A(B) flow with one RHR pump operating or > 13,000 gpm RHR Loop A(B) flow with two RHR pumps operating.
		NOTE: Procedure may be continued while condensate transfer is being isolated.
		10. IF RHR Loop A(B) condensate transfer keep-full is in service, AND RHR Loop A(B) pressure is LESS THAN condensate transfer pressure, THEN close I0RHR-274(I0RHR-260).
		11. Establish RHRSW flow and temperature control.
H 48 - 1 - 1	-	
	CRS	Orders SNO2 to place RHR in Torus cooling mode using the posted instructions.

~

Required Operator Actions

Op-Test I	Op-Test No.: 1 Scenario No.: 1 Event No.: 7 and 8			
Event Description: Loss of offsite AC power and failure of 'A' and 'C' EDG output breakers to close.				
Time	Time Position Applicant's Actions or Behavior			
		Places RHR in Torus cooling mode using the posted instructions. 1. IF a LPCI auto-initiation signal is sealed in, THEN perform the following:		
		a. IF RPV water level is LESS THAN 10 inches on fuel zone water level indication, and the EOPs permit diverting LPCI flow,THEN place DW & TORUS SPRAY VLV OVERRIDE OF FUEL ZONE LVL 10A-S18A(B) keylock switch in MANUAL OVERRD.		
	9 1	b. Place SPRAY CNTRL 10A-S17A(B) switch to MANUAL, spring return to normal.		
		c. Verify white SPRAY PERM 10A-DS-67A(B) light is on.		
		 2. Ensure at least one of the following RHR pumps is running: RHR PMP 10P-3A(B) RHR PMP 10P-3C(D) 		
	SNO2	NOTE: 10MOV-3/A(B) may be throttled when 10MOV-39A(B) has dual position indication.		
		3. Open RHR TEST TORUS CLG & SPRAY 10MOV-39A(B).		
		 Throttle RHR TEST & TORUS CLG 10MOV-34A(B) to establish desire flow. 		
		5. WHEN RHR Loop A(B) flow is GREATER THAN 1500 gpm, ensure closed MIN FLOW VLV I0MOV-I6A(B).		
		NOTE: Procedure may be continued while condensate transfer is being isolated.		
		6. IF RHR Loop A(B) condensate transfer keep-full is in service, AND RHR Loop A(B) pressure is LESS THAN condensate transfer pressure, close 10RHR-274(10RHR-260).		
		7. Establish RHRSW flow and temperature control.		
		NOTE		
		If Torus sprays have been initiated, terminate Torus sprays before Torus pressure drops below 0 psig.		
	SNO2	Terminates Torus sprays before Torus pressure drops below 0 psig.		
	Examiner Note:			
	Proceed to the next event			

.

Required Operator Actions

	Op-Test I	No.: <u>1</u>	Scenario No.: 1 Event No.: 9
	Event De	scription: R	CIC governor fails high
	Time	Position	Applicant's Actions or Behavior
		SNO2	Recognizes that RCIC governor has failed high when RCIC starts on low RPV water level and reports this information to the CRS.
	/	[
		SNO2	Places RCIC in manual for governor control to maintain RPV Level 177 to 222.5 inches.
	\square	SNO2	Provides update to CRS on RPV water level trend.
		CRS	Changes RPV water level band when RPV level is below 177 inches and enters Alternate RPV level Control.
Keep			By Furs ADS
		CRS	Establishes new RPV level Band. Restore and maintain RPV level above 0 inches (TAF). May use 1 or more of Group 2 Water level Control Systems.
1 - 1			
the		CRS	CRS Orders SNO2 to use LPCI-A; LPCI-B; CS-A; CS-B; and 1 or more of Group 2 Water level Control Systems for injection.
$() \mathcal{N}^{\mathcal{N}}$			
V		SNO2	Lines up LPCI-A; LPCI-B; CS-A; CS-B; and 1 or more of Group 2 Water level Control Systems for injection for injection.
			. /
			Examiner Note:
			Proceed to the next event

Required Operator Actions

Form ES-D-2

Op-Test	Op-Test No.: 1 Scenario No.: 1 Event No.: 10			
Event De	Event Description: Emergency RPV depressurization; 'A' ADS valve fails to open			
Time	Position Applicant's Actions or Behavior			
	CRS	Orders ATC to override ADS.		
	ATC	Overrides ADS and reports back to CRS.		
ст	CRS	Before RPV water level reaches – 19 inches; CRS enters Emergency Depressurization and Orders opening 7 ADS Valves.		
	ATC	Opens 7 ADS valves and reports 'A' ADS valve has failed to open.		
	CRS	Orders ATC to open another SRV.		
	ATC	Opens another SRV.		
	CRS	Orders SNO2 to maintain RPV level above 177 inches with LPCI and Core Spray.		
	RPV lev	E THE SCENARIO WHEN ALL THE FOLLOWING ARE MET: rel is controlled with band of 177 inches and 222.5 inches with LPCI re Spray.		

POST-SCENARIO:

HAVE THE APPLICANT IN THE CRS POSITION IDENTIFY THE HIGHEST EAL CLASSIFICATION FOR THE COMBINATION OF EVENTS EXPERIENCED DURING THE SCENARIO.

Alert: 3.1.1. due to Coolant leakage

NRC Scenario #2 - 2010 Fitzpatrick Operating Test

Facility: Fitzpatrick Scenario No.: 2 Op-Test No.: 1 Examiners: Operators: Initial Conditions: Reactor is in Mode 1 with power at 80%. Power ascension on hold for CRD pump swap. Turnover: Swap CRD pumps. Place 'A' CRD pump in service and remove 'B' CRD pump from service. Event Malf. No. Event Event No. Type* Description Place 'A' CRD pump in service and remove 'B' CRD pump from 1 N/A N-SNO service. TS-SRO 2 HP05 Inadvertent HPCI initiation C-SNO Upscale failure of Drywell Pressure transmitter 10PT-101A. TS-SRO 3 I- PC05-14 TS call R-ATC FW13:A 33E-6A Feedwater Heater Tube Leak. 4 C-SNO C-SNO 5 ED04:A Inverter failure 71-INV-3A failure TS-SRO C-ATC 6 MC01 Main condenser In-leakage; Loss of condenser vacuum C-SNO **RP01AA** RP01BA Failure to scram; RPS is still energized, ARI fails to actuate. 7 M-ALL **RP09** SL01 :A 8 C-ATC Trip of the in service SLC pump or B SL03;A or 9 C-ATC SLC Pump 'A' or 'B' relief 11-RV-39A or 11-RV-39B lifts В 10 RC02 C-SNO RCIC failure to auto start * (N)ormal, (R)eactivity, (I)nstrument, (C)omponent, (M)ajor

Scenario Outline

SCENARIO SUMMARY

Initial conditions are a reactor startup is in progress with power at 80%. Shift orders are to place 'A' CRD pump 03P-16A in service and remove 'B' CRD pump 03P-16B IAW OP-25 G.10.

HPCI will inadvertently initiate, requiring crew actions to validate HPCI response and trip HPCI. Enters TS 3.5.1.D and C, 14 day LCO, verify RCIC operable. 72 hours to restore HPCI or LPCI.

Drywell pressure transmitter 10PT-101A will fail upscale. The SRO must assess TS for the failure. And will determine that Tech Spec 3.3.5.1.A must be entered.

33E-6A FWH will develop a tube leak. CRS will enter AOP-62 and will need to order power reduction IAW AOP-62; Loss of Feedwater Heating guidance

LPCI 'A' Inverter output breaker trips. SNO transfer TS call for the SRO. T/S 3.8.4.D. declares the associated LPCI subsystem inoperable immediately.

There will be main condenser in-leakage causing condenser vacuum to degrade. CRS enters AOP-31 for loss of condenser Vacuum. Eventually the main turbine will trip on loss of vacuum.

There will be a failure to scram when the scram is attempted. Entry into EOP-2 and then EOP-3 will be required. The 'A' SLC pump when started will trip and 'B' SLC is inoperable without L-16. Requiring the use of de-energizing the scram solenoids or venting the scram air header.

When RPV water level is intentionally lowered, RCIC will have an auto start failure requiring a manual start.

The scenario will be terminated when all control rods are inserted to or beyond position 02 and EOP-2 has been entered.

INITIAL SIMULATOR SETUP

\checkmark	ITEM / MALFUNCTION / REMOTE FUNCTION / CONDITION
	- Reset simulator to : Protected IC
	Apply Information Tags on the following components:
	 Take out of FREEZE and ensure the following: Rx power is at 80% ready to swap CRD pumps
	 Ensure materials for applicants: OP-65; Startup and shutdown procedure; step D.21.4 OP-25; Changing in-service CRD pumps; step G.10
	 Ensure the following malfunctions are loaded: HP05; HPCI inadventent initiation; trigger 1 I-PC05-14; Failure of drywell pressure transmitter; trigger 2 FW13A; 33E-6A Feedwater Heater Tube Leak trigger 3 ED04; LPCI inverter 71-INV-3A; trigger 4 MC01; Main condenser in-leakage; trigger 5. RP01AA; RP01BA and RP09; PRESET ; Failure to scram SL01:A; 'A' SLC pump trip; trigger 6 RC02; RCIC failure to auto start; PRESET Ensure the following remote functions are loaded: RD03 RD04
	 Ensure the following overrides are loaded: None Ensure the following triggers are built: trigger 1; HP05; HPCI inadventent initiation trigger 2; I-PC05-14; Failure of drywell pressure transmitter trigger 3; FW13A; 33E-6A Feedwater Heater Tube Leak trigger 4; ED04; LPCI inverter 71-INV-3A; trigger 4 trigger 5; MC01; Main condenser in-leakage. SL01:A; trigger 6
	Reset any annunciators that should not be present

Required Operator Actions

Form ES-D-2

INSTRUCTIONS FOR SIMULATOR OPERATOR

EVENT 1: Swap in-service CRD pumps

 ✓ 	MALFUNCTION / REMOTE FUNCTION / REPORT
	Place 03P-16A in service and removed 03P-16B
	Respond as NPO during the start of 'A' CRD pump

EVENT 2: HPCI inadvertent initiation

MALFUNCTION / REMOTE FUNCTION / REPORT
Activate Trigger 1 after CRD pumps are swapped
Respond to request for assistance as appropriate.

EVENT 3: Upscale failure of Drywell Pressure transmitter 10PT-101A

✓	MALFUNCTION / REMOTE FUNCTION / REPORT
	Activate Trigger 2 after event 2 is completed.
	Respond to request for assistance as appropriate.

EVENT 4: 33E-6A Feedwater Heater Tube Leak AOP-62

✓	MALFUNCTION / REMOTE FUNCTION / REPORT
	Activate trigger 3 after TS call has been made.
	Respond to request for assistance as appropriate.

EVENT 5: Loss of LPCI inverter 71-INV-3A

✓	MALFUNCTION / REMOTE FUNCTION / REPORT
	Activate trigger 4 after event 4 is completed
	Respond to request for assistance as appropriate.

EVENT 6: Main Condenser in-leakage Enter AOP-31

 ✓ 	MALFUNCTION / REMOTE FUNCTION / REPORT	
	Activate trigger 5 after TS call has been made.	
	All valve in correct positions per AOP-14, Step C.5	
	Report a tear in the "A" RFPT Exhaust Boot	
	Respond to request for assistance as appropriate.	

EVENT 7: Failure to scram

✓	MALFUNCTION / REMOTE FUNCTION / REPORT	
	PRESET RP01AA; RP01BA and RP09	
	Respond to request for assistance as appropriate.	

EVENT 8: Trip the in service SLC pump

 ✓ 	MALFUNCTION / REMOTE FUNCTION / REPORT	
	Booth Operator insert malfunction SL01:A; trigger 5 or SL01:B trigger 6 as appropriate.	
	Respond to request for assistance as appropriate.	

EVENT 9: In service SLC pump relief valve lifts 11-RV-39A or B

✓	MALFUNCTION / REMOTE FUNCTION / REPORT	
	Booth Operator insert malfunction SL03:A; trigger 7 or SL03:B trigger 8 as appropriate.	
	Respond to request for assistance as appropriate.	

EVENT 10: RCIC failure to auto start

√	MALFUNCTION / REMOTE FUNCTION / REPORT
	PRESET RC02
	Respond to request for assistance as appropriate.

Basis-

()

~ 02 <

, Fi

CRITICAL TASKS

- 1. EOP-3: De-energize scram solenoid fuses or vent the scram air header per EP-3 until all rods are fully inserted.
 - Standard: With failure of RPS and ARI to actuate control rod insertion is required by removal of scram solenoid fuses or venting the scram air header.
 - Basis: EP-3 basis for backup control rod insertion methods
- 2. EOP-3: Terminate and Prevent injection sources per EP-5 with Reactor Power >2.5% Re-inject to maintain RPV water level 0 - 100 inches > TAF/

Standard - Terminate and Prevent with Reactor Power > 2.5% and all RPV injection except SLC, RCIC and CRD.

RPV water level is lowered to prevent thermal-hydraulic instabilities. Core instabilities may occur in a BWR when the reactor is operated at relatively high power-to-flow ratios and recirculation flow is reduced. The potential for instabilities is largely dependent upon core inlet subcooling. The greater the subcooling, the more likely that power oscillations will occur and increase in magnitude. Prompt level reduction is the most effective method of preventing or suppressing power oscillations.

3. EOP-3 Terminate and prevent all RPV injection sources except RCIC, CRD and SLC when BIIT is exceeded per EP-5. re-inject to maintain RPV water level -19 inches and either:

the level to which RPV water level was lowered, if it was deliberately lowered or

222.5 inches, if RPV water level was not deliberately lowered.

Standard: Terminate and prevent all RPV injection sources except RCIC, CRD and SLC when BIIT is exceeded per EP-5. re-inject to maintain RPV water level -19 inches and either:

the level to which RPV water level was lowered, if it was deliberately lowered

22.5 inches, if RPV water level was not deliberately lowered.

Basis: RPV water level is lowered to prevent thermal-hydraulic instabilities. Core instabilities may occur in a BWR when the reactor is operated at relatively high power-to-flow ratios and recirculation flow is reduced. The potential for instabilities is largely dependent upon core inlet subcooling. The greater the subcooling, the more likely that power oscillations will occur and increase in magnitude. Prompt level reduction is the most effective method of preventing or suppressing power oscillations.

Appendix D	Ap	pen	dix	D
------------	----	-----	-----	---

Required Operator Actions

Form ES-D-2

SHIFT TURNOVER INFORMATION

OFF GOING SHIFT D

DATE: Today

PART I: To be performed by the oncoming Operator before assuming the shift.

• Control Panel Walkdown (all panels) (SM,CRS,STA,RO,SNO)

PART II: To be reviewed by the oncoming Operator before assuming the shift.

- Shift Manager Log (SM,CRS,STA)
- RO Log (RO)
- Lit Control Room Annunciators (SM,CRS,STA,RO, SNO)
- Shift Turnover Checklist (ALL)
- LCO Status (SM,CRS,STA)
- Computer Alarm Summary (RO)

Evolutions/General information/Equipment Status:

Plant startup in progress from a refuel outage. Plant is at approximately 80% power

PART III: Remarks/Planned Evolutions:

- 1. Swap in-service CRD pumps. Place 'A' CRD pump in service and remove 'B' CRD pump
- 2. Continue power ascension to 85% power IAW RAP-7.3.16 by withdrawing control rods

PART IV: To be reviewed/accomplished shortly after assuming the shift:

- Review new Clearances (SM)
- Shift Crew Composition (SM/CRS)
- Test Control Annunciators (SNO)

TITLE	NAME	TITLE	NAME
SRO			
ATC			
SNO			

Required Operator Actions

Op-Test N	lo.: _1	Scenario No.: _2 Event No.: _1_	
Event Description: 03P-16B		Swap in-service CRD pumps. Place 03P-16A in service and remove	
Time	Position	Applicant's Actions or Behavior	
	CRS	Orders SNO to place 03P-16A; 'A' CRD pump in service and then remove 03P-16' 'B' CRD pump per OP-25; section G.10	
		<u>Note:</u> Procedure marked up steps completed up to step G.10.2	
	SNO	Coordinate with NPO to monitor 03P-16A pump start.	
	SNO	 Adjust CRD FLOW CNTRL 03FIC-301 to establish 20 to 30 gpm on 03FIC-301 or 03FI-310. Starts CRD PMP 03P-16A. Stop CRD PMP 03P-16B. Adjust CRD FLOW CNTRL 03FIC-301 to establish 59 to 61 gpm on 03FI-310 or 03FIC-301. Verify normal operating values on the following indicators at panel 09-5: CHG WTR PRESS 03PI-302: BETWEEN 1390 and 1580 psig, not to exceed 1670 psig DRV WTR DIFF PRESS 03DPI-303: 260 to 270 psid CLG WTR DIFF PRESS 03DPI-304: approximately 10 to 26 psid DRV WTR FLOW 03FI-305: zero when no CRD is being driven CLG WTR FLOW 03FI-306: 59 to 61 gpm 	
	Sim Booth Operator	Respond as NPO that 03P-16A pump start is sat.	
		Examiner Note:	
		Proceed to the next event	

Required Operator Actions

		Examiner Note: Proceed to next event			
	SNO	SBGT started on HPCI start, secure SBGT or lineup flowpath by opening suction valve			
	CRS	Enters TS 3.5.1.D and C, 14 day LCO, verify RCIC operable. 72 hours to restore HPCI or LPCI			
	CRS	(If HPCI injects and power changes), CRS enters AOP-32 Unexplained/Unanticipated reactivity change			
	SNO	Secures HPCI			
	CRS	Directs SNO to trip HPCI			
	SNO	Observes indications for Drywell pressure and reactor water level, determines HPCI start is not valid			
	CRS	Directs crew to verify the validity of the HPCI auto start using multiple indications.			
	All	Recognize HPCI is starting			
Time	Position	Applicant's Actions or Behavior			
Event De	Event Description: Inadvertent HPCI Initiation				
Op-Test No.: <u>1</u> Scenario No.: <u>2</u> Event No.: <u>2</u>					

Required Operator Actions

Op-Test I	Op-Test No.: <u>1</u> Scenario No.: <u>2</u> Event No.: <u>3</u>				
Event De	Event Description: Upscale failure of Drywell Pressure Transmitter 10PT-101A				
Time	Position	Applicant's Actions or Behavior			
	ALL	Respond to annunciator 09-3-1-24 RHR LOGIC DW PRESS HI			
	SNO	Determines Drywell pressure transmitter 10PT-101A has failed upscale.			
	CRS	Enters T/S 3.3.5.1.A. Chanel is already in the tripped condition			
	CRS	Briefs crew on this event			
	Examiner Note:				
	Proceed to the next event				

Required Operator Actions

Op-⊺est No.: <u>1</u>		Scenario No.: _2 Event No.: _4			
Event Description: 33E-6A Feedwater Heater Tube Leak					
Time	Position	Applicant's Actions or Behavior			
		<u>OVERRIDES</u> IF indications of thermal-hydraulic instability occur,			
		THEN insert a manual scram and exit this procedure.			
		CAUTIONS			
		Lower feedwater temperature reduces the margin to the onset of core thermal-hydraulic instability.			
		A noticeable rise in core thermal power or APRM power in			
		conjunction with a lowering RPV feedwater inlet temperature			
		 (EPIC Screen FDWTR) caused by the following: Loss of feedwater heater level control 			
	ALL	 Closure of reheat steam supply valve 			
		 Isolation of extraction steam to the feedwater heater(s) 			
		High level in first point feedwater heater			
	ATC/ SNO	Identifies 33E-6A Feedwater Heater Tube leak			
	CRS	Enters AOP-62 for a loss of feed water heating			
	CRS	Orders ATC to monitor for indications of thermal-hydraulic instability per OP-16 posted attachment. And monitors APRM power and RPV feedwater inlet temperature changes on EPIC Screen FDWTR or EPIC points A-3411 and A-3412.			
	ATC	Monitors for indications of thermal-hydraulic instability per OP-16 posted attachment. And monitors APRM power and RPV feedwater inlet temperature changes on EPIC Screen FDWTR or EPIC points A-3411 and A-3412.			

Required Operator Actions

Form ES-D-2

 Op-Test No.:
 1
 Scenario No.:
 2
 Event No.:
 4

Event Description: 33E-6A Feedwater Heater Tube Leak

			
Time	Position	Applicant's Actions or Behavior	
	CRS	 CRS orders if initial reactor power is LESS THAN OR EQUAL TO 90%, AND core flow is GREATER THAN 80%, THEN perform the following: Lower RWR flow to establish approximately 55% core flow. Insert cram groups per RAP-7.3.16 UNTIL reactor power is BELOW 100% rod line. Maintain reactor power at least 20% below the pre-transient power 	
		level	
	CRS	 Orders ATC to lower RWR flow to establish approximately 55% core flow. Orders ATC Insert cram groups per RAP-7.3.16 UNTIL reactor power is BELOW 100% rod line. Orders ATC maintain reactor power at least 20% below the pre-transient power level. 	
	ATC	 Lowers RWR flow to establish approximately 55% core flow. Inserts cram groups per RAP-7.3.16 UNTIL reactor power is BELOW 100% rod line. Maintains reactor power at least 20% below the pre-transient power level. 	
	SNO	Monitors secondary side of the plant and performs verifications for ATC.	
	CRS	 WHEN reactor power is stable demand an Official 3D Program and review core thermal-hydraulic parameters. If Feedwater Heater 33E-6A, 33E-6B, OR a Feedwater Heater String isolates, THEN reduce power to establish and maintain total feedwater flow LESS THAN OR EQUAL TO 6 x 10⁶ lbm/hr (~ 55 % power). 	
		CONTINUE TO NEXT PAGE	

Appendix D	A	qq	en	di	х	D
------------	---	----	----	----	---	---

Required Operator Actions

Form ES-D-2

 Op-Test No.:
 1
 Scenario No.:
 2
 Event No.:
 4

Event Description: 33E-6A Feedwater Heater Tube Leak

Time	Position	Applicant's Actions or Behavior	
	CRS	 Orders SNO when reactor power is stable demand an Official 3D Program and review core thermal-hydraulic parameters. Orders ATC If Feedwater Heater 33E-6A, 33E-6B, OR a Feedwater Heater String isolates, THEN reduce power to establish and maintain total feedwater flow LESS THAN OR EQUAL TO 6 x 10⁶ lbm/hr 	
	SNO	Demands an Official 3D program and reviews core thermal-hydraulic parameters.	
	ATC	If Feedwater Heater 33E-6A, 33E-6B, OR a Feedwater Heater String isolates, THEN reduce power to establish and maintain total feedwater flow LESS THAN OR EQUAL TO 6 x 10 ⁶ lbm/hr (~ 55% power).	
	CRS	Briefs crew on the event.	
		Examiner Note:	
	Proceed to the next event		

Required Operator Actions

Op-Test	No.: <u>1</u>	Scenario No.: _2 Event No.: _5	
Event De	escription: Fa	illure of LPCI inverter 71-INV-3A	
Time	Position	Applicant's Actions or Behavior	
	All	09-8-3-15 LPCI MOV IPS A 71INV-3A MINOR ALARM TROUBLE (various power supply trouble alarms)	
	CRS	Investigate the cause of the alarm.	
	SNO	Sends a NPO to the LPCI inverter	
	CRS	If the cause of the alarm is not readily apparent, then place LPCI MOV BUS A on alternate feed. CRS directs SNO to place LPCI MOV BUS A on alternate feed.	
		 Verifies L-15 is energized at panel 09-8 	
	SNO	 Places LPCI MOV A PWR SUPP switch in ALT PULL TO LOCK at panel 09-8. 	
		 When the cause of the alarm is known and corrected, LPCI MOV Bus A may be restored to normal per Section G of OP-43C 	
	CRS	Enters T/S 3.8.4.D declares the associated LPCI subsystem inoperable immediately.	
		Examiner Note:	
Proceed to the next event			

Required Operator Actions

Form ES-D-2

Op-Test No.: 1 Scenario No.: 2

Event No.: 6

Event Description: Main condenser in-leakage

Time	Position	Applicant's Actions or Behavior
		 Any of the following conditions exist: Annunciator 09-6-1-29 CNDSR VAC LO alarms Main Condenser vacuum is in Region 1 or 2 of Attachment 1 Main Condenser vacuum is less than expected for current plan conditions
	CRS	Enters AOP-31 for loss of Condenser Vacuum
		OVERRIDES 1. IF any of the following occur: • Turbine load is LESS THAN 255 MWe AND vacuum is LESS THAN 25 inches Hg (Region 1 of Att 1) • Condenser vacuum lowers to OR is rapidly approaching the main turbine trip setpoint. THEN perform the following: • IF reactor power is GREATER THAN 29%, THEN insert a Manual Scram. • Trip the main turbine 2. As Main Condenser Vacuum lowers, Verify Automatic Actions of Section C. 3. Before main condenser vacuum lowers to 8 inches Hg, ensure MSIVs are closed.
	CRS	Orders SNO to perform the actions of AOP-31
	CRS	Set a manual scram benchmark for ATC. (Typically ~23 inches)
	SNO	Obtain AOP-31:
	SNO	 At 09-6, Trip the Recombiner and verify The Hydrogen Addition System trips Dispatch an NPO to verify valve positions at the Off Gas System Recombiner Panel (01-1070GR)

Required Operator Actions

	Applicant's Actions or Behavior
SNO	Dispatch NPO to place spare SJAE's in service
SNO	At 09-6, Observe Off Gas Flow on 38FR-101 and determine that the source of condenser vacuum loss is air in leakage
SNO	Dispatch NPO(s) to inspect for source of air in leakage.
SNO	At 09-7 monitor Turbine Steam Seal Pressure and SPE Vacuum
CRS	Trend Condenser Vacuum and Orders SNO to perform a power reduction with recirculation flow to combat trend. Limit the SNO to maintain \geq 50% Core Flow. Rapid rates may apply.
SNO	Obtain OP-27, Section E: (Normal Rates at \leq 200 Mwth/min)
SNO	At 09-4, Alternately lower recirculation pump speeds in 1-3% increments while monitoring:
SNO	Obtain OP-27, Section G.1 (Rapid Rates):
SNO	At 09-4, Simultaneously lower recirculation pump speeds while monitoring:
	SNO SNO CRS SNO SNO

Form ES-D-2

Op-Test No.: 1 Scenario No.: 2 Event No.: 6

Event Description: Main condenser in-leakage

Time	Position	Applicant's Actions or Behavior
	ATC	Obtain RAP-7.3.16, Attachment 1 (Posted at 09-5):
	ATC	At 09-5, Fully insert the selected control rods until all control rods in cram group 1 are inserted.
		Examiner Note:
		Proceed to the next event

Required Operator Actions

Op-Test	No.: <u>1</u>	Scenario No.: _2 Event No.: _7
Event De	escription: Fail	ure to scram
Time	Position	Applicant's Actions or Behavior
	CRS	Orders ATC to perform a manual scram and AOP-1 immediate actions
	ATC	 Insert Manual Scram and perform AOP-1 Immediate Actions Depress Manual Scram pushbuttons Reactor Mode Switch to Shutdown Fully Insert all SRM's and IRM's Verifies all rods did not scram Verifies SDIV Vent and Drain valves are open Verifies APRM's are not downscale Verifies Main Turbine is still on line Verifies at least 1 Circ Water pump running
	CRS	Orders SNO to maintain RPV water band of 177 inches to 222.5 inches using condensate and feed water.
	SNO	Trend level performance and manipulate GEMAC Master/Individual controllers, RFP discharge valves and RFP trip as necessary to control level.
	CRS	Enters EOP-2 and then EOP-3; Failure to scram.
	CRS	Orders ATC to initiate ARI.
	ATC	Initiate ARI and recognizes all 5 valves did not de-energize. Reports RPS and ARI failed to actuate to CRS.
	CRS	Orders ATC to reduce recirculation to minimum and trip Recirc Pumps

Required Operator Actions

Form ES-D-2

 Op-Test No.:
 1
 Scenario No.:
 2
 Event No.:
 7

Event Description: Failure to scram

Time	Position	Applicant's Actions or Behavior
	ATC	Reduces Recirculation to minimum and trips Recirc Pumps
	CRS	Orders SNO to control RPV pressure between 800-1000 psig with SRVs.
	SNO	Controls RPV pressure between 800-1000 psig with SRVs.
СТ	CRS	Orders ATC to de-energize scram solenoids or vent scram air header per EP-3.
СТ	ATC	Determine EP-3 success path is de-energizing scram solenoids; section 5.2
		Removes RPS scram fuses from Panel 09-15 and 09-17.
	CRS	Orders ATC to Override ADS.
	ATC	ATC places both ADS Override switches to Override.
СТ	CRS	If Reactor power is above 2.5% or cannot be determined and RPV water level is above 110 in. Orders T/P all injection except SLC, CRD and RCIC per EP-5. Terminate high pressure sources first.
		Identify reinjection source as feedwater with a level band of 80- 100" and caution against rapid level changes during reinjection.
		CONTINUE ON NEXT PAGE

Required Operator Actions

Form ES-D-2

Op-Test No.: 1

Scenario No.: 2

Event No.: 7

Event Description: Failure to scram

Time	Position	Applicant's Actions or Behavior
ст		SNO lowers RPV water level to below 110 inches by terminating and preventing all injections except for SLC, RCIC, and CRD (EP-5).
		 At 09-3, Depress HPCI Turbine Trip Pushbutton
		At 09-5, Select both RFP GEMAC Controllers to Manual
		• At 09-5, Reduce both RFP GEMAC Controllers to Minimum
		• At 09-6, Ensure both RFP Min Flow Valves are Open
		 At 09-6, As necessary, adjust RFP speed, Feedwater Startup Valve position and RFP Discharge Valve position to maintain level 80-100 inches. Exercise caution against rapid level rise.
	SNO	 At 09-3, Place both 14MOV-11A and B Auto Actuation Bypass switches in Bypass.
		 At 09-3, Verify both white Auto Actuation Bypass lamps are lit.
		 At 09-3, Ensure closed 14MOV-11A and B
		 At 09-3, Ensure both Core Spray pumps are stopped
		 At 09-3, Place both 10MOV-27A and B Auto Control Bypass switches in Bypass.
		 At 09-3, Verify both white Auto Control Bypass lamps are lit.
		 At 09-3, Ensure closed 10MOV-27A and B.
		At 09-3, Ensure RHR pumps not required to be running are stopped
	CRS	Assign either operator to hang MSIV Low Water Level Jumpers per EP-2
	SNO	Dispatch NPO to hang MSIV Low Water Level Jumpers
		Examiner Note:
		Proceed to the next event

Required Operator Actions

Op-Test I	No.: _1	Scenario No.: _2 Event No.: _8 and 9	
Event De	scription: Tr	ip the in-service SLC pump and relief valve lift on the second SLC pump.	
Time	Time Position Applicant's Actions or Behavior		
	CRS	Orders SNO If a high Drywell pressure ECCS initiation signal exists (2.7 psig) THEN prevent injection from those CS and RHR pumps not required to assure adequate core cooling before depressurizing below their maximum injection pressures (EP-5)	
	SNO	Prevents injection if a high Drywell pressure ECCS initiation signal exists (2.7 psig) THEN prevent injection from those CS and RHR pumps not required to assure adequate core cooling before depressurizing below their maximum injection pressures (EP-5)	
	ÇRS	Orders ATC to override ADS (lave, W	
	AIC	AIGOVERRIDES ADS have in	
<u>C1</u>		Before exceed BIIT	
	CRS	Orders ATC to initiate SLC either SYS –A or Sys-B	
	ATC	Initiates SLC either SYS –A or Sys-B - Verifies white SQUIB VLVS READY lights are on. - Notes level on TK LVL IILI-66. - Places SLC pump keylock switch in START SYS-A or START SYS-B. - Verifies red SLC pump running light is on. - Verifies SLC pump discharge pressure on DISCH PRESS 11PI-65 is greater than or equal to RPV pressure. - Verifies the following: RWCU trips And the following valves are closed: - CLN UP SUCT 12MOV-18 - CLN UP RETURN ISOL VALVE 12MOV-69	
	SIM BOOTH OPER	Insert malfunction SL01:A or malfunction SL01:B 1 minute after the respective SLC pump is started.	

Required Operator Actions

Time	Applicant's Actions or Behavior	
	ATC	Recognizes the trip of the in-service SLC and reports this to the CRS.
	CRS	Orders ATC to start the other SLC system and to Orders an NPO to the tripped SLC pump.
	ATC	Initiates SLC the other SYS - A or Sys-B - Verifies white SQUIB VLVS READY lights are on. - Notes level on TK LVL IILI-66. - Places SLC pump keylock switch in START SYS-A or START SYS-B - Verifies red SLC pump running light is on. - Verifies SLC pump discharge pressure on DISCH PRESS 11PI-65 is greater than or equal to RPV pressure.
	SIM BOOTH OPER	Insert malfunction SL03:A or malfunction SL03:B; When the respective SLC pump is started.
	ATC	ATC recognizes that the in service SLC pump discharge pressure is not greater than or equal to RPV pressure and reports this to the CRS.
	CRS	Enters EP-4; Boron injection using CRD and executes it concurrently with this procedure
	ATC	Dispatches NPO to commence EP-4 field actions.
	SIM BOOTH OPER	Report back to ATC that the first SLC pump started has a tripped breaker and the motor is hot to the touch and acknowledge ATC report to commence EP-4 field actions.

Required Operator Actions

		Scenario No.: _2 Event No.: _10 IC failure to auto start
Time	Position	Applicant's Actions or Behavior
	SNO	Recognizes and reports to the CRS that RCIC failed to auto start on RPV low water level
	CRS	Orders RCIC to be placed in service manually using the posted instructions
	SNO	Places RCIC in injection mode manually using the posted instructions for RCIC manual startup for injection.
СТ	CRS	If BIIT exceeded while power is > 2.5%: Order T/P all injection except SLC, CRD and RCIC per EP-5. Terminate high pressure sources first. Identify reinjection source as feedwater with a level band of -19" to the level at which injection may recommence. Caution against rapid level changes during reinjection.
СТ	SNO	At 09-5, Reduce both RFP GEMAC Controllers to Minimum
СТ	SNO	At 09-3, confirm all other terminate and prevent actions are complete.
СТ	CRS	When Rx Power <2.5%, or RPV level at TAF (0") or SRV's will remain closed order injection with feedwater at a level band of current RPV level to -19".
	SNO	At 09-6, As necessary, adjust RFP speed, Feedwater Startup Valve position and RFP Discharge Valve position to maintain level 80-100 inches. Exercise caution against rapid level rise.
СТ	ATC	ATC removes scram solenoid fuses or scram air header is vented and verifies reactor is shutdown.

Required Operator Actions

Form ES-D-2

Op-Test No.: <u>1</u>		Scenario No.: 2 Event No.: 10		
Event De	Event Description: RCIC failure to auto start			
Time	Position	Applicant's Actions or Behavior		
-	TERMINATE THE SCENARIO WHEN ALL THE FOLLOWING ARE MET:			
	 When all control rods are inserted to or beyond postion 02. 			
	 EOP- 3 has been exited and EOP-2 has been entered. 			

POST-SCENARIO:

HAVE THE APPLICANT IN THE CRS POSITION IDENTIFY THE HIGHEST EAL CLASSIFICATION FOR THE COMBINATION OF EVENTS EXPERIENCED DURING THE SCENARIO.

SAE 2.2.2 Any RPS setpoint has been exceeded and automatic and manual scrams fail to result in a control rod pattern which assures reactor shutdown under all conditions without boron and either:

Reactor power > 2.5%

OR

Torus Temperature > Boron Injection Initiation Temperature

Scenario Outline

Form ES-D-1

Facility: Fitzpatrick

Scenario No.: 4

Op-Test No.: 1

Examiners:

Operators: ___

Initial Conditions: Reactor power is 60%. ST-3PA, 'A Core Spray Valve IST' is marked as complete up to step 8.2. UPS MG Set is tagged OOS. UPS on alternate power. B CRD flow control valve in service.

Turnover: Power was lowered to 60% power to perform a rod pattern adjustment. Perform section 8.2 of ST-3PA for Core Spray Loop A Quarterly Operability Test (IST), and then perform rod pattern adjustment. UPS MG Set is tagged OOS and all other equipment is operable.

Event No.	Malf. No.	Event Type*	Event Description
1	OVR 1	N-SNO2 TS-SRO	Perform ST-3PA Sect 8.2 only. A Core Spray Valve IST
2	NA	R-ATC	Perform Rod Pattern adjustment.
3	RD03:B	C-SNO2	B CRD Flow control valve fails partially closed. Swap to A valve.
4	RR22:A RPO1AA	TS-SRO I-SNO2	Reactor Level Transmitter 02-3LT-101A fails low with failure to half scram.
5	ED03:A	C-Crew	Transformer T13 fault causes loss of L15, L25 and UPS.
6	RX01 MS08B:C MS08B:G	M-Crew TS-SRO	Fuel failure leads to High Rad. MSL. Initiate Manual Isolation. One MSL fails to isolate.
7	MS05	M-Crew	MSL break. Enter Radioactivity Release Control EOP-6
8	OVR 2	C-SNO2	Turbine Building Ventilation Trips.
9	NA	M-Crew	Enter RPV control and Emergency Depressurization prior to GE.
*	* (N)ormal, (R)eactivity, (I)nstrument, (C)omponent, (M)ajor		

SCENARIO SUMMARY

1. Perform section 8.2 of ST-3PA for Core Spray Loop A Quarterly Operability Test (IST). One valve will stroke longer than technical specifications allow. TS call for SRO.

2. A minor rod pattern adjustment will be performed at 60% reactor power using control rods.

3. At the end of the rod pattern adjustment, the in service flow control valve for CRD will fail partially closed. Operators will have to diagnose the failure and swap to the other flow control valve.

4. Reactor Level Transmitter 02-3LT-101A fails low with failure to half scram. Operators will have to diagnose and make TS call. Can manually put trip in on RPS system A.

5. Transformer T13 fault causes loss of L15, L25 and UPS. The fault will be removed and busses can be recovered. Loss of UPS causes a RWR runback and the turbine driven feed pumps need to be manually adjusted to maintain reactor level. Possible that CRS determines to manually scram the reactor per AOP override statement.

6. Fuel failure leads to High Radiation MSL. Initiate Manual Isolation of Main steam Lines. One MSL fails to isolate.

7. MSL break. Enter Radioactivity Release Control EOP-6 when above the alert level. Turbine Building Ventilation Trips which is recoverable by bypassing EOP interlocks per EP-2.

8. Radiation levels approach the GE level and the operators then enter RPV control and Emergency Depressurization prior to GE.

INITIAL SIMULATOR SETUP

✓	ITEM / MALFUNCTION / REMOTE FUNCTION / CONDITION
	Reset simulator to an IC with power at 60%. UPS MG IS Tagged OOS.
	Apply Information Tags on the following components: NA
	Take out of FREEZE and ensure the following: B CRD flow control valve in service.
	Ensure materials for applicants: Stopwatch and a copy of ST-3PA marked up to step 8.2.

✓	ITEM / MALFUNCTION / REMOTE FUNCTION / CONDITION
	 Ensure the following malfunctions are loaded: RPO1AA MS08B:C MS08B:G Ensure the following remote functions are loaded: RD08 for event 3. ED 13 for event 5.
	Ensure the following overrides are loaded: Override 1: 14MOV-11A takes 13 seconds to close Override 2: Trip of Turbine Building Ventilation
	 Ensure the following triggers are built: Trigger 1: RD03:B set to 25% Trigger 2: RR22:A Set to 50% Trigger 3: ED03:A Trigger 4: RX01 Set to 50% Trigger 5: MS05
	Reset any annunciators that should not be present

INSTRUCTIONS FOR SIMULATOR OPERATOR

EVENT 1: Perform ST-3PA Sect 8.2 only. A Core Spray Valve IST

 ✓ 	MALFUNCTION / REMOTE FUNCTION / REPORT
	Insert override to make 14MOV-11A closing time slow
	Respond to request for assistance as appropriate.

EVENT 2: Perform Control Rod pattern adjustment at 60% power

✓	MALFUNCTION / REMOTE FUNCTION / REPORT
	Respond to request for assistance as appropriate.

EVENT 3: B CRD Flow control valve fails partially closed

✓	MALFUNCTION / REMOTE FUNCTION / REPORT
	Insert trigger 1 when directed by chief examiner
	When requested use remote function RD08 to permit the standby (A) flow control valve to be valved in.
	Respond to request for assistance as appropriate.

EVENT 4: Reactor Level Transmitter 02-3LT-101A fails low with failure to half scram.

✓	MALFUNCTION / REMOTE FUNCTION / REPORT
	Insert trigger 2 when directed by chief examiner
	Respond to request for assistance as appropriate

EVENT 5: Transformer T13 fault causes loss of L15, L25 and UPS.

MALFUNCTION / REMOTE FUNCTION / REPORT
Insert trigger 3 when directed by chief examiner
Role play that the trip was an overload on T13 and tripped breaker 10560 which has an 86 lockout.
Remove malfunction and reset using RF ED 13 when requested.
Manually reset and energize UPS from alternate feed when requested.
Respond to request for assistance as appropriate

EVENT 6: Fuel failure leads to High Rad. MSL. Initiate Manual Isolation. One MSL fails to isolate.

✓	MALFUNCTION / REMOTE FUNCTION / REPORT
	Insert trigger 4 when directed by chief examiner
	Respond to request for assistance as appropriate

EVENT 7: MSL break. Enter Rad Control EOP

✓	MALFUNCTION / REMOTE FUNCTION / REPORT
	Insert trigger 5 when directed by chief examiner
	Respond to request for assistance as appropriate

EVENT 8: Turbine Building Ventilation Trips.

 ✓ 	MALFUNCTION / REMOTE FUNCTION / REPORT
	Perform Override 2 when directed by chief examiner
	Role play when requested to defeat interlocks for TB Ventilation.
	Respond to request for assistance as appropriate

EVENT 9: Enter RPV control and Emergency Depressurization prior to GE.

✓	MALFUNCTION / REMOTE FUNCTION / REPORT
	Respond to request for assistance as appropriate

CRITICAL TASKS

- 1. EOP-6 Scram the reactor
 - Standard: 1. Expected when Offgas timer times out, then manually scrams the reactor per AOP-3.
 - 2. Failure criteria, before the offsite release rate reaches the E-Plan General Emergency Level, Verify Reactor Scram.
 - Basis: The scram reduces the rate of energy production and thus the rate of radioactivity release. EOP-6 Basis.
- 2. EOP-6 Perform emergency blowdown.
 - Standard: Before the offsite release rate reaches the Emergency Plan "General Emergency" level: perform Emergency RPV Depressurization per EOP-6, open 7 ADS valves. Note >12mR/hr on Turbine Building Exhaust Monitor for > 15 minutes is the GE criteria.
 - Basis: An offsite release rate above the General Emergency level is an indication of Degrading conditions and presents a more immediate threat to the health and safety of the public. If a primary system is discharging outside the primary and secondary containments, a blowdown is performed before the release reaches the General Emergency level to reduce the discharge rate. EOP-6 Basis.

Required Operator Actions

Form ES-D-4

 Op-Test No.:
 1
 Scenario No.:
 4
 Event No.:
 1

Event Description: Perform ST-3PA Sect 8.2 only. A Core Spray Valve IST

Time	Position	Applicant's Actions or Behavior
	CRS	Perform brief for performing ST-3PA, "CORE SPRAY LOOP A QUARTERLY OPERABILITY TEST (IST)" .Declare Core Spray Loop A inoperable.
		NOTE: A Core Spray Loop A Keep-full alarm could occur while testing core spray loop valves. The keep-full alarm is cleared in Subsection 8.3.
		Close and time MIN FLOW VLV 14MOV-5A. Closing time secs (IST: 15.2 to 20.5)
		Open and time MIN FLOW VLV 14MOV-5A. Opening time secs (IST: 15.2 to 20.4)
	SNO2	Ensure closed INBD INJ VLV 14MOV-12A. Close and time OUTBD INJ VLV 14MOV-11A. Closing time secs (IST: 7.2 to 11.9) NOTE: (Actual time will be 13 seconds)
		Open and time OUTBD INJ VLV 14MOV-IIA. Opening time secs (IST: 6.9 to 11.3)
		CAUTION Failure to minimize time that 14MOV-7A is closed will cause a loss of suction to the core spray holding pump.
		Close and time SUCT VLV 14MOV-7A. Closing time secs (IST: 65.2 to 88.1)
	SNO2	Open and time SUCT VLV 14MOV-7A. Opening time secs (IST: 62.3 to 84.1)
	CRS	Review surveillance. Determine 14MOV-11A is inoperable. TS 3.6.1.3A
		Examiner Note:
		Proceed to the next event

Required Operator Actions

Op-Test I	Op-Test No.: 1 Scenario No.: 4 Event No.: 2			
Event Description: Perform Control Rod pattern adjustment at 80% power				
Time	Position	Applicant's Actions or Behavior		
	CRS	If not already performed, CRS conducts reactivity brief on performing control rod pattern adjustment IAW RAP-7.3.16.		
		Reviews Reactor Engineering RAP-7.3.16, if not previously performed.		
	CRS	CRS directs ATC to perform control rod pattern adjustment.		
		Provides Reactivity CRS monitoring		
	ATC	IAW RAP-7.3.16 and OP-26; Control rod drive manual control system step E.1; Notch withdrawal; commences rod withdrawal to perform control rod pattern adjustment.		
	SNO2	Monitors plant for correct response as control rods are manipulated.		
		en chief examiner has seen enough of the reactivity manipulations, completion of rod manipulations move on to the next event.		
	Proceed to the next event			

Required Operator Actions

Time	Position	Applicant's Actions or Behavior
		NOTE : When the CRD flow control valve is in service and failed close (0%), the effect is a decrease in CRD system flow, indicated on 03FI-310; an increase in charging water header pressure as indicated on 3PI- 302; drive water header differential pressure, (03DPI-303), and Cooling water differential pressure, (03DPI-304), will decrease to low values. Subsequent movement of control rods by normal operation is impossible since the differential pressure developed across the piston in the CRD mechanism is too low. Prolonged operation without adequate cooling water will result in higher CRD temperatures than normal. This is indicated on temperature recorder 03TR-244, on panel 25-09, and may result in actuating Alarm CRD HI TEMP, on panel 09-5, depending on the duration of reduced flow.
	ATC	Determines that Control Rod will not move.
	Crew	Diagnose that CRD flow is low and the cause of Control Rods not being able to move.
	CRS	Brief crew on swapping to the A CRD flow control valve per G.14 of OP-25.
		Ensures controller is in auto
		Adjust controller setpoint to zero gpm
	SNO2	Verify open 03CRD-68A
		Slowly open outlet isolation valve 03CRD69A

Required Operator Actions

Op-Test I	No.: <u>1</u>	Scenario No.: _4 Event No.: _3_
Event De	scription: B C	RD Flow control valve fails partially closed
Time	Position	Applicant's Actions or Behavior
	SNO2	Have EO at Flow Control Hand Select Station place AUTO-MAN switch for 03HSS-245A in AUTO Have EO at Flow Control Hand Select Station place AUTO-MAN switch for 03HSS-245B in MAN
	SNO2	Slowly raise setpoint on CRD FLOW CNTRL 03FIC-301 to establish 59 to 61 gpm on 03FIC-301
	SNO2	 Verify normal operating values on the following indicators: CHG WATER PRESS 03PI-302 Between 1390 and 1580 psig DRV WTR DIFF PRESS 03DPI-303: 260-270 psid CLG WTR DIFF PRESS 03DPI-304 approx. 10 to 26 psid DRV WTR FLOW 03FI-305 zero with no CRD is being driven CLG WTR FLOW 03FI-306 59 to 61 gpm
	CRS	May continue with rod pattern adjustment after CRD flow control is re- established.
		Examiner Note: Proceed to the next event

Required Operator Actions

Op-Test	No.: <u>1</u>	Scenario No.: _4 Event No.: _4
Event De	escription: Rea	ctor Level Transmitter 02-3LT-101A fails low with failure to half scram
Time	Position	Applicant's Actions or Behavior
		NOTE: The following alarms will come in RPS RX VESSEL LO LVL TRIP
		EPIC Point A #963 & D 1207 will respond
	CREW	Responds to alarm. Determines that 02-3LT-101A is reading approx. 150".
		Determines that half scram on RPS CH A1 did not occur as expected.
		Determines TS call 3.1.1.1.A One or more required channel inoperable. 12 hour completion time.
	CRS	Action required Place channel in trip OR Place associated trip system in trip.
		Note: Since failure to half scram will require placing trip system in trip to satisfy action statement.
	CRS	Briefs crew on placing a trip in the A RPS resulting in a half scram.
	ATC	Places a manual scram in RPS channel A.
		Examiner Note:
		Proceed to the next event

Required Operator Actions

Op-Test I	No.: <u>1</u>	Scenario No.: _4 Event No.: _5
Event De	scription: Tr	ansformer T13 fault causes loss of L15, L25 and UPS.
Time	Position	Applicant's Actions or Behavior
		Note: Large amount of alarms are going to come in.
		L15 and L25 4KV SUPP FDR TRIP OR CNTRL PWR LOSS is the cause of the loss of L15, L25 and UPS.
		Automatic Actions from a Complete Loss of UPS
		15 seconds after loss of UPS, RWR MG sets run back to min-speed, if not locked up.
		RFP MGUs lose power and remain at the pre-power loss position.
		If RWR pumps run back, RPV water level rises rapidly due to steam flow - feed flow mismatch.
		RWCU isolates due to loss of power to demin inlet temperature switch.
		Automatic Actions from loss of L25
		Loss of RPS Bus A PCIS Group I Half Isolation (Alarm only) PCIS Group I1 half Isolation
		Loss of IIA" Drywell Cams Loss of "A" Hydrogen/Oxygen Monitor 27PCX-101A
		Loss of Reactor Building Vent Rad Monitor 17RM-452A
		Numerous FPP Alarms due to loss of MPX Power
		Automatic Actions from loss of L15
		Loss of "A" CRD Drive Water Pump
		Loss of "A" STBY Gas Treatment Train
		Loss of "A" SLC Pump and SLC suction heat trace Loss of Drywell Cooling Assemblies 68FN-2Af 2C, 4A, 4C
		· · · · · · · · · · · · · · · · · · ·

Appendix D

Required Operator Actions

Op-Test	No.: <u>1</u>	Scenario No.: _4 Event No.: _5
Event De	escription: Tr	ransformer T13 fault causes loss of L15, L25 and UPS.
 Time	Position	Applicant's Actions or Behavior
	rosition	Responds to alarms and runback. Recognizes loss of UPS.
	Crew	If recognizes prior to runback starting (15 seconds) immediate action is to lock scoop tubes by taking RWR A & B Scoop Tube to Trip
		Note: Override in AOP-21 Loss of UPS states
		IF plant shutdown is required as determined by CRS, Then shutdown shall be completed by inserting manual scram.
	CRS	Directs operator to trip one feed pump and take manual control of feed pump speed.
	SNO2	Trip one RFP. Take manual control of one RFP as follows: a. Lower MSC until speed reduction is observed b. Place the associated RFPT A(B) MGU HYD JACK switch in High Speed Stop c. Control RPV water level with MSC.
		WHEN RWR MG set runback is complete, perform the following: a. Place the following control switches to TRIP,
		spring return to normal: RWR A SCOOP TUBE RWR B SCOOP TUBE
	ATC	b. Verify the following annunciators in alarm: 09-4-3-11 RWR MG A SCOOP TUBE LOCK 09-4-3-20 RWR MG B SCOOP TUBE LOCK
		c. Place the following control switches in ON: SCOOP TUBE A AUTO UNLOCK SCOOP TUBE B AUTO UNLOCK
		NOTE: Cram groups can not be inserted due to loss of power to rod select relays and RPIS.

Required Operator Actions

Time	Position	Applicant's Actions or Behavior
		Directs entry into AOP-69 CRD Pump Trouble
		To restore CRD
		Directs execution of the following actions:
	CRS	Execute AOP-8 Loss or reduction of RWR flow.
		Verify cleanup auto isolation per section G of OP-28
		Execute AOP-59 Loss of A RPS
		Execute AOP-18A Loss of L15
		Execute AOP-18B Loss of L25
	ATO	Places CRD flow controller to manual. Rotates flow control fully coun clockwise.
	ATC	Starts the B CRD Pump. Adjusts for 60 gpm and places back in manual.
		Note: fault is recoverable.
	CRS	Investigates cause of loss of UPS. Directs Reset of 86 and close breaker 10560.
		Directs to energize UPS bus per attachment 4 of AOP-21.
		·

Appendix	¢ D	Required Operator Actions <u>Form ES</u>
		Scenario No.: <u>4</u> Event No.: <u>5</u>
Time	Position	Applicant's Actions or Behavior
		Examiner Note:
		Proceed to the next event
Op-Test I	No.: <u>1</u>	Scenario No.: <u>4</u> Event No.: <u>6</u>
Event De isolate	scription: Fue	el failure leads to High Rad. MSL. Initiate Manual Isolation. One MSL fails to
Time	Position	Applicant's Actions or Behavior
		Entry conditions for AOP-3:
		09-3-2-27 OFF GAS RAD MON HI is in alarm and is not an expected condition.
		Any of the following annunciators are in alarm:

.

	condition.
	Any of the following annunciators are in alarm:
	- 09-3-2-10 OFF GAS TIMER INITIATED - 09-3-2-38 OFF GAS RAD MON HI-HI - 09-3-3-1 MAIN STM RAD MON HI
	- 09-5-1-32 MAIN STM LINE RADIATION HI-HI
 Crew	Responds to increasing radiation levels. Enter AOP-3 High Activity in Reactor coolant or Off-Gas.
CRS	Directs Chemistry to sample reactor coolant an off-gas. Directs Rad Pro to survey for changing rad levels.

Required Operator Actions

Form ES-D-4

Op-Test No.: 1 Scenario No.: 4

Event No.: 6

Event Description: Fuel failure leads to High Rad. MSL. Initiate Manual Isolation. One MSL fails to isolate

Time	Position	Applicant's Actions or Behavior
		When 2 or more main steam line rad monitors are tripped on hi-hi radiation then ensure condenser air removal pumps are tripped.
		Ensure closed the following valves:
	SNO2	Main Steam drain 29MOV-74
		Main Steam drain 29MOV-77
		RWR Loop B Sample Isol VLV 02-2AOV-39 & 40
		Air Removal PMP Suct VLV 38AOV-111 & 112
	Enter EOP-5 Secondary Containment Control	
	CRS	Consider Closing MSIV's to minimize release.
ļ		Manually closes MSIV's when directed by CRS.
	SNO2	Determines that MSL C failed to isolate.
	SNUZ	MSIV 02-86C & 02-80C
	CRS	When off-gas rad timer 17-157 times out directs a manual scram.
		Note: Use attachment 2 of AOP-21 Loss of UPS to assist in performance of AOP-1 actions if UPS is de-energized.

Required Operator Actions

Form ES-D-4

Op-Test No.: <u>1</u> Scenario No.: <u>4</u>

Event No.: 6

Event Description: Fuel failure leads to High Rad. MSL. Initiate Manual Isolation. One MSL fails to isolate

Time	Position	Applicant's Actions or Behavior	
		Insert Manual Scram and perform AOP-1: Reactor Scram Immediate Actions	
		Depress Manual Scram pushbuttons	
		Reactor Mode Switch to Shutdown	
ĺ		Fully Insert all SRM's and IRM's	
	ATC	Verify all rods in	
		Verify SDIV Vent and Drain valves closed	
		Verify APRM's downscale	
		Verify/Trip Main Turbine	
		Verify electrical distribution fast transfer	
		Verify at least 1 Circ Water pump running	
	Examiner Note:		
	Proceed to the next event		

Required Operator Actions

Op-Test I	Op-Test No.: 1 Scenario No.: 4 Event No.: 7		
Event De	Event Description: MSL break. Enter Rad Control EOP		
Time	Position Applicant's Actions or Behavior		
		Note: the following alarms will come in during this event, 1) TURB BLDG ARM RAD HI 2) DIV I AMBIENT TEMP HI 3) DIV II AMBIENT TEMP HI	
	Crew	Responds to temperature alarms. Enters AOP-40	
	CRS	Determines that Turb Bulding exhaust is above 9.9E5 cpm (Alert level) and enters EOP-6	
		Isolates Control Room and Relay Room ventilation within 30 minutes	
[Isolates Control Room Ventilation per section G of OP-55B.	
	SNO	Isolates Relay Room Ventilation per section G of OP-56.	
	CRS	TSC filtered ventilation system is activated within 60 minutes.	
	CRS	Dispatches a team to check turbine building integrity.	
		Examiner Note:	
	Proceed to the next event		

Required Operator Actions

Form ES-D-4

Op-Test No.: 1	Scenario No.:	_4	Event No.: _	8
----------------	---------------	----	--------------	---

Event Description: Turbine Building Ventilation Trips.

Time	Position	Applicant's Actions or Behavior	
	SNO2	Responds to Turbine Building ventilation trip.	
	CRS	Directs operator to restart Turbine Building ventilation and defeat interlocks as necessary per EP-2.	
		NOTE: Subsection 5.27 of EP-2 overrides turbine building ventilation exhaust duct radiation monitor high-high radiation and radiation monitor failure isolations.	

•

Required Operator Actions

Op-Test I	Op-Test No.: <u>1</u> Scenario No.: <u>4</u> Event No.: <u>8</u>			
	Event Description: Turbine Building Ventilation Trips.			
Time	Position	Applicant's Actions or Behavior		
		Ensure control switch for each of the following fans is green flagged at panel 09-75:		
		TURB BLDG SUPP 67FN-5A TURB BLDG SUPP 67FN-5B TURB BLDG EXH 67FN-6A TURB BLDG EXH 67FN-6B STM TUN EXH 67FN-23A		
		STM TUN EXH 67FN-23B		
		Directs equipment operator perform step 5.27.2, 3 and 4 of EP-2 to defeat interlocks.		
		Place turbine building exhaust fans in normal operating lineup as follows at panel 09-75:		
		NOTE: The turbine building exhaust fan will start when its outlet damper is open.		
	SNO2	A. Start TURB BLDG EXH 67FN-6A or 6B by placing its control switch to ON, spring return to normal.		
		B. Ensure control switch for the other turbine building exhaust fan (TURB BLDG EXH 67FN-6A		
		or 6B) is green flagged.		
		Place turbine building supply fans in normal operating lineup as follows at panel 09-75:		
		NOTE: The turbine building supply fan will start when its outlet damper is open.		
		 A. Start TURB BLDG SUPP 67FN-5A or 5B by placing its control switch to ON, spring return to normal. B. Ensure control switch for the other turbine building supply fan (TURB BLDG SUPP 67FN-5A 		
		or 5B) is green flagged.		

Required Operator Actions

Op-Test	Op-Test No.: 1 Scenario No.: 4 Event No.: 8		
Event De	Event Description: Turbine Building Ventilation Trips.		
Time	Position	Applicant's Actions or Behavior	
		Place steam pipe tunnel exhaust fans in normal operating lineup as follows at panel 09-75:	
		NOTE: The steam pipe tunnel exhaust fan outlet damper will open after fan is started.	
	SNO2	A. Ensure STM TUN EXH 67FN-23A or 23B is running with its control switch red flagged.	
		B. Ensure control switch for the other steam pipe tunnel exhaust fan (STM TUN EXH	
		67FN-23A or 23B) is green flagged.	
		·	
		Examinor Note:	
	Examiner Note: Proceed to the next event		
Proceed to the next event			

Required Operator Actions

Form ES-D-4

Op-Test I	Op-Test No.: 1 Scenario No.: 4 Event No.: 9		
Event De	Event Description: Enter RPV control and Emergency Depressurization prior to GE.		
Time	Position	Position Applicant's Actions or Behavior	
		Note : >12mR/hr on Turbine Building Exhaust Monitor for > 15 minutes is the GE criteria.	
		Ensures the following ventilation systems are isolated:	
	CRS	Control Room	
 		Relay Room	
ст		Trends Turbine Building exhaust High Range Monitor.	
	CRS	Prior to High Range Monitor exceeding 12 mR/hr (General Emergency EAL) with low range monitor upscale for >15 minutes, then enters EOP-2 (scrams if not already done) and performs an Emergency RPV Depressurization.	
	ATC	Performs Emergency RPV Depressurization by opening all 7 ADS valves.	
	SNO2	Maintains reactor level with feedwater in manual.	
	 TERMINATE THE SCENARIO WHEN ALL THE FOLLOWING ARE MET: Blowdown has been complete and reactor level is being controlled in the normal range. 		

POST-SCENARIO:

HAVE THE APPLICANT IN THE CRS POSITION IDENTIFY THE HIGHEST EAL CLASSIFICATION FOR THE COMBINATION OF EVENTS EXPERIENCED DURING THE SCENARIO.

General Emergency 5.1 Effluent Monitors